



Lt. Franco Bagnoli Chemistry Department – Flight Test Center "M. De Bernardi Airport" via Pratica di Mare 45 00040 Pratica di Mare – Pomezia (RM) Italy Tel. +39.06.91292894 / Fax +39.06.9120217

e-mail: f.bagnoli01@libero.it

ABSTRACT

The use in service life of the Tornado aircraft showed several areas subjected to wear. Due to its design some of them include, for example, the attachment for the variable wings, the related components and the flap tracks; some concern the taileron and the air intake ducts. According to this, the affected interfaces of different materials and the structural components have been protected with appropriate coatings to maintain the operability of the aircraft. Depending on the function of the moveable joints on the structure coatings with adequate hardness and wear resistance have been adopted. The range of applied anti wear coatings comprises both organic and inorganic compounds, such as polymers, composites, oxides, carbides, etc.. Sometimes the adopted protection methods showed good results; in other cases, alternative systems to improve the wear protection have been investigated.

This paper describes protection systems proposed and introduced on components in the Tornado aircraft structure subjected to adhesive and erosive wear. Particular attention will be addressed to the flap tracks and to the leading edges of both taileron and air intake ducts.

1.0 INTRODUCTION

The Tornado is a multirole fighter – bomber aircraft with a variable sweep wings. In relation to its characteristic, several structural groups, in addiction to the engines, are subjected to different kind of wear that include, for example, the wing attachment, the nib an the fairing. In particular, the related components of the wing attachment, such as the pivot pin, the bearing and the shear bearing device, are affected by sliding and fretting, as well as the roller and the bearing pin of the nib are exposed to friction. Other structural parts, such as the leading edge, are exposed to damage caused by the impingement of raindrops of high speed or owing to the missile firing. In an effort to find a solution, IAF, GAF, RAF and the related Industries have been concerned to introduce adequate protection systems to maintain the operability of the aircraft. Therefore, investigations with several materials were performed by tests simulating the realistic service conditions, in terms of loads, speed, temperature and environmental exposition. The wear resistant coatings comprise composite materials [1, 2], ceramics [3], and both organic [4] and inorganic [5] compounds. The minimum cost and the best performance in terms of wear resistance, high temperature strength and chemical stability made in the last years more attractive the use of ceramics and composites. Most of the adopted systems showed good results in terms of FH, so that they have been introduced on Tornado aircraft structure. Table 1 shows some structural parts subjected to wear and the specific materials applied. Nevertheless, in some cases, the achieved results were not satisfactory and further investigations are still ongoing.

Paper presented at the RTO AVT Specialists' Meeting on "The Control and Reduction of Wear in Military Platforms", held in Williamsburg, USA, 7-9 June 2003, and published in RTO-MP-AVT-109.

Report Documentation Page					Form Approved OMB No. 0704-0188	
maintaining the data needed, and c including suggestions for reducing	llection of information is estimated t completing and reviewing the collect this burden, to Washington Headqu uld be aware that notwithstanding an OMB control number.	ion of information. Send comments arters Services, Directorate for Info	regarding this burden estimate rmation Operations and Reports	or any other aspect of the s, 1215 Jefferson Davis	is collection of information, Highway, Suite 1204, Arlington	
1. REPORT DATE		2. REPORT TYPE		3. DATES COVE	RED	
01 JUN 2004		N/A -				
4. TITLE AND SUBTITLE				5a. CONTRACT NUMBER		
Adequate Protection Systems for Reduction of Wear on Tornado Aircraft 5b. GRANT NUMBER 5c. PROGRAM ELEMENT NUMBER 5c. PROGRAM ELEMENT NUMBER			1BER			
			5c. PROGRAM ELEMENT NUMBER			
6. AUTHOR(S)			5d. PROJECT NUMBER			
			5e. TASK NUMBER			
			5f. WORK UNIT NUMBER			
	IZATION NAME(S) AND AI ment Flight Test Ce	· /	i Airport via	8. PERFORMING REPORT NUMB	G ORGANIZATION ER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)			10. SPONSOR/MONITOR'S ACRONYM(S)			
		11. SPONSOR/MONITOR'S REPORT NUMBER(S)				
12. DISTRIBUTION/AVAIL Approved for publ	LABILITY STATEMENT ic release, distributi	on unlimited				
	otes 69, RTO-MP-AVT- tion de lusure des pl				•	
14. ABSTRACT						
15. SUBJECT TERMS						
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF	18. NUMBER	19a. NAME OF	
a. REPORT unclassified	b. ABSTRACT unclassified	c. THIS PAGE unclassified	- ABSTRACT UU	OF PAGES 6	RESPONSIBLE PERSON	

Standard Form 298 (Rev. 8-98) Prescribed by ANSI Std Z39-18



Structural part	Protection system		
Wing pivot pin	Silver plating		
Wing bearing	Silver plating, Teflon liner		
Shear bearing device	Teflon liner		
Bearing pin	Titanium alloy strip, KAron V		

Table 1: Structural parts and coatings applied

2.0 IDENTIFICATION OF STRUCTURAL GROUPS SUBJECTED TO ADHESIVE AND EROSIVE WEAR

The structural groups subjected to adhesive and erosive wear on Tornado structure are:

- Attachment of the wings;
- Wing fairing;
- Wing nib;
- Flap track;
- Taileron;
- Air intake ducts.

In this paper will be describe the protection systems proposed and in case introduced on the flap tracks and on the leading edges of both taileron and air intake ducts.

2.1 Flap track

The flap track elements consisting of the flaps and rollers are bolted to the wing structure. The rollers allow continuous movement of the flaps during flight operation. The wear affected part of this assembly includes the flap track in titanium alloy, the roller in steel and the Teflon liner as anti wear strip attached to the face wall of the flap, Figure 1.

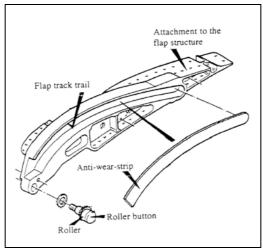


Figure 1: The flap track

The flap track is subject to slight deformation in the contact area of the roller in completely extended position of the flap mainly caused trough taxiing and during landing. Problems are caused by the anti wear strip as protection against contact of the roller end button with the flap track material. In the past loss of



adhesive bonded anti wear strip or damages of this protection occurred within less than 300 FH causing fretting on the flap track. Introduction of a new adhesive system reduced the loss of the strip but significant improvement of the reliability could not be achieved. Further solutions to improve this situation were investigated. In particular, coating of the roller end buttons with KAron V polymeric coating containing PFTE applied by spray equipment (thickness about 300 μ m) together replacement of the Teflon strip and the use of LW-5 tungsten/silicon carbide applied by D- gun (thickness about 300 μ m) were proposed for testing [6]. The use of KAron V protection system experienced good results achieving more than 300 FH without severe sign of wear both on the flap track and the roller buttons.

2.2 Taileron leading edge

The taileron are attached to the rear fuselage by pivot pins and consist of twist panel, leading and trailing edge, Figure 2. As consequence of the AIM-9L Sidewinder firing missile the leading edge, consisting of aluminium alloy, is subjected to heavy damage due to thermal erosion. To overcome the problem investigations with different anti erosion coatings on behalf of nations using Tornado were performed during the years. One solution proposed from IAF concerned the use on the leading edge of silicone rubber against the thermal stress covered with polyurethane anti erosion adhesive. Nevertheless the results of this experience were not significant for damages caused for aerodynamic friction on the protection within less 40 FH and with only two firing missile.

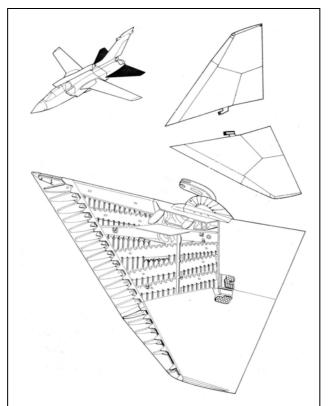


Figure 2: The taileron

The use of an acrylic primer [7] proposed from GAF improved the thermal resistance of the leading edge but caused problems by age hardening of the resin which could be by cured by re-painting. Therefore, the RAF thought necessary to use new taileron with leading edge made in nickel alloy as Inconel 600, which showed good properties in terms of both thermal resistance and erosion. On this experience IAF and GAF replaced the taileron as well: in particular, in the case of the IAF, the introduction of new taileron has become executive from May 2002 and will be completed in 2012.



2.3 Air intake duct

On both top and bottom lips of the air intake ducts is placed the anti ice coating, Figure 3, which consists of seven glass fiber layers and heating elements applied by spray among the layers selves. Stranded wire in copper give the continuity. The coating, attached to the structure by polymerization of spraymat resin in autoclave at high temperature, is covered by erocoat top coat layer (thickness about $300 \,\mu$ m) for protection against both the rain and impact of materials.

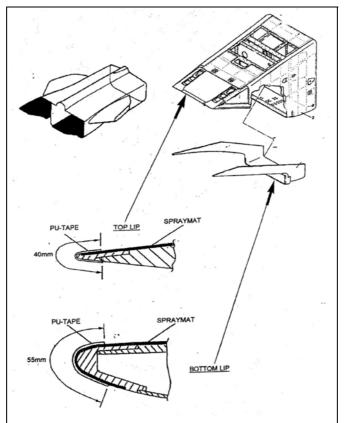


Figure 3: The air intake ducts

The erosion of the top coat permits the water permeation between the resin and the surface of the air intake which causes superficial corrosion detectable only after the coating raising or with the short circuit of the heating elements. Methods of protecting the coating were proposed during the years. RAF intended to spray tungsten carbide [8] to retard erosion, whereas GAF used a polyurethane tape and a Thermovision trial as method of inspection for corrosion with good results, suggesting the regularization from Panavia. Nevertheless further tests are still ongoing to solve problems due to overheating of the heating elements for insulating effect and aerodynamic erosion of the tape.

3.0 CONCLUSIONS

This paper showed the structural parts of Tornado aircraft more affected to wear and the investigations carried out to limit the phenomenon. Some, such as in the case of the taileron leading edge, were adequate, so that were adopted from the Nations using Tornado aircraft; some, for example in the case of air intake ducts, require further improved wear systems.



4.0 **REFERENCES**

- [1] Aerospace Engineering, August 2003, 9;
- [2] www.manufacturingtalk.com/news/lic/lic109.html;
- [3] <u>www.indestructible.co.uk/cat2/range.html;</u>
- [4] ibidem [3];
- [5] <u>www.cvdmaterials.com;</u>
- [6] C. D. Hamm, K. Blomeir, 82nd Meeting of the AGARD SMP, Sesimbra, Portugal, May 1996;
- [7] Minutes of Tri-National corrosion information exchange meeting, St. Athan, RAF, Nov. 1997;
- [8] Minutes of Tri-National corrosion information exchange meeting, Cottesmore, RAF, Sep. 1994.



AVT-109

Specialist Meeting on the Control and Reduction of Wear in Military Platforms

Summary of Discussion Sessions

The following presents a summary of the discussion of papers presented in the various sessions of the workshop. Only questions where the authors provided transcripts of their answers are reported.

Session 1 – Service Experience and Repair

Chair: Dr. Georg Gunther, EADSM, Germany

Paper MP-AVT-109-7

Dr. Ali Lafci, ASELSAN A.S., Turkey

Q. What are the corrosion and erosion problems on the service parts of the F16 aircraft?

Dr. Franco Bagnoli, Italian Air Force, Italy.

A. The F16 aircraft were in service in the Italian Air Force (IAF) only for the last year, and cases of erosion or corrosion problems so far have not been seen.

Dr. Ali Lafci, ASELSAN A.S., Turkey

Q. Are the problems faced on Tornados arising from materials selection or other sources?

Dr. Franco Bagnoli, Italian Air Force, Italy

A. The main problems are due to aerodynamic and thermal effects.