

# SIEMENS

## SINUMERIK

### SINUMERIK 840D sl, SINAMICS S120 Alarms

#### Diagnostics Manual

#### Preface

---

#### Introduction

---

1

#### NCK alarms

---

2

#### Cycle alarms

---

3

#### HMI alarms

---

4

#### SINAMICS alarms

---

5

#### Drive and I/O alarms

---

6

#### PLC alarms

---

7

#### List of actions

---

8

#### System responses

---

9

#### Appendix A

---

A

Valid for

SINUMERIK 840D sl / 840DE sl control

Software	version
CNC software	4.4
SINAMICS S120	4.4




09/2011

6FC5398-6BP40-2BA0

## Legal information

### Warning notice system

This manual contains notices you have to observe in order to ensure your personal safety, as well as to prevent damage to property. The notices referring to your personal safety are highlighted in the manual by a safety alert symbol, notices referring only to property damage have no safety alert symbol. These notices shown below are graded according to the degree of danger.

 <b>DANGER</b>
indicates that death or severe personal injury <b>will</b> result if proper precautions are not taken.
 <b>WARNING</b>
indicates that death or severe personal injury <b>may</b> result if proper precautions are not taken.
 <b>CAUTION</b>
with a safety alert symbol, indicates that minor personal injury can result if proper precautions are not taken.
<b>CAUTION</b>
without a safety alert symbol, indicates that property damage can result if proper precautions are not taken.
<b>NOTICE</b>
indicates that an unintended result or situation can occur if the corresponding information is not taken into account.


If more than one degree of danger is present, the warning notice representing the highest degree of danger will be used. A notice warning of injury to persons with a safety alert symbol may also include a warning relating to property damage.

### Qualified Personnel

The product/system described in this documentation may be operated only by **personnel qualified** for the specific task in accordance with the relevant documentation for the specific task, in particular its warning notices and safety instructions. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when working with these products/systems.

### Proper use of Siemens products

Note the following:

 <b>WARNING</b>
Siemens products may only be used for the applications described in the catalog and in the relevant technical documentation. If products and components from other manufacturers are used, these must be recommended or approved by Siemens. Proper transport, storage, installation, assembly, commissioning, operation and maintenance are required to ensure that the products operate safely and without any problems. The permissible ambient conditions must be adhered to. The information in the relevant documentation must be observed.

### Trademarks

All names identified by ® are registered trademarks of the Siemens AG. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

### Disclaimer of Liability

We have reviewed the contents of this publication to ensure consistency with the hardware and software described. Since variance cannot be precluded entirely, we cannot guarantee full consistency. However, the information in this publication is reviewed regularly and any necessary corrections are included in subsequent editions.

# Preface

## SINUMERIK documentation

The SINUMERIK documentation is organized in the following categories:

- General documentation
- User documentation
- Manufacturer/service documentation

## Additional information

You can find information on the following topics at [www.siemens.com/motioncontrol/docu](http://www.siemens.com/motioncontrol/docu):

- Ordering documentation/overview of documentation
- Additional links to download documents
- Using documentation online (find and search in manuals/information)

Please send any questions about the technical documentation (e.g. suggestions for improvement, corrections) to the following address:

[docu.motioncontrol@siemens.com](mailto:docu.motioncontrol@siemens.com)

## My Documentation Manager (MDM)

Under the following link you will find information to individually compile OEM-specific machine documentation based on the Siemens content:

[www.siemens.com/mdm](http://www.siemens.com/mdm)

## Training

For information about the range of training courses, refer under:

- [www.siemens.com/sitrain](http://www.siemens.com/sitrain)  
SITRAIN - Siemens training for products, systems and solutions in automation technology
- [www.siemens.com/sinustrain](http://www.siemens.com/sinustrain)  
SinuTrain - training software for SINUMERIK

## FAQs

You can find Frequently Asked Questions in the Service&Support pages under Product Support. <http://support.automation.siemens.com>

## **SINUMERIK**

You can find information on SINUMERIK under the following link:

[www.siemens.com/sinumerik](http://www.siemens.com/sinumerik)

## **Target group**

This publication is intended for:

- Project engineers
- Commissioning engineers
- Machine operators
- Service and maintenance personnel.

## **Benefits**

The Diagnostics Manual enables the intended target group to evaluate error and fault indications and to respond accordingly.

With the help of the Diagnostics Manual, the target group has an overview of the various diagnostic options and diagnostic tools.

## **Technical Support**

You will find telephone numbers for other countries for technical support in the Internet under <http://www.siemens.com/automation/service&support>

# Table of contents

	<b>Preface</b> .....	<b>3</b>
<b>1</b>	<b>Introduction</b> .....	<b>7</b>
	1.1 Using the Diagnostics Manual .....	7
	1.2 Structure of the diagnostics manual .....	7
	1.3 Alarm number ranges .....	10
	1.4 System error alarms .....	13
<b>2</b>	<b>NCK alarms</b> .....	<b>15</b>
<b>3</b>	<b>Cycle alarms</b> .....	<b>529</b>
<b>4</b>	<b>HMI alarms</b> .....	<b>677</b>
<b>5</b>	<b>SINAMICS alarms</b> .....	<b>697</b>
<b>6</b>	<b>Drive and I/O alarms</b> .....	<b>1175</b>
<b>7</b>	<b>PLC alarms</b> .....	<b>1187</b>
<b>8</b>	<b>List of actions</b> .....	<b>1217</b>
<b>9</b>	<b>System responses</b> .....	<b>1239</b>
	9.1 System reactions to SINUMERIK alarms .....	1239
	9.2 Cancel criteria for alarms.....	1242
	9.3 System reactions for SINAMICS alarms.....	1243
<b>A</b>	<b>Appendix A</b> .....	<b>1247</b>
	A.1 List of abbreviations.....	1247
	A.2 Overview.....	1252



# Introduction

## 1.1 Using the Diagnostics Manual

The Diagnostics Manual refers to the alarms / messages from the NCK area, HMI, PLC and SINAMICS. It should be used as a reference manual and allows operators at the machine tool:

- To correctly assess special situations when operating the machine.
- To identify the response of the system to the special situation.
- To utilize the possibilities for continued operation following the special situation.
- To follow references to other documentation containing further details.

## 1.2 Structure of the diagnostics manual

### NCK / HMI / drive and I/O / PLC alarms

The descriptions for the alarms can be found in the chapters:

- NCK alarms [Page 15]
- HMI alarms [Page 677]
- Drive and I/O alarms [Page 1175]
- PLC alarms [Page 1187]

In each chapter, the alarm descriptions are sorted according to ascending alarm number. There are gaps in the sequence.

### Structure of the NCK / HMI / drive and I/O / PLC alarm descriptions

The descriptions of the alarms have the following layout:

---

**<Alarm No.>**    **<Alarm text>**

**Explanation:**

**Reaction:**

**Help:**

**Continue  
program:**

Each alarm is uniquely identified using the <Alarm number> and the <Alarm text>.

The description of the alarms is classified according to the following categories:

- Explanation  
See Chapter: NCK alarms [Page 15]
- Response
- Remedy
- Program continuation  
See Chapter: Cancel criteria for alarms [Page 1242]

### Action list

The actions described in the NCK alarm texts ("Action %...") are explained in the following Chapter:

List of actions [Page 1217]

### SINAMICS alarms

The faults and states detected by the individual components of the drive system are indicated by alarms. These SINAMICS alarms are categorized into faults and alarms.

The differences between faults and alarms are as follows:

<b>Fault</b>	<ul style="list-style-type: none"><li>• The appropriate fault reaction is initiated when a fault occurs.</li><li>• The following measures are required to remove the fault:<ul style="list-style-type: none"><li>– Removing the cause of the fault</li><li>– Acknowledging the fault</li></ul></li></ul>
<b>Alarm</b>	<ul style="list-style-type: none"><li>• No fault reaction.</li><li>• Alarms are self-acknowledging, i.e. if the cause has been removed, the alarms reset themselves automatically.</li></ul>

The descriptions for the SINAMICS alarms are provided Chapter:

System reactions for SINAMICS alarms [Page 1243]

### Structure of SINAMICS alarm descriptions

The descriptions of the SINAMICS alarms have the following layout:



---

**<Alarm No.>      <Location data>    <Alarm text>**

**Message value:**

**Drive object:**

**Reaction:**

**Acknowledgment:**

**Cause:**

**Help:**

Each alarm is uniquely identified using the <Alarm number> and the <Alarm text>.

The <Location data> is optional display information. Location data can include:

- Axis name and drive number or
- Bus and slave number of the PROFIBUS DP component affected

The place holder <Location data> is kept in the alarm description for this optional information.

The description of the SINAMICS alarms is classified according to the following categories:

- Message value

The information provided under the message value tells you about the composition of the fault/alarm value.

Example:

Message value: Component number: %1, cause: %2

This fault value or alarm value contains information about the component number and cause. The entries %1 and %2 are place holders, which are filled appropriately in online operation with the commissioning software.

- Drive object

For each alarm (fault/alarm) it is specified in which drive object this message can be found. A message can belong to either one, several or all drive objects.

- Response

Specifies the default reaction in the event of a fault.

See Chapter: System reactions for SINAMICS alarms [Page 1243]

- Acknowledgment

See Chapter: System reactions for SINAMICS alarms [Page 1243]

- Cause

For the cause of the alarm, the fault/alarm value is essentially prepared in text form.

- Remedy

## References

If you require further information on the alarms, you can find the alarms under a 5-character parameter number in List Manual SINAMICS S120/S150.

The notation of the parameter numbers can be derived as follows:

In the SINAMICS List Manual, faults and alarms start with the letter "F" and the following five-digit number.

Example:

The description of alarm **207016** can be found under parameter **F07016**.

## Synchronization of time and date

### NOTICE

#### Synchronization of time

The SINAMICS drives have no real-time clock. The time of day and date of the SINAMICS clock are synchronized in a 10-second cycle with the SINUMERIK real-time clock.

The result is that after a change of the date and/or the clock of the SINUMERIK real-time clock up to 10 seconds expire until this change has been synchronized with the SINAMICS drives.

If in this up period of up to 10 seconds SINAMICS alarms occur (alarm numbers 200000 - 299999), this SINAMICS alarms still receive the outdated date / time stamp. The SINUMERIK alarms (alarm numbers < 200000 and > 300000) triggered as a result of the SINAMICS alarms, on the other hand, already receive the new date/ time stamp.

## 1.3 Alarm number ranges

The following tables show an overview of all of the reserved number ranges for alarms/ messages.

### NOTICE

In the alarm lists of this Diagnostics Manual, only those number ranges are represented, which are valid for the specified product.

Table 1-1 NCK alarms/messages

000 000 - 009 999	General alarms	
010 000 - 019 999	Channel alarms	
020 000 - 029 999	Axis/spindle alarms	
	027 000 - 027 999	Alarms for Safety Integrated

Table 1-1 NCK alarms/messages

030 000 - 099 999	Functional alarms	
	060 000 - 064 999	Cycle alarms SIEMENS
	065 000 - 069 999	Cycle alarms user
	070 000 - 079 999	Compile cycles - manufacturers and OEMs
	082 000 - 082 999	Messages, SHOPMILL and CMT cycles
	083 000 - 084 999	Messages, measurement cycles
	085 000 - 089 999	Messages, user cycles

Table 1-2 HMI alarms/messages

100 000 - 119 999	HMI Embedded	
	100 000 - 100 999	Basic system
	101 000 - 101 999	Diagnostics
	102 000 - 102 999	Services
	103 000 - 103 999	Machine
	104 000 - 104 999	Parameter
	105 000 - 105 999	Programming
	106 000 - 106 999	Reserved
	107 000 - 107 999	MCU
	108 000 - 108 999	HiGraph
	109 000 - 109 999	Distributed systems (M : N)
	110 000 - 110 999	Cycles
	113 000 - 113 999	Wizard (HMI Embedded)
	114 000 - 114 999	HT 6
119 000 - 119 999	OEM	
120 000 - 129 999	HMI Advanced	
130 000 - 139 999	HMI Advanced OEM	
142 000 - 142 099	Remote diagnostics, RCS host/viewer	
148 500 - 148 999	MCIS	
149 000 - 149 999	ePS	
150 000 - 159 999	SINUMERIK Operate	
160 000 - 169 999	SINUMERIK Operate OEM	

Table 1-3 SINAMICS alarms (faults/alarms)

201 000 - 203 999	Control Unit, closed-loop control	
	201 600 - 201 799	Messages from the "Safety Integrated" function integrated in the drive
204 000 - 204 999	Reserved	
205 000 - 205 999	Power unit	
206 000 - 206 899	Infeed	
206 900 - 206 999	Braking Module	

## 1.3 Alarm number ranges

Table 1-3 SINAMICS alarms (faults/alarms)

207 000 - 207 999	Drive
208 000 - 208 999	Option Board
209 000 - 212 999	Reserved
213 000 - 213 010	Licensing
213 011 - 219 999	Reserved
220 000 - 229 999	OEM
230 000 - 230 999	DRIVE-CLiQ component power unit
231 000 - 231 999	DRIVE-CLiQ component encoder 1
232 000 - 232 999	DRIVE-CLiQ component encoder 2 <b>Note:</b> Faults that occur are automatically output as an alarm if the encoder is parameterized as a direct measuring system and does not intervene in the motor control.
233 000 - 233 999	DRIVE-CLiQ component encoder 3 <b>Note:</b> Faults that occur are automatically output as an alarm if the encoder is parameterized as a direct measuring system and does not intervene in the motor control.
234 000 - 234 999	Voltage Sensing Module (VSM)
235 000 - 235 199	Terminal Module 54F (TM54F)
235 200 - 235 999	Terminal Module 31 (TM31)
236 000 - 236 999	DRIVE-CLiQ Hub Module
240 000 - 240 999	Controller Extension
241 000 - 248 999	Reserved
249 000 - 249 999	SINAMICS GM/SM/GL
250 000 - 250 499	Communication Board (COMM BOARD)
250 500 - 259 999	OEM Siemens
260 000 - 265 535	SINAMICS DC MASTER (DC closed-loop control)

Table 1-4 Drive and I/O alarms

300 000 - 399 999	General drive alarms
-------------------	----------------------

Table 1-5 PLC alarms/messages

400 000 - 499 999	General PLC alarms
500 000 - 599 999	Channel alarms <sup>2)</sup>
600 000 - 699 999	Axis/spindle alarms <sup>2)</sup>
700 000 - 799 999	User area <sup>2)</sup>

<sup>1)</sup> More detailed information is available via the diagnostic function (diagnostic buffer) in SIMATIC STEP 7.

<sup>2)</sup> The PLC alarms in the range 500000 - 899999 are configured and described by the machine manufacturer.

Table 1-5 PLC alarms/messages

800 000 - 899 999	Sequencers/graphs <sup>2)</sup>
(810 001 - 810 009	System fault messages in the PLC <sup>1)</sup>

- 1) More detailed information is available via the diagnostic function (diagnostic buffer) in SIMATIC STEP 7.
- 2) The PLC alarms in the range 500000 - 899999 are configured and described by the machine manufacturer.

## 1.4 System error alarms

The following alarms are system errors:

1000	1005	1013	1017
1001	1010	1014	1018
1002	1011	1015	1019
1003	1012	1016	1160

These system error alarms are not described in detail. If such a system error occurs, please contact the hotline and indicate the following details:

- Alarm number
- Alarm text
- Internal system error number (contained in the alarm text)



## NCK alarms

---

<b>1030</b>	<b>System error in link module error code %1 error type %2</b>
<b>Parameters:</b>	%1 = Hex-Zahl Link-Error %2 = Hex-Zahl Link-Error-Type
<b>Definitions:</b>	This alarm is not a user error. An internal error has occurred in the software of the link module. Two parameters are output with this error for debugging purposes. They provide information about the cause and location of the error.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Place a support request with the error text under: <a href="http://www.siemens.com/automation/support-request">http://www.siemens.com/automation/support-request</a>
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

<b>1031</b>	<b>Link module generated an unspecified error %1 NCU %2 %3 %4</b>
<b>Parameters:</b>	%1 = Hex-Zahl unspecified status in stateOfLinkModules %2 = NCU number %3 = Command from link module to NCK %4 = Status of own link
<b>Definitions:</b>	This alarm is not a user error. - 1. If NCU== 0 -> A parameter not equal to zero was not found - 2. If NCU not equal to zero -> An error which the NC was not able to interpret in the connection to this NCU. The error is output as a number. It is possible that the NCU link module is running a newer software version than the NC. The other parameters are used for error localization in the NC/LINK-MODUL software.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Place a support request with the error text under: <a href="http://www.siemens.com/automation/support-request">http://www.siemens.com/automation/support-request</a>
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

<b>2000</b>	<b>PLC sign-of-life monitoring</b>
<b>Definitions:</b>	The PLC must give a sign of life within a defined period of time (MD10100 \$MN_PLC_CYCLIC_TIMEOUT). If this does not occur, the alarm is triggered. The sign of life is a counter reading on the internal NC/PLC interface which the PLC causes to count up with the 10 ms time alarm. The NCK also tests cyclically whether the counter reading has changed.
<b>Reaction:</b>	NC not ready. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check monitoring time frame in MD10100 \$MN\_PLC\_CYCLIC\_TIMEOUT (reference value: 100ms). Establish the cause of the error in the PLC and eliminate it (analysis of the ISTACK. If monitoring has responded with a loop in the user program rather than with a PLC Stop, there is no ISTACK entry).

**Program Continuation:** Switch control OFF - ON.

---

**2001 PLC has not started up**

**Definitions:** The PLC must give at least 1 sign of life within a period of time defined in MD10120 \$MN\_PLC\_RUNNINGUP\_TIMEOUT (default: 1 sec.).

**Reaction:** NC not ready.  
Local alarm reaction.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Please inform the authorized personnel/service department. The monitoring time in MD10120 \$MN\_PLC\_RUNNINGUP\_TIMEOUT must be checked and adapted to the first OB1 cycle.  
- Determine the cause of error in the PLC (loop or stop in the user program) and eliminate it.

**Program Continuation:** Switch control OFF - ON.

---

**2100 NCK battery warning threshold reached**

**Definitions:** The undervoltage monitor of the NCK battery has reached the prewarning threshold. This is at 2.7-2.9 V (nominal voltage of the battery is 3.0-3.1 V at 950 mAh).

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. The battery must be replaced within the next 6 weeks. After this period, the voltage can drop below the alarm limit of 2.4-2.6 V if the RAMs to be buffered take up a lot of current.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**2101 NCK battery alarm**

**Definitions:** The undervoltage monitoring (2.4 - 2.6 V) of the NCK battery has responded during cyclic operation.

**Reaction:** Alarm display.

**Remedy:** If the NCK battery is replaced without interrupting the power supply, no data will be lost. This means that production can continue without taking any further steps. (A buffer capacitor on the NCK holds the supply voltage for at least 30 minutes and the battery can be replaced within this time even when the control is switched off). Sinumerik combines an NCU's two potential parts subject to wear (fan/battery) in one shared mechanically replaceable module the construction of which is easily accessible.  
When the battery module is unplugged during operation, the module is also separated from the fan's air supply. Therefore the battery should only be replaced during operation, if production cannot be continued otherwise.  
If it is not possible to replace the battery quickly, a second fan/battery module should be available for use during the replacement process. It should be plugged onto the NCU during replacement of the battery.  
In this context please note for the safety function of the '840D sl' that it will switch off the module automatically after a certain time, if the fan is defect or not plugged in; this will protect the NCU from thermal destruction (see Manual: chapter Dual fan/battery module).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---



---

**2102 NCK battery alarm**

<b>Definitions:</b>	The undervoltage monitoring (2.4 - 2.6 V) of the NCK battery was detected during system power-up.
<b>Reaction:</b>	NC not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Pull out the battery/fan unit from the NC module and replace the battery (type: lithium battery with lead, size 1/2 AA, 850 mAh, min. 3.2 V). The system must then be reinitialized because it must be assumed that data has been lost in the buffered RAM during the last power-off phase as a result of insufficient supply voltage (refer to Section 2.2 in the Installation and Start-up Guide for the procedure). The following data might have been corrupted or entirely lost: <ul style="list-style-type: none"> <li>- NC machine data</li> <li>- Drive machine data</li> <li>- Option data</li> <li>- Setting data</li> <li>- User variable</li> <li>- Global subroutines</li> <li>- Cycles and macros, as well as</li> <li>- PLC machine data</li> <li>- PLC basic program</li> <li>- PLC user program, and all</li> <li>- PLC user data</li> </ul> User data in the NCK and PLC (e.g. tool and workpiece data) that have been altered by the manufacturing process since the last data backup must be updated manually to match the present machine status!
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**2110 NCK temperature alarm**

<b>Definitions:</b>	The temperature sensor has reached the response threshold of 60 degrees C +/- 2.5 degrees C.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	In order to reset the sensor, the temperature must be reduced by 7 degrees C.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

**2120 NCK fan alarm type %1**

<b>Definitions:</b>	The fan consists of a 26 VDC motor with electronic commutator (rated speed: approx. 8700 rpm). The commutator signal is used for speed monitoring, response speed: < 7500 rpm. If 'Type 1' is output, this involves a module that can be shut off forcefully to prevent mechanical destruction (see Manual: Chapter Dual fan/battery module).
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The unit with the fan and NCK battery must be replaced.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

**2130**                    **5V/24V encoder or 15V D/A converter undervoltage**

**Definitions:**            A failure has occurred in the power supply to the encoder (5V/24V) or D/A converter (+/-15V).

**Reaction:**                NC not ready.  
The NC switches to follow-up mode.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Axes of this channel must be re-referenced.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:**                 Please inform the authorized personnel/service department. Check the encoder and cable for short-circuits (the fault should not occur when you remove the cable). Check the power feeder line.

**Program Continuation:**    Switch control OFF - ON.

---

**2140**                    **The actual service switch position forces the SRAM to be cleared at the next Power On (general reset active)**

**Definitions:**            The initialization switch is currently set to overall reset. This means that the module's SRAM is deleted with the next module reset. The NC data memory is cleared during this operation.

**Reaction:**                NC not ready.  
Interface signals are set.  
Alarm display.

**Remedy:**                 Reset initialization switch to zero.

**Program Continuation:**    Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**2190**                    **Hardware plug-in module for communication with the digitizer missing**

**Definitions:**            MD \$MN\_ASSIGN\_DIGITIZE\_TO\_CHAN was used to activate the digitizing function by assigning it to a channel. The function requires a hardware module (RS422 board plugged into the NCU) for communication with the digitizing unit. This module was not found when booting.

**Reaction:**                Interface signals are set.  
Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department. Plug in communications module or cancel channel assignment.

**Program Continuation:**    Switch control OFF - ON.

---

**2192**                    **No NCU link module exists, MD %1 reset**

**Parameters:**            %1 = String: MD identifier

**Definitions:**            An attempt was made to activate the NCU link functionality but the hardware is not available. The MD was reset. Only occurs with the NCU link system

**Reaction:**                NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:**                 Install the hardware module and activate the function again (MD).

**Program** Switch control OFF - ON.  
**Continuation:**

### 2193 **'Safety Integrated' is not available for link axis %1.**

**Parameters:** %1 = Machine axis index  
**Definitions:** The "Safety Integrated" function is not available for a link axis. Only occurs with the NCU link system  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Use "Safety Integrated" function for local axes only.  
**Program** Switch control OFF - ON.  
**Continuation:**

### 2194 **Link axis active and \$MN\_MM\_SERVO\_FIFO\_SIZE != 3**

**Definitions:** At least one axis is to be distributed via NCU link, then the machine data \$MN\_MM\_SERVO\_FIFO\_SIZE must be 3. Occurs only with an NCU link system.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Set \$MN\_SERVO\_FIFO\_SIZE to 3.  
**Program** Switch control OFF - ON.  
**Continuation:**

### 2195 **[Channel %1: ] Axis %2 high-speed punching/nibbling not possible via link**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
**Definitions:** An attempt was made to activate high-speed nibbling or punching for an axis programmed on a different NCU than the drive.  
**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.  
**Remedy:** High-speed nibbling and punching is only supported on one NCU.  
**Program** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.  
**Continuation:**

### 2196 **Link axis active and MD18720 \$MN\_MM\_SERVO\_FIFO\_SIZE != %1**

**Parameters:** %1 = required value in MD18720 \$MN\_MM\_SERVO\_FIFO\_SIZE

**Definitions:** Occurs only with an NCU link system.  
- Possible causes of the fault:  
- At least one axis is to be distributed via NCU link, then the MD18720 \$MN\_MM\_SERVO\_FIFO\_SIZE must be 3 or 4.  
- The IPO cycle of this NCU is faster than the link communication cycle, then the MD18720 \$MN\_MM\_SERVO\_FIFO\_SIZE must be set to the value proposed in the alarm.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** MD18720 \$MN\_MM\_SERVO\_FIFO\_SIZE must be set to the value proposed in the alarm.

**Program Continuation:** Switch control OFF - ON.

---

**2200 [Channel %1: ] Fast punching/nibbling not possible in several channels**

**Parameters:** %1 = Channel number

**Definitions:** An attempt was made to activate fast nibbling or punching in a channel while it has already been active in another channel. Fast punching and nibbling is only possible simultaneously in the same channel.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Fast nibbling and punching simultaneously in 1 channel only.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**2900 Reboot is delayed**

**Definitions:** This alarm indicates a delayed reboot.  
This alarm only occurs when reboot was carried out by the HMI and MD10088 \$MN\_REBOOT\_DELAY\_TIME was set greater than zero.  
The alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK Bit 20.

**Reaction:** NC not ready.  
The NC switches to follow-up mode.  
Mode group not ready, also effective for single axes.  
Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Alarm reaction delay is cancelled.

**Remedy:** See MD10088 \$MN\_REBOOT\_DELAY\_TIME and MD11410 \$MN\_SUPPRESS\_ALARM\_MASK.

**Program Continuation:** Switch control OFF - ON.

---

---

<b>3000</b>	<b>Emergency stop</b>
<b>Definitions:</b>	The EMERGENCY STOP request is applied to the NCK/PLC interface DB10 DBX56.1 (Emergency stop).
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Alarm reaction delay is cancelled.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Remove the cause of the emergency stop and acknowledge the emergency stop via the PLC/NCK interface DB10 DBX56.2 (emergency stop acknowledgement).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

<b>4000</b>	<b>[Channel %1: ] Machine data %2[%3] has gap in axis assignment</b>
<b>Parameters:</b>	%1 = Channel number %2 = String: MD identifier
<b>Definitions:</b>	The assignment of a machine axis to a channel by the MD20070 \$MC_AXCONF_MACHAX_USED must be contiguous. At system power-up (Power On) gaps are detected and displayed as an alarm.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The entries for the indices for the machine axes used in the channels must be contiguous in table MD20070 \$MC_AXCONF_MACHAX_USED. Channel axis gaps must be enabled via MD11640\$MN_ENABLE_CHAN_AX_GAP.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4001</b>	<b>[Channel %1: ] Axis %2 defined for more than one channel via machine data %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Index: Machine axis number %3 = String: MD identifier
<b>Definitions:</b>	In the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED [CHn, AXm]=x (n ... channel number, m ... channel axis number, x ... machine axis number), several channels were assigned to a machine axis without having a master channel defined for this axis. -
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. In the axis-specific MD30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN [AXm]=n (m ... machine axis number, n ... channel number), a master axis was set for the axes that are supposed to be alternately assigned by the NC program to one or the other channel.
<b>Program Continuation:</b>	Switch control OFF - ON.

**4002 [Channel %1: ] Machine data %2[%3] assigns an axis not defined in channel**

**Parameters:** %1 = Channel number  
 %2 = String: MD identifier  
 %3 = Index: MD array index

**Definitions:** Only axes that have been activated in the channel by means of MD20070 \$MC\_AXCONF\_MACHAX\_USED [kx]=m may be declared as geometry axes or transformation axes by means of the MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB [gx]=k. This also applies to MD22420 \$MC\_FGROUP\_DEFAULT\_AXES (gx: Geometry axis index, kx: Channel axis index, k: Channel axis no., m: Machine axis no.).  
 Assignment of geometry axes to channel axes  
 MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB (includes channel axis no. k):  
 - Geometry axis index: 0, 1st channel: 1, 2nd channel: 1  
 - Geometry axis index: 1, 1st channel: 2, 2nd channel: 0  
 - Geometry axis index: 2, 1st channel: 3, 2nd channel: 3  
 MD20070 \$MC\_AXCONF\_MACHAX\_USED (includes machine axis no. m):  
 - Channel axis index: 0, 1st channel: 1, 2nd channel: 4  
 - Channel axis index: 1, 1st channel: 2, 2nd channel: 5  
 - Channel axis index: 2, 1st channel: 3, 2nd channel: 6  
 - Channel axis index: 3, 1st channel: 7, 2nd channel: 0  
 - Channel axis index: 4, 1st channel: 8, 2nd channel: 0  
 - Channel axis index: 5, 1st channel: 0, 2nd channel: 0  
 - Channel axis index: 6, 1st channel: 0, 2nd channel: 0  
 - Channel axis index: 7, 1st channel: 0, 2nd channel: 0

**Reaction:** NC not ready.  
 Mode group not ready, also effective for single axes.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
 Correct  
 - MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB  
 - MD24... \$MC\_TRAFO\_AXES\_IN\_...  
 - MD24... \$MC\_TRAFO\_GEOAX\_ASSIGN\_TAB\_...  
 - MD22420 \$MC\_FGROUP\_DEFAULT\_AXES  
 - and/or MD20070 \$MC\_AXCONF\_MACHAX\_USED.

**Program Continuation:** Switch control OFF - ON.

**4003 Axis %1 incorrect assignment of master channel in machine data %2**

**Parameters:** %1 = Axis  
 %2 = String: MD identifier

**Definitions:** For some applications, it is useful to operate an axis in several channels (C axis or spindle on single spindle or double carriage machines).  
 The machine axes which are defined through the channel-specific MD20070 \$MC\_AXCONF\_MACHAX\_USED in several channels, must be assigned to a master channel with the axis-specific MD30550 \$MA\_AXCONF\_ASSIGN\_MASTER\_CHAN.  
 For axes that are activated in one channel only, the number of this channel or zero must be entered as a master channel.

**Reaction:** NC not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Modify MD 20070: \$MC\_AXCONF\_MACHAX\_USED and/or MD30550: \$MA\_AXCONF\_ASSIGN\_MASTER\_CHAN.

**Program** Switch control OFF - ON.  
**Continuation:**

#### 4004 [Channel %1: ] Machine data %2 axis %3 defined repeatedly as geometry axis

**Parameters:** %1 = Channel number  
 %2 = String: MD identifier  
 %3 = Axis index

**Definitions:** An axis may only be defined once as a geometry axis.

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Correct MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB.

**Program** Switch control OFF - ON.  
**Continuation:**

#### 4005 [Channel %1: ] Maximum number of axes is exceeded. Limit %2

**Parameters:** %1 = Channel number  
 %2 = Upper limit for the number of axes in the channel

**Definitions:** MD20070 \$MC\_AXCONF\_MACHAX\_USED defines which machine axes can be used in this channel. This simultaneously defines the number of active axes in the channel. This upper limit has been exceeded. Note: The channel axis gaps may cause certain indices of MD20070 \$MC\_AXCONF\_MACHAX\_USED to remain unused and therefore do not count as active channel axes.  
 Example:  
 - CHANDATA(2)  
 - \$MC\_AXCONF\_MACHAX\_USED[0] = 7  
 - \$MC\_AXCONF\_MACHAX\_USED[1] = 8  
 - \$MC\_AXCONF\_MACHAX\_USED[2] = 0  
 - \$MC\_AXCONF\_MACHAX\_USED[3] = 3  
 - \$MC\_AXCONF\_MACHAX\_USED[4] = 2  
 - \$MC\_AXCONF\_MACHAX\_USED[5] = 0  
 - \$MC\_AXCONF\_MACHAX\_USED[6] = 1  
 - \$MC\_AXCONF\_MACHAX\_USED[7] = 0  
 This channel uses the five machine axes 1, 2, 3, 8, 7, i.e. it has 5 active channel axes.

**Reaction:** NC not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify MD20070 \$MC\_AXCONF\_MACHAX\_USED.

**Program** Switch control OFF - ON.  
**Continuation:**

#### 4006 The maximum number of activatable axes has been exceeded (limit %1)

**Parameters:** %1 = Number of axes

**Definitions:** The sum of the two option data \$ON\_NUM\_AXES\_IN\_SYSTEM and \$ON\_NUM\_ADD\_AXES\_IN\_SYSTEM must not exceed the maximum number of axes in the system.

**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personel/service department. The sum of the two option data \$ON\_NUM\_AXES\_IN\_SYSTEM and \$ON\_NUM\_ADD\_AXES\_IN\_SYSTEM must not exceed the maximum number of axes (dependent on configuration).

**Program Continuation:** Switch control OFF - ON.

---

**4007 Axis %1 incorrect assignment of master NCU in machine data %2**

**Parameters:** %1 = Axis  
%2 = String: MD identifier

**Definitions:** Machine axes which can be activated on several NCKs through MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB must be assigned to a master NCU in MD30554 \$MA\_AXCONF\_ASSIGN\_MASTER\_NCU. For axes that are activated on only one NCU, the number of this NCU or 0 must be entered as master NCU. An assignment can only be made with MD30554 \$MA\_AXCONF\_ASSIGN\_MASTER\_NCU if the machine axis is also addressed via a channel MD20070 (\$MC\_AXCONF\_MACHAX\_USED+ MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB).

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct MD30554 \$MA\_AXCONF\_ASSIGN\_MASTER\_NCU and/or MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB.

**Program Continuation:** Switch control OFF - ON.

---

**4009 Machine data %1 contains an illegal value.**

**Parameters:** %1 = String: MD identifier

**Definitions:** A value has been entered which exceeds the value range or a limit value for a variable, a machine data or a function.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Enter correct values.

**Program Continuation:** Switch control OFF - ON.

---

**4010 Invalid identifier used in machine data %1[%2]**

**Parameters:** %1 = String: MD identifier  
%2 = Index: MD array index



---

<b>Definitions:</b>	When determining a name in the NCK tables (arrays) for: machine axes, Euler angles, direction vectors, normal vectors, interpolation parameters and intermediate point coordinates, one of the following syntax rules for the identifier to be entered has been violated: <ul style="list-style-type: none"> <li>- The identifier must be an NC address letter (A, B, C, I, J, K, Q, U, V, W, X, Y, Z), possibly with a numerical extension (840D: 1-99)</li> <li>- The identifier must begin with any 2 capital letters but not with \$ (reserved for system variables).</li> <li>- The identifier must not be a keyword of the NC language (e.g. POSA).</li> </ul>
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Enter the identifier for user-defined names with correct syntax in the displayed MD. <ul style="list-style-type: none"> <li>- Machine axes: MD10000 \$MN_AXCONF_MACHAX_NAME_TAB</li> <li>- Euler angles: MD10620 \$MN_EULER_ANGLE_NAME_TAB</li> <li>- Normal vectors: MD10630 \$MN_NORMAL_VECTOR_NAME_TAB</li> <li>- Direction vectors: MD10640 \$MN_DIR_VECTOR_NAME_TAB</li> <li>- Interpolation parameters: MD10650 \$MN_IPO_PARAM_NAME_TAB</li> <li>- Intermediate point coordinates: MD10660 \$MN_INTERMEDIATE_POINT_NAME_TAB</li> </ul>
<b>Program Continuation:</b>	Switch control OFF - ON.

---

#### 4011 [Channel %1: ] Invalid identifier used in machine data %2[%3]

<b>Parameters:</b>	%1 = Channel number %2 = String: MD identifier %3 = Index: MD array index
<b>Definitions:</b>	When defining names in the channel-specific tables for geometry axes and channel axes, one of the following syntax rules for the identifier to be entered has been violated: <ul style="list-style-type: none"> <li>- The identifier must be an NC address letter (A, B, C, I, J, K, U, V, W, X, Y, Z), possibly with a numerical extension.</li> <li>- The identifier must begin with any 2 capital letters but not with \$ (reserved for system variables).</li> <li>- The identifier must not be a keyword of the NC language (e.g. SPOS).</li> </ul>
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Enter the identifier for user-defined names with correct syntax in the displayed MD <ul style="list-style-type: none"> <li>- Geometry axes: MD20060 \$MC_AXCONF_GEOAX_NAME_TAB</li> <li>- Channel axes: MD20080 \$MC_AXCONF_CHANAX_NAME_TAB</li> </ul>
<b>Program Continuation:</b>	Switch control OFF - ON.

---

#### 4012 Invalid identifier used in machine data %1[%2]

<b>Parameters:</b>	%1 = String: MD identifier %2 = Index: MD array
--------------------	--

**Definitions:** The selected identifier is invalid. Valid identifiers are:  
- AX1 - AXn: Machine axis identifiers  
- N1AX1 - NnAXm: Link axis identifiers (NCU + machine axis), only for 'NCU-Link' expansion level!  
- C1S1 - CnSm: Container axis identifiers (container + container location), only for 'Axis container' expansion level!

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Use the correct identifier.

**Program**  
**Continuation:** Switch control OFF - ON.

---

**4013 Invalid NCU link configuration by machine data %1 = %2 , on NCU\_1 = %3**

**Parameters:** %1 = String: MD identifier  
%2 = Index: MD array  
%3 = MD value of master NCU

**Definitions:** The link module configuration detected on the local NCU is different from the master NCU of the NCU cluster. The link module configuration defines the system clock time, the communication baudrate and the maximum number of message transfer retries.  
The following machine data are used for this purpose:  
- SYSCLOCK\_SAMPL\_TIME\_RATIO,  
- IPO\_SYSCLOCK\_TIME\_RATIO,  
- LINK\_RETRY\_CTR,  
- LINK\_BAUDRATE\_SWITCH,  
- SYSCLOCK\_CYCLE\_TIME  
The values of these machine data must be the same on all NCUs.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** The machine data required for the link module configuration must be the same on all NCUs in the cluster.

**Program**  
**Continuation:** Switch control OFF - ON.

---

**4014 Axis %1 defined several times in %2**

**Parameters:** %1 = String: MD identifier  
%2 = String: Check and, if necessary, correct the following machine data with reference to the data sheet:

**Definitions:** An axis was assigned several times.  
The axis can be a:  
- Machine axis  
- Link axis  
- Axis in a container location

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Define a correct, unique axis assignment.

**Program Continuation:** Switch control OFF - ON.

#### **4015 Axis container %1, location %2, location %3 mixed spindle and axis**

**Parameters:** %1 = Axis container number  
%2 = Axis container location  
%3 = Axis container location

**Definitions:** An axis container can contain either spindles only (35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX != 0) or axes only (35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX == 0). Mixed operation is not possible. However, spindles can run in axis mode.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Machine data 35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX must be either != 0 or == 0 for all axes/spindles in an axis container.

**Program Continuation:** Switch control OFF - ON.

#### **4016 Axis %1 already used by NCU %2**

**Parameters:** %1 = Machine axis index  
%2 = NCU number

**Definitions:** An attempt was made to apply setpoints to one axis from several NCUs. Only occurs with the NCU link system

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Define a correct, unique axis assignment.

**Program Continuation:** Switch control OFF - ON.

#### **4017 Axis container %1, location %2 already used by NCU %3**

**Parameters:** %1 = Axis container number  
%2 = Axis container location  
%3 = NCU number

**Definitions:** A multiple reference to the axis container location has been made via the logical axis table (MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB). With the NCU link, the multiple reference may also have been made by another NCU in the NCU group.  
Example: Container1 location1 was referenced twice incorrectly  
- \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB[0] = CT1\_SL1  
- \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB[6] = CT1\_SL1

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct and complete the container location assignments. Check the machine data for the logical axis assignment table (MN\_AXCONF\_LOGIC\_MACHAX\_TAB)  
**Program Continuation:** Switch control OFF - ON.

---

**4018 Axis container %1, location %2 not used by any channel**

**Parameters:** %1 = Axis container number  
%2 = Axis container location  
**Definitions:** The container location is not referenced by any channel.  
**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Correct and complete the container location assignments. Check machine data MD20070 \$MC\_AXCONF\_MACHAX\_USED and MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB.  
**Program Continuation:** Switch control OFF - ON.

---

**4019 Switching axis container %1 in current status %3 of the axis/spindle %4 in channel %2 not permitted.**

**Parameters:** %1 = Axis container number  
%2 = Channel number  
%3 = Current state  
%4 = Axis/spindle  
**Definitions:** This error only occurs with direct advancing of the container. With direct container advancing, only one channel is allowed to activate the NC language command for advancing the container. In order to ensure this, the other channels must have the reset status and the axes must be stationary.  
With NCU link, the above condition applies to all channels of the NCU group.  
Current status:  
- 1 : Interpolator active for axis-container-axis  
- 2: Turning spindle in NCUs various IPO cycle  
- 3: New config active  
- 4: AXCT axis is active leading axis/spindle  
- 5: Measurement active for AXCT axis  
- 6: Overlaid motion active for AXCT axis  
- 7: AXCT axis is active following axis/spindle  
- 8: PLC request active for AXCT axis  
- 9: External work offset is active for AXCT axis  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** The program must be canceled with Reset and the zero offset deselected before activating the axis container switch.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4020 Identifier %1 used several times in machine data %2**

**Parameters:** %1 = String: Name of identifier  
%2 = String: MD identifier

---

<b>Definitions:</b>	When determining a name in the NCK tables (arrays) for: machine axes, Euler angles, direction vectors, normal vectors, interpolation parameters and intermediate point coordinates, an identifier has been used that already exists in the control.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Select for the identifier to be entered a character string that is not yet used in the system (max. 32 characters).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

#### **4021 [Channel %1: ] Identifier %2 used several times in machine data %3**

<b>Parameters:</b>	%1 = Channel number %2 = String: Name of identifier %3 = String: MD identifier
<b>Definitions:</b>	To determine the name in the channel-specific tables for geometry axes and channel axes an identifier already existing in the control has been used.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Select for the identifier to be entered a character string that is not yet used in the system (max. 32 characters).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

#### **4022 [Channel %1: ] Axis %2: axis container %3 switch not allowed: ext. work offset active**

<b>Parameters:</b>	%1 = Channel %2 = Axis/spindle %3 = Axis container number
<b>Definitions:</b>	The axis container switch enable cannot be given because an external zero offset is active.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	The program must be aborted with the RESET key and the external zero point offset deselected before the container is advanced.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

#### **4023 Axis container %1 switch not allowed, axis container %2 switch active**

<b>Parameters:</b>	%1 = Axis container %2 = Axis container
--------------------	--

**Definitions:** Only one axis container can be rotated at a time.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Program must be canceled with Reset and the program sequences (NCUs, channels) must be synchronized such that only one axis container switch is active at a time.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4024 Invalid axis configuration due to missing axis container machine data**

**Parameters:** %1 = NCU number  
%2 = Axis container number  
**Definitions:** The axis configuration could not be generated due to missing axis container machine data. This error can only occur as a result of a communication error. The communication failure will be indicated separately by further alarms.  
**Reaction:** NC not ready.  
Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Correct the link communication problems (refer to the other alarm messages).  
**Program Continuation:** Switch control OFF - ON.

---

**4025 [Channel %1: ] Axis %2: axis container %3 switch not allowed: master/slave active.**

**Parameters:** %1 = Channel  
%2 = Axis/spindle  
%3 = Axis container number  
**Definitions:** It is not possible to enable axis container switch as a master/slave link is active.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Abort program with the RESET key. If required, disconnect the master - slave coupling.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4026 Machine data %1[%2], link axis NC%3\_AX%4 not used by any channel**

**Parameters:** %1 = String: MD identifier  
%2 = Index: MD array  
%3 = NCU number  
%4 = Machine axis number  
**Definitions:** The link axis is not referenced by any channel.  
**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct and complete the logical axis assignments. Check machine data MD20070 \$MC\_AXCONF\_MACHAX\_USED and MD10002 \$MN\_AXCONF\_LOGIC\_MACHAX\_TAB.  
**Program** Switch control OFF - ON.  
**Continuation:**

**4027 NOTICE! MD %1 was also changed for the other axes of axis container %2**

**Parameters:** %1 = String: MD identifier  
 %2 = Axis container number  
**Definitions:** Message to the user indicating that the machine data change for the axis was also performed for all other axes in the same container.  
**Reaction:** Alarm display.  
**Remedy:** None  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

**4028 Attention! The axial MDs of the axes of the axis containers were matched.**

**Definitions:** Note for the user, that the machine data of the axis were matched in the axis containers.  
**Reaction:** Alarm display.  
**Remedy:** None  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**4029 NOTICE! The axial MDs in axis container %1 will be matched on the next power-up**

**Parameters:** %1 = Axis container number  
**Definitions:** Message to the user indicating that the machine data of the axes in the axis container will be matched on the next power-up. An axis container allows axes to be exchanged between channels and NCUs. To ensure that no conflicts arise, the axes within the same axis container must have a similar behavior. The first axis in the axis container determines which machine data have to be the same for the other axis in the axis container.  
**Reaction:** Alarm display.  
**Remedy:** None  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

**4030 [Channel %1: ] Identifier missing in machine date %2[%3]**

**Parameters:** %1 = Channel number  
 %2 = String: MD identifier  
 %3 = Index: MD array index  
**Definitions:** An axis identifier is expected for the displayed MD in accordance with the axis configuration in the MD20070 \$MC\_AXCONF\_MACHAX\_USED and MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB.  
**Reaction:** NC not ready.  
 Mode group not ready, also effective for single axes.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Check axis configuration and enter the missing identifier into the MD or, should the axis not exist, specify for this channel axis the machine axis 0 in the channel-specific MD20070 \$MC\_AXCONF\_MACHAX\_USED. If this concerns a geometry axis that is not to be used (this applies only for 2-axis machining, e.g. on lathes), then channel axis 0 must be entered additionally in the channel-specific MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB.

**Program Continuation:** Switch control OFF - ON.

---

**4031 [Channel %1: ] Link axis %2 defined for more than one channel in machine data %3**

**Parameters:** %1 = Channel number  
%2 = Index: Axis number for logical axis assignment  
%3 = String: MD identifier

**Definitions:** -

**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the MD20070 \$MC\_AXCONF\_MACHAX\_USED or assign a master channel. In the event of a link communication failure, these error causes have to be remedied first.

**Program Continuation:** Switch control OFF - ON.

---

**4032 [Channel %1: ] Wrong identifier for facing axis in %2**

**Parameters:** %1 = Channel number  
%2 = String: MD identifier

**Definitions:** According to the axis configuration in MD20150 \$MC\_GCODE\_RESET\_VALUES or MD20100 \$MC\_DIAMETER\_AX\_DEF, a facing axis identifier is expected at the specified location.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Add the correct identifier.

**Program Continuation:** Switch control OFF - ON.

---

**4033 NOTICE! NCU link communication still not connected**

**Definitions:** The NCU link communication could not be established due to other active alarms. This is the case, for example, if during boot-up the system detects and modifies incorrect cycle times (see alarm 4110).

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Analyze and fix the other alarms and start the control again.

**Program Continuation:** Switch control OFF - ON.



---

<b>4034</b>	<b>Local link axis %1 is not allowed for different interpolation cycle time = %2/%3</b>
<b>Parameters:</b>	%1 = Axis name %2 = Local interpolation cycle %3 = Max. interpolation cycle
<b>Definitions:</b>	Local link axes are only permissible on an NCU if the interpolation cycle set corresponds to the slowest interpolation cycle of the interconnected NCU systems.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Remove local link axis (see MD10000 \$MN_AXCONF_MACHAX_NAME_TAB and MD12701\$MN_AXCT_AXCONF_ASSIGN_TAB1) or adapt the interpolation cycle (MD10070 \$MN_IPO_SYSCLOCK_TIME_RATIO ).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4035</b>	<b>Interpolation cycle from NCU%1 = %2 does not match NCU%3 = %4</b>
<b>Parameters:</b>	%1 = NCU_number1 %2 = MD value of NCU_number1 %3 = NCU_number2 (with slowest IPO cycle) %4 = MD value of NCU_number2
<b>Definitions:</b>	Occurs only with an NCU link system. The interpolation cycles of the NCUs specified in the alarm do not match one another. The slowest IPO cycle in interconnected NCU systems must be an integral multiple of all configured IPO cycles.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Set a suitable value in MD10070 \$MN_IPO_SYSCLOCK_TIME_RATIO for all interconnected NCUs.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4036</b>	<b>Wrong NCU link configuration by MD %1</b>
<b>Parameters:</b>	%1 = String: MD identifier
<b>Definitions:</b>	Occurs only with an NCU link system. Different interpolation and position control cycles have been set in the NCUs of the LINK group. This is only allowed if the function FAST-IPO-LINK in MD18780 \$MN_MM_NCU_LINK_MASK has been activated. Caution: For diagnostic purposes, two additional alarm parameters are output together with this alarm. - 1. 2nd parameter: Position control or IPO cycle time of this NCU - 2. 2nd parameter: Position control or IPO cycle time of another NCU.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

**Remedy:** - Activate FAST-IPO-LINK function in MD18780 \$MN\_MM\_NCU\_LINK\_MASK  
- Or do not set different position control or IPO cycles on the NCUs (see MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO and MD10060 \$MN\_POSCTRL\_SYSCLOCK\_TIME\_RATIO).  
**Program Continuation:** Switch control OFF - ON.

---

**4037 Switching axis container %1 in current state of channel %2 not permitted.**

**Parameters:** %1 = Axis container number  
%2 = Channel number  
**Definitions:** This error occurs only in direct container switching. With direct container switching, only one channel has to activate the NC language command to switch the container. To ensure this, all other channels must be in reset state.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** The program must be canceled with Reset and the zero offset deselected before activating the axis container switch.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4038 Axis container %1 advance not allowed with current status of NCU %2**

**Parameters:** %1 = Axis container number  
%2 = NCU number  
**Definitions:** This error occurs only in direct container switching. With direct container switching, only one channel has to activate the NC language command to switch the container. To ensure this, all other channels must be in reset state.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** The program must be canceled with Reset and the zero offset deselected before activating the axis container switch.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4039 [channel %1: ] : Switching axis container %2 not permitted: Channel has no container axes**

**Parameters:** %1 = Channel  
%2 = Axis container number  
**Definitions:** This error occurs only with direct container switching. The request for direct axis container rotation can be executed only in one channel with container axes.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Program must be stopped with reset. Activate direct container rotation in a channel with container axes.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>4040</b>	<b>[Channel %1: ] Axis identifier %2 not consistent with machine data %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = String: Axis identifier %3 = String: MD identifier %4 = There are not enough channel axes entered in the MD displayed.
<b>Definitions:</b>	The use of the specified axis identifier in the displayed MD is not consistent the channel's axis configuration stated in the MD20070 \$MC_AXCONF_MACHAX_USED and MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB. Only with active "OEM transformation" compile cycle: There are not enough channel axes entered in the MD displayed.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check and correct the identifier used in the MD10000 \$MN_AXCONF_MACHAX_NAME_TAB, MD20080 \$MC_AXCONF_CHANAX_NAME_TAB and/or MD20060 \$MC_AXCONF_GEOAX_NAME_TAB. Only with active "OEM transformation" compile cycle: In addition to the specified MD, check and correct MD24110 \$MC_TRAFO_AXES_IN_1[n] of the activated OEM transformation according to the function description.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4045</b>	<b>[Channel %1: ] Conflict between machine data %2 and machine data %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = String: MD identifier %3 = String: MD identifier
<b>Definitions:</b>	Using the specified machine data %1 leads to a conflict with machine data %2.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct the specified machine data.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4050</b>	<b>NC code identifier %1 cannot be reconfigured to %2</b>
<b>Parameters:</b>	%1 = String: Old identifier %2 = String: New identifier
<b>Definitions:</b>	Renaming of an NC code was not possible for one of the following reasons: - The old identifier does not exist - The new identifier lies in another type range. NC codes/keywords can be reconfigured via machine data as long as the type range is not abandoned. Type 1: "real" G codes: G02, G17, G33, G64, ... Type 2: named G codes: ASPLINE, BRISK, TRANS, ... Type 3: settable addresses: X, Y, A1, A2, I, J, K, ALF, MEAS, ...
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Correct MD10712 \$MN\_NC\_USER\_CODE\_CONF\_NAME\_TAB (protection level 1).  
The list must be built up as follows:  
Even address: Identifier to be modified.  
Following odd address: New identifier  
e.g.: \$MN\_NC\_USER\_CODE\_CONF\_NAME\_TAB [10] = "ROT"  
\$MN\_NC\_USER\_CODE\_CONF\_NAME\_TAB [11] = " "  
clears the ROT function from the control

**Program Continuation:** Switch control OFF - ON.

---

**4060 Standard machine data loaded (%1, %2, %3, %4)**

**Parameters:** %1 = Identifier 1  
%2 = Identifier 2  
%3 = Identifier 3  
%4 = Identifier 4

**Definitions:** The standard MD were loaded because  
- a cold start was requested or  
- the MD buffer voltage failed or  
- an initialization was requested for loading the standard machine data (MD11200 \$MN\_INIT\_MD).

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. After automatically loading the standard MDs, the individual MDs must be entered or loaded in the relevant system.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4062 Backup data loaded**

**Definitions:** The user data saved in the flash memory are loaded to the SRAM.

**Reaction:** Alarm display.

**Remedy:** Load specific machine data again.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**4065 Buffered memory was restored from backup medium (potential loss of data!)**

<b>Definitions:</b>	<p>Only occurs with SINUMERIK 840D / 840Di sl / 802D. !! 840Di sl only</p> <p>The user data of the NC and the remanent data of the PLC are stored in the static memory area (SRAM) of the MCI board. The content of the SRAM is backed up as an SRAM image on PCU hard disk at each "NCK POWER ON reset" and each time Windows XP is closed down normally. The previously valid SRAM image then becomes the SRAM backup, which is also stored on the PCU hard disk.</p> <p>The SRAM backup is used and alarm 4065 issued in the following cases:</p> <table> <thead> <tr> <th>HW serial no</th> <th>SRAM MCI board</th> <th>SRAM image</th> </tr> </thead> <tbody> <tr> <td>MCI board</td> <td>"OK"</td> <td>"OK"</td> </tr> <tr> <td>1. Known</td> <td>No</td> <td>No</td> </tr> <tr> <td>2. Unknown</td> <td>Yes</td> <td>No</td> </tr> <tr> <td>3. Unknown</td> <td>No</td> <td>No</td> </tr> </tbody> </table> <p>!! Only for 802D</p> <p>The reason for this alarm is that the backup time is exceeded. Make sure that the required operating time of the control corresponds to the specifications in your Installation &amp; Start-up Guide. The current backup copy of the buffered memory has been created by the last internal data backup via the "Save data" softkey on the HMI.</p>	HW serial no	SRAM MCI board	SRAM image	MCI board	"OK"	"OK"	1. Known	No	No	2. Unknown	Yes	No	3. Unknown	No	No
HW serial no	SRAM MCI board	SRAM image														
MCI board	"OK"	"OK"														
1. Known	No	No														
2. Unknown	Yes	No														
3. Unknown	No	No														
<b>Reaction:</b>	<p>NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display.</p>															
<b>Remedy:</b>	<p>Make a POWER ON reset. !! 840Di / 840Di sl only: Alarm 4065 also has to be acknowledged on the HMI after a POWER ON reset: HMI: Operating area switchover &gt; Diagnostics &gt; NC/PLC Diagnostics &gt; Diagnostics &gt; "Acknowledge alarm 4065" button Note Press the "ETC" key to change to the secondary softkey bar in order to acknowledge the alarm with a softkey.</p>															
<b>Program Continuation:</b>	<p>Switch control OFF - ON.</p>															

**4070 Normalizing machine data has been changed**

<b>Definitions:</b>	<p>The control uses internal physical units (mm, degrees, s, for paths, velocities, acceleration, etc.). During programming or data storage, some of these values are input and output using different units (rev./min, m/s<sup>2</sup>, etc.). The conversion is carried out with the scaling factors that can be entered (system-specific MD array MD10230 \$MN_SCALING_FACTORS_USER_DEF USER_DEF[n] (n ... index number 0 - 10), when the corresponding masking bit is set to "1".</p> <p>If the masking bit is set to "0" then scaling takes place with the internal standard factors.</p> <p>The following machine data influence the scaling of other MDs:</p> <p>MD10220: \$MN_SCALING_USER_DEF_MASK MD10230: \$MN_SCALING_FACTORS_USER_DEF MD10240: \$MN_SCALING_SYSTEM_IS_METRIC MD10250: \$MN_SCALING_VALUE_INCH MD30300: \$MA_IS_ROT_AX</p> <p>If these data are modified, the NCK must be powered up again. Only then will the input of dependent data be performed correctly.</p>
<b>Reaction:</b>	<p>Alarm display.</p>
<b>Remedy:</b>	<p>Please inform the authorized personnel/service department.</p> <p>If the alarm has been displayed after downloading an MD file which is consistent within itself, then the download operation must be repeated with a new NC power-up. (The file contains scaling-dependent machine data in front of the scaling factors).</p>
<b>Program Continuation:</b>	<p>Clear alarm with the Delete key or NC START.</p>

---

**4071 Check the position of the encoder**

**Definitions:** A machine data has been changed that affects the value of an absolute encoder position. Please check the position values.  
For absolute encoders:  
Encoder adjustment has been changed, the machine reference of the axis position may have changed, check the encoder adjustment.  
Other encoders:  
The reference point of the axis position has been changed, check the referencing procedure.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**4073 Compile cycle functions define machine data number %1 several times**

**Parameters:** %1 = Machine data number

**Definitions:** Can only occur when installing compile cycle functions. Two different compile cycle applications use the same machine data number. The machine data which was defined twice is shifted into the free number range above 64000.

**Reaction:** Alarm display.

**Remedy:** The error has no effect on the usability of the machine data and the function of the compile cycle application. To ensure that the compile cycle machine data documentation is correct, you must contact the supplier of the compile cycle. Only the supplier can remedy the error by changing the software.

**Program Continuation:** Switch control OFF - ON.

---

**4075 Machine data %1 (and maybe others) not changed due to missing permission level %2**

**Parameters:** %1 = String: MD identifier  
%2 = Write protection level of the MD

**Definitions:** On executing a TOA file or when writing machine data from the part program, an attempt has been made to write an item of data with a higher protection level than the access authorization currently set in the control. The item of data in question has not been written and program execution is continued. This alarm is set only when access violation is detected for the first time.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Set the required access level by means of keyswitch or password entry or delete the machine data concerned from the MD file/part program.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**4076 %1 Machine data could not be changed with permission level %2**

**Parameters:** %1 = Number of MDs  
%2 = Preset access authorization

**Definitions:** On executing a TOA file or when writing data from the part program an attempt has been made to write data with a higher protection level than the access authorization currently set in the control. The data in question have not been written and program execution is continued without hindrance. This alarm is issued on acknowledging alarm 4075. It can be cleared only with Power ON.

**Reaction:** NC Start disable in this channel.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Set the required access level by means of keyswitch or password entry or delete the machine data concerned from the MD file/part program.

**Program Continuation:** Switch control OFF - ON.

---

**4077 New value %1 of MD %2 not set. Requested %3 bytes too much %4 memory.**

**Parameters:** %1 = New value of machine data  
 %2 = Machine data number  
 %3 = Number of bytes requested that exceeded availability  
 %4 = Type of memory

**Definitions:** An attempt was made to enter a new value in the specified memory configuration machine data. It was not possible to modify the value, as this would have cleared the contents of the user memory. This was because the memory requested exceeded the available capacity.  
 The third parameter specifies the number of bytes by which the maximum user memory was exceeded.  
 The fourth parameter specifies the type of memory whose limit was exceeded.  
 - "D" stands for dynamic or non-buffered user memory (this is where, for example, the LUD variables are stored and the interpolation buffer size is entered). The capacity of this memory type is defined by the current memory configuration and the value in MD18210 \$MN\_MM\_USER\_MEM\_DYNAMIC.  
 - "S" stands for static or buffered user memory (this is where part programs, offset data, R parameters, tool data, etc. are stored). This memory type is defined by the current memory configuration and the value in MD18230 \$MN\_MM\_USER\_MEM\_BUFFERED.  
 - "iS" stands for internal static or buffered user memory. This memory type is defined by the current memory configuration (not settable). A few NCK functions use this memory.

**Reaction:** Alarm display.

**Remedy:** If the modification was unintentional, ignore the error message and continue. The alarm has no negative effects. The remedy depends on the access right and the current memory configuration of the NCK:  
 - The intended change is not possible -> Try again with a smaller value. Observe the change in the number of bytes.  
 - Is it possible to expand the memory? This option depends on the model in use. (Not possible if parameter 4 equals "iS").  
 - The NCK user memory may have been set smaller than it could be. With the appropriate access authorization, the machine data (see above) can be changed.  
 - If parameter 4 equals "iS" and no synchronous actions are used, then MD18232 \$MN\_MM\_ACTFILESYS\_LOG\_FILE\_MEM[2] = 0 can be set. Otherwise the desired machine data change cannot be made.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**4080 Incorrect configuration of indexing axis in MD %1**

**Parameters:** %1 = String: MD identifier

**Definitions:** The assignment of a position table to an indexing axis or the contents of a position table contains an error, or the length of a position table has been parameterized with 0.

**Reaction:** NC not ready.  
 Mode group not ready, also effective for single axes.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. 3 MD identifiers are output, depending on the type of error.  
 1. MD30500 \$MA\_INDEX\_AX\_ASSIGN\_POS\_TAB: the error is due to multiple assignment of a position table MD10910 \$MN\_INDEX\_AX\_POS\_TAB\_1 or MD10930 \$MN\_INDEX\_AX\_POS\_TAB\_2) to axes with different types (linear/rotary axis).  
 2. MD10910 \$MN\_INDEX\_AX\_POS\_TAB\_1 or MD10930 \$MN\_INDEX\_AX\_POS\_TAB\_2: the contents of the displayed tables are incorrect.  
 - The entered positions must be arranged in increasing size.  
 - A particular position must not be set more than once.  
 - If the table is assigned to one or several modulo axes, then the contents must be within the 0 to < 360 degree range.  
 3. MD10900 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_1 or MD10920 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_2: the length of the displayed position table n was specified with 0.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4082 [channel %1: ] invalid value in machine date %2%3**

**Parameters:** %1 = Channel number  
 %2 = String: MD identifier  
 %3 = String: MD field index

**Definitions:** A value has been entered which exceeds the value range or a limit value for a variable, a machine data or a function.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Enter correct values.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4090 Too many errors during power-up**

**Definitions:** More than <n> errors occurred during control power-up.

**Reaction:** NC Start disable in this channel.  
 Alarm display.

**Remedy:** Set the machine data correctly.

**Program Continuation:** Switch control OFF - ON.

---

**4100 System cycle time/scan time divider corrected for digital drive**

**Definitions:** MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME (system clock cycle) and/or MD10080 \$MN\_SYSCLOCK\_SAMPL\_TIME\_RATIO (division factor of the position control cycle for actual value acquisition) have been corrected.  
 The new value of the system clock cycle can be taken from MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME.  
 For PROFIdrive:  
 The sampling cycle to which the digital drive is synchronized (drive clock cycle) is largely determined by the cycle specifications of the STEP 7 project (above all the PROFIBUS and PROFINET cycle grids).  
 An additional, independent cycle division factor is not required for the actual value acquisition (that means MD10080 \$MN\_SYSCLOCK\_SAMPL\_TIME\_RATIO = 1 usually applies).

**Reaction:** Alarm display.

**Remedy:** No remedial measures are required. The alarm display can be canceled with Reset.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---



---

**4110**                    **IPO cycle changed to %1 ms**

**Parameters:**        %1 = String (new IPO cycle time)

**Definitions:**        The IPO cycle divisor was set to a value which was not an integral multiple of the position control cycle divisor. The divisor (MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO) was increased.  
For PROFIBUS/PROFINET: MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO has been modified because of the modified DP cycle in the SDB (MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME).

**Reaction:**            Alarm display.

**Remedy:**             MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO has been modified.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4111**                    **PLC cycle increased to %1 ms**

**Parameters:**        %1 = String (new PLC cycle time)

**Definitions:**        The PLC cycle divisor was set to a value which was not an integral multiple of the IPO cycle divisor. The divisor (MD10074 \$PLC\_IPO\_TIME\_RATIO) has been increased.  
For PROFIBUS/PROFINET: MD10074 \$PLC\_IPO\_TIME\_RATIO has been modified because of the modified DP cycle in the SDB (MD10050 \$SYSCLOCK\_CYCLE\_TIME).

**Reaction:**            Alarm display.

**Remedy:**             MD10074 \$MN\_PLC\_IPO\_TIME\_RATIO has been modified.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4112**                    **Servo cycle changed to %1 ms**

**Parameters:**        %1 = String (new servo cycle time)

**Definitions:**        For PROFIBUS/PROFINET only:  
MD10060 \$POSCTRL\_SYSCLOCK\_TIME\_RATIO has been modified because of the modified DP cycle in the SDB (MD10050 \$SYSCLOCK\_CYCLE\_TIME).

**Reaction:**            Alarm display.

**Remedy:**             MD10060 \$MN\_POSCTRL\_SYSCLOCK\_TIME\_RATIO has been modified.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4113**                    **Sysclock cycle changed to %1 ms**

**Parameters:**        %1 = String (new PLC cycle time)

**Definitions:**        For PROFIBUS/PROFINET only:  
MD10050 \$SYSCLOCK\_CYCLE\_TIME has been modified because of the modified DP cycle in the SDB.

**Reaction:**            Alarm display.

**Remedy:**             MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME has been modified.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4114**                    **Error in DP cycle of the SDB**

**Parameters:**        %1 = String (new PLC cycle time)

**Definitions:** For PROFIBUS/PROFINET only:  
The DP cycle in the SDB contains an error and cannot be set. The default value of MD10050\$MN\_SYSCLOCK\_CYCLE\_TIME is set.

**Reaction:** Alarm display.

**Remedy:** Correct the SDB

**Program Continuation:** Switch control OFF - ON.

**4115 Time ratio communication to lpo changed to %1**

**Parameters:** %1 = String (new PLC cycle time)

**Definitions:** The value of the MD10072 \$MN\_COM\_IPO\_TIME\_RATIO has been adapted. This can only occur, if the value of the machine data is smaller than one and the time thus calculated is no multiple of the position control cycle.

**Reaction:** Alarm display.

**Remedy:** The MD10072 \$MN\_COM\_IPO\_TIME\_RATIO has been adapted. Please check to ensure that the calculated value is correct.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**4150 [Channel %1: ] Invalid M function subprogram call configured**

**Parameters:** %1 = Channel number

**Definitions:** MD10715 \$MN\_M\_NO\_FCT\_CYCLE[n] or MD10718 \$MN\_M\_NO\_FCT\_CYCLE\_PAR contains invalid configuration data: An M function, which is occupied by the system and cannot be replaced by a subprogram call has been specified in MD10715 \$MN\_M\_NO\_FCT\_CYCLE[n] for the configuration of the subprogram call via M function:

- M0 to M5,
- M17, M30,
- M19, M40 to M45,
- M function for selecting spindle/axis mode according to MD20094 \$MC\_SPIND\_RIGID\_TAPPING\_M\_NR (default: M70),
- M functions for nibbling/punching as configured in MD26008 \$MC\_NIBBLE\_PUNCH\_CODE if activated by MD26012 \$MC\_PUNCHNIB\_ACTIVATION.
- Also M96 to M99 for applied external language (MD18800 \$MN\_MM\_EXTERN\_LANGUAGE).

MD10718 \$MN\_M\_NO\_FCT\_CYCLE\_PAR contains an invalid array index of MD10715 \$MN\_M\_NO\_FCT\_CYCLE[n]. Currently, the values 0 to 9 are permissible. The affected machine data is reset to the default value -1. This deactivates the function.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Configure an M function in MD10715 \$MN\_M\_NO\_FCT\_CYCLE[n] that is not occupied by the system, or configure a permissible array index in MD10718 \$MN\_M\_NO\_FCT\_CYCLE\_PAR.

**Program Continuation:** Switch control OFF - ON.

---

**4152                    Illegal configuration of the 'Block display with absolute values' function**

<b>Definitions:</b>	The "Block display with absolute values" function has been illegally parameterized: - An illegal block length has been set with MD28400 \$MC_MM_ABSBLOCK: While ramping up, the machine data will be checked for the following value range: 0, 1, 128 to 512 - An invalid display range has been set with MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[]. While ramping up, the machine data will be checked for the following upper and lower limits: 0 <= MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[0] <= 8 0 <= MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[1] <= (MD28060 \$MC_MM_IPO_BUFFER_SIZE + MD28070\$MC_MM_NUM_BLOCKS_IN_PREP). Alarm 4152 is issued if the limits are violated.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Configure block length/display range within the permissible limits.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**4160                    [Channel %1: ] Invalid M function number configured for spindle switchover**

<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	An M function was specified in MD20094 \$MC_SPIND_RIGID_TAPPING_M_NR in order to configure the M function number for spindle switchover. The M function number is assigned by the system and cannot be used for the switchover (M1 to M5, M17, M30, M40 to M45).
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Configure an M function which is not used by the system (M1 to M5, M17, M30, M40 to M45) in MD20094 \$MC_SPIND_RIGID_TAPPING_M_NR.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**4170                    Invalid M function number for channel synchronisation assigned**

<b>Definitions:</b>	An M number between 0 and 99 has been specified In machine data MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN or MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX for the configuration of the M number range for channel synchronization in ISO2/3 mode or the machine data MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX is smaller than MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN and MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX.
<b>Program Continuation:</b>	Switch control OFF - ON.

**4180 Invalid M function number assigned to enable ASUP**

**Definitions:** An invalid M function number has been assigned for activation of ASUP. An illegal M number has been assigned in MD10804 \$MN\_EXTERN\_M\_NO\_SET\_INT or MD10806 \$MN\_EXTERN\_M\_NO\_DISABLE\_INT for the configuration of the M number range for activation/deactivation of the interrupt program.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check MD10804 \$MN\_EXTERN\_M\_NO\_SET\_INT and MD10806 \$MN\_EXTERN\_M\_NO\_DISABLE\_INT.

**Program Continuation:** Switch control OFF - ON.

---

**4181 [Channel %1: ] Invalid assignment of an M auxiliary function number**

**Parameters:** %1 = Channel number

**Definitions:** In MD22254 \$MC\_AUXFU\_ASSOC\_M0\_VALUE or MD22256 \$MC\_AUXFU\_ASSOC\_M1\_VALUE, a number has been specified for the configuration of a new predefined M function which is occupied by the system, and cannot be used for an assignment. (M0 to M5, M17, M30, M40 to M45).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Configure an M function in machine data MD22254 \$MC\_AUXFU\_ASSOC\_M0\_VALUE or MD22256 \$MC\_AUXFU\_ASSOC\_M1\_VALUE which is not occupied by the system (M1 to M5, M17, M30, M40 to M45).

**Program Continuation:** Switch control OFF - ON.

---

**4182 [Channel %1: ] Invalid M auxiliary function number in %2%3, MD reset**

**Parameters:** %1 = Channel number  
%2 = MD identifier  
%3 = If required, MD index

**Definitions:** In the specified machine data, a number has been specified for the configuration of an M function which is occupied by the system, and cannot be used for an assignment. (M0 to M5, M17, M30, M40 to M45 and also M98, M99 with applied ISO dialect). The value set by the user has been reset to the default value by the system.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Configure an M function in the specified machine data which is not occupied by the system (M0 to M5, M17, M30, M40 to M45 and also M98, M99 with applied ISO dialect).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4183 [Channel %1: ] M auxiliary function number %2 used several times (%3 and %4)**

<b>Parameters:</b>	%1 = Channel number %2 = M auxiliary function number %3 = MD identifier %4 = MD identifier
<b>Definitions:</b>	In the specified machine data, a number has been used several times for the configuration of an M function.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check the specified machine data and create a unique assignment of M auxiliary function numbers.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

**4184 [Channel %1: ] Illegally predefined auxiliary function in %2[%3], MD reset**

<b>Parameters:</b>	%1 = Channel number %2 = MD identifier %3 = If required, MD index
<b>Definitions:</b>	In the specified machine data, a predefined auxiliary function has been illegally configured. The value set by the user has been reset to the default value by the system.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Configure a valid value in the specified machine data.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**4185 [Channel %1: ] Illegal auxiliary function configured %2 %3 %4**

<b>Parameters:</b>	%1 = Channel number %2 = Type of auxiliary function %3 = Extension %4 = Auxiliary function value
<b>Definitions:</b>	An auxiliary function has been illegally configured. Predefined auxiliary functions cannot be reconfigured by user-defined auxiliary functions. See: MD22010 \$MC_AUXFU_ASSIGN_TYPE[n] MD22020 \$MC_AUXFU_ASSIGN_EXTENSION[n] MD22030 \$MC_AUXFU_ASSIGN_VALUE[n] MD22035 \$MC_AUXFU_ASSIGN_SPEC[n]
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Reconfigure the auxiliary function.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**4200 [Channel %1: ] Geometry axis %2 must not be declared a rotary axis**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The geometry axes represent a Cartesian coordinate system and therefore the declaration of a geometry axis as rotary axis leads to a definition conflict.

**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Remove rotary axis declaration for this machine axis.  
For this purpose, the geometry axis index for the displayed geometry axis must be determined by means of MD20060 \$MC\_AXCONF\_GEOAX\_NAME\_TAB. The channel axis number is stored with the same index in MD20050 \$MC\_AXCONF\_GEOAX\_ASSIGN\_TAB. The channel axis number minus 1 provides the channel axis index under which the machine axis number is found in MD20070 \$MC\_AXCONF\_MACHAX\_USED.

**Program** Switch control OFF - ON.  
**Continuation:**

---

**4210 [Channel %1: ] Spindle %2 declaration as rotary axis missing**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** If a machine axis is to be operated as a spindle, this machine axis must be declared as a rotary axis.

**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Set rotary axis declaration for this machine axis in the axis-specific MD30300 \$MA\_IS\_ROT\_AX.

**Program** Switch control OFF - ON.  
**Continuation:**

---

**4215 [Channel %1: ] Spindle %2 declaration as modulo axis missing**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The spindle functionality requires a modulo axis (positions in [deg]).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Set MD30310 \$MA\_ROT\_IS\_MODULO.

**Program Continuation:** Switch control OFF - ON.

#### **4220 [Channel %1: ] Spindle %2 declared repeatedly**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The spindle number exists more than once in the channel.

**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
The spindle number is stored in the axis-specific MD35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX. The channel to which this machine axis/spindle is assigned is listed in the machine axis index. (The machine axis number is given in the channel-specific MD20070 \$MC\_AXCONF\_MACHAX\_USED).

**Program Continuation:** Switch control OFF - ON.

#### **4225 [Channel %1: ] Axis %2 declaration as rotary axis missing**

**Parameters:** %1 = Channel number  
%2 = Axis name, axis number

**Definitions:** The modulo functionality requires a rotary axis (positions in [deg]).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Set MD30300 \$MA\_IS\_ROT\_AX.

**Program Continuation:** Switch control OFF - ON.

#### **4230 [Channel %1: ] Data alteration from external not possible in current channel state**

**Parameters:** %1 = Channel number

**Definitions:** It is not allowed to enter this data while the part program is being executed (e.g. setting data for working area limitation or for dry run feedrate).

**Reaction:** Alarm display.

**Remedy:** The data to be entered must be altered before starting the part program.

**Program Continuation:** Clear alarm with the Delete key or NC START.

#### **4240 Runtime overflow for IPO cycle or position controller cycle, IP %1**

**Parameters:** %1 = Program location

**Definitions:** The settings for the interpolation and position control cycle were modified before the last power-up such that too little computing time is now available for the requisite cyclic task.  
The alarm occurs immediately after power-up if too little runtime is available even when the axes are stationary and the NC program has not started. However, task overflow can occur only when computation-intensive NC functions are called during program execution.

**Reaction:** NC not ready.  
The NC switches to follow-up mode.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Alarm reaction delay is cancelled.

**Remedy:** Please inform the authorized personnel/service department.  
Take greater care when optimizing the clock times MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME, MD10060 \$MN\_POSCTRL\_SYSCLOCK\_TIME\_RATIO and/or MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO.  
The test should be performed with an NC program that represents the highest possible control load. To be on the safe side, a margin of 15 to 25% should be added to the times determined in this way.

**Program Continuation:** Switch control OFF - ON.

---

**4250 FastPlcCom functionality not available**

**Definitions:** This alarm indicates that the PLC provides the None FastPlcCom functionality during start-up although this functionality is requested by the NCK.

**Reaction:** Alarm display.

**Remedy:** Retrofit the PLC with the FastPlcCom functionality or deactivate the FastPlcCom functionality by means of NCK machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4252 PLCIO read error: %1**

**Parameters:** %1 = PLCIO error code

**Definitions:** This alarm indicates that errors occurred when reading the PLCIO with the FastPlcCom functionality.  
- PLC hardware does not exist  
- Incorrect data transmission  
- Functionality is already used by 'technological function'.

**Reaction:** Alarm display.

**Remedy:** Check machine data MD10394 \$MN\_PLCIO\_NUM\_BYTES\_IN / MD10395 \$MN\_PLCIO\_LOGIC\_ADDRESS\_IN.  
Check PLC hardware configuration.  
Check whether 'technological function' already uses the functionality.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4254 PLCIO write error: %1**

**Parameters:** %1 = PLCIO error code

**Definitions:** This alarm indicates that errors occurred when writing on the PLCIO with the FastPlcCom functionality.  
- PLC hardware does not exist  
- Incorrect data transmission  
- Functionality is already used by 'technological function'.

**Reaction:** Alarm display.



**Remedy:** Check machine data MD10396 \$MN\_PLCIO\_NUM\_BYTES\_OUT / MD10397 \$MN\_PLCIO\_LOGIC\_ADDRESS\_OUT.  
Check PLC hardware configuration.  
Check whether 'technological function' already uses the functionality.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

## 4260 Machine data %1 illegal

**Parameters:** %1 = String: MD identifier

**Definitions:** The selected cam pair was not activated by MD10450 \$MN\_SW\_CAM\_ASSIGN\_TAB, or several cam pairs were selected.

**Reaction:** Mode group not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Activate the cam pair or select only one cam pair.

**Program Continuation:** Switch control OFF - ON.

## 4270 Machine data %1 assigns not activated NCK input/output byte %2

**Parameters:** %1 = String: MD identifier  
%2 = Index

**Definitions:** The specified machine data assigns a digital input/output byte or an analog input/output signal the processing of which has not been activated to an NC function.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Correct machine data. Activate required inputs/outputs via MDs:  
MD10350 \$MN\_FASTIO\_DIG\_NUM\_INPUTS  
MD10360 \$MN\_FASTIO\_DIG\_NUM\_OUTPUTS  
MD10300 \$MN\_FASTIO\_ANA\_NUM\_INPUTS  
MD10310 \$MN\_FASTIO\_ANA\_NUM\_OUTPUTS  
Activation of fast inputs/outputs does not require the corresponding hardware configuration to be available at the control. All functions using fast inputs/outputs can also be made use of by the PLC specification/modification defined in the VDI interface, if the response time requirements are reduced accordingly.  
Activated inputs/outputs increase the computation time requirement of the interpolation cycle because the PLC manipulation signals are handled cyclically. Note: Deactivate any inputs/outputs not in use.

**Program Continuation:** Switch control OFF - ON.

## 4275 Machine data %1 and %2 both assign the same NCK output byte no. %3 several times

**Parameters:** %1 = String: MD identifier  
%2 = String: MD identifier  
%3 = No. of output

**Definitions:** The specified machine data assign two NC functions to the same digital/analog output.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Please inform the authorized personnel/service department. Correct machine data.  
**Program Continuation:** Switch control OFF - ON.

---

**4280 Assignment of NCK input/output byte via MD %1[%2] does not match hardware configuration**

**Parameters:** %1 = String: MD identifier  
%2 = Index: MD array  
**Definitions:** When booting, the required input/output module was not found at the slot specified in the MD.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Please inform the authorized personnel/service department. Check hardware or correct the MD, if necessary. Note: monitoring of the hardware configuration is performed independently of the number of activated inputs/outputs (MD10300 \$MN\_FASTIO\_ANA\_NUM\_INPUTS, MD10310 \$MN\_FASTIO\_ANA\_NUM\_OUTPUTS, MD10350 \$MN\_FASTIO\_DIG\_NUM\_INPUTS, MD10360 \$MN\_FASTIO\_DIG\_NUM\_OUTPUTS)  
**Program Continuation:** Switch control OFF - ON.

---

**4282 Hardware of external NCK outputs assigned repeatedly**

**Definitions:** Several outputs have been configured on the same hardware byte.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Please inform the authorized personnel/service department. Alter MD10368 \$MN\_HW\_ASSIGN\_DIG\_FASTOUT or MD10364 \$MN\_HW\_ASSIGN\_ANA\_FASTOUT.  
**Program Continuation:** Switch control OFF - ON.

---

**4285 Error on terminal block %1, error code %2**

**Parameters:** %1 = Number of terminal block (1 ... 4)  
%2 = Error code

**Definitions:**

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check hardware.

**Program**  
**Continuation:** Switch control OFF - ON.

**4290 Sign of life monitoring: local P-bus not alive**

**Definitions:** The COM computer must alter the sign-of-life on the local P-bus in each SERVO cycle. Monitoring for alteration takes place in the IPO cycle. If the sign of life has not altered, this alarm is triggered.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check hardware.

**Program**  
**Continuation:** Switch control OFF - ON.

**4291 Failure of module in local P-bus slot %1, error codes %2 %3 %4**

**Parameters:** %1 = Slot number  
%2 = Error code  
%3 = Error code  
%4 = Error code

**Definitions:** The module on the specified slot has signaled a diagnostics alarm. The error code reported corresponds to the AS300 documentation.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check hardware.

**Program**  
**Continuation:** Switch control OFF - ON.

**4300 Declaration in MD %1 is not allowed for axis %2.**

**Parameters:** %1 = String: MD identifier  
%2 = Axis name, spindle number

**Definitions:** The axis cannot be operated as competing positioning axes, for example because the axis is the slave axis within a closed gantry group or a gantry group to be closed.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Reset MD30450 \$MA\_IS\_CONCURRENT\_POS\_AX for the axis concerned.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4310 Declaration in MD %1 index %2 is not allowed.**

**Parameters:** %1 = String: MD identifier  
%2 = Index: MD array index

**Definitions:** The machine data values must be written in the array in ascending order.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Correct the MD.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**4320 Axis %1 function %2 %3 and %4 not allowed**

**Parameters:** %1 = String: Axis identifier  
%2 = String: MD identifier  
%3 = String: Bit  
%4 = String: MD identifier

**Definitions:** The functions declared by the specified machine data cannot simultaneously be active for one axis.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Deactivate one of the functions.

**Program Continuation:** Switch control OFF - ON.

---

**4334 [Channel %1: ] The amount of fine correction in parameter %2 of the orientable toolholder %3 is too large**

**Parameters:** %1 = Channel number  
%2 = Invalid parameter of the orientable toolholder  
%3 = Number of the orientable toolholder

**Definitions:** The maximum permissible value of the fine correction in an orientable toolholder is limited by the MD20188 \$MC\_TOCARR\_FINE\_LIM\_LIN for linear variables, and by the MD20190 \$MC\_TOCARR\_FINE\_LIM\_ROT for rotary variables. The alarm can only occur if the SD42974 \$SC\_TOCARR\_FINE\_CORRECTION is not equal to zero.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Enter a valid fine correction value.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>4336</b>	<b>[Channel %1: ] Orientable toolholder no. %2 for orientation transformation %3 does not exist</b>
<b>Parameters:</b>	%1 = Channel number %2 = Number of the orientable toolholder %3 = Number of the orientation transformation that is to be parameterized with the orientable toolholder
<b>Definitions:</b>	The orientable toolholder, with whose data the orientation transformation is to be parameterized (see MD2.... \$MC_TRAFO5_TCARR_NO_...), does not exist.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Enter a valid tool-carrier number.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>4338</b>	<b>[Channel %1: ] Invalid transformation type '%2' in toolholder %3 for orientation transformer %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Transformer type %3 = Number of the orientable toolholder %4 = Number of the orientation transformation that is to be parameterized with the orientable toolholder
<b>Definitions:</b>	The parameters of the orientation transformation are taken over from the data of an orientable toolholder. This orientable toolholder contains an invalid transformation type. (Types T, P and M are permissible).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Enter a valid transformation type.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>4340</b>	<b>[Channel %1: ] Block %2 invalid transformation type in transformation no. %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Transformation number
<b>Definitions:</b>	An invalid, i.e. undefined, number was entered in one of the machine data TRAFO_TYPE_1 ... TRAFO_TYPE_8. This alarm also occurs if a certain type of transformation is only impossible on the type of control used (e.g. 5-axis transformation on a SINUMERIK 802D).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Enter a valid transformation type.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**4341 [Channel %1: ] Block %2 no data set available for transformation no. %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Transformation number

**Definitions:** Only a limited number of machine data sets (usually 2) is available for each related group of transformations (e.g. orientation transformations, Transmit, Tracyl, etc.). This alarm is output if an attempt is made to set more transformations from a group.  
 Example:  
 Two orientation transformations are allowed. The machine data contains e.g.:  
 TRAFO\_TYPE\_1 = 16 ; 1st orientation transformation  
 TRAFO\_TYPE\_2 = 33 ; 2nd orientation transformation  
 TRAFO\_TYPE\_3 = 256 ; 1st transmit transformation  
 TRAFO\_TYPE\_4 = 20 ; 3rd orientation transformation ==> This entry triggers alarm

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Enter valid machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4342 [Channel %1: ] Invalid machine data for general 5-axis transformation error no. %2**

**Parameters:** %1 = Channel number  
 %2 = Error type

**Definitions:** The machine data which describe the axis directions and the basic orientation and the input axes for the general 5-axis transformation are invalid. The error parameter displayed specifies the cause of the alarm:  
 - 1: The first axis (MD2.... \$MC\_TRAFO5\_AXIS1\_...) is not defined (all three entries of the vector are 0)  
 - 2: The second axis (MD2.... \$MC\_TRAFO5\_AXIS2\_...) is not defined (all three entries of the vector are 0)  
 - 3: The basic orientation (MD2.... \$MC\_TRAFO5\_BASE\_ORIENT\_...) is not defined (all three entries of the vector are 0)  
 - 4: The first and second axis are (virtually) parallel  
 - 5: On MD2.... \$MC\_TRAFO\_TYPE\_ = 56 (rotatable tool and workpiece) there is no 4-axis transformation, i.e. 2 rotary axes must always be available. (See MD2.... \$MC\_TRAFO\_AXES\_IN\_...)  
 - 6: The third axis (MD2.... TRAFO5\$MC\_TRAFO5\_AXIS3\_...) is not defined (all three entries of the vector are 0) (6-axis transformation)  
 - 7: The normal tool vector (MD2.... TRAFO6\$MC\_TRAFO6\_BASE\_ORIENT\_NORMAL\_...) is not defined (all three entries of the vector are 0) (6-axis transformation)  
 - 8: The basic tool orientation (MD2.... \$MC\_TRAFO5\_BASE\_ORIENT\_...) and the normal tool vector (MD2.... \$MC\_TRAFO6\_BASE\_ORIENT\_NORMAL\_...) are (virtually) parallel (6-axis transformation)  
 - 9: The first external axis (MD2.... \$MC\_TRAFO7\_EXT\_AXIS1\_\*) has not been defined (all three vector entries are 0) (7-axis transformation)  
 -10: Invalid transformation type (MD2.... \$MC\_TRAFO\_TYPE\_...). A transformation type unequal to 24 has been entered for the generic 7-axis transformation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Set valid machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**4343 [Channel %1: ] Attempt made to change the machine data of an active transformation.**

**Parameters:** %1 = Channel number

---

<b>Definitions:</b>	An attempt was made to change the machine data of an active transformation and to activate the machine data with RESET or NEWCONFIG.
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Set valid machine data.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

#### 4344 **[Channel %1: ] Block %2 Axis %3 defined in \$NK\_NAME[%4] is not available in the current channel**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Index of the chain element
<b>Definitions:</b>	In the specified chain element a machine axis was indicated that is not available in the current channel on transformation selection. This means that this axis is currently assigned to another channel.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Specify the axis available in the channel.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

#### 4345 **[Channel %1: ] Invalid configuration in chained transformation no. %2**

<b>Parameters:</b>	%1 = Channel number %2 = Transformation number
<b>Definitions:</b>	A chained transformation is incorrectly configured (MD24995 \$MC_TRACON_CHAIN_1 or MD24996 \$MC_TRACON_CHAIN_2). The following causes for the error are possible: <ul style="list-style-type: none"> <li>- The list of transformations to be chained starts with a 0 (at least one entry not equal to zero is required).</li> <li>- The list of transformations to be chained contains the number of a transformation which does not exist.</li> <li>- The number of a transformation in the list is greater than or equal to the number of the chained transformation.</li> </ul> Example: The cascaded transformation is the fourth transformation in the system, i.e. MD24400 \$MC_TRAFO_TYPE_4 = 8192. In this case, only values 1, 2 or 3 may be entered in the associated list (e.g. MD24995 \$MC_TRACON_CHAIN_1[...]). <ul style="list-style-type: none"> <li>- The chaining setting is invalid. The following restrictions currently apply. A maximum of two transformations can be chained. The first transformation must be an orientation transformation, transmit, peripheral curve transformation or inclined axis. The second transformation must be the inclined axis transformation.</li> </ul>
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Set a valid transformation chain.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**4346**                    **[Channel %1: ] Invalid geoaxis assignment in machine data %2[%3]**

**Parameters:**            %1 = Channel number  
                              %2 = Name of machine data  
                              %3 = Transformation number

**Definitions:**            MD2.... \$MC\_TRAFO\_GEOAX\_ASSIGN\_TAB\_... contains an invalid entry. The following causes for the error are possible:  
                              - The entry references a channel axis which does not exist.  
                              - The entry is zero (no axis) but the transformation needs the relevant axis as a geometry axis.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm at block end.

**Remedy:**                 Correct the entry in MD2.... \$MC\_TRAFO\_GEOAX\_ASSIGN\_TAB\_ or MD2.... \$MC\_TRAFO\_AXES\_IN\_.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4347**                    **[Channel %1: ] Invalid channel axis assignment in machine data %2[%3]**

**Parameters:**            %1 = Channel number  
                              %2 = Name of machine data  
                              %3 = Transformation number

**Definitions:**            MD2.... \$MC\_TRAFO\_AXIS\_IN\_... contains an invalid entry. The following causes for the error are possible:  
                              - The entry refers to a channel axis which does not exist.  
                              - The entry is zero (no axis) but the transformation needs the relevant axis as a channel axis.  
                              - More than one external axis has been entered in MD2.... \$MC\_TRAFO\_AXIS\_IN\_... for the 7-axis transformation.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm at block end.

**Remedy:**                 Correct the entry in MD2.... \$MC\_TRAFO\_AXES\_IN\_.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**4348**                    **[Channel %1: ] Block %5 Configuration error %6 in transformation \$NT\_NAME[%3] = '%2'.**

**Parameters:**            %1 = Channel number  
                              %2 = Name of the transformation data record  
                              %3 = Index of the transformation data record  
                              %4 = Block number, label|error number



<b>Definitions:</b>	<p>The transformation data record is incorrect. The error cause is defined in detail by the following error number:</p> <ul style="list-style-type: none"> <li>- 1. The transformer type is not known, i.e. \$NT_TRAFO_TYPE[n] contains an illegal name.</li> <li>- 2. The machine kinematics have not been defined, i.e. neither \$NT_TOOL_CHAIN[n,0} nor \$NT_PART_CHAIN[n,0] refer to kinematic chains.</li> <li>- 3. The kinematic chain with the name contained in \$NT_T_CHAIN_NAME[n] could not be found.</li> <li>- 4. The kinematic chain element with the name contained in \$NT_T_CHAIN_1ST_ELEM[n] could not be found.</li> <li>- 5. The kinematic chain element with the name contained in \$NT_T_CHAIN_LAST_ELEM[n] could not be found.</li> <li>- 6. The kinematic chain with the name contained in \$NT_P_CHAIN_NAME[n] could not be found.</li> <li>- 7. The kinematic chain element with the name contained in \$NT_P_CHAIN_1ST_ELEM[n] could not be found.</li> <li>- 8. The kinematic chain element with the name contained in \$NT_P_CHAIN_LAST_ELEM[n] could not be found..</li> <li>- 9. The kinematic chain element with the name contained in \$NT_T_REF_ELEM[n] could not be found.</li> <li>- 10. The rotary axis defined in \$NT_ROT_AX_NAME[n,0] could not be found in any of the relevant kinematic chains.</li> <li>- 11. The rotary axis defined in \$NT_ROT_AX_NAME[n,1] could not be found in any of the relevant kinematic chains.</li> <li>- 12. The rotary axis defined in \$NT_ROT_AX_NAME[n,2] could not be found in any of the relevant kinematic chains.</li> <li>- 20. The linear axis defined in \$NT_GEO_AX_NAME[n,0] could not be found in any of the relevant kinematic chains.</li> <li>- 21. The linear axis defined in \$NT_GEO_AX_NAME[n,1] could not be found in any of the relevant kinematic chains.</li> <li>- 22. The linear axis defined in \$NT_GEO_AX_NAME[n,2] could not be found in any of the relevant kinematic chains.</li> <li>- 30. The base orientation has not been defined, i.e. all three components of \$NT_BASE_ORIENT[n, 0..2] are zero.</li> <li>- 31. The orientation normal vector has not been defined, i.e. all three components of \$NT_BASE_ORIENT_NORMAL[n, 0..2] are zero.</li> <li>- 32. The vectors for the definition of the base orientation (\$NT_BASE_ORIENT[n, 0..2]) and the base normal vector (\$NT_BASE_ORIENT_NORMAL[n, 0..2]) are parallel.</li> <li>- 40. The first and the second orientation axis of an orientation transformation are parallel.</li> <li>- 41. The second and the third orientation axis of an orientation transformation are parallel.</li> <li>- 42. No orientation axis has been defined (an orientation transformation requires at least one orientation axis).</li> <li>- 43. Illegal 3-axis orientation transformation: The orientation axis is not vertical to the plane created by the two geometry axes.</li> <li>- 50. Fewer than two geometry axes have been defined for an orientation transformation or an inclined axis transformation.</li> <li>- 51. Not all three geometry axes have been defined for an orientation transformation with more than one orientation axis.</li> <li>- 60. Geometry axes 1 and 2 are parallel.</li> <li>- 61. Geometry axes 1 and 3 are parallel.</li> <li>- 62. Geometry axes 2 and 3 are parallel.</li> <li>- 65. The 3 geometry axes are on one plane.</li> <li>- 100. The maximum number of kinematic elements (total of linear axes, rotary axes, and constant elements) has been exceeded. A sequence of constant elements in a chain that is not interrupted by an axis counts as only one element.</li> </ul> <p style="padding-left: 2em;">A maximum of 15 kinematic elements is currently permissible for orientation transformations.</p> <ul style="list-style-type: none"> <li>- 101. The maximum number of rotary axes in the kinematic chains for the definition of a transformation has been exceeded.</li> <li>- 103. The maximum number of elements in the definition of the kinematic chain for the tool has been exceeded.</li> <li>- 104. The maximum number of elements in the definition of the kinematic chain for the workpiece has been exceeded.</li> </ul> <p style="padding-left: 2em;">A maximum of 6 rotary axes is currently permissible for orientation transformations.</p> <ul style="list-style-type: none"> <li>- 1000. Illegal redundant rotary axis. For the time being, only one redundant axis is permissible for orientation transformation. This rotary axis must be the first axis in the kinematic chain.</li> </ul>
<b>Reaction:</b>	<p>Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.</p>
<b>Remedy:</b>	<p>Define valid transformation data record.</p>
<b>Program Continuation:</b>	<p>Clear alarm with the RESET key. Restart part program</p>

**4349****[Channel %1: ] No free memory space available for transformations.****Parameters:**

%1 = Channel number  
%2 = Number of the transformations already active

**Definitions:** Any kinematic transformation in the NCK requires a defined memory space. If MD18866 \$MN\_MM\_NUM\_KIN\_TRAFOS does not equal zero, it indicates how many kinematic transformations are allowed to be active in the NCK at the same time.  
If MD18866 \$MN\_MM\_NUM\_KIN\_TRAFOS equals zero, the maximum number of kinematic transformations that are active at the same time, is determined automatically (currently twenty times the number of the existing channels).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Increase the value of MD18866 \$MN\_MM\_NUM\_KIN\_TRAFOS.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**4350 [Channel %1: ] Axis identifier %2 machine data %3 not consistent with machine data %4**

**Parameters:** %1 = Channel number  
%2 = String: Axis identifier  
%3 = String: MD identifier  
%4 = String: MD identifier

**Definitions:** MD32420 \$SMA\_JOG\_AND\_POS\_JERK\_ENABLE (jerk limitation) and MD35240 \$SMA\_ACCEL\_TYPE\_DRIVE (acceleration reduction) have been defined as the normal position for an axis.  
However, the two functions cannot be activated at the same time for one axis.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Resetting of MD32420 \$SMA\_JOG\_AND\_POS\_JERK\_ENABLE or MD35240 \$SMA\_ACCEL\_TYPE\_DRIVE.

**Program Continuation:** Switch control OFF - ON.

**4400 MD alteration will cause reorganization of buffered memory (Art %1), (loss of data!) - %2**

**Parameters:** %1 = Memory type  
%2 = MD identifier, if required

**Definitions:** A machine data has been altered that configures the buffered memory. If the NCK powers up with the altered data, this will lead to reorganization of the buffered memory and thus to the loss of all buffered user data (part programs, tool data, GUD, leadscrew error compensation, ...)  
Meaning of the 1st parameter  
0x00 buffered memory (internal)  
0x01 buffered memory

**Reaction:** Alarm display.

**Remedy:** If the control includes user data that have not yet been saved, then a data backup must be performed before the next NC power-up. By manually resetting the altered MD to the value it had before the last power-up, reorganization of the memory can be avoided.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>4402</b>	<b>%1 causes a machine data reset</b>
<b>Parameters:</b>	%1 = Machine data
<b>Definitions:</b>	If this machine data is set, the current machine data values are overwritten by the default values at the next ramp-up. Under certain circumstances, this may cause data loss (even in the buffered memory).
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. If the control includes user data that has not yet been saved, then a data backup must be performed before the next NCK power-up. By manually resetting the altered MD to the value it had before the last power-up, reorganization of the memory can be avoided.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>4502</b>	<b>[Channel %1: ] Anachronism %2(%3) -&gt; %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = String: MD identifier %3 = String: MD identifier %4 = String: MD identifier
<b>Definitions:</b>	Previously, in MD20110 \$MC_RESET_MODE_MASK Bit4 and Bit5, the reset behavior of the 6th or 8th G groupe was determined. This setting is now made in MD20152 \$MC_GCODE_RESET_MODE. In order to ensure compatible handling of "old" data backups, the "old" values are taken from MD20110 \$MC_RESET_MODE_MASK and entered in MD20152 \$MC_GCODE_RESET_MODE.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	--
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>4503</b>	<b>[TO unit %1: ] H number %2 assigned more than once. Machine data is not set.</b>
<b>Parameters:</b>	%1 = TO unit %2 = H number
<b>Definitions:</b>	This error can only occur if MD10880 \$MN_MM_EXTERN_CNC_SYSTEM= 1 or 2. MD10890, \$MN_EXTERN_TOOLPROG_MODE bit 3 is reset (this MD becomes effective at power-on). On checking data management, it was found that various edges of the same TO unit had the same H number. MD10890 \$MN_EXTERN_TOOLPROG_MODE bit 3 remains set and is not included in data management.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	H numbers must be assigned only once in a TO unit. Then, MD10890, \$MN_EXTERN_TOOLPROG_MODE, bit 3 can be set = 0 and a restart can be performed.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>4600</b>	<b>Invalid handwheel type for handwheel %1</b>
<b>Parameters:</b>	%1 = Handwheel number
<b>Definitions:</b>	The handwheel type (hardware segment) for handwheel %1 requested through MD11350 \$MN_HANDWHEEL_SEGMENT is invalid.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Configure a valid type for the corresponding handwheel through MD11350 \$MN_HANDWHEEL_SEGMENT.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**4610 Invalid handwheel module for handwheel %1**

**Parameters:** %1 = Handwheel module  
**Definitions:** For SINUMERIK 840D and SINUMERIK 840Di only:  
The handwheel module for handwheel %1 requested through MD11351 \$MN\_HANDWHEEL\_MODULE is not available for 840D systems. An 840D system is always regarded as a module. Therefore MD11351 \$MN\_HANDWHEEL\_MODULE = 1 must always be set for handwheels directly linked to 840D systems.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Set machine data MD11351 \$MN\_HANDWHEEL\_MODULE = 1 for the corresponding handwheel.  
**Program Continuation:** Switch control OFF - ON.

---

**4611 Invalid handwheel input for handwheel %1**

**Parameters:** %1 = Handwheel input  
**Definitions:** For SINUMERIK 840D and SINUMERIK 840Di only:  
The handwheel input for handwheel %1 requested through MD11352 \$MN\_HANDWHEEL\_INPUT is not available for 840D systems. A maximum of 2 or 3 handwheels can be linked directly to 840D systems:  
840D powerline: 1st and 2nd handwheels directly to the 840D hardware  
840Di: 1st and 2nd handwheels directly to the extension board  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Configure MD11352 \$MN\_HANDWHEEL\_INPUT for a valid input for the corresponding handwheel  
**Program Continuation:** Switch control OFF - ON.

---

**4620 Invalid handwheel module for handwheel %1**

**Parameters:** %1 = Handwheel module  
**Definitions:** The handwheel module for handwheel %1 requested through MD11351 \$MN\_HANDWHEEL\_MODULE is not available for 802D sl, 828D sl, 808D systems. 802D sl, 828D sl, 808D systems are always regarded as modules. Therefore MD11351 \$MN\_HANDWHEEL\_MODULE = 1 must always be set for directly linked handwheels.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Set machine data MD11351 \$MN\_HANDWHEEL\_MODULE = 1 for the corresponding handwheel.  
For 840D sl systems, MD11350 \$MN\_HANDWHEEL\_SEGMENT should be checked.  
**Program Continuation:** Switch control OFF - ON.

---

**4621 Invalid handwheel input for handwheel %1**

**Parameters:** %1 = Handwheel input  
**Definitions:** The handwheel input for handwheel %1 requested through MD11352 \$MN\_HANDWHEEL\_INPUT is not available for 802D sl, 828D sl, 808D systems. A maximum of 2 handwheels can be directly linked to 802D sl, 828D sl, 808D systems.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Configure MD11352 \$MN\_HANDWHEEL\_INPUT for a valid input for the corresponding handwheel.  
For 840D sl systems, MD11350 \$MN\_HANDWHEEL\_SEGMENT should be checked.  
**Program Continuation:** Switch control OFF - ON.

---

<b>4630</b>	<b>Invalid handwheel module for handwheel %1</b>
<b>Parameters:</b>	%1 = Handwheel module
<b>Definitions:</b>	For PROFIBUS/PROFINET only: The reference in \$MN_HANDWHEEL_MODULE to a corresponding entry in machine data array \$MN_HANDWHEEL_LOGIC_ADDRESS[] which is required for configuring PROFIBUS handwheels is not available.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Configure the machine data MD11351 \$MN_HANDWHEEL_MODULE for the corresponding PROFIBUS handwheel so that there is a valid reference to an entry in the machine data array MD11353 \$MN_HANDWHEEL_LOGIC_ADDRESS[].
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4631</b>	<b>Invalid handwheel slot for handwheel %1</b>
<b>Parameters:</b>	%1 = Handwheel slot
<b>Definitions:</b>	For PROFIBUS/PROFINET only: The handwheel slot for handwheel %1 requested through machine data \$MN_HANDWHEEL_INPUT is not available for PROFIBUS handwheels.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Configure machine data MD11352 \$MN_HANDWHEEL_INPUT to a valid handwheel slot for the corresponding PROFIBUS handwheel.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4632</b>	<b>Logical PROFIBUS handwheel slot base address for handwheel %1 not found</b>
<b>Parameters:</b>	%1 = Handwheel number
<b>Definitions:</b>	For PROFIBUS/PROFINET only: The logical basic address of the PROFIBUS handwheel slot in machine data array \$MN_HANDWHEEL_LOGIC_ADDRESS[] indexed in machine data \$MN_HANDWHEEL_MODULE was not found in the current STEP 7 hardware configuration.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Check if MD11351 \$MN_HANDWHEEL_MODULE of the corresponding handwheel is correct. Check if indexed logical base address of PROFIBUS handwheel slot in machine data array MD11353 \$MN_HANDWHEEL_LOGIC_ADDRESS[] is correct.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>4640</b>	<b>Invalid handwheel module for handwheel %1</b>
<b>Parameters:</b>	%1 = Handwheel module
<b>Definitions:</b>	For ETHERNET only: The handwheel module for handwheel %1 requested through MD11351 \$MN_HANDWHEEL_MODULE is not available for ETHERNET handwheels. MD11351 \$MN_HANDWHEEL_MODULE = 1 must always be set when configuring ETHERNET handwheels.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Set machine data MD11351 \$MN_HANDWHEEL_MODULE = 1 for the corresponding handwheel.

**Program Continuation:** Switch control OFF - ON.

---

**4641 Invalid handwheel input for handwheel %1**

**Parameters:** %1 = Handwheel input  
**Definitions:** For ETHERNET only:  
The handwheel input for handwheel %1 requested through MD11352 \$MN\_HANDWHEEL\_INPUT is not available for ETHERNET handwheels. A maximum of 6 handwheels can be configured.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Configure MD11352 \$MN\_HANDWHEEL\_INPUT for a valid input for the corresponding handwheel  
**Program Continuation:** Switch control OFF - ON.

---

**4700 PROFIBUS I/O: The logical slot / I/O area address %1 was not found.**

**Parameters:** %1 = Area address  
**Definitions:** For PROFIBUS/PROFINET only:  
The logical slot / I/O area address was not found in MD10500 \$MN\_DPIO\_LOGIC\_ADDRESS\_IN with the stated slot / I/O area in the current STEP 7 hardware configuration.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Check the slot / I/O area address in the configuration (STEP 7, HW Config).  
**Program Continuation:** Switch control OFF - ON.

---

**4702 PROFIBUS I/O: The logical slot / I/O area address %1 was not found.**

**Parameters:** %1 = Area address  
**Definitions:** For PROFIBUS/PROFINET only:  
The logical slot / I/O area address was not found in MD10506 \$MN\_DPIO\_LOGIC\_ADDRESS\_OUT with the stated slot / I/O area index in the current STEP 7 hardware configuration.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** Check the slot / I/O area address in the configuration (STEP 7, HW Config).  
**Program Continuation:** Switch control OFF - ON.

---

**5000 Communication job not executable %1**

**Parameters:** %1 = Reference to which resources are no longer available.  
**Definitions:** The communication job (data exchange between NCK and HMI, e.g.: loading an NC part program) cannot be executed because there is insufficient memory space. Cause: too many communication jobs in parallel.  
**Reaction:** Alarm display.  
**Remedy:**  
- Reduce the number of communication jobs taking place at the same time or increase MD10134 \$MN\_MM\_NUM\_MMC\_UNITS  
- Restart communication job.  
Please inform the authorized personnel/service department. No remedial measures are possible - the operation triggering the alarm message has to be repeated. Clear the alarm display with Cancel.

**Program Continuation:** Clear alarm with the Delete key or NC START.

## 6000 Memory reorganized using standard machine data

**Definitions:** The memory management was not able to allocate the NC user memory with the values in the machine data. It did not have enough memory available because the total memory available is provided as dynamic and static memory for the NC user (e.g. for macro definitions, user variables, number of tool offsets, number of directories and files etc.).

**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Redefine the NC memory structure!  
A specific MD for NC user memory allocation cannot be stated to be the cause of the alarm. The MD initiating the alarm therefore has to be determined on the basis of the default values in the machine data by changing the user-specific memory structure step by step.  
Usually, it is not just one single MD that has been set too large. Therefore it is advisable to reduce the memory area by a certain proportion in several MDs.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

## 6010 [Channel %1: ] Data block %2 not or not completely created, error code %3

**Parameters:** %1 = Channel number  
%2 = String (block name)  
%3 = Internal error code

**Definitions:** Data management has detected an error during ramp-up. The specified data block may not have been created. The error number specifies the type of error. An error number >100000 indicates a fatal system error. Other error numbers indicate that the user memory area provided is too small. In this case the (user) error numbers have the following meaning:

- Error number 1: No memory space available
- Error number 2: Maximum possible number of symbols exceeded
- Error number 3: Index 1 lies outside the valid value range
- Error number 4: Name already exists in channel
- Error number 5: Name already exists in NCK

If the alarm occurs after cycle programs, macro definitions or definitions for global user data (GUD) have been introduced, the machine data for the user memory configuration has been configured incorrectly. In all other cases, changes to machine data that is already correct lead to errors in the user memory configuration.

The following block names (2nd parameter) are known in the NCK (all system and user data blocks; in general, only problems in the user data blocks can be remedied by user intervention):

- \_N\_NC\_OPT - System internal: option data, NCK global
- \_N\_NC\_SEA - System internal: setting data, NCK global
- \_N\_NC\_TEA - System internal: machine data, NCK global
- \_N\_NC\_CEC - System internal: 'cross error compensation'
- \_N\_NC\_PRO - System internal: protection zones, NCK global
- \_N\_NC\_GD1 - User: 1st GUD block defined by \_N\_SGUD\_DEF, NCK global
- \_N\_NC\_GD2 - User: 2nd GUD block defined by \_N\_MGUD\_DEF, NCK global
- \_N\_NC\_GD3 - User: 3rd GUD block defined by \_N\_UGUD\_DEF, NCK global
- \_N\_NC\_GD4 - User: 4th GUD block defined by \_N\_GUD4\_DEF, NCK global

- \_N\_NC\_GD5 - User: 5th GUD block defined by \_N\_GUD5\_DEF, NCK global
- \_N\_NC\_GD6 - User: 6th GUD block defined by \_N\_GUD6\_DEF, NCK global
- \_N\_NC\_GD7 - User: 7th GUD block defined by \_N\_GUD7\_DEF, NCK global
- \_N\_NC\_GD8 - User: 8th GUD block defined by \_N\_GUD8\_DEF, NCK global
- \_N\_NC\_GD9 - User: 9th GUD block defined by \_N\_GUD9\_DEF, NCK global
- \_N\_NC\_MAC - User: macro definitions
- \_N\_NC\_FUN - System internal: predefined functions and procedures, NCK global
- \_N\_CHc\_OPT - System internal: option data, channel-specific
- \_N\_CHc\_SEA - System internal: setting data, channel-specific
- \_N\_CHc\_TEA - System internal: machine data, channel-specific
- \_N\_CHc\_PRO - System internal: protection zones, channel-specific
- \_N\_CHc\_UFR - System internal: frames, channel-specific
- \_N\_CHc\_RPA - System internal: R-parameters, channel-specific
- \_N\_CHc\_GD1 - User: 1st GUD block defined by \_N\_SGUD\_DEF, channel-specific
- \_N\_CHc\_GD2 - User: 2nd GUD block defined by \_N\_MGUD\_DEF, channel-specific
- \_N\_CHc\_GD3 - User: 3rd GUD block defined by \_N\_UGUD\_DEF, channel-specific
- \_N\_CHc\_GD4 - User: 4th GUD block defined by \_N\_GUD4\_DEF, channel-specific
- \_N\_CHc\_GD5 - User: 5th GUD block defined by \_N\_GUD5\_DEF, channel-specific
- \_N\_CHc\_GD6 - User: 6th GUD block defined by \_N\_GUD6\_DEF, channel-specific
- \_N\_CHc\_GD7 - User: 7th GUD block defined by \_N\_GUD7\_DEF, channel-specific
- \_N\_CHc\_GD8 - User: 8th GUD block defined by \_N\_GUD8\_DEF, channel-specific
- \_N\_CHc\_GD9 - User: 9th GUD block defined by \_N\_GUD9\_DEF, channel-specific
- \_N\_AXa\_OPT - System internal: option data, axial
- \_N\_AXa\_SEA - System internal: setting data, axial
- \_N\_AXa\_TEA - System internal: machine data, axial
- \_N\_AXa\_EEC - System internal: leadscrew error compensation data, axial
- \_N\_AXa\_QEC - System internal: quadrant error compensation data, axial
- \_N\_Tot\_TOc - System internal: toolholder data, TOA-specific
- \_N\_Tot\_TOA - System internal: tool data, TOA-specific
- \_N\_Tot\_TMA - System internal: magazine data, TOA-specific
- \_N\_NC\_KIN - System internal: data to describe kinematic chains, NCK-specific
- \_N\_NC\_NPA - System internal: data to describe 3D protection zones, NCK-specific
- \_N\_NC\_TRA - System internal: transformation data sets, NCK-specific
- \_N\_NC\_WAL - System internal: data to describe coordinate-specific working area limitation
- \_N\_COMPLETE\_CYD - System internal: cycle and display machine data, NCK-, channel-, axis-specific

c = Channel number

a = Machine axis number

t = TOA unit number

There are also other internal system data blocks with identifiers.

**Reaction:**

NC not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:**

Correct the machine data or undo the changes made.  
 Please inform the authorized personnel/service department. There are two determining machine data for cycle programs:  
 - MD18170 \$MN\_MM\_NUM\_MAX\_FUNC\_NAMES = max. number of all cycle programs, error number = 2 shows that this value is too small.  
 - MD18180 \$MN\_MM\_NUM\_MAX\_FUNC\_PARAM = max. number of all parameters defined in the cycle programs, error number = 2 shows that this value is too small  
 (If these MDs are modified, the memory backup is retained)  
 The following applies to macro definitions:  
 MD18160 \$MN\_MM\_NUM\_USER\_MACROS = max. number of all macro definitions, error number = 2 shows that this value is too small.  
 (If these MDs are modified, the memory backup is retained)  
 The following applies to GUD variables:  
 -



- MD18120 \$MN\_MM\_NUM\_GUD\_NAMES\_NCK = max. number of all NCK global GUD variables, error number = 2 shows that this value is too small.
- MD18130 \$MN\_MM\_NUM\_GUD\_NAMES\_CHAN = max. number of all channel-specific GUD variables in the channel, error number = 2 shows that this value is too small.
- MD18150 \$MN\_MM\_GUD\_VALUES\_MEM = total value memory of all GUD variables together, error number = 1 shows that this value is too small.

**Program****Continuation:**

Switch control OFF - ON.

**6020****Machine data have been changed - now memory is reorganized****Definitions:**

Machine data have been changed that define the NC user memory allocation. Data management has restructured the memory in accordance with the altered machine data.

**Reaction:**

Alarm display.

**Remedy:**

No remedial measures are required. Any user data that are required must be input again.

**Program**

Clear alarm with the RESET key. Restart part program

**Continuation:****6030****Limit of user memory has been adapted****Definitions:**

Data management checks during power-up the actually available physical user memory (DRAM, DPRAM and SRAM) with the values in the system-specific machine data MD18210 \$MN\_MM\_USER\_MEM\_DYNAMIC, MD18220 \$MN\_MM\_USER\_MEM\_DPR und MD18230 \$MN\_MM\_USERMEM\_BUFFERED-USERMEM\_BUFFERED.

**Reaction:**

Alarm display.

**Remedy:**

No remedial measures are required. The new maximum permissible value can be read from the reduced machine data.

**Program**

Clear alarm with the RESET key. Restart part program

**Continuation:****6035****Instead of %1 KB the system has only %2 KB of free user memory of type '%3'****Parameters:**

%1 = Free memory capacity in KB defined for the control model

%2 = Actual maximum capacity of free memory in KB

%3 = Type of memory, "D" =non-battery-backed, "S" =battery-backed

**Definitions:**

The alarm can only occur after a 'cold start' (=NCK start-up with standard machine data). The alarm is only a notice. There is no interference with any NCK functions. It shows that the NCK has less free user memory available than specified by Siemens for this control variant. The value of the actually available free user memory can also be taken from the MD18050 \$MN\_INFO\_FREE\_MEM\_DYNAMIC, MD18060 \$MN\_INFO\_FREE\_MEMS\_STATIC. Siemens supplies NCK with default settings that, depending on the model, have certain (free) memory space available for the specific settings of the actual applications. The original factory setting of NCK systems is thus that the alarm does not occur with a cold start.

**Reaction:**

Alarm display.

**Remedy:**

Reasons for the message:

- The NCK contains compile cycle software, that uses so much memory space that the hardware cannot provide the required memory.
- The NCK runs on hardware that is not intended for this NCK release (i.e. that has not enough memory capacity).
- If the application runs properly with the remaining free user memory (i.e. can be setup without any errors), the message can simply be ignored.
- If the actual application cannot be configured because there is not enough memory capacity available, either the existing compile cycle must be reduced or, if possible, the system must be upgraded with additional memory space.

**Program**

Clear alarm with the RESET key. Restart part program

**Continuation:**

**6100 Error while creating %1, error number %2 %3**

**Parameters:** %1 = Symbolname  
 %2 = Error code  
 %3 = If required, internal error identifier

**Definitions:** An error was detected while creating a compile cycle machine data. The error number specifies the type of error.  
 - Error number 1: Insufficient memory available  
 - Error number 2: Symbol in the NCK already exists  
 - Error number 3: Maximum possible number of symbols exceeded  
 - Error number 4: Invalid name prefix  
 - Error number 5: Illegal array size  
 Note: Other errors of this type could have occurred, but have not been displayed.

**Reaction:** NC not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** - Error number 1: The memory reserved by MD18238 \$MN\_MM\_CC\_MD\_MEM\_SIZE has to be increased. If the error occurs while loading an archive, then the machine data must be increased "manually". To do this, either Edit the archive with 'arcedit' or Overwrite the MD in the MD picture and prevent the deletion of the machine data when writing the archive (MMC: Set Ask\_for\_CFG\_RESET.INI = 1 in 'dino.ini'). Also refer to: Upgrade instructions P6.x.  
 - Error number 2: Error in the combination or while reloading compile cycles: Do not activate compile cycle.  
 - Error number 3: Error in the combination or while reloading compile cycles: Do not activate compile cycle.  
 - Error number 4: Error in the compile cycle: Do not activate compile cycle.  
 - Error number 5: Error in the compile cycle: Do not activate compile cycle.

**Program Continuation:** Switch control OFF - ON.

**6200 Memory for CC MD full.**

**Definitions:** The memory reserved for storage of compile cycle machine data is full.  
 Some of these machine data could not be created correctly.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 If the alarm is displayed on setup of compile cycles, this may be remedied by increasing MD18238 \$MN\_MM\_CC\_MD\_MEM\_SIZE.

**Program Continuation:** Switch control OFF - ON.

**6401 [Channel %1: ] Tool change not possible: Empty location for tool %2 on magazine %4 not available.**

**Parameters:** %1 = Channel ID  
 %2 = String (identifier)  
 %3 = -Not used-  
 %4 = Magazine number

**Definitions:** The tool cannot be moved into the selected tool magazine. There is no appropriate location for this tool. A suitable location is mainly determined by the status. The status must indicate that this location is free, not disabled, not reserved and not co-occupied by a tool that is too large. Furthermore, it is important that the type of tool matches the type of any magazine location that may be free. (If, for example, all magazine locations are of the 'B' type and these are all free and the tool is of type 'A', then this tool cannot be put into this magazine).

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

---

<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check whether the magazine data have been defined correctly.</li> <li>- Check whether there is still room in the magazine to add another tool; there may not be due to operating procedures.</li> <li>- Check whether a location type hierarchy is defined and whether it, for example, does not allow insertion of a type 'A' tool in a free location with type 'B'.</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 6402 [Channel %1: ] Tool change not possible. Magazine no. %2 not available

<b>Parameters:</b>	%1 = Channel ID %2 = Magazine number
<b>Definitions:</b>	The desired tool change is not possible. The magazine with the specified number is not available.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check whether the magazine data have been defined correctly.</li> <li>- Check whether the magazine is connected to the desired tool holder/spindle via a distance relation.</li> <li>- The user PLC program may have sent wrong data to the NCK.</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 6403 [Channel %1: ] Tool change not possible. Magazine location number %2 on magazine %3 not available.

<b>Parameters:</b>	%1 = Channel ID %2 = Magazine number %3 = Magazine location number
<b>Definitions:</b>	The desired tool change is not possible. The specified magazine location is not contained in the specified magazine.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check whether the magazine data have been defined correctly. The user PLC program may have delivered incorrect data to the NCK.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 6404 [Channel %1: ] Tool change not possible. Tool %2 not available or not usable

<b>Parameters:</b>	%1 = Channel ID %2 = String (identifier)
<b>Definitions:</b>	The desired tool change is not possible. The specified tool does not exist or cannot be loaded. The tool cannot be loaded either if it is part of a multitool which is already active with another tool, or is part of a multitool whose state is 'Change active' in relation to another toolholder.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check whether the part program is written correctly.</li> <li>- Check whether the tool data are correctly defined.</li> <li>- Check whether there is a replacement tool which can be used for the specified tool.</li> </ul>

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**6405 [Channel %1: ] Command %2 has invalid PLC acknowledge parameter %3 - identifier %4**

**Parameters:** %1 = Channel ID  
 %2 = Command no.  
 %3 = PLC acknowledge parameter  
 %4 = Error code

**Definitions:** The specified command has been answered by the PLC with an invalid acknowledgement in the current context. The following assignments are defined for "command no.":

- 1 Move tool, load or unload magazine
- 2 Prepare tool change
- 3 Execute tool change
- 4 Prepare tool change and execute with T command
- 5 Prepare tool change and execute with M command
- 7 Terminate canceled tool command
- 8 Check tool movement with reservation
- 9 Check tool movement
- 0 Transport acknowledgement

Parameters 2 and 3 designate the PLC command and the status number of the acknowledgement.  
 Example: Parameter 4 of the alarm message is 10. It is not defined that a buffer location has to be reserved for asynchronous tool motion. In the example, the parameter is ignored by the NCK. Further possible causes for the alarm: The tool change defined by the command is not possible. The magazine location specified in the invalid parameter does not exist in the magazine.

- The 3rd parameter - error identification - gives a more detailed description of the alarm. Meanings:
- 0 = not defined
  - 1 = status not allowed or undefined status received by PLC
  - 2 = source and/or target magazine no./location no. unknown
  - 3 = not defined
  - 4 = target magazine no. and/or location no. are not the end target in the tool motion command
  - 5 = not defined
  - 6 = source and/or target magazine no./location no. unknown during tool change
  - 7 = PLC comm. with inconsistent data: either inconsistent magazine addresses in VDI or NCK command unequal to PLC acknowledgement or both
  - 8 = PLC comm. with inconsistent data: while rejecting a tool, the tool to be rejected was unloaded asynchronously. NCK cannot perform a new selection.
  - 9 = PLC comm. with inconsistent data: the command acknowledgement data wants to move a tool to a location that is occupied by another tool.
  - 10 = Asynchronous tool motion with reservation is only defined for the motion from a magazine to a buffer location.
  - 11 = The replaced tool is within a multi-tool. PLC must not acknowledge the multi-tool position defined by the NCK with another value.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Erroneous PLC communication: Correct the PLC program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**6406 [Channel %1: ] PLC acknowledge for command %2 is missing**

**Parameters:** %1 = Channel ID  
 %2 = Command no.

---

<b>Definitions:</b>	There is still no acknowledgement from the PLC for the tool change. The NCK cannot continue processing until it receives this acknowledgement for the specified command number. Possible command number values are described for alarm 6405.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Erroneous PLC communication: Correct the PLC program. - It is possible to release NCK with the PLC command 7 from the wait condition. This aborts the waiting command.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>6407</b>	<b>[Channel %1: ] Tool %2 cannot be placed in magazine %3 on location %4. Invalid definition of magazine!</b>
<b>Parameters:</b>	%1 = Channel ID %2 = String (identifier) %3 = Magazine number %4 = Magazine location number
<b>Definitions:</b>	A tool change request or a verification request was issued to put the tool in a location which does not satisfy the prerequisites for filling. The following causes for the error are possible: - Location is blocked or not free! - Tool type does not match the location type! - Tool possibly too large, adjacent locations are not free!
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	- Check whether the magazine data are correctly defined (especially the location type). - Check whether the tool data are correctly defined (especially the location type).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>6410</b>	<b>[TO unit %1: ] Tool %2 has reached its prewarning limit with D = %4</b>
<b>Parameters:</b>	%1 = TO unit %2 = Tool identifier (name) %3 = -Not used- %4 = D number
<b>Definitions:</b>	Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter. If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm is triggered through the HMI or PLC (=OPI interface). The channel context is not defined. The TO unit was specified for this reason (see MD28085 \$MC_MM_LINK_TOA_UNIT).
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only. The user must decide what to do.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**6411 [Channel %1: ] Tool %2 has reached its prewarning limit with D = %4**

**Parameters:** %1 = Channel number  
 %2 = Tool identifier (name)  
 %3 = -Not used-  
 %4 = D number

**Definitions:** Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter. If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC\_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm originates during NC program execution.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** For information only. The user must decide what to do.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6412 [TO unit %1: ] Tool %2 has reached its monitoring limit with D = %4**

**Parameters:** %1 = TO unit  
 %2 = Tool identifier (name)  
 %3 = -Not used-  
 %4 = D number

**Definitions:** Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter. If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC\_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm is triggered through the HMI or PLC (=OPI interface). The channel context is not defined. The TO unit was specified for this reason (see MD28085 \$MC\_MM\_LINK\_TOA\_UNIT).

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** For information only. The user must decide what to do.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6413 [Channel %1: ] Tool %2 has reached its monitoring limit with D = %4**

**Parameters:** %1 = TO unit  
 %2 = Tool identifier (name)  
 %3 = -Not used-  
 %4 = D number

**Definitions:** Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter. If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC\_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm originates during NC program execution.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** For information only. The user must decide what to do.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

<b>6415</b>	<b>[TO unit %1: ] Tool %2 with tool edge no. %3 has reached tool monitor warning limit</b>
<b>Parameters:</b>	%1 = TO unit %2 = Tool identifier %3 = Cutting edge number
<b>Definitions:</b>	This message informs that at least one cutting edge of the time or quantity monitored tool has reached its monitoring limit. The alarm was triggered through the OPI interface (MMC, PLC). The channel context is not defined. The TO unit was specified for this reason.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only. The user must decide what to do.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>6416</b>	<b>[Channel %1: ] Tool %2 with tool edge no. %3 has reached tool monitor warning limit</b>
<b>Parameters:</b>	%1 = Channel number %2 = Tool identifier %3 = Cutting edge number
<b>Definitions:</b>	This message informs that at least one cutting edge of the time or quantity monitored tool has reached its monitoring limit. The limit was detected in the channel context. The alarm originated during NC program execution.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only. The user must decide what to do.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>6417</b>	<b>[TO unit %1: ] Tool %2 with tool edge no. %3 has reached tool monitoring limit</b>
<b>Parameters:</b>	%1 = TO unit %2 = Tool identifier %3 = Cutting edge number
<b>Definitions:</b>	This message informs that at least one cutting edge of the time or quantity monitored tool has reached its monitoring limit. The alarm was triggered through the OPI interface (MMC, PLC). The channel context is not defined. The TO unit was specified for this reason.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only. The user must decide what to do.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>6418</b>	<b>[Channel %1: ] Tool %2 with tool edge no. %3 has reached tool monitoring limit</b>
<b>Parameters:</b>	%1 = Channel number %2 = Tool identifier %3 = Tool number
<b>Definitions:</b>	This message informs that at least one cutting edge of the time or quantity monitored tool has reached its monitoring limit. The limit was detected in the channel context. The alarm originated during NC-program execution.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only. The user must decide what to do.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6421 [Channel %1: ] Tool move not possible. Empty location for tool %2 on magazine %4 not available.**

**Parameters:** %1 = Channel ID  
 %2 = String (identifier)  
 %3 = -Not used-  
 %4 = Magazine number

**Definitions:** The desired tool motion command - triggered from the MMC or PLC - is not possible. The tool cannot be moved into the specified tool magazine. There is no appropriate location for this tool.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:**

- Check whether the magazine data have been defined correctly (e.g. the magazine must not be disabled).
- Check whether the tool data are correctly defined (for example, the tool location type must match the location types allowed in the magazine).
- Check whether the magazine has simply no more room to accept another tool thanks to operating procedures.
- Check whether a location type hierarchy is defined and whether, for example, it does not allow insertion of a type 'A' tool in a free location with type 'B'.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6422 [Channel %1: ] Tool move not possible. Magazine no. %2 not available.**

**Parameters:** %1 = Channel ID  
 %2 = Magazine number

**Definitions:** The desired tool motion command - triggered from the MMC or PLC - is not possible. The magazine with the specified number is not available.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:**

- Check whether the magazine data have been defined correctly.
- If the PLC issued the command for motion: check whether the PLC program is correct.
- If the MMC issued the command for motion: check whether the MMC command was assigned correct parameters.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6423 [Channel %1: ] Tool move not possible. Location %2 on magazine %3 not available.**

**Parameters:** %1 = Channel ID  
 %2 = Magazine location number  
 %3 = Magazine number

**Definitions:** The desired tool motion command - triggered from the MMC or PLC - is not possible. The specified magazine location is not contained in the specified magazine.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check whether the magazine data have been defined correctly.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>6424</b>	<b>[Channel %1: ] Tool move not possible. Tool %2 not available/not usable.</b>
<b>Parameters:</b>	%1 = Channel ID %2 = String (identifier)
<b>Definitions:</b>	The desired tool motion command - triggered from the HMI or PLC - is not possible. The status of the specified tool does not allow movement of the tool. The specified tool is not defined or is not permitted for the command. The specified tool cannot be moved either if it is part of a multitool (only the multitool itself can be moved).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check whether the tool status 'is being changed' ('H20') is set. If yes, then the appropriate tool change command must first be completed by the PLC. Then the tool should be able to be moved.</li> <li>- Check whether the tool data are correctly defined. Has the correct T number been specified?</li> <li>- Check whether the move command has been correctly parameterized. Is the desired tool at the source location? Is the target location suitable for taking the tool?</li> <li>- Check whether the tool has already been loaded (if the alarm occurs while loading the tool).</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>6425</b>	<b>[Channel %1: ] Tool %2 cannot be placed in magazine %3 on location %4. Invalid definition of magazine!</b>
<b>Parameters:</b>	%1 = Channel ID %2 = String (identifier) %3 = Magazine number %4 = Magazine location number
<b>Definitions:</b>	The desired tool motion command - triggered from the MMC or PLC - is not possible. A movement request was issued to put the tool in a location which does not satisfy the prerequisites for filling. The following causes for the error are possible: <ul style="list-style-type: none"> <li>- Location is blocked or not free!</li> <li>- Tool type does not match the location type!</li> <li>- Tool possibly too large, adjacent locations are not free!</li> <li>- If a tool is to be loaded or unloaded, the load/unload position must be of 'load location' type.</li> <li>- If a tool is to be loaded or unloaded, is the magazine in question linked to the load/unload location?</li> </ul> See \$TC_MDP1, \$TC_MDP2.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check whether the magazine data have been defined correctly.</li> <li>- Check whether there is still room in the magazine to add another tool; there may not be due to operating procedures.</li> <li>- Check whether a location type hierarchy is defined and whether it, for example, does not allow insertion of a type 'A' tool in a free location with type 'B'.</li> <li>- Check whether the magazine in question is linked to the load/unload location or whether a distance has been defined.</li> <li>- Check whether the load/unload position is of 'load location' type.</li> </ul> See also \$TC_MPP1.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**6430 Workpiece counter: overflow in table of monitored cutting edges.**

**Definitions:** No more cutting edges can be entered in the piece counter table.  
 As many cutting edges can be noted for the workpiece counter as are possible in total in the NCK.  
 This means that if for each tool each cutting edge in each TO unit is used precisely once for a workpiece then the limit is reached.  
 If several workpieces are made on several toolholders/spindles simultaneously, it is possible to note MD18100 \$MN\_MM\_NUM\_CUTTING\_EDGES\_IN\_TOA cutting edges for the workpiece counter for all of the workpieces.  
 If this alarm occurs, it means that cutting edges used subsequently are no longer quantity monitored until the table has been emptied again, e.g. by means of the NC language command SETPIECE or by the relevant job from HMI, PLC (PI service).

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Was decrementing of the piece counter forgotten? Then program SETPIECE in the part program, or add the correct command in the PLC program.  
 - If the part program/PLC program is correct, then more memory should be set for tool cutting edges via the MD18100 \$MN\_MM\_NUM\_CUTTING\_EDGES\_IN\_TOA (can only be performed with the necessary access rights!).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6431 [Channel %1: ] Block %2 Function not allowed. Tool management/monitoring is not active.**

**Parameters:** %1 = Channel ID  
 %2 = Block number, label

**Definitions:** Occurs when a data management function is called which is not available because ToolMan is deactivated. For example, the language commands GETT, SETPIECE, GETSELT, NEWT, DELT, TCA.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Please inform the authorized personnel/service department.  
 - Make sure of how the NC is supposed to be configured! Is tool management or tool monitoring needed but not activated?  
 - Are you using a part program that is meant for a numerical control with tool management/tool monitoring? It is not possible to start this program on the numerical control without tool management/tool monitoring. Either run the part program on the appropriate NC control or edit the part program.  
 - Activate tool management/tool monitoring by setting the appropriate machine data. See MD18080\$MN\_MM\_TOOL\_MANAGEMENT\_MASK, MD20310\$MC\_TOOL\_MANAGEMENT\_MASK  
 - Check whether the required option is set accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**6432 Function not executable. No tool assigned to tool holder/spindle**

**Parameters:** %1 = Channel ID

**Definitions:** When an attempt is made to perform an operation that requires a tool to be located on the spindle. This can be the quantity monitoring function, for example.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** Select another function, another toolholder/spindle, position tool on toolholder/spindle.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6433**                    **[Channel %1: ] Block %2 %3 not available with tool management**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = Source symbol

**Definitions:**        The symbol variable specified in %3 is not available with active tool management. The function GELSELT should be used with \$P\_TOOLP.

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Modify program. If \$P\_TOOLP has been programmed, the GETSELT function should be used instead.

**Program**                Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**6434**                    **[Channel %1: ] Block %2 NC command SETMTH not allowed because tool holder function not active**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**        No master toolholder has been defined for the initial state (MD20124 \$MC\_TOOL\_MANAGEMENT\_TOOLHOLDER = 0), therefore no toolholder is available. The NC command SETMTH has neither been defined. In this setting, the tool change is carried out referring to the master spindle. The master spindle is set with SETMS.

**Reaction:**            Correction block is reorganized.  
                         Local alarm reaction.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Correct the NC program (delete or replace SETMHT) or enable toolholder function via machine data.

**Program**                Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**6436**                    **[Channel %1: ] Block %2 command '%3' cannot be programmed. Function '%4' has not been activated.**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = Programmed command  
                         %4 = Function identifier

**Definitions:**        The command cannot be programmed due to the lack of a function enable or activation.

**Reaction:**            Correction block is reorganized.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Correct the NC program

**Program**                Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**6438**                    **[Channel %1: ] Block %2 inconsistent data modification is not permitted.**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:** In a defined multitool, for example, the distance coding \$TC\_MTP\_KD cannot be changed once the multitool location has been generated.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the NC program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**6441 Writing of \$P\_USEKT not allowed.**

**Definitions:** An attempt was made to write the value of \$P\_USEKT. This is not possible since programming T= 'location number' with automatic setting of \$P\_USEKT is active.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check how the NC is supposed to be configured. (See bit16 and bit22 in MD 20310 \$MC\_TOOL\_MANAGEMENT\_MASK).  
- Is a part program being used that is intended for an NC control without T='location number' with automatic setting of \$P\_USEKT? This program cannot be started on an NC control with T='location number' with automatic setting of \$P\_USEKT.  
- Either run the part program on an appropriate NC control or edit the part program.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6442 [Channel %1: ] Function not executable. No tool assigned to desired magazine/ magazine location %2.**

**Parameters:** %1 = Channel ID  
%2 = Magazine/magazine location no.

**Definitions:** PLC logic is presumably incorrect. Tool change with reject tool is configured. Preparatory command is pending. Selected tool is (e.g. from PLC) unloaded from its location. PLC acknowledges preparatory command with 'Repeat tool selection' (e.g. status =7). NCK cannot find the tool at the magazine location specified in the PLC command. Or: Illegal operator intervention in an active tool selection (unloading of the tool to be selected) has occurred. Therefore the PLC acknowledgement fails.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** PLC programmer must note the following:  
- Ensure that the tool is not removed from the specified magazine location (e.g. incorrect PLC program).  
- Do not remove the tool from the programmed tool change before the final acknowledgement of the command (= unload).  
!! It is however permissible to change the location of the tool to be loaded. The NCK can deal with this situation. This alarm supplements Alarm 6405, if it contains the identifier 8. Therefore, the diagnostics should be easier.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6450 [Channel %1: ] Block %2 tool change not possible. Invalid magazine location no. %3 in buffer magazine**

**Parameters:** %1 = Channel ID  
%2 = Block number, label  
%3 = Magazine location number

---

<b>Definitions:</b>	The desired tool change is not possible. The specified magazine location is either toolholder/spindle or empty. Only the numbers of the buffer that are not toolholder/spindle may be programmed with the NC command TCI, i.e. the location number of a gripper is allowed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Check whether the magazine data (\$TC_MPP1) have been defined correctly. - Check whether the alarm-causing program command _ e.g. TCI _ has been programmed correctly.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 6451 [Channel %1: ] Block %2 tool change not possible. No buffer magazine defined.

<b>Parameters:</b>	%1 = Channel ID %2 = Block number, label
<b>Definitions:</b>	The desired tool change is not possible. No buffer magazine defined.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check whether the magazine data have been defined correctly.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 6452 [Channel %1: ] Block %2 tool change not possible. Tool holder/spindle number = %3 not defined.

<b>Parameters:</b>	%1 = Channel ID %2 = Block number, label %3 = Tool holder/spindle number
<b>Definitions:</b>	The desired tool change is not possible. The toolholder/spindle number has not been defined.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	General: The following must apply: 'maximum programmed address extension s (=spindle number/toolholder number) of Ts=t, Ms=6 must be less than the value of MD18076 \$MN_MM_NUM_LOCS_WITH_DISTANCE. With magazine management: Check whether the toolholder number/spindle number and the magazine data have been defined correctly. (See also the system variables \$TC_MPP1, \$TC_MPP5 of the buffer magazine).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 6453 [Channel %1: ] Block %2 tool change not possible. No assignment between toolholder/spindle no. = %3 and buffer magazine location %4

<b>Parameters:</b>	%1 = Channel ID %2 = Block number, label %3 = Spindle no. %4 = Location no.
<b>Definitions:</b>	The desired tool change is not possible. No relation has been defined between the toolholder/spindle number and the buffer magazine location (Location No.)
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** - Check whether the magazine data (\$TC\_MLSR) have been defined correctly.  
 - Check whether the alarm-causing program command \_ e.g. TCI \_ has been programmed correctly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**6454 [Channel %1: ] Block %2 tool change not possible. No distance relation available.**

**Parameters:** %1 = Channel ID  
 %2 = Block number, label

**Definitions:** The desired tool change is not possible. Neither the spindle nor the buffer magazine location have a distance relation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check whether the magazine data (\$TC\_MDP2) have been defined correctly.  
 - Check whether the alarm-causing program command \_ e.g. TCI \_ has been programmed correctly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**6455 [Channel %1: ] Block %2 tool change not possible. Magazine location no. %3 not available in magazine %4**

**Parameters:** %1 = Channel ID  
 %2 = Block number, label  
 %3 = Magazine location number  
 %4 = Magazine number

**Definitions:** The desired tool change is not possible. The indicated magazine location is not available in the indicated magazine.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check whether the causing program command - e.g. TCI - has been parameterized correctly.  
 - Check whether magazine data have been defined correctly. (\$TC\_MAP6 and \$TC\_MAP7 of the intermediate location magazine)

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**6460 [Channel %1: ] Block %2 Command '%3' can only be programmed for tools. '%4' does not designate a tool.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Programmed command  
 %4 = Programmed parameter

**Definitions:** The specified command can only be programmed for tools. The command parameter is not a T number or a tool name. If a multitool has been programmed: The command cannot be programmed for multitools.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the NC program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>6462</b>	<b>[Channel %1: ] Block %2 Command '%3' can only be programmed for magazines. '%4' does not designate a magazine.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Programmed command %4 = Programmed parameter
<b>Definitions:</b>	The specified command can only be programmed for magazines. The command parameter is not a magazine number or a magazine name. If a multitool has been programmed: The command cannot be programmed for multitools.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the NC program
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>6464</b>	<b>[Channel %1: ] Block %2 Command '%3' cannot be programmed for the current multitool distance coding '%4'</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Programmed command %4 = Type of distance coding
<b>Definitions:</b>	\$TC_MTPPL can only be programmed if \$TC_MTP_KD has a value of 2. \$TC_MTPPA can only be programmed if \$TC_MTP_KD has a value of 3.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the NC program
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>6500</b>	<b>NC memory full</b>
<b>Definitions:</b>	The NCK file system is full. The available buffered memory does not suffice. Note: At first commissioning, files of the NC file system may be affected such as drive data, MMC files, FIFO files, NC programs...
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Adjust the size of the buffered memory (MD18230 \$MN_MM_USER_MEM_BUFFERED) or increase the space available in the buffered memory, e.g. by unloading part programs that are no longer being used. Or decrease the size of the ring buffer (see \$MC_RESU_RING_BUFFER_SIZE).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>6510</b>	<b>Too many part programs in the NC memory</b>
<b>Definitions:</b>	The maximum number of possible files in the NC file system (part of the NC memory) has been reached. Note: During first commissioning, this can affect files from the NC file system, e.g. drive data, MMC files, FIFO files, NC programs, ...
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Delete or unload files (e.g. part programs), or - Increase MD18320 \$MN_MM_NUM_FILES_IN_FILESYSTEM.

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**6520 The value of the machine data %1%2 is too low**

**Parameters:** %1 = String: MD identifier  
%2 = If required, index: MD array  
**Definitions:** The MD18370 \$MN\_MM\_PROTOC\_NUM\_FILES specifies the number of protocol files for the protocol users. However, more types are used than configured.  
**Reaction:** Alarm display.  
**Remedy:** Increase MD18370 \$MN\_MM\_PROTOC\_NUM\_FILES.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**6530 Too many files in directory**

**Definitions:** The number of files in a directory of the NC memory has reached the maximum limit.  
**Reaction:** Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
- Delete or unload files (e.g. part programs) in the respective directory, or  
- Increase MD18280 \$MN\_MM\_NUM\_FILES\_PER\_DIR.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**6540 Too many directories in the NC memory**

**Definitions:** The number of directories in the NC file system (part of the NC memory) has reached the maximum limit.  
**Reaction:** Alarm display.  
**Remedy:** - Delete or unload directory (e.g. workpiece), or  
- Increase MD18310 \$MN\_MM\_NUM\_DIR\_IN\_FILESYSTEM.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**6550 Too many subdirectories**

**Definitions:** The number of subdirectories in a directory of the NCK has reached the maximum limit.  
**Reaction:** Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
- Delete or empty subdirectories in the respective directory, or  
- Increase MD18270 \$MN\_MM\_NUM\_SUBDIR\_PER\_DIR.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**



---

**6560 Data format not allowed**

**Definitions:** An attempt was made to write impermissible data in an NCK file. This error can occur in particular when the attempt was made to load binary data in the NCK as ASCII file.  
The error can also occur during preprocessing of cycles (see MD10700 \$MN\_PREPROCESSING\_LEVEL) if the NC block is very long. In this case, subdivide the NC block.

**Reaction:** Alarm display.

**Remedy:** Specify that the file concerned is a binary file (e.g. extension: .BIN).

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**6570 NC memory full**

**Definitions:** The NC card file system of the NCK is full. The task cannot be executed. Too many system files were created in the DRAM.

**Reaction:** Alarm display.

**Remedy:** Start fewer "execute from external" processes.

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**6580 NC memory full**

**Definitions:** The NC card file system of the NCK is full. The task cannot be executed. Too many files have been loaded

**Reaction:** Alarm display.

**Remedy:** Delete or unload files (e.g. parts programs)

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**6581 NC user memory full**

**Definitions:** The DRAM file system of the user area is full. The order cannot be executed.

**Reaction:** Alarm display.

**Remedy:** Delete or unload files (e.g. parts programs)

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**6582 NC machine OEM memory full**

**Definitions:** The DRAM file system of the machine OEM area is full. The order cannot be executed.

**Reaction:** Alarm display.

**Remedy:** Delete or unload files (e.g. parts programs)

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

---

**6583 NC system memory full**

**Definitions:** The DRAM file system of the system area (Siemens) is full. The order cannot be executed.  
**Reaction:** Alarm display.  
**Remedy:** Delete or unload files (e.g. parts programs)  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6584 NC memory limit TMP reached**

**Definitions:** The DRAM file system of the TMP (temporary) area is full. The job cannot be executed.  
**Reaction:** Alarm display.  
**Remedy:** Increase MD18351 \$MN\_MM\_DRAM\_FILE\_MEM\_SIZE or MD18355 \$MN\_MM\_T\_FILE\_MEM\_SIZE or switch off the precompilation of individual or all cycles or delete files in the TMP area.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6585 NC external memory limit reached**

**Definitions:** The DRAM file system of the external area (execution of the external drive) is full. The job cannot be executed.  
**Reaction:** Alarm display.  
**Remedy:** Load the files to be executed explicitly into the NCK.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**6693 File %1 lost**

**Parameters:** %1 = File name  
**Definitions:** Due to a power failure, a file change could not be terminated properly. The file is lost.  
**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Import the file again.  
**Program Continuation:** Switch control OFF - ON.

---

**6700 [Channel %1: ] Value of the machine data %2%3 is too low**

**Parameters:** %1 = Channel number  
%2 = MD identifier  
%3 = If required, field index  
**Definitions:** The MD28302 \$MC\_MM\_PROTOD\_NUM\_ETP\_STD\_TYP specifies the number of default event types for the protocol users. However, more types are used than configured.  
**Reaction:** Alarm display.  
**Remedy:** Increase MD28302 \$MC\_MM\_PROTOD\_NUM\_ETP\_STD\_TYP.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

<b>7000</b>	<b>Too many compile cycle alarms defined</b>
<b>Definitions:</b>	Too many alarms are defined for the compile cycles. On powering up, the quantity was exceeded when defining a new CC alarm.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Apart from reducing the number of CC alarms, no remedial measures are possible at the present time. Place a support request with the error text under: <a href="http://www.siemens.com/automation/support-request">http://www.siemens.com/automation/support-request</a>
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>7010</b>	<b>MMC number range exceeded</b>
<b>Definitions:</b>	A fixed quantity of alarm numbers (100) is reserved for the compile cycles. This has been exceeded when defining a new CC alarm. (The valid range is between 0 and 4999).
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Define the CC alarm numbers in the valid range from 0 to 4999.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>7020</b>	<b>Compile cycle alarm number has not been defined</b>
<b>Definitions:</b>	The alarm ID used by the compile cycle manufacturer is not known to the system. This was not allocated when the compile cycle alarms were generated.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The alarm can have 2 possible causes: - The alarm number has not been defined. A definition must still be made. - The call parameter used is not the same as the one transferred by the NCK.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>7100</b>	<b>Compile cycles VDI area: %1 byte for inputs and %2 byte for outputs. Maximum %3 bytes available.</b>
<b>Parameters:</b>	%1 = String (machine data) %2 = String (machine data) %3 = Max. length for interface
<b>Definitions:</b>	The sum of the input and output bytes at the VDI user interface for the compile cycles exceeds the maximum quantity of 400 bytes.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Set the machine data for dividing up the VDI user interface of the compile cycles (DB 9) into input and output bytes in accordance with the functions in the compile cycles. The maximum quantity of 400 bytes must not be exceeded. There are no restrictions concerning the division into input and output bytes.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**7200**                    **Problem with externally linked compile cycle %1 %2**

**Parameters:**            %1 = Description character string  
                              %2 = Additional information

**Definitions:**            Problem with loadable compile cycles  
                              Example:  
                              "Version\_conflict\_with\_CCNCKInterface\_Version"  
                              Meaning: The interface version of the compile cycle is incompatible with the NCK version.  
                              "Loader\_problem\_from\_dFixup"  
                              Meaning: Unresolved references are left over after loading of all compile cycles, for example as an ELD file is missing.

**Reaction:**                Alarm display.

**Remedy:**                 See function description of the compile cycle!

**Program**                 Clear alarm with the Delete key or NC START.

**Continuation:**

---

**7201**                    **Assertion error in %1 line %2**

**Parameters:**            %1 = String (path with program name)  
                              %2 = (line number)

**Definitions:**            This alarm is purely a development alarm. It only occurs with externally linked compile cycles.

**Reaction:**                NC not ready.  
                              The NC switches to follow-up mode.  
                              Channel not ready.  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm.  
                              Alarm reaction delay is cancelled.

**Remedy:**                 Consultation with CC developer

**Program**                 Clear alarm with the RESET key in all channels. Restart part program.

**Continuation:**

---

**7202**                    **Missing option bit for %1: %2 <hex>**

**Parameters:**            %1 = ( ) name of the specific .elf file  
                              %2 = (int) required option bit (hex)

**Definitions:**            Alarm for SIEMENS compile cycles. This alarm appears when the option bit required for a SIEMENS compile cycle is not set.

**Reaction:**                NC not ready.  
                              Channel not ready.  
                              Interface signals are set.  
                              Alarm display.  
                              Alarm reaction delay is cancelled.

**Remedy:**                 Set the required option bit or delete the .elf file from the Flash File System.

**Program**                 Clear alarm with the RESET key in all channels. Restart part program.

**Continuation:**

---

**7203**                    **Missing release for %1 index: %2**

**Parameters:**            %1 = Name of the CC specific .elf file  
                              %2 = Index describing the problem that occurred in more detail

---

<b>Definitions:</b>	Alarm for SIEMENS compile cycles. This alarm appears when a SIEMENS compile cycle has been loaded that has not been released for the controller. The "Index" parameters describe the error cause further: Index == 1: The interface version of the compile cycle is not identical with the interface version of the NCK. Index == 2: The compile cycle cannot be applied in this controller since the hardware serial number is not one the released serial numbers.
<b>Reaction:</b>	NC not ready. Channel not ready. Interface signals are set. Alarm display. Alarm reaction delay is cancelled.
<b>Remedy:</b>	Delete the .elf file from the flash file system.
<b>Program</b>	Clear alarm with the RESET key in all channels. Restart part program.
<b>Continuation:</b>	

---

### 7205 [Channel %1: ] Incompatible OEM transformation version NCK %2 CC %3

<b>Parameters:</b>	%1 = (int) channel number %2 = Transformer interface version NCK %3 = Transformer interface version OEM
<b>Definitions:</b>	The interface for OEM transformations has changed incompatibly in the system.
<b>Reaction:</b>	NC not ready. Channel not ready. Interface signals are set. Alarm display. Alarm reaction delay is cancelled.
<b>Remedy:</b>	Load the new compile cycle version
<b>Program</b>	Clear alarm with the RESET key in all channels. Restart part program.
<b>Continuation:</b>	

---

### 7300 Problem with externally linked COA application %1 Index: %2 Additional information: %3

<b>Parameters:</b>	%1 = Name of the COA application %2 = Index describing the problem that occurred in more detail %3 = Optional additional parameter
<b>Definitions:</b>	A problem occurred while loading the COA application. This problem is described in more detail by the parameters "Index" and "Additional information": Index == 1: The interface version of the COA application is incompatible with the NCK version. The additional information contains the interface version of the COA application. Index == 2: The heap memory requested by the COA application is not available. The additional information contains the heap memory requested in KB. Index == 3: The \$P_INCOAP parameters requested by the COA application cannot be created due to insufficient memory. The additional information contains the heap memory requested in KB.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Index == 1: The COA application is not executable in the current environment. Please inform the authorized personnel/ service department. Index == 2 or 3: Check MD18235 \$MN_MM_INCOA_MEM_SIZE. The memory requested by the COA application will not become available until after another warm restart. This means that the alarm should no longer occur with a warm restart (NCK reset). Otherwise, there is a real memory problem, and the COA application is not executable (see Index == 1).
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

**7301 Assertion error in %1 line %2**

**Parameters:** %1 = File name  
 %2 = Line number

**Definitions:** This alarm is purely a development alarm. It only occurs with externally linked COA applications.

**Reaction:** NC not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Alarm reaction delay is cancelled.

**Remedy:** Query with COA developers

**Program Continuation:** Clear alarm with the RESET key in all channels. Restart part program.

---

**7500 Block %1 invalid protection level for command %2 (protection level act.: %3 prog.: %4)**

**Parameters:** %1 = Block number  
 %2 = Programmed command  
 %3 = Current protection level of the command  
 %4 = Programmed protection level of the command

**Definitions:** On assigning a protection level for a parts program command via REDEF command  
 - an impermissible parts program command has been programmed  
 - a protection level has been programmed that is logically smaller (larger in value) than the protection level currently applicable for this command.  
 - the relevant definition file has not been protected sufficiently against write access. The write protection of the file must be at least as high as the highest protection level that has been assigned to a parts program command in this definition file.

**Reaction:** Alarm display.

**Remedy:** Modify definition files /\_N\_DEF\_DIR/\_N\_MACCESS\_DEF or /\_N\_DEF\_DIR/\_N\_UACCESS\_DEF-CESS\_DEF.  
 Please see the Siemens Programming Guide or the OEM documentation for the language commands permissible for the relevant system configurations.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**8000 [Channel %1: ] Option 'Interrupt routines' not set**

**Parameters:** %1 = Channel number

**Definitions:** Fast NCK inputs are required for the input signals in order to activate the interrupt routines and rapid lift from contour. This function is not included in the basic version and must be retrofitted when needed.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Do not use rapid interrupt inputs or contact the machine manufacturer with a view to retrofitting this option!

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>8010</b>	<b>Option 'activation of more than %1 axes' not set</b>
<b>Parameters:</b>	%1 = Number of axes
<b>Definitions:</b>	More machine axes have been defined through the MD20070 \$MC_AXCONF_MACHAX_USED than are allowed in the system.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The sum of all axes that have been configured using the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED must not exceed the maximum number of axes (dependent upon the configuration -> option, basic version: 4 axes). Please also observe the information relating to the definition of auxiliary axes/spindles.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>8020</b>	<b>Option 'activation of more than %1 channels' not set</b>
<b>Parameters:</b>	%1 = Number of channels
<b>Definitions:</b>	A 2nd channel has been indicated but the corresponding option does not exist.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	In the system-specific MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP, reduce the number of channels to 1 or retrofit the option for a 2nd channel.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>8021</b>	<b>Option 'activation of more than %1 mode groups' not set</b>
<b>Parameters:</b>	%1 = Number of mode groups
<b>Definitions:</b>	The option for the number of mode groups is not compatible with the activated mode group.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Add option for more mode groups. Activate fewer mode groups.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>8022</b>	<b>Option 'activation of more than %1KB SRAM' not set</b>
<b>Parameters:</b>	%1 = Memory size
<b>Definitions:</b>	The option for memory extension does not correspond to the active SRAM.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Buy option - Activate less SRAM

**Program Continuation:** Switch control OFF - ON.

---

**8023 Option 'Activation of more than %1 KB PLC user memory' not set**

**Parameters:** %1 = Memory size  
**Definitions:** The option for the memory configuration does not correspond to the PLC user memory used.  
**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
- Purchase option  
- Use less PLC user memory  
**Program Continuation:** Switch control OFF - ON.

---

**8024 Option 'Activation of more than %1 magazines' not set**

**Parameters:** %1 = Number of permissible magazines  
**Definitions:** The option for activating multiple magazines is not set  
**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
- Buy option  
- Reduce the number of magazines (MD18084 \$MN\_MM\_NUM\_MAGAZINE)  
**Program Continuation:** Switch control OFF - ON.

---

**8025 [Channel %1: ] Option 'Advanced Surface' not set**

**Parameters:** %1 = Channel number  
**Definitions:** The option for 'Advanced Surface' functionality is not set.  
**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
- Purchase option  
- Reset the activation of 'Advanced Surface' functionality (MD20606 \$MC\_PREPDYN\_SMOOTHING\_ON and/or MD20443 \$MC\_LOOKAH\_FFORM)  
**Program Continuation:** Switch control OFF - ON.

---

**8030 [Channel %1: ] Block %2 option 'interpolation of more than %3 axes' not set**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of permissible axes



---

<b>Definitions:</b>	The option for the number of interpolating axes does not correspond to the number of axes programmed in the interpolation group.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Option: "Interpolation of more than 4 axes" (the number of axes permitted can be set in this option) or, in the part program, program up to as many axes as are permitted by the configuration of the controller.
<b>Program</b>	
<b>Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 8031 [Channel %1: ] Block %2 axis %3: Axis has no IPO functionality

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis, spindle number
<b>Definitions:</b>	An axis/spindle that has been defined as a special axis/auxiliary spindle (see MD30460 \$MA_BASE_FUNCTION_MASK bit8), should be operated as an interpolating axis.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Define axis as interpolating axis (see MD30460 \$MA_BASE_FUNCTION_MASK bit8) or change part program
<b>Program</b>	
<b>Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 8032 Option 'activation of more than %1 link axes' not set

<b>Parameters:</b>	%1 = Number of axes
<b>Definitions:</b>	The option for the number of link axes does not match the number of axes programmed in MD10002 \$MN_AXCONF_LOGIC_MACHAX_TAB.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Buy option - Configure fewer link axes
<b>Program</b>	
<b>Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 8034 Option 'activation of axis containers' not set

<b>Definitions:</b>	The option for activating the axis container function in MD10002 \$MN_AXCONF_LOGIC_MACHAX_TAB is not enabled.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Buy option - Do not configure any containers
<b>Program</b>	
<b>Continuation:</b>	Clear alarm with the RESET key. Restart part program

**8036**                    **Option: it is not allowed to set different IPO cycles or position control cycles with NCU link.**

**Definitions:**            The option for activating the FAST\_IPO\_LINK has not been set. For NCU link, all IPO or position control cycles must then be equal (see FAST-IPO-LINK description).

**Reaction:**                NC not ready.  
                                 Channel not ready.  
                                 NC Start disable in this channel.  
                                 Interface signals are set.  
                                 Alarm display.  
                                 NC Stop on alarm.

**Remedy:**                 - Buy option  
                                 - Do not activate different IPO or position control cycles (see MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO and MD10060 \$MN\_POSCTRL\_SYSCLOCK\_TIME\_RATIO).

**Program Continuation:**    Switch control OFF - ON.

---

**8037**                    **'Activate APC/Number of current setpoint filters' option not set.**

**Definitions:**            More than six current setpoint filters were activated in the drive, although the corresponding option had not been set.

**Reaction:**                NC not ready.  
                                 Channel not ready.  
                                 NC Start disable in this channel.  
                                 Interface signals are set.  
                                 Alarm display.  
                                 NC Stop on alarm.

**Remedy:**                 - Buy option  
                                 - Deactivate the 'Advanced Positioning Control' (APC) function in the drive.  
                                 - Set a maximum of six current setpoint filters in the drive.

**Program Continuation:**    Switch control OFF - ON.

---

**8038**                    **Option 'activation of more than %1 lead link axes' not set**

**Parameters:**            %1 = Number of axes

**Definitions:**            The option for the number of lead link axes does not match the number of configured axes in the MD30554 \$MA\_AXCONF\_ASSIGN\_MASTER\_NCU.

**Reaction:**                Interpreter stop  
                                 NC Start disable in this channel.  
                                 Interface signals are set.  
                                 Alarm display.

**Remedy:**                 - Buy option  
                                 - Configure fewer lead link axes

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**8040**                    **Machine data %1 reset, corresponding option is not set**

**Parameters:**            %1 = String: MD identifier

**Definitions:**            A machine data has been set that is locked by an option.

**Reaction:**                Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
For retrofitting the option, please refer to your machine manufacturer or to a sales representative of SIEMENS AG, A&D MC.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### 8041 **Axis %1: MD %2 reset, corresponding option not sufficient**

**Parameters:** %1 = Axis number  
%2 = String: MD identifier

**Definitions:** All of the axes selected in the machine data of the assigned option are used. Safety functions have been selected for too many axes in the axial machine data.  
The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** --

**Program Continuation:** Switch control OFF - ON.

### 8044 **Option for IPO cycle time %1 ms not set**

**Parameters:** %1 = Impermissible IPO cycle time

**Definitions:** The option for activation of an IPO cycle time of %1 ms has not been set.  
Option - Permiss. IPO cycle time:  
- Option-free >= 8ms  
- 1. 1st step >= 6ms  
- 2. 2nd step >= 4ms  
- 3. 3rd step >= 2ms  
- 4. 4th step <2ms

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Buy option  
- Increase IPO cycle time (e.g. via MD10070 \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO)

**Program Continuation:** Switch control OFF - ON.

### 8050 **Option 'SPL inputs/outputs' not set.**

**Definitions:** The number of PLC I/Os has not been set in the option date for Solution Line.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select area SI Basic or SI Comfort in the option date.

**Program Continuation:** Switch control OFF - ON.

---

**8051                      Option 'Handwheel on PROFIBUS' not set**

**Definitions:**            The option to operate handwheels on PROFIBUS is not set.  
**Reaction:**                NC Start disable in this channel.  
                                 Interface signals are set.  
                                 Alarm display.  
**Remedy:**                 Activate option 'Handwheel on PROFIBUS'  
**Program**                 Switch control OFF - ON.  
**Continuation:**

---

**8080                      %1 option(s) is/are activated without setting the license key**

**Parameters:**            %1 = Number of non-licensed options  
**Definitions:**            One or more options were activated but no license key was set to prove the purchase of the option(s).  
**Reaction:**                Alarm display.  
**Remedy:**                 Generate a license key on the internet at <http://www.siemens.com/automation/licence> and enter it in the operating area "Setup", function (HSK) "Licenses".  
**Program**                 Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**8081                      %1 option(s) is/are activated that are not licensed by the license key**

**Parameters:**            %1 = Number of non-licensed options  
**Definitions:**            One ore more options were activated, that are not licensed by the license key entered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Generate a new license key on the internet at <http://www.siemens.com/automation/licence> and enter it in the operating area "Setup", function (HSK) "Licenses"..  
**Program**                 Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**8082                      A wrong license key was entered three times, Power On required before next try.**

**Definitions:**            The license key was entered wrongly at least three times. Before the next input, a new power ON is required.  
**Reaction:**                Alarm display.  
**Remedy:**                 Execute NCK Power On and enter the license key (correctly).  
**Program**                 Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**8083                      Export-restricted system software without valid licensing.**

**Definitions:**            A special CompactFlash Card and a special license key are required for operating the export-restricted system software.  
**Reaction:**                Interpreter stop  
                                 NC Start disable in this channel.  
                                 Interface signals are set.  
                                 Alarm display.  
**Remedy:**                 Please ensure that a corresponding CompactFlash Card is available in the controller. Generate a license key for export-restricted system software via the internet under <http://www.siemens.com/automation/licence> and enter in the license key under "Start-up" operating area function (HSK) "Licenses".

**Program** Switch control OFF - ON.  
**Continuation:**

### 8088 'Selection of non-grinding-specific tools' option not possible

**Definitions:** The system version of the software only allows selection of grinding specific tools (i.e. tools of type 4xx).  
**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Select a tool of type 4xx (grinding tool)  
 or install a standard version of the system software  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### 8098 Invalid combination of options (%1)

**Parameters:** %1 = Bit mask of options  
**Definitions:** The following restrictions apply to this module for the combination of options:  
 The option "Two-channel" and the options "External language", "Nibbling", "Neural quadrant error compensation" and "Measurement level 2" exclude one another!  
 Bit0 (LSB): Nibbling  
 Bit1 : External language  
 Bit2 : Neural quadrant error compensation  
 Bit3 : Measurement level 2  
**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Set the options accordingly.  
**Program** Switch control OFF - ON.  
**Continuation:**

### 8100 [Channel %1: ] Block %2: function not possible

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** - Impossible due to embargo regulations:  
 - 1. Synchronous actions: Writing of feed, override and axial offsets (\$AA\_VC, \$AC\_VC, \$AA\_OVR, \$AA\_VC and \$AA\_OFF) from synchronous actions as well as Continuous Dressing can be programmed only once in a block.  
 - 2. Extended measurement: 'Cyclic measurement' (MEAC) and 'Measurement from synchronous action' is not possible.  
 - 3. Axis interpolation: The number of axes interpolating with one another must not exceed 4 (this also includes synchronous coupling of axes via synchronous actions "DO POS[X]=\$A..." "DO FA[X]=\$A...").  
**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Modify part program.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**8101                    Option for collision avoidance is inadequate**

**Definitions:**            The option stage is inadequate for the desired function. Possible reasons:  
                                  1. More 3D protection zones have been created than is possible.  
                                  2. A protection zone type was requested that is not permitted.

**Reaction:**                Interpreter stop  
                                  NC Start disable in this channel.  
                                  Interface signals are set.  
                                  Alarm display.

**Remedy:**                 1. Buy an adequate option stage.  
                                  2. Reduce the number of 3D protection zones.  
                                  3. Avoid impermissible protection zone types.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**8102                    [Channel %1: ] Block %2 motion synchronous action: %3 function not possible**

**Parameters:**            %1 = Channel number  
                                  %2 = Block number, line number  
                                  %3 = Synact ID

**Definitions:**            - Impossible due to embargo regulations:  
                                  - 1. Synchronous actions: Writing of feed, override and axial offsets (\$AA\_VC, \$AC\_VC, \$AA\_OVR, \$AA\_VC and \$AA\_OFF) from synchronous actions as well as Continuous Dressing can be programmed only once in a block.  
                                  - 2. Extended measurement: 'Cyclic measurement' (MEAC) and 'Measurement from synchronous action' is not possible.  
                                  - 3. Axis interpolation: The number of axes interpolating with one another must not exceed 4 (this also includes synchronous coupling of axes via synchronous actions "DO POS[X]=\$A..." "DO FA[X]=\$A...").

**Reaction:**                NC Start disable in this channel.  
                                  Interface signals are set.  
                                  Alarm display.  
                                  NC Stop on alarm.

**Remedy:**                 Modify part program.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**8120                    [Channel %1: ] Block %2 following axis/spindle %3 generic coupling %4 required**

**Parameters:**            %1 = Channel number  
                                  %2 = Block number  
                                  %3 = Slave axis  
                                  %4 = String

**Definitions:**            The option stage is inadequate for the desired function. Possible reasons:  
                                  More couplings have been created than are permitted.  
                                  The number of permissible leading axes has been exceeded for one or more couplings.  
                                  The range of functions of one or more couplings has not been released.

**Reaction:**                Interpreter stop  
                                  NC Start disable in this channel.  
                                  Interface signals are set.  
                                  Alarm display.

**Remedy:**                 Buy an adequate option stage.  
                                  Reduce the number of simultaneously active couplings.  
                                  Reduce the number of leading axes per coupling or only use the released range of functions.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**9000 Handwheel %1 failed**

<b>Parameters:</b>	%1 = Handwheel number
<b>Definitions:</b>	For PROFIBUS/PROFINET only: PROFIBUS handwheel has failed
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Restore connection to PROFIBUS handwheel
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**9050 PROFIBUS I/O: Sign of life failure, logical slot / I/O area address %1**

<b>Parameters:</b>	%1 = Area address
<b>Definitions:</b>	For PROFIBUS/PROFINET only: The sign of life of the slot / I/O area has failed. No data can currently be read from the PROFIBUS I/O devices.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the communications link to the PROFIBUS I/O devices.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**9052 PROFIBUS I/O: Sign of life failure, logical slot / I/O area address %1**

<b>Parameters:</b>	%1 = Area address
<b>Definitions:</b>	For PROFIBUS/PROFINET only: The sign of life of the slot / I/O area has failed. No data can currently be written to the PROFIBUS I/O devices.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the communications link to the PROFIBUS I/O devices.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10203 [Channel %1: ] NC start without reference point (action=%2<ALNX>)**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	NC start has been activated in the MDI or AUTOMATIC mode and at least one axis that needs to be referenced has not reached its reference point.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Via the channel-specific MD20700: \$MC_REFP_NC_START_LOCK (NC Start without reference point) you can decide whether or not the axis has to be referenced before NC Start. The start of referencing can be enabled channel-specific or axis-specific. Channel-specific reference point approach: The rising edge of the NC/PLC interface signal DB21-30 DBX1.0 (Activate referencing) starts an automatic sequence which starts the axes of the channel in the same sequence as specified in the axis-specific MD34110 \$MA_REFP_CYCLE_NR (axis sequence channel-specific referencing). 0: The axis does not participate in channel-specific referencing, but it must be referenced for NC Start, -1: The axis does not participate in channel-specific referencing, but it need not be referenced for NC Start, 1- 8: Starting sequence for the channel-specific referencing (simultaneous start at the same no.), 1 - 31: CPU type Axis-specific referencing: Press the direction key that corresponds to the approach direction in the axis-specific MD34010 \$MA_REFP_CAM_MDIR_IS_MINUS (reference point approach in minus direction).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10208 [Channel %1: ] Continue program with NC start**

**Parameters:** %1 = Channel number  
**Definitions:** After block search with calculation, the control is in the desired state. The program can now be started with NC Start or the state can be changed for the time being with overstore/jog.  
**Reaction:** Interpreter stop  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Press NC Start.  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10209 [Channel %1: ] Internal NC stop after block search**

**Parameters:** %1 = Channel number  
**Definitions:** Internal alarm which only initiates the alarm response NC Stop.  
 The alarm is output in the following situations:  
 - If MD11450 \$MN\_SEARCH\_RUN\_MODE, bit 0 ==1 and the last action block is loaded in the main run after block search. Alarm 10208 is then activated as a function of the NC/PLC interface signal DB21-30 DBX1.6 (PLC action finished).  
 - Search alarm 10208 has been suppressed by the PI service \_N\_FINDBL (third decade of the parameter supplied with "2"). Alarm 10209 is set as a function of whether or not a search ASUB has been configured (MD11450 \$MN\_SEARCH\_RUN\_MODE bit 1) with the end of the search ASUB or the loading of the last action block in the main run.  
**Reaction:** Interpreter stop  
 NC Stop on alarm.  
**Remedy:** NC-Start  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10222 [Channel %1: ] Inter-channel communication not possible**

**Parameters:** %1 = Channel number  
**Definitions:** This channel has received a negative acknowledgment from the inter-channel communication because the destination channel number is not known, e.g.: START(x) or WAITE(x) but channel x has not been initialized  
**Reaction:** Alarm display.  
**Remedy:** This is an indication of possible discrepancies. The program continues if no acknowledgment is called for.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10223 [Channel %1: ] Command %2 is already occupied**

**Parameters:** %1 = Channel number  
 %2 = Event name  
**Definitions:** This channel has received a negative acknowledgment from the inter-channel communication because this command is already active or has not yet been terminated, e.g.: INIT(x,"ncprog") but a program select request is already active for channel x.  
**Reaction:** Alarm display.



**Remedy:** This is an indication of possible discrepancies. The program continues if no acknowledgment is called for.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 10225 [Channel %1: ] command denied

**Parameters:** %1 = Channel number  
**Definitions:** The channel has received a command that cannot be executed.  
**Reaction:** Alarm display.  
**Remedy:** Press RESET.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 10261 [Channel %1: ] Communication overload for block preparation

**Parameters:** %1 = Channel number  
**Definitions:** The internal communication between the NCK modules that evaluate the channel-specific VDI signals (START/STOP/RESET/DDTG/ASUBS/...) and the block preparation are overloaded. The block preparation modules are not being allocated enough computing time.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** More processor time must be allocated to the block preparation modules. Machine data \$MN\_IPO\_SYSCLOCK\_TIME\_RATIO or \$MN\_SYSCLOCK\_CYCLE\_TIME can be increased for this purpose.  
**Program** Switch control OFF - ON.  
**Continuation:**

### 10299 [Channel %1: ] Auto-Repos function is not enabled

**Parameters:** %1 = Channel number  
**Definitions:** The Auto-Repos function (operating mode) was selected in the channel but is not implemented.  
**Reaction:** Alarm display.  
**Remedy:** This message is purely informational.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 10600 [Channel %1: ] Block %2 auxiliary function during thread cutting active

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** An auxiliary function output is programmed in a thread cutting block.  
**Reaction:** Alarm display.  
**Remedy:** Consequential errors can occur if the machining path of the thread block is too short and further blocks (thread blocks) follow in which no machining stop may occur.  
Possible remedial measures:  
- Program a longer path and/or a lower traversing rate.  
- Output auxiliary function in another block (program section).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10601 [Channel %1: ] Block %2 zero velocity at block end point during thread cutting**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** This alarm occurs only when several blocks with G33 follow in succession. The block end velocity in the specified block is zero, although a further thread cutting block follows. The reasons for this can be, for instance:

- G9
- Auxiliary function after motion
- Auxiliary function output before the motion of the following block
- Positioning axis in the block

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify the NC part program by removing any programmed "Stop at end of block" G09.  
Modify general MD11110 \$MN\_AUXFU\_GROUP\_SPEC [n] for selecting the output time of an auxiliary function group by changing "Auxiliary function output before/after the movement" to "Auxiliary function output during the movement".  
Bit 5 = 1: Auxiliary function output before movement  
Bit 6 = 1: Auxiliary function output during movement  
Bit 7 = 1: Auxiliary function output after movement

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10602 [Channel %1: ] Block %2 velocity limitation during thread cutting**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the displayed thread block, the axis would exceed its maximum velocity when the spindle override is in the maximum position.

**Reaction:** Local alarm reaction.  
Alarm display.

**Remedy:** If the axis velocity is not limited (faultless thread) no remedial measures are necessary. Otherwise, a lower spindle speed must be programmed for the thread block.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10604 [Channel %1: ] Block %2 thread pitch increase too high**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The thread pitch increase is causing an axis overload. A spindle override of 100% is assumed during verification.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Reduce the spindle speed, thread pitch increase or path length in the NC program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10605 [Channel %1: ] Block %2 thread pitch decrease too high**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The thread pitch decrease is causing an axis standstill in the thread block.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce the thread pitch decrease or path length in the NC program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**10607 [channel %1: ] block %2 thread with frame cannot be executed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The current frame distorts the relationship between thread length and thread pitch.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Perform thread cutting with G33, G34, G35 without a frame. Use G63 or G331/G332.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**10610 [Channel %1: ] Axis %2 not stopped**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An axis/spindle has been positioned over several NC blocks using the POSA/SPOSA instruction. The programmed target position had not yet been reached ("exact stop fine" window) when the axis/spindle was reprogrammed. Example: N100 POSA[U]=100 : N125 X... Y... U... ; e.g.: U axis still travels from N100!
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check and correct the part program (analyze whether motion beyond block boundaries is appropriate here). Prevent block change by means of the keyword WAITP for axes or WAITS for spindles until the positioning axes or positioning spindles have also reached their target position. Example for axes: N100 POSA[U]=100 : N125 WAITP(U) N130 X... Y... U... Example for spindles: N100 SPOSA[2]=77 : N125 WAITS(2) N130 M6

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10620 [Channel %1: ] Block %3 axis %2 at software limit switch %4**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label  
%4 = String

**Definitions:** During the traversing motion, the system detected that the software limit switch would be traversed in the direction indicated. Exceeding the traversing range was not detected during block preparation because there has either been a motion overlay or a zero offset has been executed or a coordinate transformation is active.

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Depending on the reason for this alarm being triggered, the following remedial measures should be undertaken:  
- Handwheel override: Cancel the motion overlay and avoid this or keep it smaller when the program is repeated.  
- Transformation: Check the preset/programmed zero offsets (current frame). If the values are correct, the tool holder (fixture) must be moved in order to avoid triggering the same alarm when the program is repeated, which would again cause the program to be aborted.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10621 [Channel %1: ] Axis %2 rests on software limit switch %3%4**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = String  
%4 = The axis of the software limit switch is only output if different from the traversing axis.

**Definitions:** The specified axis is already positioned at the displayed software end delimiter.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check machine data MD36110 \$MA\_POS\_LIMIT\_PLUS/MD36130 \$MA\_POS\_LIMIT\_PLUS2 and MD36100 \$MA\_POS\_LIMIT\_MINUS/MD36120 \$MA\_POS\_LIMIT\_MINUS2 for the software limit switches.

Shut down in JOG mode from the software limit switch.

Please inform the authorized personnel/service department.

Machine data:

Check whether the 2nd software limit switch has been selected in the .axis-specific interface signals: "DB31, ... DBX12.3 (2nd software limit switch plus) and DB31, ... DBX12.2 (2nd software limit switch minus).

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10630 [Channel %1: ] Block %2 axis %3 at working area limit %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis, spindle number  
%4 = String (+ or -)

---

<b>Definitions:</b>	The specified axis violates the working area limitation. This is recognized only in the main run either because the minimum axis values could not be measured before the transformation or because there is a motion overlay.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Program other motion or do not perform overlaid motion.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 10631 [Channel %1: ] Axis %2 rests at working area limit %3%4

<b>Parameters:</b>	%1 = Channel number %2 = Axis, spindle %3 = String (+ or -) %4 = The axis of the working area limitation is only output if different from the traversing axis.
<b>Definitions:</b>	The specified axis reaches the working area limitation in JOG mode.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Check SD43420 \$SA_WORKAREA_LIMIT_PLUS and SD43430 \$SA_WORKAREA_LIMIT_MINUS for the working area limitation.
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

---

### 10632 [Channel %1: ] Block %2 axis %3 reaches the coordinate system-specific working area limit %4

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis, spindle number %4 = String ( + or - )
<b>Definitions:</b>	The specified axis violates the coordinate system-specific working area limitation. This is not detected until the main run, either because the minimum axis values could not be determined before the transformation or because there is an overlaid movement.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Program other motion or do not perform overlaid motion.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 10633 [Channel %1: ] Axis %2 is at coordinate system-specific working area limit %3%4

<b>Parameters:</b>	%1 = Channel number %2 = Axis, spindle %3 = String ( + or - ) %4 = The axis of the coordinate system-specific working area limitation is only output if different from the traversing axis.
<b>Definitions:</b>	The specified axis reaches the coordinate system-specific working area limitation in JOG mode.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Check the system parameter \$P_WORKAREA_CS_xx for the coordinate system-specific working area limitation.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10634 [Channel %1: ] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: The tool is not oriented parallel to the axis.**

**Parameters:** %1 = Channel number  
%2 = Axis, spindle  
%3 = 0: BCS, 1: WCS / SZS

**Definitions:** The tool radius compensation of the working area limitation of the stated axis is not taken into account.  
Reason: The tool is not oriented parallel to the axis (e.g. because toolcarrier or transformation is active).  
The alarm is reported in JOG mode.

**Reaction:** Alarm display.

**Remedy:** The tool radius compensation for working area limitations in JOG mode can only be taken into account if the tool is parallel to the axis.  
Active transformation and toolcarrier must be switched off for this function.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10635 [Channel %1: ] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: no milling or drilling tool.**

**Parameters:** %1 = Channel number  
%2 = Axis, spindle  
%3 = 0: BCS, 1: WCS / SZS

**Definitions:** The tool radius compensation of the working area limitation of the stated axis is not taken into account.  
Reason: The tool must be of type milling cutter or drill.  
The alarm is reported in JOG mode.

**Reaction:** Alarm display.

**Remedy:** The tool radius compensation for working area limitations in JOG mode can only be taken into account for milling or drilling tools.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10636 [Channel %1: ] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: Transformation is active.**

**Parameters:** %1 = Channel number  
%2 = Axis, spindle  
%3 = 0: BCS, 1: WCS / SZS

**Definitions:** The tool radius compensation of the working area limitation of the stated axis is not taken into account.  
Reason: A transformation is active.  
The alarm is reported in JOG mode.

**Reaction:** Alarm display.

**Remedy:** The tool radius compensation for working area limitations in JOG mode cannot be taken into account if transformation is active.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

---

<b>10637</b>	<b>[Channel %1: ] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: Tool not active.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis, spindle %3 = 0: BCS, 1: WCS / SZS
<b>Definitions:</b>	The tool radius compensation of the working area limitation of the stated axis is not taken into account. Reason: No tool is active. The alarm is reported in JOG mode.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The tool radius compensation for working area limitations in JOG mode cannot be taken into account without an active tool.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>10650</b>	<b>[Channel %1: ] Axis %2 incorrect gantry machine data, error code %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis %3 = Error no.
<b>Definitions:</b>	An incorrect value was entered in the gantry-specific axial machine data. Further information can be derived from the error number. - Error no. = 1 => either an incorrect gantry unit has been entered or the designation of the following axis is incorrect. - Error no. = 2 => master axis has been specified more than once.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Correct the machine data: MD37100 \$MA_GANTRY_AXIS_TYPE 0: No gantry axis 1: Master axis grouping 1 11: Slave axis grouping 1 2: Master axis grouping 2 12: Slave axis grouping 2 3: Master axis grouping 3 13: Slave axis grouping 3
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>10651</b>	<b>[Channel %1: ] Gantry configuration error. Error code %2</b>
<b>Parameters:</b>	%1 = Channel number %2 = Reason
<b>Definitions:</b>	The gantry configuration set in the machine data is erroneous. Gantry unit and reason for objection can be found in the transfer parameter. The transfer parameter is made up as follows. - %2 = error designation + gantry unit (XX). - %2 = 10XX => no master axis declared - %2 = 20XX => no slave axis declared - %2 = 30XX => different contents in MD30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN slave axis and master axis - %2 = 40XX => different channel or NCU assignment of the gantry axes - %2 = 50XX => no slave axis declared in this channel

- %2 = 60XX => different channel assignment of the master axis
  - %2 = 10000 => error: slave axis is geometry axis
  - %2 = 11000 => error: competing positioning axis as slave axis
  - %2 = 12000 => error: compile cycle axis as slave axis
  - %2 = 13000 => error: gantry axis is spindle
  - %2 = 14000 => error: gantry axis is Hirth geared
- e.g. error code 1001 = no master axis declared, gantry unit 1.

**Reaction:** NC not ready.  
 Mode group not ready, also effective for single axes.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Correct the machine data:  
 MD37100 \$MA\_GANTRY\_AXIS\_TYPE  
 0: No gantry axis  
 1: Master axis grouping 1  
 11: Slave axis grouping 1  
 2: Master axis grouping 2  
 12: Slave axis grouping 2  
 3: Master axis grouping 3  
 13: Slave axis grouping 3

**Program Continuation:** Switch control OFF - ON.

**10652 [Channel %1: ] Axis %2 gantry warning threshold exceeded**

**Parameters:** %1 = Channel number  
 %2 = Axis

**Definitions:** The gantry following axis has exceeded the warning limit specified in MD37110  
 \$MA\_GANTRY\_POS\_TOL\_WARNING.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 1. Check axis (uneven mechanical movement?)  
 2. MD not set correctly (MD37110 \$MA\_GANTRY\_POS\_TOL\_WARNING). Changes to this MD take effect after a RESET.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**10653 [Channel %1: ] Axis %2 gantry error threshold exceeded**

**Parameters:** %1 = Channel number  
 %2 = Axis

**Definitions:** The gantry following axis has exceeded the error limit (actual value tolerance) specified in MD37120  
 \$MA\_GANTRY\_POS\_TOL\_ERROR.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
 1. Check axis (uneven mechanical movement?)  
 2. MD not set correctly (MD37120 \$MA\_GANTRY\_POS\_TOL\_ERROR). A POWER ON is necessary after modifying the MD.  
 If the axes are not yet referenced, MD37130 \$MA\_GANTRY\_POS\_TOL\_REF is the trigger condition for the error message.



**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### 10654 **[Channel %1: ] Waiting for synchronization start of gantry group %2**

**Parameters:** %1 = Channel number  
 %2 = Gantry unit

**Definitions:** The alarm message appears when the axes are ready for synchronization. The gantry grouping can now be synchronized. The actual value difference between the master and slave axes is greater than the gantry warning limit MD 37110 \$MA\_GANTRY\_POS\_TOL\_WARNING. The synchronization must be started explicitly with the NC/PLC interface signal DB31, ... DBX29.4 (Start gantry synchronization).

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 See Function Manual, Special Functions, Gantry Axes (G1)

**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

### 10655 **[Channel %1: ] Synchronization of gantry group %2 in progress**

**Parameters:** %1 = Channel number  
 %2 = Gantry unit

**Definitions:** The alarm may be suppressed with MD37150 \$MA\_GANTRY\_FUNCTION\_MASK Bit2 = 1.

**Reaction:** Alarm display.

**Remedy:** --

**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

### 10656 **[Channel %1: ] Axis %2 gantry slave axis dynamically overloaded**

**Parameters:** %1 = Channel number  
 %2 = Axis

**Definitions:** The indicated gantry slave axis is dynamically overloaded, i.e. the slave axis cannot follow the master axis dynamically

**Reaction:** Mode group not ready.  
 Local alarm reaction.  
 Channel not ready.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Compare the axial machine data of the gantry slave axis with the data of the gantry master axis

**Program** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.  
**Continuation:**

### 10657 **[Channel %1: ] Axis %2 power OFF in the gantry error limit exceeded status**

**Parameters:** %1 = Channel number  
 %2 = Axis

**Definitions:** Gantry error limit exceeded status (alarm 10653) has been switched off.  
The error can only be removed by deleting MD37135 \$MA\_GANTRY\_ACT\_POS\_TOL\_ERROR or by deactivating the extended monitoring (MD37150 \$MA\_GANTRY\_FUNCTION\_MASK Bit0).

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
1. Remove a mechanical misalignment  
2. Check axis (uneven mechanical movement?)  
3. Delete MD37135 \$MA\_GANTRY\_ACT\_POS\_TOL\_ERROR or deactivate the extended monitoring  
4. MD37120 \$MA\_GANTRY\_POS\_TOL\_ERROR is set incorrectly  
If the MD is changed, a Power ON will be required.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10658 [Channel %1: ] Axis %2 impermissible axis status %3.**

**Parameters:** %1 = Channel number  
%2 = Axis number  
%3 = Error ID and gantry unit.

**Definitions:** Error ID and gantry unit  
- 30XX => Gantry group cannot be closed, as not all gantry axes are in one channel.  
- 40XX => Gantry group cannot be closed, as the gantry axes have different axis states (the axis is assigned to the PLC, for example).  
- 50XX => Gantry group is to change channel due to a PLC request, not all gantry axes are known in the new channel.  
- 60XX => Gantry group is to be transferred to the channel due to an NC program request, but the channel does not know all the gantry axes.  
- 70XX => Gantry group cannot be closed, as movement is pending for at least one gantry axis.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Local alarm reaction.

**Remedy:** Error ID:  
- 30XX => assign all gantry axes to the current channel, for example via axis exchange.  
- 40XX => set all axes of the gantry group to the same axis state, for example assign all axes to the NC program, or assign all axes to the PLC.  
- 50XX => make all gantry axes known to the required channel.  
- 60XX => make all gantry axes known to the required channel.  
:end

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10700 [Channel %1: ] Block %2 NCK protection zone %3 violated during automatic or MDI mode**

**Parameters:** %1 = Channel number  
%2 = Block number  
%3 = Protection zone number

**Definitions:** The workpiece-related NCK protection zone has been violated. Note that another tool-related protection zone is still active. The workpiece-related protected area can be traversed after a new NC Start.

**Reaction:** Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Protection zone can be traversed after a new NC Start.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10701 [Channel %1: ] Block %2 channel-specific protection zone %3 violated during automatic or MDI mode**

**Parameters:** %1 = Channel number  
 %2 = Block number  
 %3 = Protection zone number

**Definitions:** The workpiece-related channel-specific protection zone has been violated. Note that another tool-related protection zone is still active. The workpiece-related protected area can be traversed after a new NC Start.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Protection zone can be traversed after a new NC Start.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10702 [Channel %1: ] NCK protection zone %2 violated during manual mode**

**Parameters:** %1 = Channel number  
 %2 = Protection zone number

**Definitions:** The workpiece-related NCK protection zone has been violated. Note that another tool-related protection zone is still active. The workpiece-related protected area can be traversed after a new NC Start.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Protection zone can be traversed after a new NC Start.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

**10703 [Channel %1: ] Channel-specific protection zone %2 violated during manual mode**

**Parameters:** %1 = Channel number  
 %2 = Protection zone number

**Definitions:** The workpiece-related channel-specific protection zone has been violated. Note that another tool-related protection zone is still active. The workpiece-related protected area can be traversed after a new NC Start.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Protection zone can be traversed after a new NC Start.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

**10704 [Channel %1: ] Block %2 protection zone monitoring is not guaranteed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** New movements of a geometry axis which have been added could not be allowed for at the time of block preparation. It is therefore not certain that the protection zones will not be violated. This is just a warning message without further reactions.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Take other measures to ensure that the geometry axes motion, including the additional motion, does not violate the protection zones. (The warning comes nevertheless) or exclude additional motions.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10706 [Channel %1: ] NCK protection zone %2 reached with axis %3 during manual mode**

**Parameters:** %1 = Channel number  
%2 = Protection zone number  
%3 = Axis name

**Definitions:** The workpiece-related NCK protection zone has been reached with the specified axis. Note that another tool-related protection zone is still active. The workpiece-related protection zone can be traversed when the PLC has issued an enable signal.

**Reaction:** Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Protection zone can be traversed after enable signal from PLC.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10707 [Channel %1: ] Channel-specific protection zone %2 reached with axis %3 during manual mode**

**Parameters:** %1 = Channel number  
%2 = Protection zone number  
%3 = Axis name

**Definitions:** The workpiece-related channel-specific protection zone has been reached with the specified axis. Note that another tool-related protection zone is still active. The workpiece-related protection zone can be traversed when the PLC has issued an enable signal.

**Reaction:** Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Protection zone can be traversed after enable signal from PLC.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**10710 [Channel %1: ] Block %2 conflict with centerless grinding**

**Parameters:** %1 = Channel number  
%2 = Spindle number

---

<b>Definitions:</b>	Centerless grinding is active and a block has been processed that satisfies at least one of the following conditions: - G96 active and regulating spindle is master spindle. - Regulating spindle is in interdependent grouping. - Axes of centerless transformation overlap with an active transformation and a tool is active. - Constant wheel peripheral speed for the regulating spindle is active.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 10720 [Channel %1: ] Block %3 axis %2 software limit switch %4

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String (+ or -)
<b>Definitions:</b>	The path programmed for the axis violates the currently valid software limit switch. The alarm is activated when preparing the part program block. If bit 11=0 in the machine data MD11411 \$MN_ENABLE_ALARM_MASK, this alarm is issued instead of alarm 10722. If bit 11 is set in the machine data MD11411 \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check and correct positions in the NC program. Please inform the authorized personnel/service department. Check machine data: MD36100 \$MA_POS_LIMIT_MINUS / MD36120 \$MA_POS_LIMIT_MINUS2 and MD36110 \$MA_POS_LIMIT_PLUS / MD36130 \$MA_POS_LIMIT_PLUS2 for the software limit switches. Check the axis-specific interface signals: DB31, ... DBX12.3 / 12.2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected. Check the currently active work offsets via the current frame. Work offsets, overlaid movements (\$AA_OFF), DRF and transformation components must also be checked.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10721 [Channel %1: ] Block %3 axis %2 software limit switch %4

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String ( + or - )
<b>Definitions:</b>	The motion planned for the axis violates the currently valid software limit switch. The alarm is activated during the preprocessing of approach or rest blocks for REPOS. Depending on MD11411 \$MN_ENABLE_ALARM_MASK, bit11=0 this alarm is output instead of alarm 10723. If this MD11411 \$MN_ENABLE_ALARM_MASK, bit11 is set in this machine data \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI. See also the Diagnostics Manual for alarm 10723.
<b>Reaction:</b>	Local alarm reaction. Interface signals are set. Alarm display.

**Remedy:** Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs.  
 Check the axis-specific NC/PLC interface signals DB31, ... DBX12.3 / 12.2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected.  
 Check the currently active work offset via the current frame.  
 Also check the external work offsets, overlaid movements (\$AA\_OFF), DRF and transformation components.  
 Cancel the NC program with NC reset.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10722 [Channel %1: ] Block %5 axis %2 software limit switch %6 violated, residual distance: %7 %3<ALUN> violated**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Unit of distance  
 %4 = Block number, label|number+string(+/-)|residual distance

**Definitions:** The path programmed for the axis violates the currently valid software limit switch. The alarm is activated when preparing the part program block.  
 This alarm is issued instead of alarm 10720 if bit 11=1 in the MD11411 \$MN\_ENABLE\_ALARM\_MASK. Alarm 10722 offers an expanded diagnostics option for the software limit switch violation. The condition for activation is the presence of the ALUN\* alarm file in the HMI.  
 See also diagnostics guide for alarm 10720.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check and correct positions in the NC program.  
 Please inform the authorized personnel/service department.  
 Machine data: MD36100 \$MA\_POS\_LIMIT\_MINUS/MD36120 \$MA\_POS\_LIMIT\_MINUS2 and MD36110 \$MA\_POS\_LIMIT\_PLUS/MD36130 \$MA\_POS\_LIMIT\_PLUS2 must be checked for the software limit switches.  
 Check the axis-specific interface signals: DB31, ... DBX12.3 / 12.2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected.  
 Check currently active work offsets via the current frame.  
 Work offsets, overlaid movements (\$AA\_OFF), DRF and transformation components must also be checked.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10723 [Channel %1: ] Block %5 axis %2 software limit switch %6 violated, residual distance: %7 %3<ALUN>**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Unit of distance  
 %4 = Block number, label|number+string(+/-)|residual distance

**Definitions:** The motion planned for the axis violates the currently active software limit switch.  
 The alarm is activated during the preprocessing of approach or rest blocks for REPOS.  
 This alarm is issued instead of alarm 10721 if bit11=1 in MD11411 \$MN\_ENABLE\_ALARM\_MASK. Alarm 10723 offers an expanded diagnostics option for the software limit switch violation. The condition for activation is the presence of the ALUN\* alarm file in the HMI.  
 See also the Diagnostics Manual for alarm 10721.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

<b>Remedy:</b>	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Please inform the authorized personnel/service department. Check the MD36100 \$MA_POS_LIMIT_MINUS / MD36120 \$MA_POS_LIMIT_MINUS2 and MD36110 \$MA_POS_LIMIT_PLUS / MD36130 \$MA_POS_LIMIT_PLUS2 for the software limit switches. Check the axis-specific interface signals DB31, ... DBX12.3 / 12.2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel the NC program with NC reset.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

### 10730 [Channel %1: ] Block %3 axis %2 working area limitation %4

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String (+ or -)
<b>Definitions:</b>	This alarm is generated if it is determined during block preparation that the programmed path of the axis violates the working area limitation. If bit 11=0 in machine data MD11411\$MN_ENABLE_ALARM_MASK, this alarm is issued instead of alarm 10732. If bit 11 is set in machine data MD11411 \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	a) Check NC program for correct positional data and, if necessary, make corrections. b) Check zero offsets (current frame) c) Correct working area limitation via G25/G26, or d) Correct working area limitation via setting data, or e) Deactivate working area limitation via setting data 43410 WORKAREA_MINUS_ENABLE=FALSE
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

### 10731 [Channel %1: ] Block %3 axis %2 working area limitation %4

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String ( + or - )
<b>Definitions:</b>	The motion planned for the axis violates the currently active working area limit. The alarm is activated during the preparation of approach or rest blocks for REPOS. This alarm is issued instead of alarm 10733 if bit 11 is not set in MD11411 \$MN_ENABLE_ALARM_MASK.
<b>Reaction:</b>	Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel NC program with NC reset.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**10732**            **[Channel %1: ] Block %5 axis %2 working area limitation violated, residual distance: %6 %3<ALUN>**

**Parameters:**        %1 = Channel number  
                          %2 = Axis name, spindle number  
                          %3 = Unit of distance  
                          %4 = Block number, label|residual distance

**Definitions:**        This alarm is generated if it is determined during block preprocessing that the programmed path of the stated axis violates the working area limitation.  
                          If MD11411 \$MN\_ENABLE\_ALARM\_MASK, bit11=1, this alarm is issued instead of alarm 10730. Alarm 10732 offers an expanded diagnostics option for the working area limitation violation. The condition for activation is the presence of the ALUN\* alarm file in the HMI.

**Reaction:**            Correction block is reorganized.  
                          Local alarm reaction.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             a) Check NC program for correct positional data and, if necessary, make corrections.  
                          b) Check zero offsets (current frame)  
                          c) Correct working area limitation via G25/G26, or  
                          d) Correct working area limitation via setting data, or  
                          e) Deactivate working area limitation via SD43410 \$SA\_WORKAREA\_MINUS\_ENABLE=FALSE

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**10733**            **[Channel %1: ] Block %5 axis %2 working area limitation violated, residual distance: %6 %3<ALUN>**

**Parameters:**        %1 = Channel number  
                          %2 = Axis name, spindle number  
                          %3 = Unit of distance  
                          %4 = Block number, label|residual distance

**Definitions:**        The motion planned for the axis violates the currently active working area limitation.  
                          The alarm is activated during the preparation of approach or rest blocks for REPOS.  
                          This alarm is issued instead of alarm 10731 if bit11=1 in MD11411 \$MN\_ENABLE\_ALARM\_MASK. Alarm 10733 offers an expanded diagnostics option for the working area limitation violation. The condition for activation is the presence of the ALUN\* alarm file in the HMI.

**Reaction:**            Local alarm reaction.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs.  
                          Check the currently active work offset via the current frame.  
                          Also check the external work offsets, overlaid movements (\$AA\_OFF), DRF and transformation components.  
                          Cancel NC program with NC reset.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**10735**            **[Channel %1: ] Block %5 axis %2 coordinate system-specific working area limitation violated, residual distance: %6 %3<ALUN>**

**Parameters:**        %1 = Channel number  
                          %2 = Axis name, spindle number  
                          %3 = Unit of distance  
                          %4 = Block number, label|residual distance



---

<b>Definitions:</b>	This alarm is generated if it is determined during block preparation that the programmed path of the stated axis violates the coordinate system-specific working area limitation.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	a) Check NC program for correct positional data and, if necessary, make corrections. b) Check work offsets (current frame) c) Correct the working area limitation with WALCS1 ... WALCS9, or d) Correct the working area limitation in \$P_WORKAREA_CS_LIMIT_PLUS or \$P_WORKAREA_CS_LIMIT_MINUS, or e) Deactivate the working area limitation with \$P_WORKAREA_CS_MINUS_ENABLE =FALSE or \$P_WORKAREA_CS_PLUS_ENABLE. In cases d) and e), then reactivate the group of the selected coordinate system-specific working area limitation.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10736</b>	<b>[Channel %1: ] Block %5 axis %2 coordinate system-specific working area limitation violated, residual distance: %6 %3&lt;ALUN&gt;</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label residual distance
<b>Definitions:</b>	This alarm is generated if it is determined during block preparation that the programmed path of the stated axis violates the coordinate system-specific working area limitation. The alarm is activated during the preparation of approach or residual blocks for REPOS.
<b>Reaction:</b>	Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel NC program with NC reset.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>10740</b>	<b>[Channel %1: ] Block %2 too many empty blocks in WAB programming</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	It is not allowed to program more blocks than specified by MD20202 \$MC_WAB_MAXNUM_DUMMY_BLOCKS between the WAB block and the block determining the approach and retraction tangent.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10741 [Channel %1: ] Block %2 direction reversal with WAB infeed motion**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A safety distance which has been programmed is located perpendicular to the machining plane and not between the start and end point of the WAB contour.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10742 [Channel %1: ] Block %2 WAB distance invalid or not programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Possible causes:  
In a WAB block, the parameter DISR has not been specified or its value is less than or equal to 0.  
During approach or retraction with circle and active tool radius, the radius of the internally generated - WAB contour is negative. The internally generated WAB contour is a circle with a radius which, when offset with the current offset radius (sum of tool radius and offset value OFFN), yields the tool center point path with the programmed radius DISR.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10743 [Channel %1: ] Block %2 WAB programmed several times**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An attempt has been made to activate a WAB motion before a previously activated WAB motion was terminated.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10744 [Channel %1: ] Block %2 no valid WAB direction defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

<b>Definitions:</b>	The tangent direction for smooth approach or retraction is not defined. Possible causes: In the program, no block with travel information follows the approach block. Before a retraction block, no block with travel information has been programmed in a program. The tangent to be used for WAB motion is vertical to the current machining plane.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10745 [Channel %1: ] Block %2 WAB end position not clear

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In the WAB block and in the following block, the position has been programmed perpendicular to the machining direction. In the WAB block, no position has been indicated in the machining plane.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program. Either remove the position data for the infeed axis from the WAB block or the following block, or program a position in the machining plane in the WAB block as well.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10746 [Channel %1: ] Block %2 block search stop for WAB

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A preprocessing stop has been inserted between an SAR approach block and the following block defining the tangent direction or between an SAR retraction block and the following block defining the end position.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10747 [Channel %1: ] Block %2 retraction direction not defined for WAB

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** In a WAB retraction block with quarter circle or semi-circle (G248 or G348), the end point in the machining plane was not programmed, and either G143 or G140 without tool radius compensation is active.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program. The following changes are possible:  
- Indicate end point in the machining plane in the WAB block.  
- Activate tool radius compensation (effective for G140 only, not for G143).  
- State retraction side explicitly with G141 or G142.  
- Perform retraction with a straight line instead of a circle.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10748 [Channel %1: ] Block %2 illegal retract plane with WAB**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** By means of DISRP a position of the retraction plane has been programmed which is not situated between the safety distance (DISCL) and the starting point (during approach) and/or end point (during retraction) of the WAB movement.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10750 [Channel %1: ] Block %2 tool radius compensation activated without tool number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A tool T... must be selected so that the control can make allowance for the associated compensation values. A correction data block (D1) containing the correction values (parameter P1 - P25) is automatically assigned to each tool (T number). Up to 9 correction data blocks can be assigned to a tool by specifying the required data block with the D number (D1 - D9).  
The cutter radius compensation (CRC) is allowed for if function G41 or G42 is programmed. The correction values are contained in parameter P6 (geometry value) and P15 (wear value) of the active correction data block Dx.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Before calling the CRC with G41/G42, program a tool number under the address T...

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10751 [Channel %1: ] Block %2 danger of collision due to tool radius compensation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

<b>Definitions:</b>	The "Bottleneck detection" (calculation of intersection for the following compensated traversing blocks) has not been able to calculate a point of intersection for the reviewed number of traversing blocks. It is therefore possible that one of the equidistant paths violates the workpiece contour.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check the part program and, if possible, modify the programming so that inside corners with smaller paths than the correction value are avoided. (Outside corners are not critical because the equidistants are lengthened or intermediate blocks are inserted, so that there is always a point of intersection). Increase the number of reviewed traversing blocks via machine data MD20240 \$MC_CUTCOM_MAXNUM_CHECK_BLOCKS (default: 3), this increases the amount of calculation and consequently also the block cycle time.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10752</b>	<b>[Channel %1: ] Block %2 overflow of local block buffer with tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The cutter radius compensation must buffer a variable number of intermediate blocks in order to enable calculation of the equidistant tool path for each NC block. The size of the buffer cannot be determined by simple means. It depends on the number of blocks without traversing information in the compensation plane, the number of contour elements to be inserted and the shape of the curvature in spline and polynomial interpolation. The size of the buffer is fixed by the system and cannot be changed via the MDs.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Reduce the size of the buffer that has been assigned by modifying the NC program. - By avoiding: - Blocks without traversing information in the compensation plane - Blocks with contour elements having a variable curvature (e.g. ellipses) and with curvature radii that are smaller than the compensation radius. (Such blocks are divided up into several subblocks). - Reduce the number of reviewed blocks for collision monitoring (MD20240 \$MC_CUTCOM_MAXNUM_CHECK_BLOCKS).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10753</b>	<b>[Channel %1: ] Block %2 selection of the tool radius compensation only possible in linear block</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Selection of tool radius compensation with G41/G42 may only be performed in blocks where the G function G00 (rapid traverse) or G01 (feed) is active. In the block with G41/G42, at least one axis in the plane G17 to G19 must be written. It is always advisable to write both axes because, as a rule, both axes are traversed when selecting the compensation.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.

**Remedy:** Correct the NC program and put the compensation selection in a block with linear interpolation.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10754 [Channel %1: ] Block %2 deselection of the tool radius compensation only possible in linear block**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Deselection of tool radius compensation with G40 can only be performed in blocks where the G function G00 (rapid traverse) or G01 (feed) is active.  
 In the block with G40, at least one axis in the plane G17 to G19 must be written. It is always advisable to write both axes because, as a rule, both axes are traversed when deselecting the compensation.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Correct the NC program and put the compensation selection in a block with linear interpolation.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10755 [Channel %1: ] Block %2 selection of the tool radius compensation via KONT not possible at the current starting point**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When activating the cutter radius compensation with KONT the starting point of the approach block is within the compensation circle and therefore already violates the contour.  
 If the cutter radius compensation is selected with G41/G42, the approach behavior (NORM or KONT) determines the compensation movement if the present actual position is behind the contour. With KONT, a circle is drawn with the cutter radius around the programmed initial point (= end point of the approach block). The tangent that passes through the current actual position and does not violate the contour is the approach movement.  
 If the start point is within the compensation circle around the target point, no tangent passes through this point.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Place selection of the CRC such that the starting point of the approach movements comes to rest outside of the correction circle around the target point (programmed traversing movements > compensation radius). The following possibilities are available:  
 Selection in the previous block  
 Insert intermediate block  
 Select approach behavior NORM

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10756 [Channel %1: ] Block %2 deselection of the tool radius compensation via KONT not possible at the programmed end point**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	On deselection of the cutter radius compensation, the programmed end point is within the compensation circle. If this point were in fact to be approached without compensation, there would be a contour violation. If the cutter radius compensation is deselected via G40, the approach behavior (NORM or KONT) determines the compensation movement if the programmed end point is behind the contour. With KONT, a circle is drawn with the cutter radius about the last point at which the compensation is still active. The tangent passing through the programmed end position and not violating the contour is the retraction movement. If the start point is within the compensation circle around the target point, no tangent passes through this point.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Place deselection of the CRC such that the programmed end point comes to rest outside the compensation circle around the last active compensation point. The following possibilities are available: Deselection in the next block Insert intermediate block Select retract behavior NORM
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10757 [Channel %1: ] Block %2 changing the compensation plane while tool radius compensation is active not possible

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In order to change the compensation plane (G17, G18 or G19) it is first necessary to deselect the cutter radius compensation with G40.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Insert an intermediate block in the part program using the correction deselection. After the plane change, the cutter radius compensation is to be selected in an approach block with linear interpolation.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10758 [Channel %1: ] Block %2 curvature radius with variable compensation value too small

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The current cutter radius compensation (the cutter used) is too large for the programmed path radius. In a block with variable tool radius compensation, a compensation must be possible either anywhere or nowhere on the contour with the smallest and the largest compensation value from the programmed range. There must be no point on the contour in which the curvature radius is within the variable compensation range. If the compensation value varies its sign within a block, both sides of the contour are checked, otherwise only the compensation side.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Use smaller cutters or allow for a part of the cutter radius at the time of contour programming.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**10759 [Channel %1: ] Block %2 path is parallel to tool orientation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In a block with spline or polynomial interpolation, the corrected path runs in at least one point parallel to the tool orientation, i.e. the path has a tangent perpendicular to the compensation plane. The tangent at a point on a path is regarded as parallel to the tool orientation if the angle between the two directions is less than the limit value defined by MD21080 \$MC\_CUTCOM\_PARALLEL\_ORI\_LIMIT. However, in circumferential milling, straight lines running parallel to the tool orientation are permissible, as well as circles with a circle plane perpendicular to the compensation plane (application with smooth retraction from the groove).  
Straight lines in the direction of the tool orientation are not permissible in face milling (CUT3D, CUT3DF, CUT3DFS).

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Do not use splines or polynomials when writing the contour section, but straight lines and circles instead. Divide up the tool piece geometry and deselect the cutter radius compensation between the various sections.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10760 [Channel %1: ] Block %2 helical axis is not parallel to tool orientation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With active tool radius compensation a helix is only permissible if the helix axis is parallel to the tool, i.e. the circle plane and the compensation plane must be identical.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Orient helix axis perpendicular to the machining plane.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10761 [Channel %1: ] Block %2 tool radius compensation for ellipse with more than one revolution not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When machining the inside of an ellipse, in parts of the ellipse the curvature radii are greater than or smaller than the cutter radius compensation. In ellipses, in this case the block would be split up into 4 subblocks with curvature radii that are greater than and less than the compensation radius. Over several revolutions, there would be a tremendous increase in the amount of calculation required by the unlimited number of resulting subblocks, and therefore this situation is rejected by the error message.  
If compensation is possible everywhere or nowhere on the ellipse, then ellipses are also permissible that cover more than one full revolution.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.



**Remedy:** Use cutter with smaller radius or program motion block on blocks with no more than one revolution.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10762 [Channel %1: ] Block %2 too many empty blocks between two traversing blocks with active tool radius compensation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The maximum permissible number of empty blocks is limited by a machine data.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** - Modify part program  
 - Modify machine data  
 - Check whether SBL2 is activated. With SBL2, a block is generated from each part program line which can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**10763 [Channel %1: ] Block %2 path component of the block in the compensation plane becomes zero**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Due to collision monitoring with active tool radius compensation, the path component of the block in the compensation plane becomes zero. If the original block contains no motion information perpendicular to the compensation plane, it means that this block is excluded.  
 The alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit1 = 1.

**Reaction:** Alarm display.

**Remedy:** - The behavior is correct at narrow locations that cannot be machined with the active tool.  
 - Modify the part program if necessary.  
 - Use tool with smaller radius if necessary.  
 - Program CDOF/CDOF2.

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

**10764 [Channel %1: ] Block %2 discontinuous path with active tool radius compensation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** This alarm occurs when, with active tool radius compensation, the starting point used for calculating the compensation is not identical to the end point of the preceding block. This situation can occur, for example, when a geometry axis is traversed between two positions as a positioning axis or when, with an active kinematic transformation (e.g. 5-axis transformation) the tool length compensation is altered.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10765 [Channel %1: ] Block %2 3D tool radius compensation not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** This alarm occurs when an attempt is made to activate the 3D tool radius compensation even though the option required for this is not fitted in the control.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** The option cannot be activated by altering machine data because the necessary code is not physically available.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10766 [Channel %1: ] Illegal change of surface orientation between block %2 and block %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Block number, label

**Definitions:** This alarm occurs with 3D face milling when, at the time of block transition, the surface defined in the first block is continued in the second block with the rear side of the surface defined there. The block number in the alarm designates the second block.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10767 [Channel %1: ] Block %2 processing with tilt angle unequal 0 not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When face milling with a torus milling cutter, the tilt angle must be 0 if the surface normal vector and the tool orientation include an angle that is less than the limiting angle given by the MD21082 \$MC\_CUTCOM\_PLANE\_ORI\_LIMIT, i.e. in this case only the lead angle may be unequal to 0.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program. If necessary, use another tool (ball end mill).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

<b>10768</b>	<b>[Channel %1: ] Block %2 illegal tool orientation with 3D tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm may occur during 3D face milling: the angle between the surface normal vector of the surface to be machined and the largest surface normal vector of the tool surface is smaller than the limit value given by MD21080 \$MC_CUTCOM_PARALLEL_ORI_LIMIT, or the tool is oriented such that machining would have to be performed from the rear side of the surface. In this case, the largest surface normal vector is the vector the direction of which deviates most from the direction in the tool point (i.e. parallel to the tool longitudinal axis). With cylindrical tools or tools which end in a cylindrical part (e.g. the standard torus milling cutter), this vector is positioned perpendicular to the tool vector. For this type of tool, the alarm indicates that the angle between the tool longitudinal axis of, for example an envelope line of the cylinder, and the surface to be machined is smaller than the minimum permissible value. With tools the (valid) surface of which ends in a tapered part instead of a cylindrical part (e.g. a beveled cutter or a torus milling cutter where the torus is defined to be smaller than 90 degrees), this alarm indicates that the angle between an envelope line of the taper and the surface to be machined is smaller than the minimum permissible value.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program. If necessary, use another tool.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>10769</b>	<b>[Channel %1: ] Block %2 Illegal surface normal vector with 3D tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In 3D face milling, surface normal vector and path tangent vector must theoretically be perpendicular to one another, i.e. they must be at 90° to one another. Since both vectors can be programmed independently of each other, deviations from this angle are possible and allowed. This alarm is generated when the angle between surface normal vector and path tangent vector becomes less than the limit angle given by the MD21084 \$MC_CUTCOM_PLANE_PATH_LIMIT.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>10770</b>	<b>[Channel %1: ] Block %2 change of corner type due to change of orientation with active tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** The type of a corner (inside or outside corner) depends not only on the programmed path but also on the tool orientation. For this purpose, the programmed path is projected in the plane perpendicularly to the actual tool orientation and the corner type is determined there. If a change in orientation is programmed (in one or several blocks) between two traversing blocks, resulting in the type of corner at the end of the first traversing block being different from that at the start point of the second block, the above error message is issued.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10771 [Channel %1: ] Block %2 overflow of local block buffer due to orientation smoothing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** This error occurs when more blocks must be buffered than memory space is available.  
This error can only occur when the software has been incorrectly configured.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase size of local buffer area.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10772 [Channel %1: ] Block %2 illegal orientation change when activating or deactivating 3D face cutting**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In face milling, no intermediate blocks with pure orientation change are allowed between the activation block and the first correction block or between the last correction block and the deactivation block (3D tool radius compensation).

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10773 [Channel %1: ] Illegal tool orientation in block %2 at inside corner with block %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Block number, label

---

<b>Definitions:</b>	On inside corners, the path of the traversing blocks concerned is reduced but the orientation change originally programmed in the block is retained and is now carried out in synchronism with the shortened path. Because of the ensuing changed relationship between path tangent, surface normal and tool orientation, singular points or points with impermissible side angle can occur in 3D face milling. This is not allowed.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10774 [Channel %1: ] Illegal tool dimensions with face cutting in block %2

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm occurs when illegal tool dimensions are programmed for face milling, e.g. negative tool radius, rounding radius zero or negative for tool types that require a rounding radius, taper angle zero or negative for tapered tools.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10775 [Channel %1: ] Illegal tool change with face cutting in block %2

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm occurs when a tool change has been programmed while 3D tool radius compensation is active with the result that the tool type changes or, if the tool type remains unchanged, at least one relevant tool dimension has changed as compared with the deselected tool. Depending on the tool type, relevant tool dimensions can be the tool diameter, the rounding radius or the taper angle. Changes to the tool length are allowed.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 10776 [Channel %1: ] Block%2 axis %3 must be geometry axis if tool radius compensation is active

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
--------------------	---

**Definitions:** This alarm occurs when an axis that is required for tool radius compensation is not a geometry axis. With CUT2DF, the axis can be a positioning axis perpendicular to the machining plane; with all other types of compensation (CUT2DF, CUT3DC, CUT3DF, CUT3DFF), all geometry axes must be operated as such.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.  
On selection of G41/42, the axes involved must be known as GEOAX in the channel. It is possible by programming GEOAX() or G91 G0 X0 Y0 in the block prior to G41/42.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10777 [Channel %1: ] Block %2 tool radius compensation: too many blocks with suppression of compensation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The maximum permissible number of blocks with active compensation suppression with tool radius compensation is limited by MD20252 \$MC\_CUTCOM\_MAXNUM\_SUPPR\_BLOCKS.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** - Modify part program.  
- Modify machine data.  
- Check whether SBL2 is activated. With SBL2, a block is generated from each part program line which can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10778 [Channel %1: ] Block %2 preprocessing stop with active tool radius compensation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** If a preprocessing stop is detected with active tool radius compensation (either programmed by the user or generated internally) and the SD42480 \$SC\_STOP\_CUTCOM\_STOPRE is set, then this warning is issued because in this situation machine movements which were not intended by the user can occur (termination of radius compensation and new approach).

**Reaction:** Alarm display.  
NC Stop on alarm at block end.

**Remedy:** - Continue machining with CANCEL and Start.  
- Modify part program.  
- Set SD42480 \$SC\_STOP\_CUTCOM\_STOPRE to FALSE.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**10779 [Channel %1: ] Block %2 preprocessing stop with active tool radius compensation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

<b>Definitions:</b>	If a preprocessing stop is detected with active tool radius compensation (either programmed by the user or generated internally) and the SD42480 \$SC_STOP_CUTCOM_STOPRE is set, then this warning is issued because in this situation machine movements which were not intended by the user can occur (termination of radius compensation and new approach). To continue machining, activate the CANCEL key and perform a restart.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	- Continue machining with CANCEL and Start. - Modify part program. - Set SD42480 \$SC_STOP_CUTCOM_STOPRE to FALSE.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10780</b>	<b>[Channel %1: ] Block %2 impermissible change of a turning or grinding tool with active tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A tool change on which the edge offset (difference between edge center and edge reference point) changes, is only permissible in straight and polynomial blocks. It is impermissible in circular blocks, involute blocks and in blocks including rational polynomials with maximum permissible numerator and denominator degrees.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	- Continue machining with CANCEL and Start. - Modify part program. - Set SD42480 \$SC_STOP_CUTCOM_STOPRE to FALSE.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10781</b>	<b>[Channel %1: ] Block %2 illegal orientation of involute with tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Tool radius compensation is possible for involutes only if the compensation plane matches the involute plane.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>10782</b>	<b>[Channel %1: ] Block %2 illegal curve type with tool radius compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** This alarm occurs, if an attempt is made to apply the tool radius compensation to a curve type for which this function is not implemented. The only cause at present: Involute with 3D tool radius compensation.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10783 [Channel %1: ] Block %2 tool radius compensation type requires orientation transformation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** This alarm occurs, if an attempt is made to activate a tool radius compensation which must enable a tool orientation change and the `_Orientation transformation_` option is not available. This alarm can only occur if one of the following G code is active in the G code group 22:  
- CUT3DC  
- CUT3DCC  
- CUT3DCCD

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** - Modify part program  
- Install "Orientation transformation" option

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10784 [Channel %1: ] Block %2 illegal tool for tool radius compensation with constraint surface**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When activating the tool radius compensation with constraint surface, an illegal tool type is active. Only cutting tools of the tool types 1 to 399 are admitted with the following exceptions:  
- 111 ball end milling cutter  
- 155 torus milling cutter  
- 156 torus milling cutter  
- 157 torus milling cutter

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Use another tool.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

**10790 [Channel %1: ] Block %2 plane change during linear programming with angles**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The active plane was changed between the first and second subblock when programming two straight lines with angle parameters.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10791 [Channel %1: ] Block %2 invalid angle during linear programming**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	No intermediate point was found when programming a contour consisting of two straight lines and an angle specification.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10792 [Channel %1: ] Block %2 illegal interpolation type during linear programming with angles**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Only spline or linear interpolation is permitted for programming two straight lines with angle specification. Circular or polynomial interpolation is not allowed.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10793 [Channel %1: ] Block %2 second block missing during linear programming with angles**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** The second block is missing during programming of two straight lines with angle specification. This situation only occurs if the first subblock is also the last block of a program, or if the first subblock is followed by a block with a preprocessor stop.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10794 [Channel %1: ] Block %2 angle specification missing in 2nd block during linear interpolation with angles**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The angle is missing from the second block during programming of two straight lines with angle specification. This error can only occur if an angle was programmed in the preceding block, but no axis of the active plane was programmed in that block. The cause of the error may therefore also have been the intention to program a single straight line with an angle in the previous block. In this case, exactly one axis of the active plane must be programmed.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10795 [Channel %1: ] Block %2 end point specification during angle programming contradictory**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During programming of a straight line, both positions of the active plane and an angle were specified (the position of the end point is over-specified), or the position of the programmed coordinate cannot be reached with the specified angle. If a contour consisting of two straight lines is to be programmed with angles, it is possible to specify the two axis positions of the plane and an angle in the second block. The error can also occur if, due to a programming error, the preceding block cannot be interpreted as the first subblock of such a contour. A block is interpreted as the first block of a two-block contour if an angle, but not an axis of the active plane, was programmed, and if the block is not already the second block of a contour.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10800 [Channel %1: ] Block %3 axis %2 is not a geometry axis**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number, label

**Definitions:** With an active transformation or a frame with a rotation component the geometry axes are needed for block preparation. If a geometry axis has previously been traversed as positioning axis, it retains its status of "positioning axis" until it is again programmed as a geometry axis.  
 Because of the POSA motion beyond block boundaries, it is not possible to identify in the preprocessing run whether the axis has already reached its target position when the block is executed. This is, however, an unconditional requirement for calculating the ROT component of the frame or of the transformation.  
 If geometry axes are used as positioning axes, then:  
 1. No rotation may be specified in the current overall frame.  
 2. No transformation may be selected.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** After selecting transformation or frame, reprogram the geometry axis now operating as positioning axis (e.g. with WAITP) in order to revert the status to "geometry axis."

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10805 [Channel %1: ] Block %2 repositioning after switch of geometry axes or transformation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In the asynchronous subroutine the assignment of geometry axes to channel axes was changed or the active transformation modified.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10810 [Channel %1: ] Block %2 master spindle not defined**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The function "Revolutional feedrate" (with G95 or G96), or "Rigid tapping" (with G331/G332) has been programmed, although no master spindle is defined from which the speed could be derived.  
 For the definition the MD 20090 \$MC\_SPIND\_DEF\_MASTER\_SPIND is available for the default or the keyword SETMS in the part program, thus allowing each spindle of the channel to be redefined as master spindle.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Preset the master spindle with MD20090 \$MC\_SPIND\_DEF\_MASTER\_SPIND[n]=m (n ... channel index, m ... spindle no.) or define it with an identifier in an NC part program before a G function that requires a master spindle is programmed.  
 The machine axis that is to be operated as a spindle must be equipped in MD35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX[n]=m (n ... machine axis index, m ... spindle no.) with a spindle number. Additionally, the MD20070 \$MC\_AXCONF\_MACHAX\_USED[n]=m (n ... channel axis index, m ... machine axis index) must be used to assign it to a channel (channel axis index 1 or 2).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10820 [Channel %1: ] Rotary axis/spindle %2 not defined**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** Revolutional feed has been programmed for contouring and synchronous axes or for an axis/spindle. However, the rotary axis/spindle from which the feed is to be deduced is not available.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct part program or set the SD43300 \$SA\_ASSIGN\_FEED\_PER\_REV\_SOURCE correctly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10860 [Channel %1: ] Block %2 feedrate not programmed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Cause:  
 A traversing velocity has not been programmed for the displayed traversing block.  
 Feed F or FZ:  
 With the traversing velocity defined by feed F or FZ, F or FZ was not reprogrammed after the feed type changed, for example linear feed G94 after revolutional feedrate G95 F or G95 FZ.  
 Modal feed FRCM:  
 With modal traversing velocity FRCM defined for rounding RND or chamfering CHF, feed FRCM was not reprogrammed after the feed type changed, for example linear feed G94 after revolutional feedrate G95, or revolutional feedrate G95 F after tooth feedrate G95 FZ.  
 Note:  
 Feed FRCM also has to be reprogrammed when the feed type changes if the current traversing block does not contain chamfering CHF or rounding RND, but the feed FRCM was programmed active, that is unequal to 0, before the feed type changed.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program feedrate in accordance with the interpolation type.  
 - G93: The feedrate is specified as a time-reciprocal value under address F in [rev/min].  
 - G94 and G97: The feedrate is programmed under address F in [mm/min] or [m/min].  
 - G95: The feedrate is programmed as revolutional feedrate under address F in [mm/revolution] or under the address FZ in [mm/tooth].  
 - G96: The feedrate is programmed as cutting rate under address S in [m/min]. It is derived from the current spindle speed.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10861 [Channel %1: ] Block %3 velocity of positioning axis %2 is zero**

<b>Parameters:</b>	%1 = Channel number %2 = Axis %3 = Block number, label
<b>Definitions:</b>	No axis velocity has been programmed and the positioning velocity set in the machine data is zero.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Enter a different velocity in MD32060 \$MA_POS_AX_VELO.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10862 [Channel %1: ] Block %2 master spindle also used as path axis**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A contour has been programmed that also includes the master spindle as contouring axis. However, the velocity of the contour is derived from the rotational speed of the master spindle (e.g. G95).
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify the program so that no reference is possible to the program itself.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10865 [Channel %1: ] Block %2 FZ active, but no tool offset, tool %3**

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Tool
<b>Definitions:</b>	For the displayed traversing block a tooth feedrate is active, but no tool offset. Traversing can be performed after the error has been acknowledged. For calculation of the effective feedrate one tooth per revolution will be assumed.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Check the NC program for correct tool selection and correct it, if required; then continue the program with NC start. Or: Continue the NC program with NC start. For calculation of the effective feedrate one tooth per revolution is assumed.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**10866**                    **[Channel %1: ] Block %2 FZ is active, but the number of teeth of the active D number %4 of tool %3 is zero.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Identifier  
                               %4 = D number

**Definitions:**            Tooth feedrate is active for the displayed traversing block, but a D number of 0 is selected with \$TC\_DPNT (number of teeth).  
                               Traversing can be performed after acknowledgement of the error. For calculation of the effective feedrate one tooth per revolution is assumed.

**Reaction:**                Correction block is reorganized.  
                               Local alarm reaction.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.

**Remedy:**                 Check the NC program for correct tool selection and correct it, if required;  
                               then continue the NC program with NC start.  
                               Or:  
                               Continue the NC program with NC start. The feedrate will be calculated assuming 1 tooth.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**10870**                    **[Channel %1: ] Block %2 facing axis for constant velocity not defined**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            Constant cutting speed was selected although no transverse axis was applied as reference axis for constant cutting speed or assigned through SCC[AX].  
                               Constant cutting speed can be activated as follows:  
                               - Basic position G96, G961 or G962 of G group 29 during booting  
                               - Programming of G96, G961 or G962  
                               A reference axis for G96, G961 or G962 can be applied as a transverse axis in MD20100 \$MC\_DIAMETER\_AX\_DEF or defined through the instruction SCC[AX].

**Reaction:**                Correction block is reorganized.  
                               Local alarm reaction.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department. Check MD20100 \$MC\_DIAMETER\_AX\_DEF. Before programming G96, G961 or G962 a transverse axis must be defined as a reference axis for constant cutting speed via MD20100 \$MC\_DIAMETER\_AX\_DEF or SCC[AX].

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**10880**                    **[Channel %1: ] Block %2 too many empty blocks between two traversing blocks when inserting chamfers or radii**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

---

<b>Definitions:</b>	Between 2 blocks containing contour elements and which are to be joined with a chamfer or a radius (CHF, RND), more blocks without contour information have been programmed than provided for in the MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify the part program in order that the permissible number of dummy blocks is not exceeded or adapt the channel-specific machine data MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS (dummy blocks with chamfers/radii) to the maximum number of dummy blocks.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10881 [Channel %1: ] Block %2 overflow of local block buffer in the case of chamfers or radii

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Between 2 blocks containing the contour elements and to be joined with a chamfer or a radius (CHF, RND), so many dummy blocks have been programmed without contour information that the internal buffer is too small.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program such that the number of dummy blocks is reduced.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10882 [Channel %1: ] Block %2 activation of chamfers or radii (non-modal) without traversing movement in the block

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	No chamfer or radius has been inserted between 2 linear or circle contours (edge breaking) because: There is no straight line or circle contour in the plane There is a movement outside the plane A plane change has taken place The permissible number of empty blocks without traversing information (dummy blocks) has been exceeded.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Correct the part program according to the above error description or change the number of dummy blocks in the channel-specific MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS to comply with the maximum number allowed for in the program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10883 [Channel %1: ] Block %2 chamfer or fillet has to be reduced

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** This alarm is output, if at least one of the relevant blocks when inserting chamfers or radii is so short, that the contour element to be inserted must be reduced against its originally programmed value. The alarm occurs only if bit 4 is set in the MD11411 \$MN\_ENABLE\_ALARM\_MASK. Otherwise, the chamfer or radius is adapted without an alarm being output.

**Reaction:** Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify NC program of continue program without modifications after CANCEL and Start or with Start alone.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**10890 [Channel %1: ] Block %2 overflow of local block buffer when calculating splines**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The maximum permissible number of empty blocks is limited by a machine data.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** - Modify part program  
- Modify machine data  
- Check whether SBL2 is activated. With SBL2, a block is generated from each part program line which can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10891 [Channel %1: ] Block %2 multiplicity of node is greater than its order**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the B spline the distance between nodes PL (node = point on spline at which 2 polynomials meet) has been programmed with zero too often in succession (i.e. the "multiplicity" of a node is too great).  
In the quadratic B spline the node distance may not be specified more than twice with 0 in succession, and in the cubic B spline not more than 3 times.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the node distance PL = 0 in succession no more than the degree of the B spline used.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**10900 [Channel %1: ] Block %2 no S value programmed for constant cutting speed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** If G96 is active, the constant cutting speed under address S is missing.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.



---

<b>Remedy:</b>	Program constant cutting speed under S in [m/min] or deselect the function G96. For example, with G97 the previous feed is retained but the spindle continues to rotate at the current speed.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10910 [Channel %1: ] Block %2 irregular velocity waveform of one path axis

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	When the path axis waveforms were analyzed during block preparation, a large local deviation relative to the path velocity was detected in the velocity waveform of one or more path axes. Such a situation can have the following causes: <ul style="list-style-type: none"> <li>- The path runs close to singular positions of the machine kinematics.</li> <li>- The programmed contour characteristic is very uneven.</li> <li>- The FGROUP definition is unfavorable relative to the contour.</li> <li>- The setting MD28530 \$MC_MM_PATH_VELO_SEGMENTS=0 is inadequate for curvature changes occurring within one block. This problem occurs more frequently with G643, G644 and COMPCAD.</li> <li>- A kinematic transformation has been implemented with insufficient numerical accuracy.</li> </ul> The path velocity is generally reduced substantially in order to avoid axis overloads safely. An apparent machine standstill may occur. Severe axis movements occur suddenly as soon as the singular position is reached.
<b>Reaction:</b>	Alarm display. Warning display.
<b>Remedy:</b>	Dividing a block into several smaller ones often provides an improvement. If MD28530 \$MC_MM_PATH_VELO_SEGMENTS=0 is set, then the alarm may be avoidable by a value MD28530 \$MC_MM_PATH_VELO_SEGMENTS=3 or 5, as the blocks are then analyzed considerably more accurately.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 10911 [Channel %1: ] Block %2 transformation prohibits to traverse the pole

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The given curve passes through the pole of the transformation.
<b>Reaction:</b>	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 10912 [Channel %1: ] Block %2 preprocessing and main run might not be synchronized

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The preset positioning axis run cannot be accurately calculated beforehand. The reason for this is either that the axes involved in the transformation are traversed as positioning axes or that a transformation pole is circumnavigated too frequently by the curve. The velocity check is performed starting from this block in the main run. It is more conservative than with anticipated calculation. The LookAhead function is deactivated. If it is not possible to take over the velocity check into the main run, part program processing is aborted.
<b>Reaction:</b>	Alarm display.

**Remedy:** No action is usually necessary. The velocity control operates more effectively, however, if the part program is modified.  
 - If a transformation pole is circumnavigated several times by the curve, it helps to split up the block into smaller parts.  
 - If a positioning axis is the cause, you should check whether the axis can be traversed as a path axis. The Look Ahead function remains deactivated until preprocessing can be based on defined conditions again (e.g. as a result of change from JOG->AUTO, tool or tool edge change).

**Program Continuation:** Clear alarm with the Delete key or NC START.

**10913 [Channel %1: ] Block %2 negative feed profile is ignored**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The given feed profile is in part negative. However, negative path feed is not allowed. The feed profile is ignored. The specified feed block end value is taken when traversing over the entire block.

**Reaction:** Local alarm reaction.  
 Alarm display.

**Remedy:** No action is usually necessary. The alarm message indicates an error in the programming, however, and this should be corrected.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**10914 [Channel %1: ] Block %2: movement not possible while transformation active.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The machine kinematics does not allow the specified motion. Transformation-dependent error causes can be in: TRANSMIT: A (circular) area exists around the pole, where positioning is not possible. The area is caused by the fact that the tool reference point cannot be traversed as far as into the pole.  
 The area is defined by:  
 - the machine data (MD24920 \$MC\_TRANSMIT\_BASE\_TOOL..)  
 - the active tool length compensation (see \$TC\_DP..). Whether the tool length compensation is included in the calculation depends on the working plane selected (see G17,..).  
 - The machine stops before the faulty block.

**Reaction:** Interpreter stop  
 Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program. Change the incorrectly specified tool length compensation.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**10915 [Channel %1: ] Block %2 preparation problem in Look Ahead (module %3, identifier %4)**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Module identifier  
 %4 = Error code

---

<b>Definitions:</b>	The parameterized memory is inadequate to run Look Ahead in expansion mode.
<b>Reaction:</b>	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Change parameterization. Increase work memory. Use standard Look Ahead. Contact Siemens if necessary.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

---

**10916 [Channel %1: ] Block %2 preparation problem in Look Ahead (module %3, identifier %4)**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Module identifier %4 = Error code
<b>Definitions:</b>	The parameterized memory is inadequate to create an optimum path velocity profile. The profile created is not as smooth as it could be.
<b>Reaction:</b>	Local alarm reaction. Alarm display. Warning display.
<b>Remedy:</b>	Change parameterization, increase IPO buffer.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

---

**10930 [Channel %1: ] Block %2 interpolation type not allowed in stock removal contour**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The following types of interpolation are allowed in the contour program for stock removal: G00, G01, G02, G03, CIP, CT
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	In the contour subroutine, program only path elements that consist of straight lines and arcs.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

---

**10931 [Channel %1: ] Block %2 incorrect stock removal contour**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** The following errors occurred in the subroutine for the contour during stock removal:  
- Full circle  
- Overlapping contour elements  
- Wrong start position

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The errors listed above must be corrected in the subroutine for the stock removal contour.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10932 [Channel %1: ] Block %2 preparation of contour has been restarted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The first contour preparation/contour decoding run must be terminated with EXECUTE.

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the keyword EXECUTE to terminate the contour preparation in the part program before again calling up contour segmentation (keyword CONTPRON).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10933 [Channel %1: ] Block %2 contour programm does not contain enough contour blocks**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The contour program contains:  
- Less than 3 contour blocks with CONTPRON  
- No contour blocks with CONTDCON

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase the size of the program with the stock removal contour to include at least 3 NC blocks with movements in both axes of the current machining plane.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10934 [Channel %1: ] Block %2 array for contour segmentation is set too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During contour segmentation (activated with the keyword CONTPRON), the field for the contour table has been detected as too small. For every permissible contour element (circle or straight line) there must be a row in the contour table.

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Base the definition of the field variables of the contour table on the contour elements to be expected. The contour segmentation divides some NC blocks into as many as 3 machining cuts. Example: N100 DEF TABNAME\_1 [30, 11]  
Field variables for the contour table provide for 30 machining cuts. The number of columns (11) is a fixed quantity.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 10940 [Channel %1: ] Block %2 curve table %3: delete/overwrite not possible

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** The curve table can only be deleted if it is not active in a link.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** It is necessary to deactivate all links that are being used by the curve table to be deleted.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 10941 [Channel %1: ] Block %2: Curve table %3: NC SRAM memory full, type %4

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table  
%4 = Object type

**Definitions:** Insufficient free dynamic memory during curve table definition.  
The object type parameter specifies for which curve table object the memory will not suffice:  
1: Number of curve tables too small (MD18400 \$MN\_MM\_NUM\_CURVE\_TABS)  
2: Number of linear curve table segments too small (MD18403 \$MN\_MM\_NUM\_CURVE\_SEG\_LIN)  
3: Number of polynomial curve table segments too small (MD18402 \$MN\_MM\_NUM\_CURVE\_SEGMENTS)  
4: Number of curve table polynomials too small (MD18404 \$MN\_MM\_NUM\_CURVE\_POLYNOMS)

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel / service department. Delete curve tables that are no longer required, or reconfigure the memory space for the curve tables. The curve table definition process now has to be repeated; see machine data:  
MD18400 \$MN\_MM\_NUM\_CURVE\_TABS, MD18402 \$MN\_MM\_NUM\_CURVE\_SEGMENTS, MD18403 \$MN\_MM\_NUM\_CURVE\_SEG\_LIN,  
MD 18404 \$MN\_MM\_NUM\_CURVE\_POLYNOMS.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 10942 [Channel %1: ] Block %2 curve table %3: illegal instruction during definition

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** Various illegal command sequences cause the output of this alarm during the definition of the curve table. For example, it is impermissible to terminate definition of a curve table with M30 before programming the CTABEND command.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and start it again.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10943 [Channel %1: ] Block %2 curve table %3: direction reversal of lead value in the block not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** The conditions for converting a programmed contour to a curve table were not fulfilled in this block.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and start it again.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10944 [Channel %1: ] Block %2 curve table %3: illegal transformation**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** It is impermissible to use a transformation in a curve table if the leading axis or following axis programmed in CTABDEF is involved in the transformation. Exception: TRAANG.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct NC part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10945 [Channel %1: ] Block %2 curve table %3: illegal coupling of axes**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** It is not possible to program axis links for the leading axes and following axis programmed in CTABDEF.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct NC part program.

---

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**10946 [Channel %1: ] Block %2 curve table %3: no contour defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** No movement for the leading axis was programmed between CTABDEF and CTABEND. A curve table is not permitted without a contour.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and start it again.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**10947 [Channel %1: ] Block %2 curve table %3: contour not continuous**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** The contour in a curve table must be continuous. Incontinuity can occur, for example, as a result of activating a transformation.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and start it again.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**10948 [Channel %1: ] Block %2 curve table %3: position jump at end of period**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table

**Definitions:** A periodic curve table was defined in which the position of the following axis at the end of the table was different to the position at the start of the table.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and start it again.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**10949 [Channel %1: ] Block %2 curve table %3: missing master axis motion**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of curve table

**Definitions:** A slave axis motion has been programmed without a master axis motion.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the part program and start it again.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**10950 [Channel %1: ] Calculation of arc length function too inaccurate**

**Parameters:** %1 = Channel number

**Definitions:** The calculation of the arc length function could not be performed to the required accuracy.

**Reaction:** Alarm display.  
 Warning display.

**Remedy:** The calculation of the arc length function could not be performed to the required accuracy during active polynomial interpolation. Either increase MD20262 \$MC\_SPLINE\_FEED\_PRECISION or reserve more memory for the representation of the arc length polynomials. MD28540 \$MC\_MM\_ARCLENGTH\_SEGMENTS defines how many polynomial segments can be used per block in order to approximate the arc length function.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**10951 [Channel %1: ] Block %2 curve table %3: following value period is zero**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of curve table

**Definitions:** --

**Reaction:** Alarm display.

**Remedy:** Ensure that the table specification is correct.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**10955 [Channel %1: ] Block %2 curve table %3: missing master axis motion**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of curve table

**Definitions:** A slave axis motion has been programmed without a master axis motion. This can also occur if, with active radius compensation, a block is created in which the slave axis moves but not the master axis. The alarm is for information only and can be suppressed by setting MD20900 \$MC\_CTAB\_ENABLE\_NO\_LEADMOTION = 2.

**Reaction:** Alarm display.

**Remedy:** Alarm can be switched off via MD20900 \$MC\_CTAB\_ENABLE\_NO\_LEADMOTION = 2.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

<b>10956</b>	<b>[Channel %1: ] Block %2 curve table %3: NC memory limit DRAM reached type %4.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of curve table %4 = Object type
<b>Definitions:</b>	Insufficient memory in the DRAM while defining the curve table. The object type parameter specifies for which curve table object the memory will not suffice: 1: Number of curve tables too small (MD18406 \$MN_MM_NUM_CURVE_TABS_DRAM) 2: Number of linear curve table segments too small (MD18409 \$MN_MM_NUM_CURVE_SEG_LIN_DRAM) 3: Number of polynomial curve table segments too small (MD18408 \$MN_MM_NUM_CURVE_SEGMENTS_DRAM) 4: Number of curve table polynomials too small (MD18410 \$MN_MM_NUM_CURVE_POLYNOMS_DRAM)
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Delete the curve tables that are no longer required in DRAM or reconfigure the memory space for the curve tables. The curve table must then be redefined. Machine data for memory configuration of the curve tables in DRAM: MD18406 \$MN_MM_NUM_CURVE_TABS_DRAM, MD18408 \$MN_MM_NUM_CURVE_SEGMENTS_DRAM, MD18409 \$MN_MM_NUM_CURVE_SEG_LIN_DRAM, MD18410 \$MN_MM_NUM_CURVE_POLYNOMS_DRAM.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>10958</b>	<b>[Channel %1: ] Lin. curve table %2, memory type %3 includes %4 polynomial segments.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Number of curve table %3 = Memory type %4 = Number of polynomial segments
<b>Definitions:</b>	On generating the curve table with the specified ID in the specified memory type (1 = SRAM, 2 = DRAM), polynomial segments were used instead of possible linear segments. By increasing the number of linear curve table segments by the indicated number, the curve table can be saved in a better way. The following machine data are involved depending on the memory type: 1 (SRAM): MD18403 \$MN_MM_NUM_CURVE_SEG_LIN 2 (DRAM): MD18409 \$MN_MM_NUM_CURVE_SEG_LIN_DRAM
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The indicated curve table can be created and optimized for the memory by increasing MD18403 \$MN_MM_NUM_CURVE_SEG_LIN or MD18409 \$MN_MM_NUM_CURVE_SEG_LIN_DRAM and repeating table generation.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>10960</b>	<b>[Channel %1: ] Block %2 COMPCURV/COMPCAD and radius compensation can-notbe used simultaneously</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** Compressor types COMPCURV and COMPCAD cannot be used in combination with tool radius compensation. Only compressor type COMCON can be activated while tool radius compensation is active.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**10961 [Channel %1: ] Block %2 maximum cubic polynomials are allowed on active radius compensation.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With active radius compensation, only up to cubic polynomials are permissible for the geometry axes. In this case no 4th or 5th degree polynomials can be programmed.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**10962 [Channel %1: ] Block %2 function %3 not possible with path correction**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Funktionsname

**Definitions:** With this software release, the specified function can not yet be used together with tool radius compensation. Please modify the part program or obtain a higher software version.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**10970 [Channel %1: ] Block %2 continuous-path mode active during punching**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** The active continuous-path mode G64x is ignored during punching/nibbling.

**Reaction:** Alarm display.

**Remedy:** Disable continuous-path mode with G60 during punching/nibbling.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**10980 [Channel %1: ] Block %2 orientation smoothing not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm can have the following causes: 1. Orientation smoothing cannot be activated with active path-relative orientation interpolation with ORIPATH. This means that in the 34th modal G code group the G code OSOF must be active. 2. The path-relative orientation interpolation cannot be activated with ORIPATH and ORIPATH_MODE = 1 because MD28580 \$MC_MM_ORIPATH_CONFIG = 0. This MD must have the value 1. 3. Smoothing of the orientation cannot be activated with OSD or OST because MD28580 \$MC_MM_ORIPATH_CONFIG = 0. This MD must have the value 1.
<b>Reaction:</b>	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**10982 [Channel %1: ] Block %2 orientation smoothing not possible with ORISON**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm has the following cause: The smoothing of the orientation with ORISON is only possible if MD MD28590 \$MC_MM_ORISON_BLOCKS >= 4.
<b>Reaction:</b>	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program or set MD28590 \$MC_MM_ORISON_BLOCKS >= 3.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**12000 [Channel %1: ] Block %2 address %3 programmed repeatedly**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string of the address
<b>Definitions:</b>	Most addresses (address types) may only be programmed once in an NC block, so that the block information remains unambiguous (e.g. X... T... F... etc. - exception: G and M functions).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Remove from the NC program addresses that occur more than once (except for those where multiple value assignments are allowed). - Check whether the address (e.g. the axis name) is specified via a user-defined variable (this may not be easy to see if allocation of the axis name to the variable is performed in the program through computational operations only).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**12010 [Channel %1: ] Block %2 address %3 address type programmed too often**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string of the address

**Definitions:** The number of times each address type may occur in a NC block is defined internally (for instance, all axes together form one address type to which a block limit also applies).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECTION. The correction pointer positions on the incorrect block.  
 The program information must be split up over several blocks (but make sure that the functions are of the non-modal type!).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12020 [Channel %1: ] Block %2 illegal address modification**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Valid address types are 'IC', 'AC', 'DC', 'CIC', 'CAC', 'ACN', 'ACP', 'CACN', 'CACP'. Not each of these address modifications can be used for each address type. The Programming Guide specifies which of these can be used for the various address types. If this address modification is applied to address types that are not allowed, then the alarm is generated, e.g.:  
 N10 G02 X50 Y60 I=DC(20) J30 F100  
 interpolation parameters with DC.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Key: Press the NC STOP key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer is then positioned on the incorrect block.  
 Apply non-modal address modifications only for permissible addresses, in accordance with the Programming Manual.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12030 [Channel %1: ] Block %2 invalid parameter or data type in %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** In polynomial interpolation, polynomials must not be greater than the 3rd degree (refer to Programming Guide).  
 $f(p) = a_0 + a_1 p + a_2 p^2 + a_3 p^3$   
 The coefficients a0 (the starting points) are identical to the end points of the preceding block and need not be programmed. In the polynomial block, a maximum of 3 coefficients per axis is therefore allowed (a1, a2, a3).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>12040</b>	<b>[Channel %1: ] Block %2 expression %3 is not of data type 'AXIS'</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string in the block
<b>Definitions:</b>	Some keywords require that the data in their parameters be written in variables of the type "AXIS". For example, in the keyword PO the axis identifier must be specified in the parenthesized expression, and it must be defined as a variable of the AXIS type. With the following keywords only parameters of the AXIS type are possible: AX[.], FA[.], FD[.], FL[.], IP[.], OVRA[.], PO[.], POS[.], POSA[.] Example: N5 DEF INT ZUSTELL=Z1 incorrect, this does not specify an axis identifier but the number 26 161 N5 DEF AXIS ZUSTELL=Z1 correct : N10 POLY PO[X]=(0.1,0.2,0.3) PO[Y]=(22,33,44) &PO[INFEED]=(1,2,3)
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the part program in accordance with the instructions given in the Programming Guide.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12050</b>	<b>[Channel %1: ] Block %2 DIN address %3 not configured</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = DIN address in the source text block
<b>Definitions:</b>	The name of the DIN address (e.g. X, U, X1) is not defined in the control. In addition to the fixed DIN addresses, the control also has variable addresses. Refer to "Variable addresses" in the Programming Guide. The names of these addresses can be altered by machine data. e.g.: DIN identifier -> Configured identifier G01 -> LINE, G04 -> WAIT ...
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Study the Programming Guide and the machine data with respect to the addresses actually configured and their significance and correct the DIN block accordingly.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12060</b>	<b>[Channel %1: ] Block %2 same G group programmed repeatedly</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The G functions that can be used in the part program are divided into groups that are syntax defining or non-syntax defining. Only one G function may be programmed from each G group. The functions within a group are mutually preclusive. The alarm refers only to the non-syntax defining G functions. If several G functions from these groups are called in one NC block, the last of these in a group is active in each case (the previous ones are ignored). Syntax defining G functions: 1. to 4th G group Non-syntax defining G functions: 5. to nth G group
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
No remedy is required. You should, however, check whether the G function last programmed really is the one required.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12070 [Channel %1: ] Block %2 too many syntax-defining G functions**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Syntax defining G functions determine the structure of the part program block and the addresses contained in it. Only one syntax defining G function may be programmed in each NC block. The G functions in the 1st to 4th G group are syntax defining.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
Analyze NC block and distribute the G functions over several NC blocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12080 [Channel %1: ] Block %2 syntax error in text %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Source text area

**Definitions:** At the text position shown, the grammar in the block is incorrect. The precise reason for this error cannot be specified in more detail because there are too many possibilities.  
Example 1:  
N10 IF GOTOF ... ; the condition for the jump is missing!  
Example 2:  
N10 DEF INT VARI=5  
N11 X VARI ; the operation is missing for the X and VARI variables

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
Analyze the block and correct it in accordance with the syntax rules given in the Programming Guide.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12090 [Channel %1: ] Block %2 unexpected parameter %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Disallowed parameters in the text

---

<b>Definitions:</b>	The programmed function has been predefined; no parameters are allowed in its call. The first unexpected parameter is displayed. Example: On calling the predefined subroutine TRAF0F (switching off a transformation) parameters have been transferred (one or more).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Program function without parameter transfer.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12100 [Channel %1: ] Block %2 number of passes %3 not permissible

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of passes
<b>Definitions:</b>	The subroutines called with MCALL are modal, i.e. after each block with positional information a routine run is automatically performed once. For this reason, programming of the number of passes under address P is not allowed. The modal call is effective until another MCALL is programmed, either with a new subroutine name or without (delete function).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Program the subroutine call MCALL without number of passes.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12110 [Channel %1: ] Block %2 block syntax cannot be interpreted

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The addresses programmed in the block are not permissible together with the valid syntax defining G function, e.g. G1 I10 X20 Y30 F1000. An interpolation parameter must not be programmed in the linear block.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check the block structure and correct in accordance with the programming requirements.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12120 [Channel %1: ] Block %2 G function not separately programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** The G function programmed in this block must be alone in the block. No general addresses or synchronous actions may occur in the same block. These G functions are:  
 G25, G26: Working area and spindle speed limitation  
 G110, G111, G112: Pole programming with polar coordinates  
 G92: Spindle speed limitation with v constant  
 STARTFIFO, STOPFIFO: Control of preprocessing buffer  
 E.g. G4 F1000 M100: no M function allowed in the G4 block.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program G function by itself in the block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12130 [Channel %1: ] Block %2 illegal tool orientation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The tool orientation may only be contained in a modal motion block or in a WAB block (repositioning). It can be programmed via Euler angles (A1, B1, C1), normal vector components (A2, B2, C2), direction vectors (A3, B3, C3) or the axis end values. If the tool orientation is programmed in conjunction with the functions: G04 (dwell time), G33 (thread cutting with constant lead), G74 (approach reference points) or REPOSL, REPOSQ, REPOSH (repositioning) then an alarm is issued with Euler angles, direction vectors and normal vector components.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Program tool orientation with the axis end values or use a separate block for this.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12140 [Channel %1: ] Block %2 functionality %3 not implemented**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Software construct in the source text

**Definitions:** In the full configuration of the control functions are possible that are not yet implemented in the current version.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 The displayed function must be removed from the program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12150 [Channel %1: ] Block %2 operation %3 not compatible with data type**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = String (violating operator)



---

<b>Definitions:</b>	The data types are not compatible with the required operation (within an arithmetic expression or in a value assignment). Example 1: Arithmetic operation N10 DEF INT OTTO N11 DEF STRING[17] ANNA N12 DEF INT MAX : N50 MAX = OTTO + ANNA Example 2: Value assignment N10 DEF AXIS DRILL N11 DEF INT OTTO : N50 OTTO = DRILL
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Alter the definition of the variables used such that the required operations can be executed.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12160 [Channel %1: ] Block %2 Value %3 lies beyond the value range

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Impermissible value
<b>Definitions:</b>	The programmed constant or the variable lies beyond the value range that has previously been established by the definition of the data type. An initial value in a DEF or REDEF instruction lies beyond the upper (ULI) or lower (LLI) limit values that have been programmed or already exist in the DEF instruction.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct value of the constant or adapt data type. If the value for an integer constant is too great, it can be specified as real constant by adding a decimal point. Example: R1 = 9 876 543 210 Correct: R1 = 9 876 543 210. Value range INTEGER: +/- (2**31 - 1) Value range REAL: +/- (10**-300 .. 10**+300)
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12161 [Channel %1: ] Block %2 Error on defining the limit %3

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Impermissible limit value
--------------------	---

<b>Definitions:</b>	The alarm may have the following causes. - During definition (DEF) or redefinition (REDEF) of a variable's limits, a value was entered for the upper limit that is smaller than that for the lower limit. - A limit for a variable type was programmed that is not of type CHAR, INT or REAL. - A limit value of type CHAR was programmed for a variable with the data type INT or REAL. - A string (more than one character) was programmed for one of the limits.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	If the alarm occurs in the part program (DEF instruction), press the NC Stop key and select the function "Compensation block" using PROGRAM CORRECT softkey. The cursor is placed on the incorrect block. Adjust the limit values afterwards or completely remove the limit programming in the case of an incorrect data type. If the alarm occurs on compiling a GUD or ACCESS file, correct the GUD or ACCESS definition file (DEF file).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**12162 [Channel %1: ] Block %2 Physical unit not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In a DEF or REDEF instruction, a physical unit may only be defined for variables of data type INT or REAL. Furthermore, only the following values may be programmed for the physical unit: 0 No physical unit 1 Linear or angular position, dependent upon axis type 2 Linear position [mm ; inch] 3 Angular position [degrees] 4 Linear or angular velocity, dependent upon axis type 5 Linear velocity [mm/min] 6 Angular velocity [rev/min ] 7 Linear or angular acceleration, dependent upon axis type 8 Linear accel. [m/s <sup>2</sup> ; inch/s <sup>2</sup> ] 9 Angular accel. [rev/s <sup>2</sup> ] 10 Linear or angular jerk 11 Linear jerk [m/s <sup>3</sup> ; inch/s <sup>3</sup> ] 12 Angular jerk [rev/s <sup>3</sup> ] 13 Time [s] 14 Position controller gain [16.667/s] 15 Revolutional feedrate [mm/rev ; inch/rev] 16 Unit for temperature compensation values, dependent upon axis type 18 Force [N] 19 Weight [kg] 20 Moment of inertia [kgm <sup>2</sup> ] 21 Per cent 22 Frequency [Hz] 23 Voltage [V] 24 Current [A] 25 Temperature [degrees Celsius] 26 Angle [degrees] 27 KV [ 1000/min ] 28 Linear or angluar position [mm deg or inch deg] 29 Cutting velocity [m/min; feet/min] 30 Peripheral velocity [m/s; feet/s] 31 Resistance [ohms] 32 Inductance [mH] 33 Torque [Nm] 34 Torque constant [Nm/A] 35 Current controller gain [V/A]

36 Speed controller gain [Nm/rad s<sup>-1</sup>]  
 37 Speed [rev/min]  
 42 Power [kW]  
 43 Low power [ $\mu$ A]  
 46 Low torque [ $\mu$ Nm]  
 48 Per mill HZ\_PER\_SEC = 49, [Hz/s]  
 65 Flow [l/min]  
 66 Pressure [bar]  
 67 Volume [cm<sup>3</sup>]  
 68 Controlled system gain [mm/Vmin]  
 69 Controlled system gain force controller [N/V]  
 155 Thread pitch [mm/rev; inch/rev]  
 156 Thread pitch change [mm/rev<sup>2</sup>; inch/rev<sup>2</sup>]

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** If the alarm occurs in the part program (DEF instruction), press the NC Stop key and select the function "Compensation block" using PROGRAM CORRECT softkey. The cursor is placed on the incorrect block.  
 In the compensation block the data type can now be adjusted in the DEF instruction, or the physical unit (PHU xy) must be removed.  
 If the alarm occurs on compiling a GUD or ACCESS file, correct the GUD or ACCESS definition file (DEF file).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12163 [Channel %1: ] Block %2 Change of access protection not allowed

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Changing the access rights for system variables (with REDEF) is not allowed in GUD files. They can only be changed in the ACCESS files (\_N\_SYSACCESS\_DEF, \_N\_SACCESS\_DEF, \_N\_MACCESS\_DEF and \_N\_UACCESS\_DEF).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Cut the REDEF instruction from the GUD file and paste it into one of the ACCESS files.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12164 [Channel %1: ] Block %2 access protection programmed more than once %3

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Duplicate protection level programming

**Definitions:** The language commands APW and APR are used to program access protection for access to both the part program and the OPI. APWP and APRP define access protection from the part program; APWB and APRB define access protection via the OPI. Programming APW in the same block together with APWP or APWB or programming APR in the same block together with APRP or APRB will lead to a conflict, as the protection level assignment is no longer unique.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** If access protection in the part program and on the OPI needs to be set to different levels, only the language commands APWP, APWB, APRP and APRB may be used. If access protection is to be the same in the part program and on the OPI, it can also be programmed with APW or APR, although in this case the APWP and APWB or APRP and APRB commands must not be programmed in the same block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12170**                    **[Channel %1: ] Block %2 name %3 defined several times**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Symbol in block

**Definitions:**            The symbol shown in the error message has already been defined in the active part program. Note that user-defined identifiers may occur more than once if the multiple definition occurs in other (sub)programs, i.e. local variables may be redefined with the same name if the program has been exited (subprograms) or has already been concluded. This applies both to user-defined symbols (labels, variables) and to machine data (axes, DIN addresses and G functions).

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 The symbol already known to data management is displayed. This symbol must be looked for in the definition part of the current program using the program editor. The 1st or 2nd symbol must be given a different name.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**12180**                    **[Channel %1: ] Block %2 illegal chaining of operators %3**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Chained operators

**Definitions:**            Operator chaining means the writing in sequence of binary and unary operators without using any form of parentheses.  
                               Example:  
                               N10 ERG = VARA - (- VARB) ; correct notation  
                               N10 ERG = VARA - - VARB ; error!

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Formulate the expression correctly and unambiguously making use of parentheses. This improves clarity and readability of the program.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**12185**                    **[Channel %1: ] Block %2 a bit combination with %3 is not permitted**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Address name

**Definitions:**            A bit combination is not possible with the assignment to this address. Bit combinations are permitted only for coupling addresses ( CPMBRAKE, CPMVDI and CPMAL ).

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the part rogram.  
                               If the data type of the address permits a bit combination, write the value of the address in a variable, make a bit combination with the variable, and assign the variable to the address.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

<b>12190</b>	<b>[Channel %1: ] Block %2 variable of type ARRAY has too many dimensions</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Array with variables of type STRING may be no more than 1-dimensional, and with all other variables no more than 2-dimensional.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the array definition, with multi-dimensional arrays define a second 2-dimensional array if necessary and operate it with the same field index.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12200</b>	<b>[Channel %1: ] Block %2 symbol %3 cannot be created</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Symbol in the source block
<b>Definitions:</b>	The symbol to be created with the DEF instruction cannot be created because: - it has already been defined (e.g. as variable or function) - the internal memory location is no longer sufficient (e.g. with large arrays)
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Make the following checks: - Check with the text editor whether the name to be allocated in the active program cycle (main program and called subprograms) has already been used. - Estimate the memory requirements for the symbols already defined and reduce these if necessary by using fewer global and more local variables.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12205</b>	<b>[Channel %1: ] Block %2 area specification missing for GUD area</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The area specification (NCK or CHAN) was not programmed in the definition instruction for a GUD variable.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Complete the area specification for the GUD variable definition in the GUD definition file. The definition of a GUD variable must conform to the following syntax: DEF <Area> <Data type> <Variable name> e.g. DEF NCK INT intVar1 DEF CHAN REAL realVar1
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**12210 [Channel %1: ] Block %2 string %3 too long**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = String in the source block

**Definitions:** - In the definition of a STRING type variable, an attempt has been made to initialize more than 200 characters.  
 - In an allocation, it has been found that the string does not fit the given variable.  
 - In synchronized actions, a string with more than 31 characters has been programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the "Correction block" function with the PROGRAM CORRECT softkey. The cursor is positioned on the incorrect block.  
 - Select a shorter string or divide the character string into 2 strings.  
 - Define a longer string variable.  
 - Restrict the string to 31 characters.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12220 [Channel %1: ] Block %2 binary constant %3 in string too long**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Binary constant

**Definitions:** When initializing or allocating the value of a variable of type STRING more than 8 bits have been found as binary constant.  
 DEF STRING[8] OTTO = "ABC'H55"B000011111'DEF"

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 In the window for the alarm message, the first characters of the binary constant are always displayed although the surplus bit might not be located until further on. Therefore, the complete binary constant must always be checked for an incorrect value.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12230 [Channel %1: ] Block %2 hexadecimal constant %3 in string too long**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Hexadecimal constant

**Definitions:** A string can also contain bytes that do not correspond to a character that can be entered or one that is available on a keyboard with a minimized number of keys. These characters can be input as binary or hexadecimal constants. They may occupy up to 1 byte each only - therefore be < 256, e.g.  
 N10 DEF STRING[2] OTTO=" 'HCA' 'HFE' "

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 In the window for the alarm message, the first characters of the hexadecimal constant are always displayed although the surplus bit might not be located until further on. Therefore, the complete hexadecimal constant must always be checked for an incorrect value.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12240 [Channel %1: ] Block %2 tool orientation %3 defined repeatedly

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Text

**Definitions:** Only 1 tool orientation can be programmed per DIN block. This can either be defined via the 3 Euler angles, or the end points of the axes, or through direction vectors.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
Since the tool orientation can be set in 3 different ways, the most advantageous should be selected. For this type of specification, the addresses and value assignments must be programmed and all other orientation parameters must be removed.  
Axis end points (additional axes): A, B, C axis identifiers Euler angles: A2, B2, C2 Direction vectors: A3, B3, C3

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12250 [Channel %1: ] Block %2 nested macro %3 not possible

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Source string

**Definitions:** The macro technique supplies a 1-line instruction or series of instructions with a new identifier by means of the keyword DEFINE. No further macro may be contained in the string of instructions (nesting). Example: N10 DEFINE MACRO1 AS G01 G91 X123 MACRO2 F100

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
Nested macros must be replaced by the full program information.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12260 [Channel %1: ] Block %2 too many initialization values specified %3

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Source string

**Definitions:** In the initialization of an array (array definition and value assignments to individual array elements) there are more initialization values than array elements. Example: N10 DEF INT OTTO[2,3]=(..., ..., {more than 6 values})

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Check the NC program to establish whether:  
 1. During array definition the number of array elements (n,m) was indicated correctly (DEF INT FIELDNAME[n,m] e.g. an array with 2 lines and 3 columns: n=2, m=3). 2. During initialization the value assignments have been made correctly (values of the individual field elements separated by comma, decimal point for variables of the type REAL).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12261 [Channel %1: ] Block %2 initialization of %3 not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** Frame type variables cannot be initialized in the definition. Example: DEF FRAME LOCFRAME = CTRANS(X,200)  
 Equally, no default values can be programmed for axes in the program run during field initialization via SET.  
 A REDEF instruction with PRLOC is only permitted for setting data, but not for machine data or variables.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** IPerform initialization in separate block in the execution part of the program: DEF FRAME LOCFRAME LOCFRAME = CTRANS(X,200)  
 When using for axis variables:  
 Replace DEF AXIS AXIS\_VAR [10] AXIS\_VAR [5] = SET (X, , Y) by: DEF AXIS AXIS\_VAR [10] AXIS\_VAR [5] = X  
 AXIS\_VAR [7] = Y  
 If REDEF ... INIRE, INIPO, INICF, PRLOC changes the behavior of a GUD, LUD etc., then the MD11270 \$MN\_DEFAULT\_VALUES\_MEM\_MASK must equal 1.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12270 [Channel %1: ] Block %2 macro identifier %3 already defined**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string macro name

**Definitions:** The name of the macro to be selected by the instruction DEFINE is already defined in the control as:  
 Macro name  
 Keyword  
 Variable  
 Configured identifier.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Select DEFINE instruction with another macro name.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

<b>12280</b>	<b>[Channel %1: ] Block %2 maximum macro length %3 exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	The string of instructions on the right side of the macro is limited to 256 characters. If an attempt is made to define a longer character string under one macro (possible only through V.24 input of NC blocks, because communication between operator panel and NCK is limited to a block length of 242 characters), an alarm is displayed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Divide the functions defined under the macro into 2 macros.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12290</b>	<b>[Channel %1: ] Block %2 arithmetic variable %3 not defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string arithmetic variable
<b>Definitions:</b>	Only the R parameters are predefined as arithmetic variables. All other arithmetic variables must be defined with the DEF instruction before being used. The number of arithmetic parameters is defined via machine data. The names must be unambiguous and may not be repeated in the control (exception: local variables).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Define the required variable in the definition part of the program (possibly in the calling program if it is to be a global variable).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12300</b>	<b>[Channel %1: ] Block %2 call-by-reference parameter missing on subroutine call %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	In the subroutine definition, a formal REF parameter (call-by-reference parameter) has been specified with no actual parameter assigned to it. The assignment takes place in the subroutine call on the basis of the position of the variable name and not on the basis of the name! Example: Subroutine: (2 call-by-value parameters X and Y, 1 call-by-reference parameter Z) PROC XYZ (INT X, INT Y, VAR INT Z) : M17 ENDPROC Main program: N10 DEF INT X N11 DEF INT Y N11 DEF INT Z :

N50 XYZ (X, Y); REF parameter Z missing  
 or  
 N50 XYZ (X, Z) ; REF parameter Z missing!

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Assign a variable to all REF parameters (call-by-reference parameters) of the subroutine when calling. No variable must be assigned to "normal" formal parameters (call-by-value parameters), as these are defaulted with 0.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12310 [Channel %1: ] Block %2 axis parameter missing on procedure call %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** When calling the subroutine, an AXIS parameter is missing which, according to the EXTERN declaration, should be present.  
 With the EXTERN instruction, user-defined subroutines (procedures) are made "known" that have a parameter transfer.  
 Procedures without parameter transfer require no EXTERN declaration.  
 Example:  
 Subroutine XYZ (with the formal parameters):  
 PROC XYZ (INT X, VAR INT Y, AXIS A, AXIS B)  
 EXTERN instruction (with variable types):  
 EXTERN XYZ (INT, VAR INT, AXIS, AXIS) Subroutine call (with actual parameters):  
 N10 XYZ (, Y1, R\_TISCH)  
 Variable X is defaulted with value 0  
 Variable Y is supplied with the value of the variable Y1 and returns the results to the calling program after the subroutine run  
 Variable A is supplied with the axis in R\_TISCH  
 Variable B missing!

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Program the missing AXIS parameter in the call.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12320 [Channel %1: ] Block %2 parameter %3 is no variable**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** A constant or the result of a mathematical expression has been assigned to a REF parameter instead of a variable at the time of the subroutine call, even though only variable identifiers are allowed.  
 Examples:  
 N10 XYZ (NAME\_1, 10, OTTO) or  
 N10 XYZ (NAME\_1, 5 + ANNA, OTTO)

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Remove the constant or the mathematical expression from the NC block.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

### 12330 [Channel %1: ] Block %2 type of parameter %3 incorrect

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	When calling a procedure (a subroutine) it is found that the type of the actual parameter cannot be converted into the type of the formal parameter. There are two possible cases: - Call-by-reference parameter: Actual parameter and formal parameter must be of precisely the same type, e.g. STRING, STRING. - Call-by-value parameter: Actual parameter and formal parameter can in principle be different providing conversion is basically possible. In the present case, however, the types are generally not compatible, e.g. STRING -> REAL. Overview of type conversions: - from REAL to: REAL: yes, INT: yes*, BOOL: yes1), CHAR: yes*, STRING: -, AXIS: -, FRAME: - - from INT to: REAL: yes, INT: yes, BOOL: yes1), CHAR: if value 0 ...255, STRING: -, AXIS: -, FRAME: - - from BOOL to: REAL: yes, INT: yes, BOOL: yes, CHAR: yes, STRING: -, AXIS: -, FRAME: - - from CHAR to: REAL: yes, INT: yes, BOOL: yes1), CHAR: yes, STRING: yes, AXIS: -, FRAME: - - from STRING to: REAL: -, INT: -, BOOL: yes2), CHAR: only if 1 character, STRING: yes, AXIS: -, FRAME: - - from AXIS to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: yes, FRAME: - - from FRAME to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: -, FRAME: yes 1) Value <> 0 corresponds to TRUE, value ==0 corresponds to FALSE. 2) String length 0 => FALSE, otherwise TRUE. *) At type conversion from REAL to INT fractional values that are >=0.5 are rounded up, others are rounded down.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check transfer parameters of the subroutine call and define the application accordingly as call-by-value or call-by-reference-parameter.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

### 12340 [Channel %1: ] Block %2 number of parameters too high %3

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	When calling a function or a procedure (predefined or user-defined) more parameters were transferred than defined. Predefined functions and procedures: The number of parameters has been set permanently in the NCK. User-defined functions and procedures: The number of parameters is established by type and name in the definition.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check whether the correct procedure/function has been called. Program the number of parameters in accordance with the procedure/function.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**12350**                    **[Channel %1: ] Block %2 parameter %3 no longer possible**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source string

**Definitions:**            An attempt has been made to transfer actual parameters although axis parameters located before them have not been assigned. For procedure or function calls, the assignment of parameters that are no longer required can be omitted if no more parameters are to be transferred subsequently. Example: N10 FGROUP(X, Y, Z, A, B); a max. of 8 axes possible The following call-by-value parameters would then be initialized with zero because the space-dependent assignment has been lost on account of the missing axis parameters. Axes that can be omitted and following parameters do not occur in the predefined procedures and functions.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. In predefined procedures and functions either remove the following parameters or transfer any preceding axis parameters. In user-defined procedures and functions, parameter transfer must be programmed in accordance with the instructions given in the machine manufacturer's programming guide.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**12360**                    **[Channel %1: ] Block %2 dimension of parameter %3 incorrect**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source string

**Definitions:**            The following possibilities of error must be checked:  
                               - The current parameter is an array, but the formal parameter is a variable  
                               - The current parameter is a variable, but the formal parameter is an array  
                               -

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the NC part program in accordance with the cause of error as listed above.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**12370**                    **[Channel %1: ] Block %2 range of values %3 not permissible**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source string

**Definitions:**            A variable has been initialized with a value range outside an initialization block. The definition of program-global variables is allowed only in special initialization blocks. These variables can be initialized with a value range.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
                               Remove the value range specification (begins with the keyword OF) or define the variable as a global variable in the initialization block and initialize it with a value range.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

---

<b>12380</b>	<b>[Channel %1: ] Block %2 maximum memory capacity reached</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The data definitions in this block cannot be processed because the maximum available memory for creating the data has been filled, or because the data block cannot accommodate any further data. The alarm can also occur if several subroutine calls are executed in sequence and no block with an effect on the machine is generated (motion, dwell, M function).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Reduce the number of variables, reduce the size of arrays, or increase the capacity of the data management system. - If new macro definitions are to be introduced -> Increase MD18160 \$MN_MM_NUM_USER_MACROS - If new GUD definitions are to be introduced -> Check MD18150 \$MN_MM_GUD_VALUES_MEM, MD18130 \$MN_MM_NUM_GUD_NAMES_CHAN, MD18120 \$MN_MM_NUM_GUD_NAMES_NCK - If the error occurs while executing an NC program with LUD definitions or when using cycle programs (the parameters count as LUD variable of the cycle program), the following machine data must be checked: MD28040 \$MC_MM_LUD_VALUES_MEM, MD18242 \$MN_MM_MAX_SIZE_OF_LUD_VALUE, MD18260 \$MN_MM_LUD_HASH_TABLE_SIZE, MD28020 \$MC_MM_NUM_LUD_NAMES_TOTAL, MD28010 \$MC_MM_NUM_REORG_LUD_MODULES
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12390</b>	<b>[Channel %1: ] Block %2 initialization value %3 cannot be converted</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	During initialization, a value has been assigned to a variable that does not correspond to the type of the variable, nor can it be converted to the data type of the variable. Overview of type conversions: - from REAL to REAL: no, INT: yes1), BOOL: yes, CHAR: yes2), STRING: - - from INT to REAL: yes, INT: no, BOOL: yes, CHAR: yes2), STRING: - - from BOOL to REAL: yes, INT: yes, BOOL: no, CHAR: yes, STRING: - - from CHAR to REAL: yes, INT: yes, BOOL: yes, CHAR: no, STRING: yes - from STRING to REAL: -, INT: -, BOOL: yes, CHAR: yes3), STRING: no 1) Value <> 0 corresponds to TRUE, value ==0 corresponds to FALSE. 2) String length 0 => FALSE, otherwise TRUE. 3) If only one character. It is not possible to convert from type AXIS and FRAME nor into type AXIS and FRAME.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Define variable type such that the initialization value can be assigned, or - Select initialization value in accordance with the variable definition.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**12400 [Channel %1: ] Block %2 field %3 element does not exist**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** The following causes are possible:  
 - Impermissible index list; an axis index is missing  
 - Array index does not match the definition of the variables  
 - An attempt was made to access a variable at array initialization via SET or REP; this attempt did not correspond to the standard access. Single character access, partial frame access, omitted indices not possible.  
 A non-existent element was addressed on initializing this array.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Array initialization: Check the array index of the addressed element. The 1st array element is given the index [0,0], the 2nd array element [0,1] etc. The right array index (column index) is incremented first.  
 In the 2nd row, the 4th element is also addressed with the index [1,3] (the indices start at zero).  
 Array definition: Check the size of the array. The 1st number indicates the number of elements in the 1st dimension (number of rows), the 2nd number indicates the number of elements in the 2nd dimension (number of columns).  
 An array with 2 rows and 3 columns must be defined by specifying [2,3].

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12410 [Channel %1: ] Block %2 incorrect index type for %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** In assigning a value to an element of an array variable, the array index was specified in a way that is not allowed. Only the following are allowed as array index (in square brackets):  
 - Axis identifier, provided the array variable was defined as data type FRAME.  
 - Integer values for all other data types.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct indices of the array element with respect to variable definition or define the array variable differently.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12420 [Channel %1: ] Block %2 identifier %3 too long**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** -

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. The symbol to be created or the target of program jumps (label) must conform to the system specifications, that means the name must begin with 2 letters (but the 1st sign must not be "\$") and may be up to a maximum of 32 characters.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12430 [Channel %1: ] Block %2 specified index is invalid

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In specifying an array index (in the array definition) an index was used that is outside the permissible range.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Specify array index within the permissible range. Value range per array dimension: 1 - 32 767.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12440 [Channel %1: ] Block %2 maximum number of formal arguments exceeded

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the definition of a procedure (a subroutine) or in an EXTERN instruction, more than 127 formal parameters have been specified.  
Example: PROC ABC (FORMPARA1, FORMPARA2, ... .. FORMPARA127, FORMPARA128, ...) EXTERN ABC (FORMPARA1, FORMPARA2, ... .. FORMPARA127, FORMPARA128, ...)

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. A check must be made to determine whether all parameters really have to be transferred. If so, the formal parameters can be reduced by using global variables or R parameters, or by grouping together parameters of the same type to form an array and transfer them in this form.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 12450 [Channel %1: ] Block %2 label defined twice

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The label of this block already exists.  
If the NC program is compiled off-line, the entire program is compiled block for block. During this procedure all multiple labels are recognized; this is not always the case with on-line compilation. (Only the actual program run is compiled here, i.e. program branches that are not passed through in this run are disregarded and could therefore contain programming errors).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer is positioned on the block where the displayed label occurs for the 2nd time. Use the editor to search the part program where this label occurs for the 1st time, and change one of the names.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12460**                    **[Channel %1: ] Block %2 maximum number of symbols exceeded with %3**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source string

**Definitions:**            The max. number of variable definitions (GUD, LUD), macro definitions, cycle programs and/or cycle parameters (PROC instruction) that the controller's data management system is able to handle has been exceeded.  
 If this alarm occurs in conjunction with alarm 15175, not enough memory for the preprocessing of the cycle program definitions is available (PROC instruction).  
 If this alarm occurs in conjunction with alarm 15180, then this alarm shows the name of the file (INI or DEF file) causing the error.  
 (For a list of names of INI files and their meaning -> please refer to alarm 6010)

**Reaction:**                Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**                 Generally reduce the number of symbols in the affected block (possibly by using the array technique or by using R parameters), or adapt the corresponding machine data (see below).  
 MD28020 \$MC\_MM\_NUM\_LUD\_NAMES\_TOTAL with error in LUD blocks (i.e. if more variable definitions were made in the active part program than allowed by the MD).  
 GUD data blocks can cause errors as part of the 'initial.ini download' process (e.g. in the case of a series start-up) or by selective activation via PI service \_N\_F\_COPY (activate GUD via HMI dialog). If alarm 15180 refers to a GUD definition file, then MD18120 \$MN\_MM\_NUM\_GUD\_NAMES\_NCK or MD18130 \$MN\_MM\_NUM\_GUD\_NAMES\_CHAN is set to a value that is too small.  
 Macros are loaded during POWER ON/NCK RESET or selectively via PI service \_N\_F\_COPY (activate macro via HMI dialog). If alarm 15180 refers to a macro definition file, then MD18160 \$MN\_MM\_NUM\_USER\_MACROS is set to a value that is too small.  
 Cycle program definitions (PROC instruction) are reloaded at each POWER ON/NCK RESET. In case of failure check parameter %3 to find out whether the name of the cycle program has caused the error - in this case, the value of MD18170 \$MN\_MM\_NUM\_MAX\_FUNC\_NAMES should be increased, or whether the name of a cycle call parameter has caused the error - in this case, the value of MD18180 \$MN\_MM\_NUM\_MAX\_FUNC\_PARAM should be increased.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**12470**                    **[Channel %1: ] Block %2 G function %3 is unknown**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source string

**Definitions:**            With indirectly programmed G functions, an invalid or non-allowed group number has been programmed. Allowed group number = 1. and 5 max. number of G groups. In the displayed block, a non-defined G function has been programmed. Only "real" G functions are checked, which begin with the address G, e.g. G555. "Named" G functions such as CSPLINE, BRISK etc. are interpreted as subroutine names.

**Reaction:**                Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**                 Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. You should decide on the basis of the machine manufacturer's programming guide whether or not the displayed G function exists or is available, or whether a standard G function has been reconfigured (or introduced by an OEM). Remove G function from the part program or program function call in accordance with the machine manufacturer's programming guide.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.



---

<b>12475</b>	<b>[Channel %1: ] Block %2 invalid G function number %3 programmed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = G code number
<b>Definitions:</b>	A non-allowed G function number (parameter 3) has been programmed for a G group with indirect G code programming. Only the G function numbers indicated in the Programming Guide "Fundamentals", Section 12.3 "List of G functions/Path conditions" are allowed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12480</b>	<b>[Channel %1: ] Block %2 subroutine %3 already defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	The name used in the PROC or EXTERN instruction has already been defined in another call description (e.g. for cycles). Example: EXTERN CYCLE85 (VAR TYP1, VAR TYP2, ...)
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. A program name must be selected that has not yet been used as identifier. (Theoretically, the parameter declaration of the EXTERN instruction could also be adapted to the existing subroutine in order to avoid the alarm output. However, it would have been defined identically twice).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12481</b>	<b>[Channel %1: ] Block %2 program attribute %3 not allowed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	The attribute used in the PROC instruction is not permitted in the current operating mode. The attribute SAVE, for example, is not allowed in a technology cycle.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press button NC STOP and select the function "Compensation block" using softkey PROGRAM CORRECT. The cursor jumps to the incorrect block. Then delete the invalid program attribute.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**12490 [Channel %1: ] Block %2 access permission level %3 is not valid**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** The desired access authorization, programmed with the keyword REDEF, has not been set. The desired protection level is either beyond the permitted value range or the protection level change is not allowed. (The REDEF instruction is only executable in INITIAL\_INI blocks on SINUMERIK 840D, P1 (6/94)).  
 The protection level may be changed only if:  
 1. The current protection level is equal to or higher than the level originally defined, and  
 2. The new protection level is to be below the level originally defined.  
 The higher numerical values represent the lower protection levels. The lower 4 levels (from 7 to 4) correspond to the keyswitch positions, and the upper 4 levels are associated with 4 passwords.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 - Use the REDEF instruction only in the INITIAL\_INI block  
 - Using the operator panel, set the current protection level to at least the same level as that of the variable with the highest level  
 - Program protection level within the permissible value range  
 - Only program new protection levels that are lower than the old values

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12495 [Channel %1: ] Block %2 Change (definition) of data class %3 is not allowed here**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Data class

**Definitions:** Change of the data class in this ACCESS file or definition in this GUD file (for file name see alarm 15180) not possible. Priority of the new data class may only be smaller or the same as that of the definition file. This means that DCS may only be programmed in SGUD (SACCESS), DCM not in UGUD and GUD9 (UACCESS), DCU not in GUD9. DCI is allowed in all GUD and ACCESS files.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program the data class of the area permissible for this GUD or ACCESS file.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12500 [Channel %1: ] Block %2 in this module %3 is not possible**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

---

<b>Definitions:</b>	The displayed keyword may not be used in this type of block and at this location (all files in the NCK are designated as blocks). Block types: Program block Contains a main program or subroutine Data block Contains macro or variable definitions and possibly an M, H or E function Initialization block Contains only selected language elements for data initialization
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Remove the displayed language elements (keyword) with its parameters from this block and insert in the block provided for this purpose.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12510 [Channel %1: ] Block %2 too many machine data %3

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	In the part program, in the machine data file (..._TEA) and in the initialization file (..._INI), no more than 5 machine data may be used per block. Example: N ... N 100 \$MN_OVR_FACTOR_FEEDRATE [10] = 15, \$MN_OVR_FACTOR_FEEDRATE [11] = 20 N ...
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Divide up the part program block into several blocks. - If necessary, use the local variable for storing intermediate results.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 12520 [Channel %1: ] Block %2 too many tool parameters %3

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	In the part program, in the tool offset file (..._TOA) and in the initialization file (..._INI), no more than 5 tool offset parameters may be used per block. Example: N ... N 100 \$TC_DP1 [5,1] = 130, \$TC_DP3 [5,1] = 150.123, \$TC_DP4 [5,1] = 223.4, \$TC_DP5 [5,1] = 200.12, \$TC_DP6 [5,1] = 55.02 N ...
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 - Divide up the part program block into several blocks.  
 - If necessary, use the local variable for storing intermediate results.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12530 [Channel %1: ] Block %2 invalid index for %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** In macro definitions, an attempt was made to define a G function with more than 3 decades or an M function with more than 2 decades as identifier of the macro.  
 Example:  

```
_N_UMAC_DEF DEFINE G4444 AS G01 G91 G1234
                DEFINE M333 AS M03 M50 M99
                :
                M17
```

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Modify the macro definition in accordance with the Programming Guide.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12540 [Channel %1: ] Block %2 Block is too long or too complex**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The maximum internal block length after translator processing must not exceed 256 characters. After editing, for example, several macros in the block or a multiple nesting, this limit can be exceeded.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
 Divide up the program block into several subblocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12550 [Channel %1: ] Block %2 name %3 not defined or option/function not activated**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source symbol

---

<b>Definitions:</b>	The identifier displayed has not been defined before being used. - _N_SMAC_DEF _N_MMACH_DEF _N_UMACH_DEF _N_SGUD_DEF _N_MGUD_DEF _N_UGUD_DEF Variable: DEF instruction is missing Program: PROC declaration is missing The T word cannot be interpreted in ISO mode 2, \$MN_EXTERN_DIGITS_TOOL_NO and \$MN_EXTERN_DIGITS_OFFSET_NO are 0.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Compensation block" with the softkey PROGRAM CORRECT. The cursor positions itself on the incorrect block. - Correct the name used (writing error) - Check definitions of variables, subroutines and macros - Declare subroutine with EXTERN, load subroutine to SPF-Dir - Check interface definition of subroutine - Check options. See also MD10711 \$MN_NC_LANGUAGE_CONFIGURATION.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12552</b>	<b>[Channel %1: ] Block %2 tool/magazine OEM parameter not defined. Option not set. Option not set.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The programmed \$TC_... Cx system variable is not known in the control.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Correct the name used (writing error) - \$TC_DPCx, \$TC_TPCx, \$TC_MOPCx, \$TC_MAPCx, \$TC_MPPCx, \$TC_DPCSx, \$TC_TPCSx, \$TC_MOPCSx, \$TC_MAPCSx, \$TC_MPPCSx; with x=1,...10 - These are the OEM parameters of the tools magazines, The corresponding machine data value is set to < 10, or the option 'TM OEM parameters' has not been set. - Use correct parameter number, or - if the name cannot be changed - set machine data correction (see MD18096 \$MN_MM_NUM_CC_TOA_PARAM, ... MD18206 \$MN_MM_NUM_CCS_TOA_PARAM, ...). ) - Check the option (machine data are only effective when the option is enabled).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12553</b>	<b>[Channel %1: ] Block %2 name %3 option/function is not active</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol

**Definitions:** The option (if MD10711 \$MN\_NC\_LANGUAGE\_CONFIGURATION = 1) or the NC function (if MD10711 \$MN\_NC\_LANGUAGE\_CONFIGURATION = 3) related to this language command is not active.  
 But the name of the language command is known.  
 Each programming of this language command is rejected with this alarm.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC Stop key and select the "Compensation block" function by pressing the PROGRAM CORRECT softkey.  
 The cursor positions itself on the incorrect block.  
 - Correct the name used (in the case of a typing error).  
 - Activate the NC function (if a language command of an inactive function has been programmed).  
 - Enable the option required (if a language command of a function with a non-enabled option has been programmed).  
 See also MD10711 \$MN\_NC\_LANGUAGE\_CONFIGURATION.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12554 [Channel %1: ] Block %2 replacement cycle %3 for the predefined procedure is missing.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Cycle name

**Definitions:** The replacement cycle that is to be called instead of the predefined procedure is not present / unknown in the control.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC stop key and select the "Compensation block" function by pressing the PROGRAM CORRECT softkey.  
 The cursor will position itself in the faulty block.  
 - Correct the name used for the predefined procedure (write error)  
 - Or load the replacement cycle into one of the cycle directories (+ restart)  
 - Or set the machine data bit for the predefined procedure in MD11754 \$MN\_COUPLE\_CYCLE\_MASK to 0 so that the predefined procedure is executed again.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**12555 [Channel %1: ] Block %2 function not available (identification %3)**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Fine ID

**Definitions:** The identifier has not been defined for this system.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Press the NC stop key and select the "Compensation block" function by pressing the "Program correct" softkey. The correction indicator will position in the incorrect block.  
 - Correct the name used (write error)  
 - Use a better software system in case of malfunction  
 - Check the definition of variables, subroutines and macros  
 - Declare a subroutine with EXTERNAL; load the subroutine to SPF-Dir  
 - Check the interface definition of the subroutine

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>12556</b>	<b>[Channel %1: ] Block %2 name %3 Name is already known</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	The name of the symbol to be created is part of the NC language scope and therefore already known. Although the NC function is not active, this name can no longer be used for GUDs, macros and PROC definitions.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press key NC Stop and select "Correction block" function by pressing softkey "Program correct". The correction indicator is set to the incorrect block. - Correct the name used (typing error) - With MD10711 \$MN_NC_LANGUAGE_CONFIGURATION = 2 or 4, only those language commands are created, the option of which has been set or the function of which is active.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12560</b>	<b>[Channel %1: ] Block %2 programmed value %3 exceeds allowed limits</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source string
<b>Definitions:</b>	In a value assignment, the permissible value range of the data type has been exceeded.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Assign value within the value range of the various data types, or if necessary use another type in order to increase the size of the value range, e.g. INT ->REAL. Value ranges of the various variable types: - REAL: Property: Fractional number with dec. pt., value range: +/-(-2-1022-2+1023) - INT: Property: Integers with signs, value range: +/-(-231-1) - BOOL: Property: Truth value TRUE, FALSE, value range: 0,1 - CHAR: Property: 1 ASCII character, value range: 0-255 - STRING: Property: Character string (max. 100 values), value range: 0-255 - AXIS: Property: Axis addresses, value range: Axis names only - FRAME: Property: Geometric information, value range: As for axis paths
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12570</b>	<b>[Channel %1: ] Block %2 too many motion synchronous actions in %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	No more than 16 actions are allowed in a block with motion synchronous action.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce the number of programmed actions.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**12571**                    **[Channel %1: ] Block %2 %3 not permissible for motion synchronous action**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Source symbol

**Definitions:**            The predefined subprogram %3 specified here is not allowed in a block with motion synchronous action. It may only be contained in a "normal" block.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Modify program.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

---

**12572**                    **[Channel %1: ] Block %2 %3 only permissible for motion synchronous action**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Source symbol

**Definitions:**            The predefined subprogram %3 specified here is only allowed in a block with motion synchronous action. It must not be contained alone in a "normal" block.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Modify program.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

---

**12573**                    **[Channel %1: ] Block %2 motion-synchronous action: Call by reference parameters not allowed %3**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Source text area

**Definitions:**            Call by reference parameters (keyword VAR) are not possible with technology cycles.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Correct PROC instruction of technology cycle.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

---

**12580**                    **[Channel %1: ] Block %2 %3 not permissible for assignment in motion synchronous action**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Source symbol

---



---

<b>Definitions:</b>	The variable displayed must not be written in a motion synchronous action. Only selected variables are permitted here, e.g. DO \$AA_IW[X]=10 is not allowed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify part program. In a motion synchronous action, only certain variables are allowed. E.g. \$AA_IM, \$AC_DTGPB
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12581</b>	<b>[Channel %1: ] Block %2 invalid read access to %3 while in motion synchronous action</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	In a motion synchronous action, the displayed variable must not be entered as a variable that is to be read online, i.e. <ol style="list-style-type: none"> <li>1. The displayed variable must not be written to the left of the comparison in a motion synchronous action. Only selected variables are permissible, e.g. WHEN \$AA_OVR == 100 DO ...</li> <li>2. In a motion synchronous action, the displayed variable must not be used as a \$\$ variable, e.g. WHEN \$AA_IM[X] &gt;= \$\$P_AD[1] DO ... DO \$AC_VC = \$\$P_F</li> <li>3. The displayed variable must not be programmed as an online evaluated parameter of a synchronous procedure, e.g. DO SYNFACT(1, \$AC_PARAM[0], \$SA_OSCILL_REVERSE_POS2[Z])</li> </ol>
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12582</b>	<b>[Channel %1: ] Block %2 field index %3 incorrect</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	\$A or \$V variables are assessed in real-time in motion synchronous actions, i.e. in the interpolation cycle. All other variables (e.g. user-defined variables) are still computed at block preparation. It is not permissible to index the index of a variable for block preparation with a real-time variable. Example: DEF INT INPUT[3] WHEN \$A_IN[1] == INPUT[\$A_INA[1]] DO ... The locally defined variable INPUT must not be indexed with a real-time variable. Program editing: WHEN \$A_IN[1] == \$AC_MARKER[\$A_INA[1]] DO ...
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify program: Use real-time variables.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**12583**                    **[Channel %1: ] Block %2 variable %3 no system variable**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source symbol

**Definitions:**            In motion synchronous actions, only special system variables are allowed on the left side of the compare operation for the assigned variable as input and result variable of SYNFACT and as input variable for PUTFTOCF. Real-time synchronous access is allowed here. The programmed variable is not a system variable.  
 Example:  
 DEF REAL OTTO, BERTA[2] DO SYNFACT(2,OTTO, \$MN\_...); Local variables or machine data are not allowed as parameter for SYNFACT.

**Reaction:**                Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**                 Modify part program. Local variables or machine data are not allowed as parameters for SYNFACT.

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

**12584**                    **[Channel %1: ] Block %2 variable %3 cannot be read synchronously with motion**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source symbol

**Definitions:**            In motion synchronous actions on the left side of the compare operation, only special variables are allowed as input variables of SYNFACT and as input variables for PUTFTOCF. Motion synchronous access is possible here.  
 Example:  
 PUTFTOCF(1, \$AA\_OVR, 2, 1, 2)  
 The variable \$AA\_OVR is not allowed here.

**Reaction:**                Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**                 Modify part program. For the functions SYNFACT and PUTFTOCF only certain variables are allowed, for example \$AC\_DTGPW.

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

**12585**                    **[Channel %1: ] Block %2 variable %3 cannot be changed synchronously with motion**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Source symbol

**Definitions:**            When assigning SYNFACT in motion synchronous actions and result variables, only special variables are allowed. Real-time synchronous access is allowed here.  
 Example:  
 WHEN \$AA\_IM[AX1]>= 100 DO \$AC\_TIME=1000. The variable \$AC\_TIME (time from beginning of block) cannot be written

**Reaction:**                Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**                 Modify part program. Only certain variables are allowed for the function SYNFACT where real-time synchronous access is possible.

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

<b>12586</b>	<b>[Channel %1: ] Block %2 motion synchronous action: type conflict in variable %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Source symbol
<b>Definitions:</b>	Type conversion is not possible for online variables \$A.. or \$V.., which are evaluated or written in the interpolation cycle. Only variables of the same type can be linked or assigned to one another. Example 1: WHENEVER \$AA_IM[X] > \$A_IN[1] DO ... An online variable of the REAL type (actual value) cannot be compared with a variable of the BOOL type (digital input) The operation is possible if the following change is made: WHENEVER \$AA_IM[X] > \$A_INA[1] DO ... Example 2: WHENEVER ... DO \$AC_MARKER[1]=\$AA_IM[X]-\$AA_MM[X] Improvement: WHENEVER ... DO \$AC_PARAM[1]=\$AA_IM[X]-\$AA_MM[X]
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program: Use variables of the same type.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>12587</b>	<b>[Channel %1: ] Block %2 motion synchronous action: operation/function %3 not allowed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Operator/function
<b>Definitions:</b>	The specified function / operator is not permissible for logic operations of real-time variables in motion synchronous actions. The following operators/functions are permissible: - == >= <= > < <> + - * / - DIV MOD - AND OR XOR NOT - B_AND B_OR B_XOR B_NOT - SIN COS TAN ATAN2 SQRT POT TRUNC ROUND ABS EXP LNX SPI
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>12588</b>	<b>[Channel %1: ] Block %2 motion synchronous action: address %3 not allowed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Address
<b>Definitions:</b>	- The specified address cannot be programmed in motion-synchronous actions. Example: ID = 1 WHENEVER \$A_IN[1]==1 DO D3 - The cutting edge cannot be changed out of a motion-synchronous action.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12589 [Channel %1: ] Block %2 motion synchronous action: variable %3 not allowed with modal ID**

**Parameters:** %1 = Channel number  
%2 = Block number  
%3 = Variable name

**Definitions:** The modal ID in motion synchronous action must not be formed by means of an on-line variable.  
Examples:  
ID=\$AC\_MARKER[1] WHEN \$a\_in[1] == 1 DO \$AC\_MARKER[1] = \$AC\_MARKER[1]+1  
This can be corrected in the following way:  
R10 = \$AC\_MARKER[1]  
ID=R10 WHEN \$a\_in[1] == 1 DO \$AC\_MARKER[1] = \$AC\_MARKER[1]+1  
The ID in a synchronous action is always permanent, and cannot be changed in the interpolation cycle.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program: Replace the on-line variable by an arithmetic variable.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12590 [Channel %1: ] Block %2 global user data cannot be created**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The number of global user data blocks is defined in MD18118 \$MN\_MM\_NUM\_GUD\_MODULES.  
Here, \_N\_SGUD\_DEF corresponds to block 1, \_N\_MGUD\_DEF corresponds to block 2, \_N\_UGUD\_DEF corresponds to block 3, \_N\_GUD4\_DEF corresponds to block 4 etc.  
In the directory \_N\_DEF\_DIR there is a file with definitions for global user data, the block number of which is greater than the number of blocks given in the MD.  
The alarm may, however, also be caused by value zero in one of MD18120 \$MN\_MM\_NUM\_GUD\_NAMES\_NCK, MD18130 \$MN\_MM\_NUM\_GUD\_NAMES\_CHAN and by the definition of a variable with NCK or CHAN in one of the GUD definition files.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Increase MD18118 \$MN\_MM\_NUM\_GUD\_MODULES.  
Or, if it already has the correct value, check whether MD18120 \$MN\_MM\_NUM\_GUD\_NAMES\_NCK (if a variable has been defined with attribute NCK) or MD18130 \$MN\_MM\_NUM\_GUD\_NAMES\_CHAN (if a variable has been defined with attribute CHAN) is not zero.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**12600 [Channel %1: ] Block %2 invalid line checksum**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** On processing an INI file or when executing a TEA file, an invalid line checksum has been detected.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct INI file or correct MD and create new INI file (via "upload").  
**Program** Switch control OFF - ON.  
**Continuation:**

**12610 [Channel %1: ] Block %2 accessing single character with call-by-reference parameter not possible %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** An attempt has been made to use a single character access for a call-by-reference parameter.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Temporarily store single characters in user-defined CHAR variable and transfer this.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12620 [Channel %1: ] Block %2 accessing this variable as single character not possible %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Source string

**Definitions:** The variable is not a user-defined variable. The single character access is only allowed for user-defined variables (LUD/GUD).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Temporarily store variable in user-defined STRING, process this and put back into storage.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12630 [Channel %1: ] Block %2 skip ID/label in control structure not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number

**Definitions:** Blocks with control structures (FOR, ENDIF, etc.) cannot be concealed and must not contain any labels.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program: Reproduce skip ID via an IF query. Write the label alone in the block before the control structure block.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12640 [Channel %1: ] Block %2 invalid nesting of control structures**

**Parameters:** %1 = Channel number  
 %2 = Block number

**Definitions:** Error in program run: Opened control structures (IF-ELSE-ENDIF, LOOP-ENDLOOP etc.) are not terminated or there is no beginning of loop for the programmed end of loop.  
 Example:  
 LOOP ENDIF ENDLOOP

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct part program in such a way that all opened control structures are also terminated.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**12641 [Channel %1: ] Block %2 maximum nesting depth of control structures exceeded**

**Parameters:** %1 = Channel number  
 %2 = Block number

**Definitions:** Max. nesting depth control structures (IF-ELSE-ENDIF, LOOP-ENDLOOP etc.) exceeded. At the present time, the max. nesting depth is 8.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct part program. If necessary, move parts to a subroutine.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**12650 [Channel %1: ] block %2 axis identifier %3 different in channel %4**

**Parameters:** %1 = Channel number  
 %2 = Block number  
 %3 = Source symbol  
 %4 = Channel number with different axis definition

**Definitions:** In cycles that are preprocessed at Power On, only those geometry and channel axis identifiers may be used that exist in all channels with the same meaning. In different channels, different axis indices are assigned to the axis identifier. The axis identifiers are defined via MD20060 \$MC\_AXCONF\_GEOAX\_NAME\_TAB and MD20080 \$MC\_AXCONF\_CHANAX\_NAME\_TAB. Example: C is the 4th channel axis in channel 1 and the 5th channel axis in channel 2.  
 If the axis identifier C is used in a cycle that is preprocessed at Power On, then this alarm is issued.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 1. Modify machine data: Select the same identifiers for geometry and channel axes in all channels. Example: The geometry axes are called X, Y, Z in all channels. They can then also be programmed directly in preprocessed channels.  
 2. Do not program the axis directly in the cycle but define it as a parameter of the axis type. Example: Cycle definition:  
 PROC DRILL(AXIS DRILLAXIS) G1 AX[DRILLAXIS]=10 F1000 M17  
 Call from the main program:  
 DRILL(Z)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>12660</b>	<b>[Channel %1: ] Block %2 motion synchronous action: variable %3 reserved formotion synchronous actions and technology cycles</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Variable name
<b>Definitions:</b>	The displayed variable may only be used in motion synchronous actions or in technology cycles. For example, '\$R1' may only be used in motion synchronous actions. In standard part programs R parameters are programmed with R1.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12661</b>	<b>[Channel %1: ] Block %2 technology cycle %3: no further subprogram call possible</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Name of the technology cycle call
<b>Definitions:</b>	In a technology cycle it is not possible to call a subroutine or another technology cycle.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12700</b>	<b>[Channel %1: ] Block %2 contour definition programming not allowed as modal sub-programis active</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In the external language mode, a block is programmed with contour definition and a modal cycle is active at the same time. Because of unclear address assignment (e.g. R = radius for contour definition or return plane for drilling cycle) contour definition programming must not be used when a modal cycle is active.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>12701</b>	<b>[Channel %1: ] Block %2 illegal interpolation type for contour definition active</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In one contour definition block, G01 is not active as interpolation function. In one contour definition block, the linear interpolation always has to be selected with G01. G00, G02, G03, G33 etc. are not permitted.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Modify part program. Program linear interpolation G01.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12710 [Channel %1: ] Block %2 illegal language element in external language mode**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The programmed language element is not allowed or unknown in external language mode. Only the language elements from Siemens mode which are used for subprogram calls (except for Lxx) and the language constructs for program repetition with REPEAT (UNTIL) are allowed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.  
 Check that the language command is available in Siemens mode. Switch to Siemens mode with G290. Program the command in the next block and switch back to the external language mode in the following block.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12720 [Channel %1: ] Block %2 program number for macro call (G65/G66) missing**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** During macro call with G65/G66 no program number was defined. The program number must be programmed with address "P".

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**12722 [Channel %1: ] Block %2 multiple ISO\_2/3 macro or cycle calls in the block**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A mixture of cycle and macro calls are programmed in a block, e.g. cycle calls with G81 - G89 together with an M macro in the block or a G65/G66 macro call together with M macros in the block.  
 G05, G08, G22, G23, G27, G28, G29, G30, G50.1, G51.1, G72.1, G72.2 functions (ISO mode) also execute subroutine calls. Only one macro or cycle call can appear in an NC block.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Deactivate modal cycles or modal macro calls if one of the above mentioned G functions has been programmed.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**



---

**12724**                    **[Channel %1: ] Block %2 no radius programmed for cylinder interpolation activation/deactivation**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            When programming G07.1 (cylinder interpolation TRACYL), no cylinder radius has been programmed. Selection of the cylinder interpolation (TRACYL) with G07.1 C <cylinder radius> deselect with G07.1 C0. For "C" the name of the rotary axis defined in the TRACYL machine data has to be programmed.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 G07.1 block, program the cylinder radius under the name of the rotary axis for the cylinder interpolation.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**12726**                    **[Channel %1: ] Block %2 illegal plane selection with parallel axes**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            In a block with plane selection (G17 \_ G19), a basic axis of the coordinate system must not be programmed together with the parallel axis assigned to it.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 For plane selection with G17, G18, G19 either program the basic axis of the coordinate system or the assigned parallel axis.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**12728**                    **[Channel %1: ] Block %2 distance for double turret not set**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            The tool clearance for the double turret head in the SD42162 \$SC\_EXTERN\_DOUBLE\_TURRET\_DIST is 0.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Enter tool clearance for the double turret head in the SD42162 \$SC\_EXTERN\_DOUBLE\_TURRET\_DIST.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**12730**                    **[Channel %1: ] Block %2 no valid transformation machine data parameterized**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            The machine data MD24100 \$MC\_TRAFO\_TYPE\_1, MD24110 \$MC\_TRAFO\_AXES\_IN\_1[1], MD24210 \$MC\_TRAFO\_AXES\_IN\_2[1] are incorrectly set for G07.1, G12.1.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Enter valid transformation identifier for TRACYL in MD24100 \$MC\_TRAFO\_TYPE\_1 and the rotary axis number in MD24110 \$MC\_TRAFO\_AXES\_IN\_1[1] or MD24210 \$MC\_TRAFO\_AXES\_IN\_2[1].

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**12740 [Channel %1: ] Block %2 modal macro call %3 not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Source string

**Definitions:** When calling a modal macro no other modal macro, modal cycle or modal subroutine may be active.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**12750 [channel %1: ] block %2 T splitting not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** ISO mode turning: T programming is not possible since the T word cannot be clearly separated by tool number and correction number.  
Splitting the T word is determined by the machine dates 10888 \$MN\_EXTERN\_DIGITS\_TOOL\_NO and 10889 \$MN\_EXTERN\_DIGITS\_OFFSET\_NO. However, only one of the two functions may be active, and at least one function must be active. Alarm occurs only then when no function is active (both MDs = 0) or both functions are active (both MDs <> 0).

**Reaction:** Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Machine data  
Adjust 10888 EXTERN\_DIGITS\_TOOL\_NO or  
10889 EXTERN\_DIGITS\_OFFSET\_NO.  
At least one function must be active, but both functions must not be active either.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**12755 [channel %1: ] block %2 formatting %3 not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Faulty format instructions

**Definitions:** The format instructions programmed with the ISOPRINT command are incorrect:  
- various format instructions %m.nP and %.nP were applied  
- other format instructions than %P were applied

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** - correct ISOPRINT command  
- within an ISOPRINT command, only format instructions of the same type %m.nP or %.nP may be applied

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

---

**14000 [Channel %1: ] Block %2 illegal end of file**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Alarm 14000 is output in the following situations: - Parts program was not terminated with M30, M02 or M17. - Executing from external: Download was aborted (e.g. because HMI was switched off).
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- End parts program with M30, M02 or M17 and start parts program. - Executing from external: If the download for the selected program was aborted, the default program _N_MPF0 is automatically selected with RESET The selection of the user program must be repeated after that.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**14001 [Channel %1: ] Block %2 illegal end of block**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	After system-internal data manipulation (e.g. when reloading from an external source) a part file can end without having LF as the last character.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Read out the part program, modify it with a text editor (e.g., insert blanks or comments before the displayed block), so that after reading it in again the part program has a different structure in the memory.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**14005 [Channel %1: ] Block %2 program %3 program-specific start disable has been set**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Program name
<b>Definitions:</b>	Program %3 cannot be executed, as the program-specific start disable has been set for this file.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reset the program-specific start disable for file %3.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14006 [Channel %1: ] Block %2 invalid program name %3**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Program name
--------------------	--

**Definitions:** When selecting or calling an NC program it was found that the program name did not follow NC conventions:  
 - The length of the program name, without prefix `_N_` and Suffix `_MPF / _SPF`, must not exceed 24 characters, as otherwise the program name is truncated in the OPI variables.

**Reaction:** Alarm display.

**Remedy:**  
 - Shorten the name of the program.  
 - Suppress the alarm with MD 11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 9.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**14008 [Channel %1: ] Block %2 WRITE command writes in the temporary memory area in /\_N\_EXT\_DIR**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A workpiece is executed from an external data register (Execute from external drives function). The part programs are temporarily stored in the NCK directory `/_N_EXT_DIR`. An attempt is now made to write in this temporary directory with a WRITE command.  
 The alarm is intended to indicate that this data is not stored in the original directory on the external data carrier, and will be lost at the next part program selection because the programs in the directory `/_N_EXT_DIR` will then be deleted.

**Reaction:** Alarm display.

**Remedy:** State a directory that remains permanently loaded in the NCK as the target for the WRITE command (e.g. `MPF_DIR`). The alarm can be suppressed with MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 8.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**14009 [Channel %1: ] Block %2 illegal program path %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Program path

**Definitions:** The part program command CALLPATH was called with a parameter (program path) referring to a directory which does not exist in the file system of the NCK.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:**  
 - Modify the CALLPATH instruction such that the parameter contains the complete path name of the loaded directory.  
 - Load the programmed directory in the file system of the NCK.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14010 [Channel %1: ] Block %2 invalid default parameter in subroutine call**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In a subroutine call with parameter transfer, parameters have been omitted that cannot be replaced by default parameters (call-by-reference parameters or parameters of type AXIS. The other missing parameters are defaulted with the value 0 or with the unit frame in the case of frames).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The missing parameters must be provided with values in the subroutine call.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>14011</b>	<b>[Channel %1: ] Block %2 program %3 not existing or will be edited</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Program name
<b>Definitions:</b>	A subroutine call was aborted because the called subroutine could not be opened. The subroutine call can be executed via <ul style="list-style-type: none"> <li>- subroutine designator</li> <li>- CALL / PCALL / MCALL command</li> <li>- SETINT command</li> <li>- M/T function replacement</li> <li>- event-driven program calls (PROG_EVENT)</li> <li>- selection of a PLC ASUB via PI "_N_ASUP__" and/or FB-4</li> <li>- calling a PLC ASUB via interrupt interface (FC-9)</li> </ul> There are various reasons for the alarm: <ul style="list-style-type: none"> <li>- the subroutine is not in the parts program memory the subroutine</li> <li>- the subroutine is not in the search path (selected directory, _N_SPF_DIR or cycle directories _N_CUS_DIR, _N_CMA_DIR, _N_CST_DIR)</li> <li>- the subroutine has not been released or is being edited</li> <li>- faulty absolute path name in subroutine call: <ul style="list-style-type: none"> <li>Examples of complete path names: /_N_directoryName_DIR/_N_programmName_SPF or /_N_WKS_DIR/_N_wpdName_WPD/_N_programmName_SPF. directoryName: MPF, SPF, CUS, CMA, CST (predefined directories). wpdName: application-specific designator for workpiece directories (max. of 24 signs). programmName: Name of subroutine (max. of 24 signs)</li> <li>- A reload buffer for executing from external was called as subroutine.</li> </ul> </li> </ul> Note: Unknown designators (string) found in the parts program line by themselves, are interpreted as subroutine calls.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Ensure that the subroutine (alarm parameter %3) <ul style="list-style-type: none"> <li>- is available in the parts program memory</li> <li>- has been released and is not being edited</li> <li>- is available in the search path if not being called via an absolute path name.</li> </ul>
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14012</b>	<b>[Channel %1: ] Block %2 maximum subroutine level exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The maximum nesting depth of 8 program levels has been exceeded. Subroutines can be called from the main program, and these in turn may have a nesting depth of 7. In interrupt routines the maximum number of levels is 4!
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify the machining program so that the nesting depth is reduced, e.g. using the editor copy a subroutine of the next nesting level into the calling program and remove the call for this subroutine. This reduces the nesting depth by one program level.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**14013 [Channel %1: ] Block %2 number of subroutine passes invalid**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In a subroutine call the programmed number of passes P is zero or negative.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program number of passes between 1 and 9 999.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14014 [Channel %1: ] Selected program %3 not available or will be edited**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Program name

**Definitions:** The selected parts program is not in the NCK memory or the access authorization for the program selection is from a higher level than the current control status.  
 During creation, this program received the protection level of the NC control which was active at the time.  
 In SW 5 or higher a program edited on HMI can no longer be started with NC Start.  
 The alarm will also be issued, if a file other than the specified definition file has been selected for the GUD or macro definition.

**Reaction:** Alarm display.

**Remedy:** Reload the program in the NCK memory or check and correct the name of the directory (workpiece overview) and the program (program overview) and reselect.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**14015 [Channel %1: ] Block %2 program %3 is not enabled**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Program name

**Definitions:** The execution right currently set in the control (e.g. key switch position 0) is inadequate to execute part program %3.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Raise the execution right to match the protection level of part program %3  
 - Assign a lower protection level to part program %3 or release (key switch protection level 0)

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14016 [Channel %1: ] Block %2 error when calling the subroutine via M/T function**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	The following conflict was detected in a subprogram call per M or T function: In the block referenced by parameter %2: - An M or T function replacement has already been activated - A modal subprogram call is active - A subprogram return jump is programmed - An end of program is programmed - An M98 subprogram call is active (only in external language mode) - T function replacement by D function programming in the same part program line is not possible with active TLC (G43/G44) in ISO2 system.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	An M or T function replacement is only possible if a subprogram call or return jump has not already been performed as a result of other program constructs. The part program must be corrected accordingly.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14017 [Channel %1: ] Block %2 syntax error when calling the subroutine via M function

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	When calling M code subroutine with parameter transfer, an illegal syntax was detected: - Address extension not programmed as a constant. - M function value not programmed as a constant. Note: If a parameter transfer has been programmed via MD10718 \$MN_M_NO_FCT_CYCLE_PAR for an M function replacement, the following restriction applies to this M function: both the address extension and the M function value must be programmed for replacement as constants.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Change the programming of the M function.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14018 [Channel %1: ] Block %2 parts program command %3 not executable (protection level setpoint value / actual value: %4)

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Programmed command %4 = Protection level of the command / current protection level
<b>Definitions:</b>	To parts program command %3, a protection level has been assigned that is logically higher (smaller in value) than the current access right, or the command does not exist in the current control configuration.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify parts program. Please see the Siemens Programming Guide or OEM documentation for the language commands permissible for the relevant system configuration.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14019 [Channel %1: ] block %2 motion synchronous action: %3 wrong value or wrong number of parameters on function or procedure call**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID

**Definitions:** - An illegal parameter value was specified in a function or procedure call.  
- An illegal number of actual parameters was programmed in a function or procedure call.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14020 [Channel %1: ] Block %2 wrong value or wrong number of parameters on function or procedure call**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** - An illegal parameter value was specified in a function or procedure call.  
- An illegal number of actual parameters was programmed in a function or procedure call.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14021 [Channel %1: ] Block %2 wrong value or wrong number of parameters on function or procedure call**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** - An illegal parameter value was specified in a function or procedure call.  
- An illegal number of actual parameters was programmed in a function or procedure call.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14022 [Channel %1: ] Block %2 error on function or procedure call, error code %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Error code



---

<b>Definitions:</b>	An error occurred during a function or procedure call. The cause of the error is indicated more closely by an error code. The meaning of the error code can be found in the documentation of the function or procedure that caused the error.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 14025 **[Channel %1: ] Block %2 motion synchronous action: illegal modal ID**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In modal motion synchronous actions an illegal ID number has been assigned.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 14026 **[Channel %1: ] Block %2 motion synchronous action: invalid polynomial number in the FCTDEF command**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An FCTDEF command was programmed with a polynomial number that exceeds the maximum value set in MD28252 \$MC_MM_NUM_FCTDEF_ELEMENTS.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 14027 **[Channel %1: ] Block %2 motion-synchronous action: Too many technology cycles programmed.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	You can call a maximum of eight technology cycles with one motion-synchronous action. You exceeded the upper limit.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**14028 [Channel %1: ] Block %2 motion-synchronous action: Technology cycle programmed with too many parameters**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Maximum number of transfer parameters for one technology cycle exceeded.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Change technology cycle

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14030 [Channel %1: ] Block %2 combine OSCILL and POSP during oscillation with infeedmotion**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When oscillating controlled by synchronized actions, the assignment of oscillating and infeed axis (OSCILL) as well as the definition of the infeed (POSP) must be carried out in one NC block.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14033 [Channel %1: ] Block %2 involute: no end point programmed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** No end point was programmed for the involute. This is either possible via direct programming with the geometry axis identifiers or by specifying the angle between start and end vector.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14034 [Channel %1: ] Block %2 involute: angle of rotation too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** With programming of the angle of rotation (with AR) for involute interpolation, the maximum programmable angle of rotation is limited if the involute is moving towards the basic circle. The maximum value is reached if the involute touches the basic circle. With MD21016 \$MC\_INVOLUTE\_AUTO\_ANGLE\_LIMIT = TRUE, each angle is accepted without an alarm; if necessary, the angle is automatically limited during interpolation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14035 [Channel %1: ] Block %2 involute: start point invalid

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With involute interpolation, the start point of the involute must be outside the basic circle. The programmed center point or radius must be adapted accordingly.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14036 [Channel %1: ] Block %2 involute: end point invalid

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With involute interpolation, the end point of the involute must be outside the basic circle. The programmed center point / radius or end point must be adapted accordingly.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14037 [Channel %1: ] Block %2 involute: radius invalid

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With involute interpolation, the programmed radius of the basic circle must be greater than zero.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14038 [Channel %1: ] Block %2 involute not definable: end point error

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed end point does not lie on the involute defined by the start point, radius and center point of the basic circle. The deviation of the effective end radius from the programmed value is greater than the permissible value specified in MD21015 \$MC\_INVOLUTE\_RADIUS\_DELTA.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14039 [Channel %1: ] Block %2 involute: end point programmed several times**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** With involute interpolation, either the end point with the geometry axis identifiers or the angle of rotation with AR=value can be programmed. Simultaneous programming of end point and angle of rotation in one block is not allowed, since the end point can thus not be defined exactly.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14040 [Channel %1: ] Block %2 error in end point of circle**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In circular interpolation, either the circle radii for the initial point and the end point are further apart, or the circle center points are further apart, than specified in the machine data.

1. In circle radius programming the starting and end points are identical, thus the circle position is not determined by starting and end points.
2. Radii: The NCK calculates from the present start point and the other programmed circle parameters the radii for the start and the end point.  
 An alarm message is issued if the difference between the circle radii is either  
 - greater than the value in the MD21000 \$MC\_CIRCLE\_ERROR\_CONST (for small radii, if the programmed radius is smaller than the quotient of the machine data MD21000 \$MC\_CIRCLE\_ERROR\_CONST divided by MD21010 \$MC\_CIRCLE\_ERROR\_FACTOR), or  
 - greater than the programmed radius multiplied by the MD21000 \$MC\_CIRCLE\_ERROR\_FACTOR (for large radii, if the programmed radius is greater than the quotient of the machine data MD21000 \$MC\_CIRCLE\_ERROR\_CONST divided by MD21000 \$MC\_CIRCLE\_ERROR\_FACTOR).
3. Center points: A new circle center is calculated using the circle radius at the starting position. It lies on the mid-perpendicular positioned on the connecting straight line from the starting point to the end point of the circle. The angle in the radian measure between both straight lines from the starting point to the center calculated/programmed as such must be lower than the root of 0.001 (corresponding to approx. 1.8 degrees).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 Check MD21000 \$MC\_CIRCLE\_ERROR\_CONST and MD21000 \$MC\_CIRCLE\_ERROR\_FACTOR. If the values are within reasonable limits, the circle end point or the circle mid-point of the part program block must be programmed with greater accuracy.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14045 [Channel %1: ] Block %2 error in tangential circle programming**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	The alarm may have the following causes: The tangent direction is not defined for tangent circle, e.g. because no other travel block has been programmed before the current block. No circle can be formed from start and end point as well as tangent direction because - seen from the start point - the end point is located in the opposite direction to that indicated by the tangent. It is not possible to form a tangent circle since the tangent is located perpendicular to the active plane. In the special case in which the tangent circle changes to a straight line, several complete circular revolutions were programmed with TURN.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

#### **14048 [Channel %1: ] Block %2 wrong number of revolutions in circle programming**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	In the circle programming, a negative number of full revolutions has been specified.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

#### **14050 [Channel %1: ] Block %2 nesting depth for arithmetic operations exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	For calculating arithmetic expressions in NC blocks, an operand stack with a fixed set size is used. With very complex expressions, this stack can overflow. This may also occur with extensive expressions in synchronized actions.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Divide up complex arithmetic expressions into several simpler arithmetic blocks.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

#### **14051 [Channel %1: ] Block %2 arithmetic error in part program**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	- In calculating an arithmetic expression, an overflow has occurred (e.g. division by zero) - In a data type, the representable value range has been exceeded
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Analyze the program and correct the defective point in the program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14055 [Channel %1: ] Block %2 impermissible NC language substitution, error code %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Error code

**Definitions:** This alarm occurs in conjunction with an NC language substitution configured in MD30465 \$MA\_AXIS\_LANG\_SUB\_MASK. Error code %3 gives more detailed information about the cause of the problem:  
Error code:  
1: Several events had been programmed, causing the replacement cycle to be called. Only one substitution is allowed per part program line.  
2: A non-modal synchronized action had also been programmed for the part program line with the NC language substitution.  
3: The system variables \$P\_SUB\_SPOSIT and \$P\_SUB\_SPOSMODE were called outside a replacement cycle.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Modify the NC program

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14060 [Channel %1: ] Block %2 invalid skip level with differential block skip**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With "Differential block skip", a skip level greater than 7 has been specified. (In packet 1 specification of a value for the skip level is rejected by the converter as a syntax error, i.e. the only possibility is a "Suppress block" ON/OFF on one level).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter a skip level (number behind the slash) less than 8.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14065 [channel %1: ] block %2 error in SPRINT/ISOPRINT command: error code %4 information %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Additional information  
%4 = Error code

---

<b>Definitions:</b>	When interpreting the SPRINT or ISOPRINT command, an error was detected which was described in more detail by parameter %4. Parameter %3 may supply additional information on the incurring problem. List of error codes (parameter %4): 1: invalid format description %3 recognized 2: Format %n.P: overrange when converting into 32 bit number 3: Format %P: Character %3 cannot be converted with the code selected by MD 10750 / \$MN_SPRINT_FORMAT_P_CODE. 4: Maximum string length of 400 bytes exceeded 5: SPRINT/ISOPRINT command programmed with an invalid number of parameters 6: SPRINT/ISOPRINT parameters programmed with impermissible data type 7: Format %m.n.P: overrange due to parameter n with MD 10751 / \$MN_SPRINT_FORMAT_P_DECIMAL = 0
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct SPRINT and/or ISOPRINT command(s).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14066</b>	<b>[channel %1: ] block %2 error when outputting to external device on command %3, error code: %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Part program command %4 = Error code
<b>Definitions:</b>	When interpreting the commands ISOOPEN, ISOPRINT or ISOCLOSE, an error was detected which is described in detail by the error code. List of error codes: 1: external device cannot be opened 2: external device is not configured 3: external device configured with invalid path 4: no access rights for external device 5: external device already exclusively assigned 6: external device already assigned in shared mode 8: maximum number of external devices exceeded 9: option not set for LOCAL_DRIVE 10: invalid external path programmed 14: external device not assigned or opened 20: error when writing on external device 21: error when closing external device
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Correcting parameterization of ISOCLOSE, ISOPRINT or ISOCLOSE command. See also MD 10830 \$MN_EXTERN_PRINT_DEVICE and MD 10831 \$MN_EXTERN_PRINT_MODE
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>14070</b>	<b>[Channel %1: ] Block %2 memory for variables not sufficient for subroutine call</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** A called subroutine cannot be processed (opened), either because the internal data memory to be created for general purposes is not large enough, or because the available memory for the local program variables is too small. The alarm can only occur in MDI mode.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Analyze the part program section:  
1. Has the most useful data type always been selected in the variable definitions? (For example REAL for data bits is poor; BOOL would be better)  
2. Can local variables be replaced by global variables?

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**14080 [Channel %1: ] Block %2 jump destination %3 not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Jump destination

**Definitions:** In conditional and unconditional jumps, the jump destination within the program must be a block with a label (symbolic name instead of block number). If no jump destination has been found with the given label when searching in the programmed direction, an alarm is output.  
For parameterizable returns with RET to block number or label, the jump destination within the program must be a block with the block number or label (symbolic name instead of block number).  
For returns over several levels (parameter 2), the jump destination must be a block within the program level you jumped to.  
For returns with a string as return destination, the search string must be a name known in the control and the search string must be preceded in the block by a block number and/or a label only.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check NC part program for the following possible errors:  
1. Check whether the target designation is identical with the label.  
2. Is the jump direction correct?  
3. Has the label been terminated with a colon?

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14082 [Channel %1: ] Block %2 label %3 program section not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Start or end label

**Definitions:** The start point for repetition of the program part with CALL <program name> BLOCK <start label> TO <end label> has not been found or the same program part repetition has been called recursively.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check the start and end labels for programming repetition in the user program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

**14085 [Channel %1: ] Block %2 instruction not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The instruction 'TML()' may only be used in the subprogram, which replaces the T command.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**14088 [Channel %1: ] Block %2 axis %3 doubtful position**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	An axis position larger than 3.40e+38 increments has been programmed. This alarm can be suppressed with bit11 in MD11410 \$MN_SUPPRESS_ALARM_MASK.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**14090 [Channel %1: ] Block %2 invalid D number**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A value less than zero has been programmed under address D. A set of parameters with 25 correction values has been automatically assigned to each active tool. Each tool can have 9 sets of parameters (D1 - D9, initial setting is D1). When the D number changes, the new parameter set is active (D0 is used for deselecting the correction values). N10 G.. X... Y... T15 ; Parameter set D1 of T15 active N50 G.. X... D3 M.. ; Parameter set D3 of T15 active N60 G.. X.. T20 ; Parameter set D1 of T20 active
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program D numbers in the permissible value range (D0, D1 to D9).
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**14091 [Channel %1: ] Block %2 illegal function, index %3**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index
--------------------	---

**Definitions:** A function has been programmed or triggered which is not permitted in the current program context. The function in question is encoded in the "index" parameter:  
 Index == 1: "RET" command was programmed in the main program level  
 Index == 2: Conflict between "Cancel level"/"Clear number of passes" and "Implicit GET"  
 Index == 3: Conflict ASUB start immediately after selection of overstore (up to P3)  
 Index == 4: MD10760 \$MN\_G53\_TOOLCORR = 1 : SUPA/G153/G53 programmed in G75  
 Index == 5: POSRANGE command not programmed in synchronized action  
 Index == 6: SIRELAY command not programmed in synchronized action  
 Index == 7: GOTOF/GOTOB/GOTO command programmed with string variable in synchronized action.  
 Index == 8: COA application "Cutting generator" not active  
 Index == 9: Tool radius compensation active in G75  
 Index == 10: Number of return levels too big, with RET (...xy) across several program levels

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Index == 1: Substitute "RET" command with M17/M30  
 Index == 2: Insert an auxiliary block (e.g. M99) after the subroutine call to which the "Cancel level"/"Clear number of passes" refers  
 Index == 3: Overstore an auxiliary block (e.g. M99), then start ASUB (up to P3)  
 Index == 4: With MD10760 \$MN\_G53\_TOOLCORR = 1: Do not activate SUPA/G53/G153 in the G75 block  
 Index == 5: Program POSRANGE command in synchronized action  
 Index == 6: Program SIRELAY command in synchronized action  
 Index == 7: Program GOTOF/GOTOB/GOTO command with block number or label  
 Index == 8: Load COA application "Cutting generator"  
 Index == 9: Tool radius compensation active in G75

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14092 [Channel %1: ] Block %2 axis %3 is wrong axis type**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** One of the following programming errors has occurred:  
 1. The keyword WAITP(x) "Wait with block change until the specified positioning axis has reached its end point" has been used for an axis that is not a positioning axis.  
 2. G74 "Reference point approach from the program" has been programmed for a spindle. (Only axis addresses are permitted).  
 3. The keyword POS/POSA has been used for a spindle. (The keywords SPOS and SPOSA must be programmed for spindle positioning).  
 4. If the alarm occurs with the "Rigid tapping" function (G331), the following causes are conceivable:  
 - The master spindle is not in position-controlled mode.  
 - Incorrect master spindle  
 - Master spindle without encoder  
 5. An axis name was programmed which no longer exists (e.g. when using axial variables as an index). Or NO\_AXIS has been programmed as an index.  
 6. If 14092 is output as a note with alarm 20140 Motion-synchronous action: traversing of command axis, the following causes are possible:  
 - The axis is currently being traversed by the NC program already.  
 - An overlaid movement is active for the axis.  
 - The axis is active as following axis of a coupling.  
 - An interpolation compensation such as a temperature compensation is active for the axis.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Correct the part program according to which of the above errors is involved.  
 - Program SPOS.  
 - Set the correct master spindle with SETMS.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14093 [Channel %1: ] Block %2 path interval <= 0 with polynomial interpolation

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the polynomial interpolation POLY, a negative value or 0 has been programmed under the keyword for the polynomial length PL=...

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.  
Correct the value given in PL = ...

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14094 [Channel %1: ] Block %2 polynomial degree greater than 3 programmed for polynomial interpolation

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The polynomial degree in the polynomial interpolation is based on the number of programmed coefficients for an axis. The maximum possible polynomial degree is 3, i.e. the axes are according to the function:  
 $f(p) = a_0 + a_1 p + a_2 p^2 + a_3 p^3$   
The coefficient a0 is the actual position at the start of interpolation and is not programmed!

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Reduce the number of coefficients. The polynomial block may have a form no greater than the following:  
N1 POLY PO[X]=(1.11, 2.22, 3.33) PO[Y]=(1.11, 2.22, 3.33)  
N1 PO[n]=... PL=44  
n ... n ... axis identifier, max. 8 path axes per block

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14095 [Channel %1: ] Block %2 radius for circle programming too small

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The radius entered for radius programming is too small, i.e. the programmed radius is smaller than half of the distance between start and end point.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14096 [Channel %1: ] Block %2 illegal type conversion**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During the program run, a variable value assignment or an arithmetic operation has caused data to be processed in such a way that they have to be converted to another type. This would lead to the value range being exceeded. Value ranges of the various variable types:  
 - REAL: Property: Fractional number with dec. pt., value range: +/--(2-1022-2+1023)  
 - INT: Property: Integers with signs, value range: +/--(231-1)  
 - BOOL: Property: Truth value TRUE, FALSE, value range: 0,1  
 - CHAR: Property: 1 ASCII character, value range: 0-255  
 - STRING: Property: Character string (max. 100 values), value range: 0-255  
 - AXIS: Property: Axis addresses, value range: Axis names only  
 - FRAME: Property: Geometric information, value range: As for axis paths  
 Overview of type conversions:  
 - from REAL to: REAL: yes, INT: yes\*, BOOL: yes1), CHAR: yes\*, STRING: -, AXIS: -, FRAME: -  
 - from INT to: REAL: yes, INT: yes, BOOL: yes1), CHAR: if value 0 ...255, STRING: -, AXIS: -, FRAME: -  
 - from BOOL to: REAL: yes, INT: yes, BOOL: yes, CHAR: yes, STRING: -, AXIS: -, FRAME: -  
 - from CHAR to: REAL: yes, INT: yes, BOOL: yes1), CHAR: yes, STRING: yes, AXIS: -, FRAME: -  
 - from STRING to: REAL: -, INT: -, BOOL: yes2), CHAR: only if 1 character, STRING: yes, AXIS: -, FRAME: -  
 - from AXIS to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: yes, FRAME: -  
 - from FRAME to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: -, FRAME: yes  
 1) Value <> 0 corresponds to TRUE, value ==0 corresponds to FALSE.  
 2) String length 0 => FALSE, otherwise TRUE.  
 3) If only 1 character.  
 It is not possible to convert from type AXIS and FRAME nor into type AXIS and FRAME.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify the program section such that the value range is not exceeded, e.g. by a modified variable definition.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14097 [Channel %1: ] Block %2 string cannot be converted to AXIS type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The called function AXNAME - conversion of the transferred parameters of the STRING type to an axis name (return value) of the AXIS type - has not found this axis identifier in the machine data.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check the transferred parameter (axis name) of the function AXNAME to determine whether a geometry, channel or machine axis of this name has been configured by means of the machine data:  
 MD10000 \$MN\_AXCONF\_MACHAX\_NAME\_TAB  
 MD20060 \$MC\_AXCONF\_GEOAX\_NAME\_TAB  
 MD20080 \$MC\_AXCONF\_CHANAX\_NAME\_TAB

Select the transfer string in accordance with the axis name, and change the axis name in the machine data if necessary. (If a change of name is to take place via the NC part program, this change must first be validated by means of a "POWER-ON").

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14098 [Channel %1: ] Block %2 conversion error: no valid number found**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The string is not a valid INT or REAL number.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program. If it is an entry, then you can check whether the string is a number via the preset function ISNUMBER (with the same parameter).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**14099 [Channel %1: ] Block %2 result in string concatenation too long**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The result of string chaining returns a string which is greater than the maximum string length laid down by the system.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Adapt part program. With the function STRLEN, it is also possible to query the size of the sum string before executing the chaining operation.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**14100 [Channel %1: ] Block %2 orientation transformation not available**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Up to 4 transformation groupings (transformation types) can be set for each channel via machine data. If the keyword TRAORI(n) (n ... number of the transformation grouping) is used to address a transformation grouping for which the machine data is not defaulted, the alarm message will be triggered.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Check the number of the transformation grouping when calling the part program with the keyword TRAORI(n) (n ... number of the transformation grouping). - Enter the machine data for this transformation grouping and then activate by "Power On".
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14101 [Channel %1: ] Block %2 orientation transformation not active**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** Euler angles or a vector have been used in programming an orientation and no orientation transformation is active, i.e. the keyword TRAORI(n) (n ... number of transformation grouping) is missing.  
 Example of correct transformation programming:  
 N100 ... TRAORI(1)  
 N110 G01 X... Y... ORIWKS  
 N120 A3... B3... C3...  
 N130 A3... B3... C3...  
 :  
 N200 TAFOOF

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Before the transformation is applied, the number of the transformation grouping must be specified with the keyword TRAORI(n) (n is between 1 and 4).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14102 [Channel %1: ] Block %2 polynomial degree greater than 5 programmed for orientation vector angle**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** During polynomial interpolation for the orientation vector, a polynomial degree larger than 5 has been programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14103 [Channel %1: ] Block %2 error %3 when calling function CORRTRAFO.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Error code

**Definitions:** An error occurred when the CORRTRAFO function was called. The error number specifies the cause of the error.  
 Error numbers:  
 1: No transformation active.  
 2: No orientation transformation active.  
 3: The active orientation transformation was not defined with kinematic chains.  
 10: Invalid correction index (reference to the position in the kinematic chain).  
 11: No correction element is defined at the specified position.  
 12: No compensation element has been defined.  
 13: The compensation and correction elements are identical.  
 14: Unknown correction mode for the original element.  
 15: Unknown correction mode for the compensation element.  
 16: Illegal combination of the two call parameters \_CORR\_INDEX and \_CORR\_MODE.  
 17: The fine offset in the original element is too large.  
 18: The fine offset in the compensation element is too large.  
 19: No write right for the base dimension of the original element.  
 20: No write right for the base dimension of the compensation element.  
 21: No write right for the fine offset of the original element.  
 22: No write right for the fine offset of the compensation element.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Change function call.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**14104 [Channel %1: ] Block %2 Active transformation allows neither vector programming nor interpolation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The active orientation transformation does allow neither the programming of vectors for tool orientation nor the vector interpolation (ORIVECT, ORICONxx, usw) of the orientation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Change the NC program and/or the settings of the machine data  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14105 [Channel %1: ] Block %2 error %3 when calling the procedure CORRTRAF0.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Error code

**Definitions:** An error occurred when the CORRTRAF0 procedure was called. The cause of the error is described in more detail by the content of the error code:

- 1: No transformation active.
- 2: No orientation transformation active.
- 3: No orientation transformation defined with kinematic chains is active.
- 10: The parameter `_CORR_INDEX` refers to an invalid section index (the section index must not be negative and must not be greater than the number of orientation axes).
- 11: No correction element is defined in the section to which the `_CORR_INDEX` refers. That means there is no entry in `$NT_CORR_ELEM[n, 0..3]` which refers to an element of the current section.
- 12: No compensating element has been defined, although the parameter `CORR_MODE` requires a correction of this element. That means there is no entry in `$NT_CORR_ELEM[n, 0..3]` which refers to an element of the section that contains the compensation element.
- 13: The parameter `_CORRINDEX` refers to the compensating element, and that requires a correction to be compensated with the parameter `_CORR_MODE` (the compensation and correction elements must not be identical if a compensation is required).
- 14: Unknown correction mode for the correction element (invalid character in the units digit of `_CORR_COMP`).
- 15: Unknown correction mode for the compensation element (invalid character in the tens digit of `_CORR_COMP`).
- 16: As a result of the correction, the maximim permissible value of the fine offset in the correction element is exceeded.
- 17: As a result of the correction, the maximim permissible value of the fine offset in the compensation element is exceeded.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Change the NC program and/or the settings of the machine data  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14106**                    **[Channel %1: ] Block %2 orientation calculation not possible with ORISOL.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The G code ORISOL has been programmed and either no valid orientation has been programmed or no transformation is active which is able to supply possible axis positions for a predefined orientation.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the NC program

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14107**                    **[Channel %1: ] Block %2 illegal position in \$NT\_ROT\_AX\_POS[%3,%4].**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Trafo index  
                               %4 = Axis index

**Definitions:**            The position of the specified manual rotary axis is illegal; in other words, it violates the axis limits defined in \$NT\_ROT\_AX\_MIN / \$NT\_ROT\_AX\_MAX.  
                               This alarm may occur if a transformation is selected which uses this axis.  
                               In the case of manual axes with Hirth tooth systems, the transformation may involve a position which, due to the rounding of the value contained in \$NT\_ROT\_AX\_POS, actually relates to the adjacent grid position. The alarm may, therefore, also occur if the content of \$NT\_ROT\_AX\_POS is within permissible limits but the modified position used internally violates these limits.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the NC program

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14108**                    **[Channel %1: ] Block %2 kinematic transformation and toolholder active at the same time.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            Transformations defined with kinematic chains cannot be active at the same time as orientable toolholders.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the NC program

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14109**                    **[Channel %1: ] Block %2 simultaneous linear and rotary axis movement with static orientation transformation.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label



---

<b>Definitions:</b>	The interpolation type CP (G group code 49) is not permitted with an active static orientation transformation if linear and rotary axes have to interpolate simultaneously.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Change the NC program: Activate dynamic orientation transformation. Change the G code for group 49. Execute linear and rotary axis movement successively rather than simultaneously.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14110 [Channel %1: ] Block %2 Euler angles and orientation vector components programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An orientation were programmed with Euler angles and the component of an orientation vector at the same time. Example: N50 TRAORI (1) N55 A2=10 B2=20 C3=50 ; alarm, because Euler angle and orientation vector
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program only one type, in other words when transformation is switched on program either Euler angles only or orientation vectors (direction vectors) only.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14111 [Channel %1: ] Block %2 Euler angles, orientation vector and transformation axes programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An orientation has been programmed at the same time as Euler angles or components of an orientation vector and the machine axis influenced by the orientation. Example: N50 TRAORI (1) N55 A2=70 B2=10 C2=0 X50 ; alarm, because Euler angle and axes were programmed
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program only one type, in other words with transformation switched on program either Euler angles only or orientation vectors (direction vectors) only or deselect transformation (TRAFOOF) and set tool orientation by programming the auxiliary axes.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14112 [Channel %1: ] Block %2 programmed orientation path not possible

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** In 5-axis transformation, the two orientation axes place a coordinate system comprising lengths and circles of latitude on a spherical surface.  
 If the interpolation traverses the pole point, only the 5th axis will move and the 4th axis will retain its starting position. If a motion is programmed that does not traverse the pole point directly, but passes it very closely, the preset interpolation will be deviated from if the path forms a circle that is defined by the machine data: MD24530 \$MC\_TRAFO5\_NON\_POLE\_LIMIT\_1 (changeover angle that refers to the 5th axis). The interpolated contour is then placed through the pole (in the immediate vicinity of the pole, the 4th axis would otherwise have to accelerate most rapidly and then decelerate again).  
 For the 4th axis, the result is a position deviation as compared to the programmed value. The maximum permissible angle which the programmed and the interpolated path may include is stored in the MD24540 \$MC\_TRAFO5\_POLE\_LIMIT.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** In the vicinity of the pole, always make use of axis programming. Programming of tool orientations close to the pole should generally be avoided because this always leads to problems concerning dynamic response.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14113 [Channel %1: ] Block %2 programmed lead angle too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** No further explanation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14114 [Channel %1: ] Block %2 programmed tilt angle too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** No further explanation.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14115 [Channel %1: ] Block %2 illegal definition of workpiece surface**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The surface normal vectors programmed at the beginning of block and at the end of block point in opposite directions.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14116 [Channel %1: ] Block %2 absolute orientation programmed while ORIPATH/ORIPATHS is active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The orientation has been entered as an absolute value (e.g. by a direction vector or a rotation vector), although ORIPATH or ORIPATHS are active. When ORIPATH/ORIPATHS is active, the orientation is determined from the lead angle, tilt angle and angle of rotation relative to the path tangent and surface normal vector.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14117 [Channel %1: ] Block %2 no angle or direction of the cone programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With taper circumference interpolation of orientation (ORICONCW and ORICONCC), either the opening angle or the direction vector of the taper must be programmed. Otherwise, the change of orientation is not clearly defined.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14118 [Channel %1: ] Block %2 no end orientation programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With taper circumference interpolation of orientation, no end orientation has been programmed. The change of orientation is therefore not clearly defined.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14119 [Channel %1: ] Block %2 no intermediate orientation programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With taper circumference interpolation of orientation with ORICONIO, an intermediate orientation must also be programmed in addition to the end orientation.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14120 [Channel %1: ] Block %2 plane determination for programmed orientation not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed orientation vectors (direction vectors) in the beginning of block and end of block point include an angle of 180 degrees. Therefore the interpolation plane cannot be determined.  
Example:  
N50 TRAORI (1)  
N55 A3=0 B3=0 C3=1  
N60 A3=0 B3=0 C3=-1 ; the vector of this block is precisely opposite to that in the preceding block.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify the part program so that the orientation vectors of a block are not directly opposed to each other, for instance by dividing the block up into 2 subblocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14121 [Channel %1: ] Block %2 no orientation defined (distance equals zero).**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed coordinates for the 2nd space curve with XH, YH, ZH do not define any tool orientation, as the distance of the curve to the TCP is becoming zero.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Change the part program so that the distance between the two curves is not becoming zero and that a tool orientation is defined.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14122 [Channel %1: ] Block %2 angle and direction of the cone programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With taper circumference interpolation of orientation with ORICONCW and ORICC, only the opening angle or the direction of the taper may be programmed. Programming of both in one single block is not allowed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>14123</b>	<b>[Channel %1: ] Block %2 nutation angle of the cone too small</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	With taper circumference interpolation, the programmed opening angle of the taper must be greater than the half of the angle between the start and end orientation. Otherwise, a taper cannot be defined.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>14124</b>	<b>[Channel %1: ] Block %2 start tangent for orientation is zero</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	With taper circumference interpolation with tangential continuation (ORICONTO), the start tangent of orientation must not be zero.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>14125</b>	<b>[Channel %1: ] Block %2 programmed rotation is not possible</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The programmed rotation of tool orientation cannot be traversed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>14126</b>	<b>[Channel %1: ] Block %2 ORIPATH lift factor impermissible.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The value programmed with ORIPLF = r is not within the permissible range. The relative retraction factor must lie within interval $0 \leq r < 1$ .
<b>Reaction:</b>	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

**14127**                    **[Channel %1: ] Block %2 rotation programmed several times**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The rotation (3rd degree of freedom of orientation at 6-axis transformations) has been programmed several times.  
                               The rotation is clearly defined by one of the following specifications:  
                               - Specification of the rotary axis positions included in the transformation  
                               - Specification of Euler or RPY angles (A2, B2, C2)  
                               - Specification of the normal orientation vector (AN3, BN3, CN3)  
                               - Specification of the THETA angle of rotation

**Reaction:**                Correction block is reorganized.  
                               Interpreter stop  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program**                 Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14128**                    **[Channel %1: ] Block %2 absolute programming of the orienting rotation with active ORIOTC.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The rotation of orientation (3rd degree of freedom of orientation for 6-axis transformations) has been programmed with G code ORIOTC active. This is not possible, as the rotation of orientation is oriented relatively to the path tangent when ORIOTC is active.  
                               With ORIOTC, it is only possible to program the angle of rotation THETA that indicates the angle of the rotation vector to the path tangent.

**Reaction:**                Correction block is reorganized.  
                               Interpreter stop  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program**                 Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14129**                    **[Channel %1: ] Block %2 orientation angles and orientation vector components programmed**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            An orientation angle and components of an orientation vector were programmed at the same time.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program**                 Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

<b>14130</b>	<b>[Channel %1: ] Block %2 too many initialization values given</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	On assigning an array by means of SET, more initialization values than existing array elements have been specified in the program run.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce the number of initialization values.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>14131</b>	<b>[Channel %1: ] Block %2 orientation axes and lead/tilt angles programmed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An orientation angle and a leading or sideways angle were programmed at the same time.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>14132</b>	<b>[Channel %1: ] Block %2 orientation axes incorrectly configured</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Possible causes: - The configuration of the orientation axes does not match the machine kinematics. Also, for example, when the position measuring system has not been set for the rotary axes. - An axis that is required as orientation axis is currently not available as path axis.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Adapt machine data. Provide the required orientation axes using GET(..) or GETD(..).
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>14133</b>	<b>[Channel %1: ] Block %2 G code for orientation definition not allowed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** It is only possible to program a G code of the 50th G code group if MD21102 \$MC\_ORI\_DEF\_WITH\_G\_CODE is set to TRUE.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Adapt machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14134 [Channel %1: ] Block %2 G code for orientation interpolation not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** It will only be possible to program a G code of the 51st G code group, if MD21104 \$MC\_ORI\_IPO\_WITH\_G\_CODE has been set to TRUE.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Adapt machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14136 [Channel %1: ] Block %2 Orientation polynomial is not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Programming of orientation polynomials both for the angles (PO[PHI], PO[PHI]) and for the coordinates of a reference point on the tool (PO[XH], PO[YH], PO[ZH]) is not permitted. Orientation polynomials can only be programmed, if an orientation transformation is active and the orientation is changed by interpolating the vector (ORIVECT, ORICONxxx, ORICURVE), i.e. the orientation must not be changed by interpolating the axis (ORIAxes).

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Change the NC program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14137 [Channel %1: ] Block %2 Polynomials PO[PHI] and PO[PSI] are not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A polynomial for the angles PHI and PSI can only be programmed, if the orientation is interpolated in the plane between start and end orientation (ORIVECT, ORIPLANE) or on a taper (ORICONxxx). If interpolation type ORICURVE is active, no polynomials can be programmed for angles PHI and PSI.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Change the NC program



---

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**14138 [Channel %1: ] Block %2 Polynomials PO[XH], PO[YH] and PO[ZH] are not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Polynomials for the coordinates of a reference point on the tool (PO[XH], PO[YH], PO[ZH]) can only be programmed, if interpolation type ORICURVE is active. If ORIVECT, ORIPLANE, ORICONxxx is active, no polynomials can be programmed for coordinates XH, YH and ZH.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Change the NC program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**14139 [Channel %1: ] Block %2 Polynomial for angle of rotation PO[THT] is not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A polynomial for the angle of rotation of orientation (PO[THT]) can only be programmed, if the active transformation supports it.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Change the NC program

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**14140 [Channel %1: ] Block %2 position programming without transformation not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Position information was programmed for an axis position but no transformation was active.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify the program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**14144 [Channel %1: ] Block %2 PTP movement not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The PTP G code was programmed for a movement other than G0 or G1.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Modify the program.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14146 [Channel %1: ] Block %2 CP or PTP movement without transformation not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The CP or PTP G code was programmed for a movement but no transformation was active.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Modify the program.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14147 [Channel %1: ] Block %2 spline for orientation not possible.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** If an orientation has been programmed while BSPLINE is active, the interpolation of tool orientation must be interpolated via a 2nd space curve. This means that G code ORICURVE must be active for the interpolation of the orientation.  
**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.  
**Remedy:** Change the NC program.  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14148 [Channel %1: ] Illegal reference system for Cartesian manual traverse**

**Parameters:** %1 = Channel number  
**Definitions:** In the SD42650 \$SC\_CART\_JOG\_MODE, an illegal value has been entered for the reference system with Cartesian manual travel.  
**Reaction:** Alarm display.  
**Remedy:** Enter a permitted value in the SD42650 \$SC\_CART\_JOG\_MODE.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14150 [Channel %1: ] Block %2 illegal tool carrier number programmed or declared (MD)**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

<b>Definitions:</b>	A toolholder number was programmed which is negative or greater than the MD18088 \$MN_MM_NUM_TOOL_CARRIER.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Program valid toolholder number or adapt MD 18088 \$MN_MM_NUM_TOOL_CARRIER.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14151</b>	<b>[Channel %1: ] Block %2 illegal tool carrier rotation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A toolholder was activated with an angle of rotation unequal to zero, although the associated axis is not defined. A rotary axis is not defined when all three direction components are zero.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Set angle of rotation to zero, or define the associated rotary axis.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14152</b>	<b>[Channel %1: ] Block %2 tool carrier: invalid orientation. Error code: %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Error code
<b>Definitions:</b>	An attempt was made to define a tool orientation by means of the active frame which cannot be reached with the current toolholder kinematics. This case can always occur when both rotary axes of the toolholder are not perpendicular to one another or when the toolholder has fewer than two rotary axes; or when rotary axis positions must be set that violate the corresponding axis limitations. Together with the alarm, an error code is displayed that specifies the cause in detail: The error code has the following meaning: 1: 1st rotary axis of the first solution violates the lower limit 2: 1st rotary axis of the first solution violates the upper limit 10: 2nd rotary axis of the first solution violates the lower limit 20: 2nd rotary axis of the first solution violates the upper limit 100: 1st rotary axis of the second solution violates the lower limit 200: 1st rotary axis of the second solution violates the upper limit 1000: 2nd rotary axis of the second solution violates the lower limit 2000: 2nd rotary axis of the second solution violates the upper limit 3: The required orientation cannot be set with the given axis configuration Several of the error codes that indicate a violation of the axis limits can occur simultaneously As, when an axis limit is violated, an attempt is made to reach a valid position within the permissible axis limits by adding or subtracting multiples of 360 degrees, it is - if this is not possible - not unequivocally defined whether the lower or upper axis limit has been violated.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify the part program (TOABS instead of TCOFR, activate another Frame. Change toolholder data. Change processing level G17-G19)
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**14153**                    **[Channel %1: ] Block %2 unknown tool carrier type: %3**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Tool carrier type

**Definitions:**            An invalid tool carrier type was specified in \$TC\_CARR23[]. Only the following are allowed: t, T, p, P, m, M.

**Reaction:**                Correction block is reorganized.  
                               Interpreter stop  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the tool carrier data.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14154**                    **[Channel %1: ] Block %2 The amount of fine correction in parameter %3of the orientable toolholder %4 is too large**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Invalid parameter of the orientable toolholder  
                               %4 = Number of the orientable toolholder

**Definitions:**            The maximum permissible value of the fine correction in an orientable toolholder is limited by the MD20188 \$MC\_TOCARR\_FINE\_LIM\_LIN for linear variables, and by the MD20190 \$MC\_TOCARR\_FINE\_LIM\_ROT for rotary variables. The alarm can only occur if the SD42974 \$SC\_TOCARR\_FINE\_CORRECTION is not equal to zero.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm at block end.

**Remedy:**                 Enter a valid fine correction value.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14155**                    **[Channel %1: ] Block %2 invalid base frame definition for tool carrier offset**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            If a tool carrier selection causes a change in the table offset, a valid base frame must be defined in order to store this offset; for more information see machine data 20184 (TOCARR\_BASE\_FRAME\_NUMBER).

**Reaction:**                Correction block is reorganized.  
                               Interpreter stop  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Change the NC program or machine data 20184 (TOCARR\_BASE\_FRAME\_NUMBER).

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14156**                    **[Channel %1: ] Toolholder selection error at reset**

**Parameters:**            %1 = Channel number

**Definitions:** The settings in MD20110 \$MC\_RESET\_MODE\_MASK require that an active orientable toolholder is maintained after the reset. This is done by deselecting the old orientable toolholder and then reselecting it with data that may have been modified. If an error occurs during the reselection, this alarm is issued (as a warning) and then an attempt is made to select the orientable toolholder in the initial setting. If this second attempt is successful, the reset cycle is continued without any further alarms.

Typically, the alarm only occurs when the old orientable toolholder has been selected with TCOFR, and its axis directions have been changed in such a way before the reset that a setting suitable for the associated frame is no longer possible. If there is another cause for the alarm, this results in an alarm also being issued when attempting to select in the initial setting. This is then also displayed in plain text.

**Reaction:** Alarm display.

**Remedy:** Check the program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

### 14157 [Channel %1: ] Block %2 illegal interpolation type with MOVt

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Linear or spline interpolation must be active with MOVt (G0, G1, ASPLINE, BSPLINE, CSPLINE).

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Modify program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

### 14159 [Channel %1: ] Block %2 more than two angles programmed with ROTs or AROTs

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Frame rotations are described using space angles with the language commands ROTs or AROTs. A maximum of two angles can be programmed.

**Reaction:** Correction block is reorganized.  
Interpreter stop  
Interface signals are set.  
Alarm display.

**Remedy:** Modify program.

**Program** Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

### 14160 [Channel %1: ] Block %2 tool length selection without geometry axis specification

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** If variant C (tool length acts on the programmed axis) is activated by machine data MD20380 \$MC\_TOOL\_CORR\_MODE\_G43G44 for tool length compensation with H word and G43/G44 in ISO\_2 mode, at least one geometry axis must be specified.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Change MD20380 \$MC\_TOOL\_CORR\_MODE\_G43G44 or the part program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14162 [Channel %1: ] Block %2 error %3 on activation of the CUTMOD function**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Error code

**Definitions:** An error occurred during the activation of the CUTMOD function. The type of error is more closely defined by the error code number:  
 Error code  
 1 No valid cutting direction is defined for the active tool.  
 2 The edge angles (clearance angle and holder angle) of the active tool are both zero.  
 3 The clearance angle of the active tool has an impermissible value (less than 0 degrees or greater than 180 degrees).  
 4 The holder angle of the active tool has an impermissible value (less than 0 degrees or greater than 90 degrees).  
 5 The cutting tip angle of the active tool has an impermissible value (less than 0 degrees or greater than 90 degrees).  
 6 The cutting edge position - holder angle combination of the active tool is impermissible (with cutting edge positions 1 through 4, the holder angle must be less than or equal to 90 degrees, with cutting edge positions 5 through 8, it must greater than or equal to 90 degrees).  
 7 Impermissible rotation of the active tool (the tool was rotated through +/-90 degrees (with a tolerance of about 1 degree) out of the active machining plane. As a result, the cutting edge position is no longer defined in the machining plane.  
 With the aid of MD20125 \$MC\_CUTMOD\_ERR, it can be determined for each of the named errors whether the fault condition is to lead to the issue of an alarm, and whether the alarm is only to be displayed or also trigger a program stop.

**Reaction:** Interpreter stop  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the tool data of the active tool, or modify the part program in the case of error 7. Alternatively, suppress all error alarms with the aid of MD20125 \$MC\_CUTMOD\_ERR.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14165 [Channel %1: ] Block %2 selected ISO H/D number %3 does not match tool %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = ISO H/D number  
 %4 = Tool number

**Definitions:** When an H or D number is programmed in ISO\_2 or ISO\_3 mode, it must be available in the active tool. The active tool may also be the last tool loaded on the master spindle or master toolholder. This alarm is output if there is no H or D number on this tool.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Set ISO H/D number correctly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>14166</b>	<b>[Channel %1: ] Block %2 error %3 when programming a tool length offset with TOFF / TOFFL</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Error code
<b>Definitions:</b>	An error occurred while programming a tool length offset with TOFF or TOFFL. More information about the type of error is given by the error code number: Error code 1At least one tool length offset component has been programmed twice in one block (with TOFF). 2At least one tool length offset component has been programmed twice in one block (with TOFFL). 3Tool length offset components have been programmed in one block with both TOFF and TOFFL. 4An index must be declared when a tool length offset is programmed with TOFF, the form TOFF=.... is not permissible. 5An illegal index was declared when programming TOFFL (permissible values 1..3). 6An illegal axis was declared as the index when programming TOFF. Only geometry axes are permitted.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct errors in program block.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14170</b>	<b>[Channel %1: ] Block %2 illegal interpolation type with tool length compensation</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	If tool compensation (G43/G44) is activated in language mode ISO_M, the linear type of interpolation must be active.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14180</b>	<b>[Channel %1: ] Block %2 H number %3 is not defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = H number of ISO mode
<b>Definitions:</b>	The specified H number is not assigned to a tool (ISO_M).
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14181 [Channel %1: ] Block %2 ISO tool offset %3 not present**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Offset number

**Definitions:** Only relevant in ISO2 and ISO3 modes:  
 When selecting the tool offset with H or D:  
 Only tool offsets 1 - 98 are permissible in ISO2 and ISO3 modes.  
 Exception: The structured cutting edge D1 of the active tool can also be selected with H99 in ISO2 mode or with the offset component in the tool selection in ISO3 mode.  
 When writing the tool offset with G10:  
 Only tool offsets 1 - 98 are permissible in ISO2 and ISO3 modes.  
 Tool offset H99 can only be written in Siemens programming mode (G290) with \$TC\_DPx[y,z]=.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Correct NC block and select a permissible tool offset in the range 1 to 98.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14182 [Channel %1: ] Block %2 different values under H and D addresses**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Only relevant in ISO2 mode:  
 Tool length and tool radius are programmed with H and D. The programming leads to contradictory offset numbers in the coupled offset memories.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Correct NC block. Only program H or D, or program the same value under H and D addresses.  
 Set MD10890 \$MN\_EXTERN\_TOOLPROG\_MODE, Bit6=1. Different values can then be programmed in the H and D addresses.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14183 [Channel %1: ] Block %2 H and D addresses must be programmed after Siemens offset**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Only relevant in ISO2 mode:  
 A tool offset in Siemens mode with D>1 is active and an ISO2 command G43, G44,G49 is applied. Furthermore an ISO offset with H0 - H99 or D0-D98 must be selected.  
 The alarm is also output, if MD10890 \$MN\_EXTERN\_TOOLPROG\_MODE, bit6=1:  
 If the Siemens offset memory with H99 or a cutting edge has been selected in Siemens mode, both the tool length and tool radius offsets will have to be reselected the next time the ISO offset memory is selected.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Correct NC block.  
 Program H and/or D address in the block.  
 If MD10890 \$MN\_EXTERN\_TOOLPROG\_MODE, bit6=0, only H or D address must be programmed.



**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

#### 14184 **[Channel %1: ] Block %2 G44 is not possible with tool offset H99**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Only relevant in ISO2 mode:  
The structured D number D1 of the active tool has been selected with H99. These offset values cannot be calculated negatively with G44.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Correct NC block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

#### 14185 **[Channel %1: ] Block %2 D number %3 is not defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = D number of ISO mode

**Definitions:** The specified D number is not assigned to a tool (language mode ISO\_M).

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

#### 14186 **[Channel %1: ] Block %2 ISO2 mode, and toolcarrier or tool adapter are both active (identifier %3)**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Identifier

**Definitions:** Only relevant in ISO2 mode:  
An attempt has been made to activate an ISO2 offset and toolcarrier or tool adapter together.  
Identifier 1: ISO2 offset is active (activated in ISO2 mode) and an attempt has been made to activate an additional toolcarrier in Siemens mode.  
Identifier 2: A toolcarrier has been activated in Siemens mode, and a tool offset is now activated in ISO2 mode.  
Identifier 3: A tool is active in the adapter in Siemens mode, and a tool offset is now activated in ISO2 mode.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Correct NC block.  
For identifier 1: Select a Siemens offset before activating the toolcarrier.  
For identifier 2: Deactivate the toolcarrier before selecting a TLC in ISO2 mode.  
For identifier 3: Load a tool (T=0) or activate a tool without an adapter before selecting a TLC in ISO2 mode.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14190 [Channel %1: ] Block %2 H number with G49**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** G49 (select tool length compensation) and an H word not equal to H0 have been programmed simultaneously.  
**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.  
**Remedy:** Modify part program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14195 [Channel %1: ] Block %2 D number with G49**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** G49 (select tool length compensation) and an D word not equal to D0 have been programmed simultaneously.  
**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.  
**Remedy:** Modify part program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14196 [Channel %1: ] Block %2 error %3 on interpreting the contents of \$SC\_CUTDIRMOD**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Error code

<b>Definitions:</b>	An error has occurred during the interpretation of the strings contained in SD42984 \$SC_CUTDIRMOD. This setting data is always read when a new edge is selected. The error code indicates the cause of the error: 1: The string only consists of blanks or a sign 2: Unknown frame name after \$P_ 3: No colon after the first valid frame name 4: Insufficient memory space for creating a frame internally 5: Invalid frame index 6: Further characters found after complete string 7: Second frame name is missing after the colon 8: Impermissible frame rotation (surface normals are rotated against each other by 90 degrees or more) 9: Invalid frame chain (the first frame must come before the second frame in the frame chain) 10: Invalid axis name 11: Axis is not a rotary axis 12: Invalid string that cannot be assigned to any of the error types 1 to 11 20: Invalid angle statement (numerical value) 30: Invalid angle of rotation (not an integer multiple of 90 degrees)
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Enter valid string in SD42984 \$SC_CUTDIRMOD.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 14197 [Channel %1: ] Block %2 D number and H number programmed simultaneously

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A D word and H word have been programmed simultaneously.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14198 [Channel %1: ] Block %2 illegal change of tool direction with tool offset

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	If an offset is active in the tool direction, block change is not possible if this would change the assignment of the offset axes to the channel axes (plane change, tool change, cutter <=> turning tool, geometry axis exchange).
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	- Modify part program. - Reduce the offset in tool direction to zero.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14199 [Channel %1: ] Block %2 illegal plane change for tool with diameter component**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** If a tool has a wear or length component which is evaluated as a diameter for the facing axis (bit 0 and/or bit 1 in MD20360 \$MC\_TOOL\_PARAMETER\_DEF\_MASK is set) and bit 2 of this MD is also set, this tool may only be used in the plane active on tool selection. A plane change results in an alarm.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Modify part program.  
 Reset bit 2 in MD20360 \$MC\_TOOL\_PARAMETER\_DEF\_MASK.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14200 [Channel %1: ] Block %2 negative polar radius**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In the endpoint specification of a traversing block with G00, G01, G02 or G03 in polar coordinates, the polar radius entered for the keyword RP=... is negative.  
 Definition of terms:  
 - Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03).  
 - New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct NC part program - permissible inputs for the pole radius are only positive absolute values that specify the distance between the current pole and the block end point. (The direction is defined by the polar angle AP=...).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14210 [Channel %1: ] Block %2 polar angle too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In specifying the endpoints in a traversing block with G00, G01, G02 or G03 in polar coordinates, the value range of the polar angle programmed under the keyword AP=... has been exceeded. It covers the range from -360 to +360 degrees with a resolution of 0.001 degrees.  
 Definition of terms:  
 - Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03).  
 - New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... referred to the last programmed point in the plane, G111 ... referred to the zero point of the current workpiece coordinate system (WCS), G112 ... referred to the last pole.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct NC part program. The permissible input range for the polar angle is between the values -360 degrees and +360 degrees with a resolution of 0.001 degrees.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14250 [Channel %1: ] Block %2 negative pole radius

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In redefining the pole with G110, G111 or G112 in polar coordinates, the pole radius specified under keyword RP=... is negative. Only positive absolute values are permitted.  
Definition of terms:  
- Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03).  
- New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the NC part program. Permissible inputs for the pole radius are only positive, absolute values that specify the distance between the reference point and the new pole. (The direction is defined with the pole angle AP=...).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14260 [Channel %1: ] Block %2 pole angle too large

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In redefining the pole with G110, G111 or G112 in polar coordinates, the value range of the pole angle specified under keyword AP=... has been exceeded. It covers the range from -360 to +360 degrees with a resolution of 0.001 degrees.  
Definition of terms:  
- Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03).  
- New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct NC part program. The permissible input range for the polar angle is between the values -360 degrees and +360 degrees with a resolution of 0.001 degrees.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14270 [Channel %1: ] Block %2 pole programmed incorrectly

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When defining the pole, an axis was programmed that does not belong to the selected processing level. Programming in polar coordinates always refers to the plane activated with G17 to G19. This also applies to the definition of a new pole with G110, G111 or G112.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the NC part program. Only the two geometry axes may be programmed that establish the current machining plane.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14280 [Channel %1: ] Block %2 polar coordinates programmed incorrectly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The end point of the displayed block has been programmed both in the polar coordinate system (with AP=..., RP=...) and in the Cartesian coordinate system (axis addresses X, Y,...).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the NC part program - the axis motion may be specified in one coordinate system only.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14290 [Channel %1: ] Block %2 polynomial degree greater than 5 programmed for polynomial interpolation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A polynomial degree greater than five was programmed for the polynomial interpolation. You can only program polynomials up to the 5th degree.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14300 [Channel %1: ] Block %2 overlaid handwheel motion activated incorrectly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Handwheel override has been called up incorrectly:  
- 1st For positioning axes:  
- Handwheel override programmed for indexing axes,  
- No position programmed,  
- FA and FDA programmed for the same axis in the block.  
- 2nd For contouring axes:  
- No position programmed,  
- G60 not active,  
- 1st G group incorrect (only G01 to CIP).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

---

**14320 [Channel %3: ] Axis %4: handwheel %1 used twice (%2)**

**Parameters:** %1 = Handwheel number  
 %2 = Use  
 %3 = Channel  
 %4 = Axis

**Definitions:** Informational alarm indicating that the mentioned handwheel is used twice:  
 The second parameter provides the explanation:  
 1: Block with axial handwheel override for this axis cannot be executed as the handwheel for this axis performs a DRF movement  
 2: Block with velocity override of the path cannot be executed as the handwheel performs a DRF movement for this axis of the path  
 3: Block with contour handwheel cannot be executed as the handwheel performs a DRF movement for this axis of the path  
 4: PLC axis with axial handwheel override cannot be started immediately as the handwheel performs a DRF movement for this axis  
 5: The axis is a reciprocating axis with axial handwheel override; the reciprocating movement cannot be started immediately as the handwheel performs a DRF movement for this axis  
 6: The DRF movement for this axis cannot be executed as an axial handwheel override is active for this axis with the handwheel  
 7: The DRF movement for this axis cannot be executed as a velocity override of the path with the handwheel is active and the axis belongs to the path  
 8: The DRF movement for this axis cannot be executed as the contour handwheel is active with this handwheel and the axis belongs to the path  
 9: The DRF movement for this axis cannot be executed as the axis is a PLC axis with handwheel override that is active with this handwheel  
 10: The DRF movement for this axis cannot be executed as the axis is active as reciprocating axis with handwheel override with this handwheel

**Reaction:** Alarm display.

**Remedy:** Use the handwheel for one purpose at a time only.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**14400 [Channel %1: ] Block %2 tool radius compensation active at transformation switchover**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A change of transformation is not allowed when tool radius compensation is active.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Perform tool radius compensation in the NC part program with G40 (in a block with G00 or G01) before performing a transformation change.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14401 [Channel %1: ] Block %2 transformation not available**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The required transformation is not available.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 Modify part program; program defined transformations only.  
 Check MD 24... \$MC\_TRAFO\_TYPE\_... (assigns the transformation to part program instruction).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**14402 [Channel %1: ] Block %2 spline active at transformation change**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A change of transformation is not allowed in a spline curve section. A series of spline blocks must be concluded.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14403 [Channel %1: ] Block %2 preprocessing and main run might not be synchronized**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Positioning axis runs cannot be accurately calculated beforehand. Consequently, the position in the MCS is not known exactly. It might therefore be possible that a change in the multiple significance of the transformation has been performed in the main run although no provision was made for this in the preprocessing run.

**Reaction:** Alarm display.

**Remedy:** Modify part program. Synchronize preprocessing run and main run.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**14404 [Channel %1: ] Block %2 illegal parameterization of transformation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Error has occurred when selecting transformation.  
 Possible causes of error:

- An axis traversed by the transformation has not been enabled:
- is being used by another channel (-> enable)
- is in spindle mode (-> enable with SPOS)
- is in POSA mode (-> enable with WAITP)
- is concurrent Pos axis (-> enable with WAITP)
- Parameterization via machine data has an error
- Axis or geometry axis assignment to the transformation has an error,
- Machine data has an error (-> modify machine data, restart)

Please note: Any axes not enabled might be signaled via alarm 14092 or alarm 1011 instead of alarm 14404.  
 Transformation-dependent error causes can be in: TRAORI: -  
 TRANSMIT:

- The current machine axis position is unsuitable for selection (e.g. selection in the pole) (-> change position slightly).
- Parameterization via machine data has an error.
- Special requirement with respect to the machine axis has not been fulfilled (e.g. rotary axis is not a modulo axis) (-> modify machine data, restart).



**TRACYL:**

The programmed parameter is not allowed when transformation is selected.

**TRAANG:**

- The programmed parameter is not allowed when transformation is selected.

- Parameterization via machine data has an error.

- Parameter is faulty (e.g. TRAANG: unfavorable angle value (-> modify machine data, restart))

**Persistent transformation:**

- Machine data for persistent transformation are wrong (-> consider dependencies, change machine data, restart)

Only with active "OEM transformation" compile cycle:

The axes included in the transformation must be referenced.

**Reaction:**

Correction block is reorganized.

Interface signals are set.

Alarm display.

**Remedy:**

Please inform the authorized personnel/service department. Modify part program or machine data.

Only with active "OEM transformation" compile cycle:

Reference the axes included in the transformation before selecting transformation.

**Program**

Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14410 [Channel %1: ] Block %2 spline active at geometry axis changeover****Parameters:**

%1 = Channel number

%2 = Block number, label

**Definitions:**

It is not allowed to change the assignment of geometry axes to channel axes in a spline curve definition.

**Reaction:**

Correction block is reorganized.

Interface signals are set.

Alarm display.

**Remedy:**

Modify part program.

**Program**

Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14411 [Channel %1: ] Block %2 tool radius compensation active at geometry axis changeover****Parameters:**

%1 = Channel number

%2 = Block number, label

**Definitions:**

It is not permissible to change the assignment of geometry axes to channel axes when tool radius compensation is active.

**Reaction:**

Correction block is reorganized.

Interface signals are set.

Alarm display.

**Remedy:**

Modify part program.

**Program**

Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14412 [Channel %1: ] Block %2 transformation active at geometry axis changeover****Parameters:**

%1 = Channel number

%2 = Block number, label

**Definitions:**

It is not permissible to change the assignment of geometry axes to channel axes when transformation is active.

**Reaction:**

Correction block is reorganized.

Interface signals are set.

Alarm display.

**Remedy:**

Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14413 [Channel %1: ] Block %2 fine tool correction: changeover geometry/channel axis not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** It is not permissible to change the assignment of geometry axes to channel axes during active tool fine compensation.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14414 [Channel %1: ] Block %2 GEOAX function: incorrect call**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The parameters for calling the GEOAX(...) are incorrect. Possible causes:

- Uneven number of parameters.
- More than 6 parameters were specified.
- A geometry axis number was programmed which was less than 0 or greater than 3.
- A geometry axis number was programmed more than once.
- An axis identifier was programmed more than once.
- An attempt was made to assign a channel axis to a geometry axis which has the same name as one of the channel axes.
- An attempt was made to assign a channel axis to a geometry axis lacking IPO functionality (see MD30460 \$MA\_BASE\_FUNCTION\_MASK, Bit8).
- An attempt was made to remove a geometry axis with the same name as one of the channel axes from the geometry axis grouping.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program or correction block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14415 [Channel %1: ] Block %2 tangential control: changeover geometry/channel axis not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An assignment change of the geometry axes to channel axes is not permitted with active tangential control.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Change part program and delete active tangential control with TANGDEL.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>14420</b>	<b>[Channel %1: ] Block %2 index axis %3 frame not allowed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis
<b>Definitions:</b>	The axis is to be traversed as an indexing axis, but a frame is active. This is not allowed by MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify part program. Change MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14430</b>	<b>[Channel %1: ] Block %2 tangential axis %3 must not be traversed as POS axis</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
<b>Definitions:</b>	A tangentially followed-up axis cannot be traversed as positioning axis.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Change part program and delete active tangential control with TANGDEL.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14432</b>	<b>[Channel %1: ] Block %2 Rounding length for tangential axis %3 is too small.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
<b>Definitions:</b>	For a tangential axis that is coupled during preparation, a rounding length must be indicated with TANGON() on activating the tangential control, or possibly occurring discontinuities of the tangential axis cannot be smoothed. This rounding length must be larger than 1 increment.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14434</b>	<b>[Channel %1: ] Block %2 rel. lift-off path for tangential axis %3 is invalid</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
<b>Definitions:</b>	Factor r as programmed on TLIFT for the relative lift-off path must be within range $0 \leq r < 1$ .
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Modify part program  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14500 [Channel %1: ] Block %2 illegal DEF or PROC instruction in the part program**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** NC part programs with high-level language elements are divided into a preceding definition part followed by a program part. The transition is not marked specifically; a definition statement is not allowed to follow the 1st program command.  
**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Put definition and PROFC statements at the beginning of the program.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14510 [Channel %1: ] Block %2 PROC instruction missing on subroutine call**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** In subroutine calls with parameter transfer ("call-by-value" or "call-by-reference") the called subroutine must begin with a PROC statement.  
**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Define the subroutine in accordance with the type used.  
 1. Conventional subroutine structure (without parameter transfer):  
 % SPF 123456  
 :  
 M17  
 2. Subroutine structure with keyword and subroutine name (without parameter transfer):  
 PROC UPNAME  
 :  
 M17  
 ENDPROC  
 3. Subroutine structure with keyword and subroutine name (with parameter transfer "call-by-value"):  
 PROC UPNAME (VARNAME1, VARNAME2, ...)  
 :  
 M17  
 ENDPROC  
 4. Subroutine structure with keyword and subroutine name (with parameter transfer "call-by-reference"):  
 PROC UPNAME (Typ1 VARNAME1, Typ2 VARNAME2, ...)  
 :  
 M17  
 ENDPROC  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14520 [Channel %1: ] Block %2 illegal PROC instruction in data definition section**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	The PROC statement may only be programmed at the beginning of the subroutine.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify NC part program appropriately.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 14530 [Channel %1: ] Block %2 EXTERN and PROC instruction do not correspond

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Subroutines with parameter transfer must be known before they are called in the program. If the subroutines are always available (fixed cycles) the control establishes the call interfaces at the time of system power-up. Otherwise an EXTERN statement must be programmed in the calling program. Example: N123 EXTERN UPNAME (TYP1, TYP2, TYP3, ...) The type of the variable must match the type given in the definition (PROC statements) or it must be compatible with it. The name can be different.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the variable types in the EXTERN and the PROC statements for correspondence and correctness.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 14540 [Channel %1: ] Block %2 contour tool: the min. limit angle has been programmed more than once (edge D%3)

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Edge number, label
<b>Definitions:</b>	The limit angle of a contour tool must be equal zero in an involved edge only.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Change tool definition.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 14541 [Channel %1: ] Block %2 contour tool: the max. limit angle has been programmed more than once (edge D%3)

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Edge number, label
--------------------	--

**Definitions:** The limit angle of a contour tool must be equal zero in an involved edge only.  
**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.  
**Remedy:** Change tool definition.  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14542 [Channel %1: ] Block %2 contour tool: the min. limit angle has not been programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** On defining a contour tool, either no limit angle must be indicated, or both the minimum and the maximum limit angle must be programmed once for each.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Change tool definition.  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14543 [Channel %1: ] Block %2 contour tool: the max. limit angle has not been programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** On defining a contour tool, either no limit angle must be indicated, or both the minimum and the maximum limit angle must be programmed once for each.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Change tool definition.  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14544 [Channel %1: ] Block %2 contour tool: edge D%3 is not positioned between the two border edges**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Edge number, label

**Definitions:** On defining a form tool with limit, all edges must be positioned between the edge with the minimum limit angle and the edge with the maximum limit angle when rotating counter-clockwise.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Change tool definition.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14545 [Channel %1: ] Block %2 contour tool: edge D%3 completely encircles edge D%4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Edge number, label  
 %4 = Edge number, label

**Definitions:** On defining a contour tool, tangents are placed on the adjacent circular edges. It will not be possible, if one edge is completely encircled by another one.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Change tool definition.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14546 [Channel %1: ] Block %2 contour tool: edge D%3 defines a concave corner**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Edge number, label

**Definitions:** The contour of a contour tool must be convex throughout, i.e. there must not be any concave corners.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Change tool definition.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14547 [Channel %1: ] Block %2 contour tool: checksum erroneous or not available**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When MD20372 \$MC\_SHAPED\_TOOL\_CHECKSUM was set, no edge was found for which the tool length components and the tool radius equal the negative sum of the previous edges.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Check tool definition. An edge must exist, the tool length components and tool radius of which equal the negative sum of the previous edges. This will not take the tool length components of the first edge into consideration. On comparing the components, the relevant sums of basic value and wear value are compared with each other, not the part components themselves.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14548 [Channel %1: ] Block %2 contour tool: negative radius in edge D%3 is not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Edge number, label

**Definitions:** No negative radii are permitted for contour tools, i.e. the sum of basic radius and wear value must be at least 0.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Check tool definition. Change edge radius.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14549 [Channel %1: ] Block %2 contour tool: impermissible programming. Code no. %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Error code

**Definitions:** Impermissible programming has been found for contour tools on active tool radius compensation. The error cause is explained in detail by the error code.  
 1: In G code group 17, KONT is active during activation  
 2: In G code group 17, KONT is active during deactivation  
 9: In G code group 40, CUTCONOF is not active  
 10: Reprogramming of G41 / G42 in already active tool radius compensation not permissible  
 20: Circle with more than one rotation not permissible  
 21: Ellipse (circle not in compensation level)  
 23: Involute not permissible  
 24: Several polynomials not permitted in one block only. These blocks could be created by e.g. COMPCAD or G643.  
 30: Preprocessing stop not permitted  
 41: Starting point of first compensation block cannot be reached by anyone of the defined cutting edges  
 42: End point of last compensation block cannot be reached by anyone of the defined cutting edges

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm at block end.

**Remedy:** Change the NC program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14550 [Channel %1: ] Block %2 contour tool: impermissible tool contour change. Code no. %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Error code



---

<b>Definitions:</b>	A new tool with deviating tool contour was activated for contour tools on active tool radius compensation The error cause is explained further by an error code. If the error code is an integer, the lower-value three decimal places specify the number of the edge, in which the error was detected, while the thousandth digit explains the reason in more detail. -1: The tool was deleted. -2: The number of contour elements (edges) explaining the tool, has changed. 1000: The edge center has changed 2000: The edge radius has changed. 3000: The initial angle has changed. 4000: The final angle has changed.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Change the NC program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### **14551 [Channel %1: ] Block %2 contour tool: angle area of edge D%3 larger than 359 degrees**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Edge number, label
<b>Definitions:</b>	A single edge must cover a max. angle area of 359 degrees.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Check tool definition.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### **14600 [Channel %1: ] Block %2 reload buffer %3 cannot be established**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = File name
<b>Definitions:</b>	The download buffer for "execute from external" could not be created. Possible causes: - Not enough memory available (for minimum see MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE) - No resources available for HMI NCK communication (see MD18362 \$MN_MM_EXT_PROG_NUM) - The file already exists
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Release memory, e.g. by deleting part programs - Modify MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE and/or MD18362 \$MN_MM_EXT_PROG_NUM.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**14601 [Channel %1: ] Block %2 reload buffer could not be deleted**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The reload buffer for "execute from external" could not be deleted. Possible cause:  
 - HMI/PLC communication was not terminated.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** All reload buffers are cleared on POWER ON.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14602 [Channel %1: ] Block %2 timeout while reloading from external.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** No connection could be made to the HMI while reloading external subprograms (EXTCALL) or executing from external drives) within the monitoring time set in MD10132 \$MN\_MMC\_CMD\_TIMEOUT.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check the connection to the HMI  
 - Increase MD10132 \$MN\_MMC\_CMD\_TIMEOUT.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14603 [Channel %1: ] Block %2 timeout during execution from external source.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** If a program is selected for execution from external source, it will be expected that the first part program line can be read from the reload buffer within 60s after part program start.  
 Otherwise, part program processing will be aborted with alarm 14603 due to the assumption that the connection to the HMI or the external device is faulted.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check the connection to the HMI and repeat selection of the program that is to be executed from external source.

**Program Continuation:** Clear alarm with the RESET key. Restart part program  
 - Acknowledge the alarm by pressing the RESET key  
 - Repeat program selection  
 - Start the part program

---

**14610 [Channel %1: ] Block %2 compensation block not possible**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	An alarm was output which could be eliminated basically via program correction. Since the error occurred in a program which is processed from external, a compensation block/program correction is not possible.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Abort program with reset. - Correct program on HMI or PC. - Restart reloading (possibly with block search and interrupt location).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>14615</b>	<b>[Channel %1: ] An error occurred while handling the function 'syntax check': identifier %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Is not used %3 = Error code
<b>Definitions:</b>	An error occurred while handling the function syntax check via the PI services <code>_N_CHKSEL</code> , <code>_N_CHKRUN</code> , <code>_N_CHKABO</code> and <code>_N_SEL_BL</code> . Parameter %3 describes the error situation more closely: Value 1: An invalid line number was transferred with the PI service <code>_N_SEL_BL</code> 2: An invalid line number for the range end was transferred with the PI service <code>_N_CHKRUN</code> 3: PI service <code>_N_CHKSEL</code> was activated although a block selection (PI service <code>_N_SEL_BL</code> ) was active for the selected program.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Value 1: Supply PI service <code>_N_SEL_BL</code> with the correct line number 2: Supply PI service <code>_N_CHKRUN</code> with the correct line number for the range end 3: Ensure that the channel is in reset status before activating the PI service <code>_N_CHKSEL</code> .
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>14650</b>	<b>[Channel %1: ] Block %2 SETINT instruction with invalid ASUP input</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Asynchronous subroutines (ASUBs) are subroutines that are executed following a hardware input (interrupt routine started by a rapid NCK input). The NCK input number must lie between 1 and 8. It is assigned a priority from 1 to 128 (1 is the highest priority) in the SETINT instruction with the keyword <code>PRIO = ...</code> . Example: If NCK input 5 changes to "1 signal", the subroutine <code>AB-HEB_Z</code> should be started with the highest priority. <code>N100 SETINT (5) PRIO = 1 ABHEB_Z</code> Restriction for SW PLC2xx: The number of the NCK input must be 1 or 2.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program the NCK input of the SETINT statement with a value of not less than 1 or greater than 8.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**14660**                    **[Channel %1: ] Block %2 SETINT instruction with invalid priority**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The NCK input number must lie between 1 and 8. It is assigned a priority from 0 to 128 (1 is the highest priority) in the SETINT instruction with the keyword PRIO = ... .  
 Example:  
 If NCK input 5 changes to "1-signal" the subroutine ABHEB\_Z should be started with the highest priority.  
 N100 SETINT (5) PRIO = 1 ABHEB\_Z  
 Restriction for SW PLC2xx: The number of the NCK input must be 1 or 2.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Program the priority of the NCK input with a value of not less than 1 or greater than 128.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**14700**                    **[Channel %1: ] Block %2 timeout during command to interpreter**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            A timeout has occurred in control-internal commands such as ANWAHL (part program selection), RESET (channel reset), REORG (reorganization of the preprocessing buffer) and NEWCONFIG (change in the configuration-specific machine data = restart).

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department.  
 If the runtime error occurred as the result of a temporary excessive load on the system (e.g. in the HMI area or in OEM applications) error-free execution is possible on repeating the program or operator action.  
 Otherwise, place a support request with the error text under: <http://www.siemens.com/automation/support-request>

**Program**                    Switch control OFF - ON.

**Continuation:**

---

**14701**                    **[Channel %1: ] Block %2 number of available NC blocks reduced by %3**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Number of non-available blocks

**Definitions:**            After reset, it has been found that the number of available blocks has decreased compared with the last reset. This is due to a system error. Part program execution can be resumed after the alarm has been acknowledged. If the number of blocks no longer available is less than MD28060 \$MC\_MM\_IPO\_BUFFER\_SIZE, then the POWERON alarm 14700 is output.

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Proceed as in the case of a system error.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

<b>14710</b>	<b>[Channel %1: ] Block %2 error in initialization sequence in function %3</b>
<b>Parameters:</b>	<p>%1 = Channel number          %2 = Block number, label          %3 = Identifier of the function which caused the error</p>
<b>Definitions:</b>	<p>Initialization blocks are generated (or not) after control power-up, (program) RESET and (program) START, depending on the settings in machine data MD20110 \$MC_RESET_MODE_MASK and MD20112 \$MC_START_MODE_MASK. Errors can occur because of incorrect machine data settings. The errors are output with the same error messages as would appear if the function had been incorrectly programmed in the part program. This alarm is also generated in order to indicate that an error relates to the initialization sequence. Parameter %3 specifies which function triggers the alarm:</p> <p>Control power-up and (program) RESET:          Value:          0: Error during synchronization preprocessing/main run          1: Error on selection of tool length compensation          2: Error on selection of transformation          3: Error on selection of work offset</p> <p>The macro definitions and cycle interfaces are also read in during the power-up procedure. If an error occurs here, this is indicated by value = 4, or value = 5</p> <p>6: Error creating 2 1/2 D protection zones during power up.          (Program) START:          Value          100: Error during synchronization preprocessing/main run          101: Error on selection of tool length compensation          102: Error on selection of transformation          103: Error on selection of synchronized spindle          104: Error on selection of work offset</p> <p>Particularly when tool management is active, it is possible that a tool on the spindle or the toolholder is disabled but still needs to be activated. These tools are automatically activated on RESET. On START, machine data MD22562 \$MC_TOOL_CHANGE_ERROR_MODE can be used to specify whether an alarm is to be generated or an automatic bypass strategy selected. If the parameter contains 3 values from 200 to 203, this means that an insufficient number of NC blocks is available for NC block preparation on certain commands (ASUB start, overstore selection, teach-in).          Remedy: Increase machine data MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP.</p>
<b>Reaction:</b>	<p>Interpreter stop          Channel not ready.          NC Start disable in this channel.          Interface signals are set.          Alarm display.</p>
<b>Remedy:</b>	<p>Please inform the authorized personnel/service department.          If parameter %3= 0 -3:          If the alarm or alarms occur on RESET:          Check the settings of machine data MD20110 \$MC_RESET_MODE_MASK,          MD20120 \$MC_TOOL_RESET_VALUE, MD20121 \$MC_TOOL_PRESEL_RESET_VALUE,          MD20122 \$MC_TOOL_RESET_NAME (only if tool management is active),          MD20130 \$MC_CUTTING_EDGE_RESET_VALUE, MD20132 \$MC_SUMCORR_RESET_VALUE,          MD20126 \$MC_TOOL_CARRIER_RESET_VALUE,          MD20150 \$MC_GCODE_RESET_VALUES, MD20154 \$MC_EXTERN_GCODE_RESET_VALUES,          MD20140 \$MC_TRAFO_RESET_VALUE,          MD21330 \$MC_COUPLE_RESET_MODE_1,          MD24002 \$MC_CHBFRAME_RESET_MASK</p>

If parameter %3= 100 - 104:  
 Check the setting of MD20112 \$MC\_START\_MODE\_MASK and the machine data specified under '...\_RESET...'. If tool management is active, if necessary remove the tool stated in the associated alarm from the toolholder/spindle and cancel the 'disabled' status.  
 If parameter %3= 4 or 5:  
 Check macro definitions in \_N\_DEF\_DIR  
 Check cycle directories \_N\_CST\_DIR and \_N\_CUS\_DIR  
 If parameter %3= 6:  
 Alarm 18002 or 18003 was also issued. This alarm contains the number of the incorrectly defined protection zone and an identifier of what is incorrect about the protection zone. The system variables must be appropriately corrected.  
 If Parameter %3= 200 bis 203:  
 Increase MD28070 \$MC\_MM\_NUM\_BLOCKS\_IN\_PREP.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14711 [Channel %1: ] Transformation selection not possible as axis %2 not available**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** Based on the configuration of machine data MD20110 \$MC\_RESET\_MODE\_MASK and MD20140 \$MC\_TRAFO\_RESET\_VALUE, a transformation shall be selected by performing a reset or control ramp-up. However, this is not possible as axis %2 required for this is not available. Possible reason: The axis was occupied by another channel or the PLC.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** - Use the GET command to get axis %2 in the channel in which the transformation is to be selected.  
 - Select the transformation by means of the part program command.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14720 [Channel %1: ] Block %2 axes for centerless transformation not available**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In the channel not all of the axes/spindles are available that have been defined in machine data for centerless grinding.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 1. Modify part program.  
 2. Modify machine data:  
 24110 TRAFO\_AXES\_IN\_n  
 21522 TRACLG\_GRINDSPI\_NR  
 21524 TRACLG\_CTRLSPI\_NR.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14730 [Channel %1: ] Block %2 conflict at activation of centerless transformation**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

---

<b>Definitions:</b>	<ul style="list-style-type: none"> <li>- Centerless transformation may not be activated when:</li> <li>- G96 is active and regulating spindle is also master spindle.</li> <li>- Regulating spindle is in interdependent grouping.</li> <li>- Axes of centerless transformation overlap with an active transformation and a tool is active.</li> <li>- For grinding or for regulating wheel spindle, tools are active that are not centerless tools (T1, T2).</li> <li>- Constant wheel peripheral speed for the regulating spindle is active.</li> </ul>
<b>Reaction:</b>	<p>Interpreter stop  NC Start disable in this channel.  Interface signals are set.  Alarm display.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Modify part program.</li> <li>- Check tool data.</li> <li>- Check machine data.</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>14740</b>	<b>[Channel %1: ] Block %2 no tool data available for centerless grinding</b>
<b>Parameters:</b>	<p>%1 = Channel number  %2 = Block number, label</p>
<b>Definitions:</b>	For centerless grinding, the tool data must be contained in T1, D1 (grinding wheel) or T2,D1 (regulating wheel). An error has been found here.
<b>Reaction:</b>	<p>Interpreter stop  NC Start disable in this channel.  Interface signals are set.  Alarm display.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Modify part program.</li> <li>- Check tool data.</li> <li>- Check machine data.</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>14745</b>	<b>[Channel %1: ] Block %2 centerless grinding not active</b>
<b>Parameters:</b>	<p>%1 = Channel number  %2 = Block number, label</p>
<b>Definitions:</b>	An attempt has been made to switch off the centerless grinding function even though it was not active.
<b>Reaction:</b>	<p>Interpreter stop  NC Start disable in this channel.  Interface signals are set.  Alarm display.</p>
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>14750</b>	<b>[Channel %1: ] Block %2 too many auxiliary functions programmed</b>
<b>Parameters:</b>	<p>%1 = Channel number  %2 = Block number, label</p>
<b>Definitions:</b>	More than 10 auxiliary functions have been programmed in an NC block.
<b>Reaction:</b>	<p>Correction block is reorganized.  Interface signals are set.  Alarm display.</p>

**Remedy:** Check whether all auxiliary functions are necessary in one block - modal functions need not be repeated. Create separate auxiliary function block or divide the auxiliary functions over several blocks.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14751 [Channel %1: ] Block %2 resources for motion synchronous actions not sufficient (code: %3)**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Identifier

**Definitions:** Processing of motion-synchronous actions requires resources that are configured using MD28060 \$MC\_MM\_IPO\_BUFFER\_SIZE, MD28070 \$MC\_MM\_NUM\_BLOCKS\_IN\_PREP, MD28251 \$MC\_MM\_NUM\_SAFE\_SYNC\_ELEMENTS, MD28250 \$MC\_MM\_NUM\_SYNC\_ELEMENTS, and MD28253 \$MC\_MM\_NUM\_SYNC\_STRINGS. If these resources are insufficient for the execution of the part program, then this alarm is issued. Parameter %3 shows which resource has run out:  
 Increase identifier <= 2: MD28060 \$MC\_MM\_IPO\_BUFFER\_SIZE or MD28070 \$MC\_MM\_NUM\_BLOCKS\_IN\_PREP.  
 Increase identifier > 2: MD28250 \$MC\_MM\_NUM\_SYNC\_ELEMENTS, MD28251 \$MC\_MM\_NUM\_SAFE\_SYNC\_ELEMENTS.  
 Increase identifier 7: MD28253 \$MC\_MM\_NUM\_SYNC\_STRINGS.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct part program or increase resources.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14752 [Channel %1: ] Block %2 DELDTG | STOPREOF conflict**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In a block of motion synchronous actions referring to a motion block, both DELDTG (delete distance-to-go) and STOPREOF (preprocessing stop) have been programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The functions DELDTG and STOPREOF exclude each other in a block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14753 [Channel %1: ] Block %2 motion synchronous action: %3 illegal interpolation type**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID

**Definitions:** The active interpolation type (e.g. 5-axis interpolation) is not allowed for the motion synchronous action or for the function "Several feeds".

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.



---

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14754 [Channel %1: ] Block %2 motion synchronous action: %3 wrong feed type**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID

**Definitions:** The active feed type is not allowed for the motion synchronous action or for the function "Several feeds".

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14756 [Channel %1: ] Block %2 motion synchronous action: %3 wrong value**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID

**Definitions:** Illegal value.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14757 [Channel %1: ] Block %2 motion synchronous action and wrong type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Programmed combination between action and type of motion synchronous action is not allowed.  
- RET allowed in technology cycle only  
- Function "Several feeds" not allowed in technology cycle  
- H and M function outputs not allowed with WHENEVER, FROM and DO  
- MEASA / MEAWA / MEAC with WHENEVER, FROM and DO not allowed  
- DELDTG and STOPREOF allowed only in blockwise synchronous action with WHEN and EVERY

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**14758 [Channel %1: ] Block %2 programmed value not available**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The synchronous variables \$AA\_LOAD, \$AA\_TORQUE, \$AA\_POWER and \$AA\_CURR are available only for the SIMODRIVE611D drive. They are activated by the machine data MDC 36730 \$MA\_DRIVE\_SIGNAL\_TRACKING. The system variable \$VA\_IS: Safe Actual Position is available only if the MD36901 \$MA\_SAFE\_FUNCTION\_ENABLE has been set and the option \$ON\_NUM\_SAFE\_AXES has been set to a sufficient size.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify program or machine data.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14759 [Channel %1: ] Block %2 motion synchronous action and wrong axis type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When there are several feeds, a spark-out time, or a retraction stroke for path motions, at least one GEO axis must be programmed. If the block also contains synchronous axes and there are several feeds, the feedrate for the synchronous axes is matched implicitly. No retraction stroke takes place for synchronous axes. However, after retraction stroke or spark-out time, the distance-to-go is also deleted in the block for the synchronous axes. The alarm is no longer used on P3.2.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the axis as positioning axis with axial feed, return stroke or spark-out time.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14760 [Channel %1: ] Block %2 auxiliary function of a group programmed repeatedly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The M and H functions can be divided up as required over machine data in groups in any variation. Auxiliary functions are thus put into groups that mutually preclude several individual functions of one group. Within one group only one auxiliary function is advisable and permissible.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Only program one help function per help function group. (For the group division, see the machine manufacturer's programming guide).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14761 [Channel %1: ] Block %2 motion synchronous action: DELDTG function not allowed with active tool radius compensation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

<b>Definitions:</b>	Rapid delete distance-to-go for synchronous actions is not allowed with DELDTG when tool radius compensation is active.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Deactivate tool radius compensation before performing rapid delete distance-to-go and then reselect or as of SW 4.3: "Delete distance-to-go without preparation".
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 14762 [Channel %1: ] Block %2 too many PLC variables programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The number of programmed PLC variables has exceeded the maximum permissible number. The number is set in MD 28150 \$MC_MM_NUM_VDIVAR_ELEMENTS.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program or machine data.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 14763 [Channel %1: ] Block %2 too many link variables programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The number of NCU link variables programmed exceeds the maximum limit. The number is defined in MD28160 \$MC_MM_NUM_LINKVAR_ELEMENTS.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program or machine data.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 14764 NCU link cannot transfer all link variables immediately

<b>Definitions:</b>	Informational alarm for NC program developer. A value assignment to a link variable (e.g. \$a_dld[16]=19) is performed in the main run and transferred via NCU link to all NCUs in the link network. The bandwidth of this connection restricts the number of value assignments which can be transferred in one interpolation cycle. All value assignments are combined in the next main run block and performed immediately this block is executed. A main run block is the block at which you would stop in single block mode SLB1. Examples: Blocks with a real traversing movement (G0 X100), Stopre, G4, WAITM, WAITE,... The alarm occurs if the number of link variables set in any interpolation cycle exceeds the number that can be transferred. The link variables are not transferred until one of the next interpolation cycles. The assignment is not lost!
---------------------	--

**Reaction:** Alarm display.  
Warning display.

**Remedy:** Insert main run blocks between the assignments if the program sequence allows. See also \$A\_LINK\_TRANS\_RATE.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**14765 NCU link cannot transfer all link variables**

**Definitions:** A value assignment to a link variable (e.g. \$a\_dld[16]=19) is performed in the main run and transferred via NCU link to all NCUs in the link network. The bandwidth of this connection restricts the number of value assignments which can be transferred in one interpolation cycle. Assignment operations which are not transferred are stored in a buffer memory. This buffer is full!  
All value assignments are combined in the next main run block and performed immediately this block is executed.  
A main run block is the block at which you would stop in single block mode SLB1.  
Examples: Blocks with a real traversing movement (G0 X100), Stopre, G4, WAITM, WAITE,...  
Link variable scanning operations are not affected (e.g.: R100= \$a\_dld[16])

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Insert main run blocks which require a sufficient number of interpolation cycles for execution (e.g. G4 F10) between the assignments. A block with an additional preprocessor stop does not improve the situation! See also \$A\_LINK\_TRANS\_RATE, for a variable which you can test before an assignment.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**14766 NCU link is heavily loaded, impending memory shortage**

**Definitions:** Informational alarm for NC program developer.  
The capacity of the NCU link is not large enough to transfer all the data. This non-cyclic data includes link variable assignments, machine data write operations, values for container switches and setting data write operations.  
This type of data is buffered and is not lost. The buffer memory is now 70% full.

**Reaction:** Alarm display.  
Warning display.

**Remedy:** The timing of cyclic data should not be distorted in the NC program.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**14767 Machine data matching via NCU link not complete**

**Definitions:** A non-released option has been used in the block.

**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change less setting or machine data at the same time.

**Program Continuation:** Switch control OFF - ON.

---

**14768 Axial auxiliary function for the NCU link cannot be output**

<b>Definitions:</b>	Informational alarm for the part program developer. An axial auxiliary function transmitted via an NCU link cannot be output as the transmission buffer for the PLC is filled up to 100%.
<b>Reaction:</b>	Alarm display. Warning display.
<b>Remedy:</b>	In the part program, cyclic data - in this case the output of auxiliary functions for link axes on the interpolating NCU - should be separated with regard to the time.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

**14769 [Channel %1: ] Block %2 Spindle %3 Implicit auxiliary function %4 Buffer full**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Auxiliary function number
<b>Definitions:</b>	A maximum of 5 auxiliary functions of type "M" may be entered in an NC block. The upper limit is the total of programmed and implicitly generated M auxiliary functions. Implicit auxiliary functions M19 and M70 are generated, if in MD35035 \$MA_SPIND_FUNCTION_MASK, bit 19 has been set for M19 and/or bit 20 for M70. M19 is generated with SPOS and SPOSA depending on the configuration. The same applies to M70 and transition into axis operation. The address extension corresponds to the spindle number like it is output to the PLC.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Distribute the M auxiliary functions and spindle functions that implicitly generate M19 and M70 to several blocks. - Deactivate any implicit auxiliary functions that are not required in MD35035 \$MA_SPIND_FUNCTION_MASK, bit 19 and/or bit 20.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14770 [Channel %1: ] Block %2 auxiliary function programmed incorrectly**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The permissible number of programmed auxiliary functions per NC block has been exceeded or more than one auxiliary function of the same auxiliary function group has been programmed (M and S function). In the user-defined auxiliary functions, the maximum number of auxiliary functions per group in the NCK system settings has been defined for all auxiliary functions by means of the MD11100 \$MN_AUXFU_MAXNUM_GROUP_ASSIGN (default: 1) For each user-defined auxiliary function to be assigned to a group, the assignment is effected through 4 channel-specific machine data. Return jump from asynchronous subprogram with M02/M17/M30, whereby the M code is not alone in the block. This is impermissible if the asynchronous subprogram interrupts a block with WAITE, WAITM or WAITMC. Remedy: Program M02/M17/M30 alone in the block or replace via RET. 22010 AUXFU_ASSIGN_TYPE: type of auxiliary function, e.g. M 22000 AUXFU_ASSIGN_GROUP: required group 22020 AUXFU_ASSIGN_EXTENSION: any required extension 22030 AUXFU_ASSIGN_VALUE: function value
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the part program - max. 16 auxiliary functions, max. 5 M functions per NC block, max. 1 auxiliary function per group.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14780 [Channel %1: ] Block %2 unreleased option used (identification %3)**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Fine ID

**Definitions:** A non-released option has been used in the block.

- | Identifier | Brief description                           |
|------------|---|
| 1          | LaserCtrl option                            |
| 2          | ClearCtrl option                            |
| 3          | FeedAdapt option                            |
| 4          | AaTOff option                               |
| 5          | Tang option                                 |
| 6          | LeadCtab option                             |
| 7          | ELG option                                  |
| 8          | Trafo5 option                               |
| 9          | Traoem option                               |
| 10         | Transmit option                             |
| 11         | Tracon option                               |
| 12         | Tracyl option                               |
| 13         | Traang option                               |
| 14         | Oscill option                               |
| 15         | SynSpi option                               |
| 16         | Repos option                                |
| 17         | Spline option                               |
| 18         | Involute option                             |
| 19         | Poly option                                 |
| 20         | Compress option                             |
| 23         | Masl option                                 |
| 24         | ExtLang or ExtLanguage option not activated |
| 25         | TechCycle option                            |
| 26         | Liffast option                              |
| 27         | ProgAccel option                            |
| 33         | AllAsupSynact option                        |
| 34         | CmdAxSpind option                           |
| 35         | Mea2 option                                 |
| 36         | ProgAnaOut option                           |
| 37         | OptAaTOff option                            |
| 41         | MachineMaintenance option                   |
| 42         | PathFeedSAInput option                      |
| 45         | ElecTransfer option                         |
| 46         | Cut3D option                                |
| 47         | CDA option                                  |
| 48         | Reserved: generic coupling option           |
| 49         | Measuring cycles option                     |
| 50         | ForceControl option                         |

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program, retrofit option.  
In this context, please compare the available option data and/or (if available) the license image of your controller.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>14781</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 non-released option was used</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID
<b>Definitions:</b>	A non-released option has been used in the block. Identifier Brief description 1 LaserCtrl option 2 ClearCtrl option 3 FeedAdapt option 4 AaTOff option 5 Tang option 6 LeadCtab option 7 ELG option 8 Trafo5 option 9 Traoem option 10 Transmit option 11 Tracon option 12 Tracyl option 13 Traang option 14 Oscill option 15 SynSpi option 16 Repos option 17 Spline option 18 Involute option 19 Poly option 20 Compress option 23 Masl option 24 ExtLang or ExtLanguage option not activated 25 TechCycle option 26 Liffast option 27 ProgAccel option 33 AllAsupSynact option 34 CmdAxSpind option 35 Mea2 option 36 ProgAnaOut option 37 OptAaTOff option 41 MachineMaintenance option 42 PathFeedSAInput option 45 ElecTransfer option 46 Cut3D option 47 CDA option 48 Reserved: generic coupling option 49 Measuring cycles option 50 ForceControl option
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program, retrofit option. In this context, please compare the available option data and/or (if available) the license image of your controller.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**14782 [Channel %1: ] Block %2 non-active function used (identification %3)**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Fine ID

**Definitions:** A non-active function is used in the block  
 Brief description of the identification  
     1 Transformation  
     2 H number of the tool

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Modify part program.  
 - Activate function.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14783 [Channel %1: ] Block %2 coordinate system-specific working area limitation is not active**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** An attempt is made in the block to activate a group of the coordinate system-specific working area limitation. However, this group is not set up (see MD28600 \$MC\_MM\_NUM\_WORKAREA\_CS\_GROUPS).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 The NC program is stopped. The G code of the group WALCS01 - WALCS10 can be changed.

**Remedy:** - Modify part programm.  
 - Activate more coordinate system-specific working area limitations.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14790 [Channel %1: ] Block %2 axis %3 programmed by PLC**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis

**Definitions:** In the NC block, an axis has been programmed that is already being traversed by the PLC.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Modify part program, do not use this axis.  
 - Stop traversing motion of the axis by the PLC, modify part program (insert WAITP).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14800 [Channel %1: ] Block %2 programmed path speed less or equal to zero**

**Parameters:** %1 = Channel number  
 %2 = Block number, label



---

<b>Definitions:</b>	Zero or a negative F or FZ value has been programmed in conjunction with the G functions G93, G94, G95 or G96. The path velocity may be programmed in the range of 0.001 to 999 999.999 [mm/min, mm/rev, mm/tooth, deg/min, deg/rev] for the metric input system and 0.000 1 to 39 999.999 [inch/min, inch/rev, inch/tooth] for the inch input system.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program the path velocity (geometric sum of the velocity components of the geometry axes involved) within the limits given above.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14810</b>	<b>[Channel %1: ] Block %2 negative axis speed programmed for positioning axis %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis
<b>Definitions:</b>	A negative feed (FA value) has been programmed for the displayed axis presently operating as a positioning axis. The positioning velocity may be programmed in the range 0.001 to 999 999.999 [mm/min, deg/min] for the metric input system and 0.000 1 to 39 999.999 9 [inch/min, inch/rev] for the inch input system.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program the positioning velocity within the limits given above.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14811</b>	<b>[Channel %1: ] Block %2 incorrect value range for acceleration of axis/spindle %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis, spindle
<b>Definitions:</b>	A value outside of the permissible input range of the programmed acceleration has been used. Values of between 1 and 200 % are possible.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Adjust the value range in accordance with the Programming Guide. Values of 1 ... 200% are allowed.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>14812</b>	<b>[Channel %1: ] Block %2 SOFTA not available for axis %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis
<b>Definitions:</b>	SOFT is to be set as type of motion control for an axis. This is not possible because a bent acceleration characteristic has been selected for this axis via machine data.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program or machine data.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**14815 [Channel %1: ] Block %2 negative thread pitch change programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A negative thread pitch change has been programmed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the value assignment. The programmed F value should be greater than zero. Zero is allowed but has no effect.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14820 [Channel %1: ] Block %2 negative value for maximum spindle speed programmed with constant cutting speed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** For the function "Constant cutting speed G96" a maximum spindle speed can be programmed with the keyword LIMS=.... The values are in the range 0.1 - 999 999.9 [rev/min].

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the maximum spindle speed for the constant cutting speed within the limits given above. The keyword LIMS is modal and can either be placed in front of or within the block that selects the constant cutting speed.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14821 [Channel %1: ] Block %2 error in selection or deselection of GWPS**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** On selecting GWPS programming (constant grinding wheel surface speed) with GWPSON, one of the following errors occurred:  
 - An attempt has been made to select the GWPS programming for a spindle that has already been assigned to another tool by TMON, GWPSON, CLGON or activation of the tool length compensation.  
 - An attempt has been made to select a tool which has not been defined.  
 - An attempt has been made to select an edge (implicitly) which has not been defined (implicit selection: D1 of a tool, if no tool has been specified.)  
 - Selection does not refer to a grinding-specific tool (400-499).  
 - An attempt has been made to select GWPS for the active tool, although the TLC is not switched on.  
 - Selection refers to an invalid spindle number.  
 - A grinding wheel radius equal to zero has been specified.  
 On deselecting GWPS programming with GWPSOFF, one of the following errors occurred:  
 - Deselection does not refer to a grinding-specific tool (400-499).  
 - An attempt has been made to deselect GWPS for the active tool, although the tool length compensation has not been activated.  
 - Deselection refers to an invalid spindle number.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check GWPSON and GWPSOF command.  
- Check tool compensation data:  
\$TC\_DP1 : 400 - 499;  
\$TC\_TGP1: Spindle number.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

## 14822 [Channel %1: ] Block %2 incorrect programming of GWPS

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When selecting GWPS (constant grinding wheel peripheral speed) with GWPSON or programming the GWPS with "S[spindle number] = value" one of the following errors has occurred:  
Invalid spindle number.  
Invalid parameter number for radius calculation in \$TC\_TPG9.  
The following values are valid:  
3 for \$TC\_DP3 (length 1)  
4 for \$TC\_DP4 (length 2)  
5 for \$TC\_DP5 (length 3)  
6 for \$TC\_DP6 (radius)  
Invalid angle in \$TC\_TPG8.  
The following values are valid:  $-90 \leq \$TC\_TPG8 < +90$ .  
A grinding wheel radius equal to zero was specified.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check tool compensation data.  
- \$TC\_DP1 : 400 - 499.  
- \$TC\_TPG1: Spindle number.  
- \$TC\_TPG8: Inclination angle for slope grinding wheel.  
- \$TC\_TPG9: Compensation parameters for radius computation, e.g. 3 for \$TC\_GP3.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

## 14823 [Channel %1: ] Block %2 error on selection or deselection of tool monitoring

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** When selecting tool monitoring with TMON, one of the following errors occurred:  
- Selection does not refer to a grinding-specific tool (tool types 400-499).  
- Selection refers to an invalid spindle number.  
- An attempt has been made to select tool monitoring for a spindle that is already assigned to another tool by TMON, GWPSON, CLGON or activation of tool length compensation.  
- An attempt has been made to select a tool that has not been defined.  
- An attempt has been made to select an edge (implicitly) that has not been defined. (Implicit selection: D1 of a tool, if no edge has been specified.)  
- An attempt has been made to select tool monitoring for the active tool, although no tool length compensation has been activated.  
- Invalid parameter number for radius calculation in \$TC\_TPG9.  
The following values are valid:  
3 for \$TC\_DP3 (length 1)  
4 for \$TC\_DP4 (length 2)  
5 for \$TC\_DP5 (length 3)  
6 for \$TC\_DP6 (radius)

A grinding wheel radius equal to zero has been specified.  
 On deselecting tool monitoring with TMOF, one of the following errors occurred:  
 - Deselection does not refer to a grinding-specific tool (400-499).  
 - An attempt has been made to deselect tool monitoring for the active tool, although tool length compensation is not active.  
 - Deselection refers to an invalid spindle number.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check TMON and TMOF command.  
 Check tool compensation data.  
 - \$TC\_DP1 : 400 - 499.  
 - \$TC\_TPG1: Spindle number.  
 - \$TC\_TPG8: Inclination angle for slope grinding wheel.  
 - \$TC\_TPG9: Parameter number for radius computation, e.g. 3 for \$TC\_GP3.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14824 [Channel %1: ] Block %2 conflict with GWPS**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The functions of constant grinding wheel surface speed GWPS and constant cutting speed G96 S... have been activated at the same time for a spindle.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14830 [Channel %1: ] Block %2 wrong feed type selected**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** G97 has been programmed in the displayed block although G96 was not (or G97 already) active previously.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Remove G97 from the displayed block and program the correct feed type (G93, G94, G95 or G96) for the machining section which follows.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14840 [Channel %1: ] Block %2 incorrect value range for constant cutting speed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The programmed cutting speed is not within the input range  
 Input range metric: 0.01 to 9 999.99 [m/min]  
 Input range inch: 0.1 to 99 999.99 [inch/min]

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program cutting speed under address S within the permissible range of values.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14850 [Channel %1: ] Block %2 changing the reference axis for a constant cutting speed not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** The attempt was made via the SCC[AX] instruction to change the reference axis for a constant cutting speed.  
 This is not allowed if the indicated axis is no geometry axis.  
**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Please inform authorized personnel/service.  
 When programming SCC[AX] indicate a geometry axis known in the channel.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14860 [Channel %1: ] Block %2 Selection of the tool cutting rate not allowed. Cause %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Cause of the error  
**Definitions:** Selection of the cutting rate SVC is not permissible in the current state  
 Causes of the problem: the following function is active.  
 1: Constant cutting rate G96, G961 or G962 active  
 2: SPOS/SPOSA/M19 (spindle positioning mode) active  
 3: M70/axis mode active  
 4: SUG active  
**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Activate the speed control mode for the spindle prior to programming SVC, for example with M3, M4 or M5.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**14861 [Channel %1 ] Block %2 SVC programmed, but no tool offset active**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** Cutting velocity SVC programmed in the block, but no tool offset active.  
**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Select an appropriate tool prior to the SVC instruction.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**14862 [Channel %1 ] Block %2 SVC has been programmed, but the radius of the active tool correction is zero**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A cutting velocity SVC has been programmed in the block, but the radius of the active tool offset is zero. The radius of the active tool offset consists of the offset parameters \$TC\_DP6, \$TC\_DP12, \$TC\_SCPx6 and \$TC\_ECPx6.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Select an appropriate tool offset with a positive tool radius prior to the SVC instruction.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14863 [Channel %1 ] Block %2 The programmed SVC value is zero or negative**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The programmed value for the cutting velocity SVC is zero or negative.

**Reaction:** Correction block is reorganized.  
 Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program an SVC value larger than zero.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14900 [Channel %1: ] Block %2 center point and end point programmed simultaneously**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When programming a circle by means of the opening angle, the circle center point was programmed together with the circle end point. This is too much information for the circle. Only one of the two points is allowed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Select the programming variant guaranteeing that the dimensions are definitely taken over from the workpiece drawing (avoidance of calculation errors).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**14910 [Channel %1: ] Block %2 invalid angle of aperture for programmed circle**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When programming a circle by means of the opening angle, a negative opening angle or an opening angle greater than or equal to 360 degrees has been programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program opening angle within the allowed range of values between 0.0001 and 359.9999 [degrees].  
**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 14920 [Channel %1: ] Block %2 intermediate point of circle incorrect

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** When programming a circle by means of an intermediate point (CIP) all 3 points (initial, end and intermediate points) are on a straight line and the intermediate point (programmed by means of interpolation parameters I, J, K) is not located between the initial and end points.  
 If the circle is the component of a helix, the specified number of turns (keyword TURN=...) determines further block processing:  
 - TURN>0: alarm display because the circle radius is infinitely great.  
 - TURN=0 and CIP specified between initial and end points. A straight line is generated between the initial and end points (without alarm message).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Locate the position of the intermediate point with the parameters I, J and K in such a way that it actually is located between the initial and end points of the circle or do not make use of this type of circle programming and instead program the circle with radius or opening angle or center point parameters.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 15000 [Channel %1: ] Block %2 channel-sync command using illegal marker

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A WAITM/WAITMC/SETM/CLEARM instruction was programmed with a marker number of less than 1 or greater than the maximum number of markers.  
 Exception: CLEARM(0) is allowed and clears all markers in the channel!

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the instruction accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 15010 [Channel %1: ] Block %2 program coordination instruction with invalid channel number

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A WAITM, WAITMC, INIT or START instruction was programmed with an invalid channel number.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the instruction accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**15020**            **[Channel %1: ] block %2 CHANDATA instruction cannot be executed. Channel %3 is not active**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = String (CHANDATA parameter)

**Definitions:**        With a CHANDATA instruction, the data input for a channel is selected that has not been activated. For structural reasons, the input of multi-channel data must take place twice.

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Please inform the authorized personnel/service department.  
                         - Activate the channel concerned by means of machine data or option data or  
                         - Delete the CHANDATA instruction and all following assignments to channel data. This error message occurs regularly when first reading in an INITIAL Init block with which a multi-channel system is to be installed. In this case:  
                         1. NCK Restart must be executed in order to activate the global machine data already input for the installation of the other channels.  
                         2. Input of the INITIAL Init block must be repeated.

**Program Continuation:**    Switch control OFF - ON.

---

**15021**            **[Channel %1: ] Block %2 CHANDATA instruction with invalid channel number**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**        A CHANDATA instruction is used to enter data for an illegal channel, e. g. <1,> maximum number of channels, not the active channel.

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Program CHANDATA instruction in accordance with the actual configuration.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**15025**            **CHANDATA(%3): channel is not active. Channel data will be ignored.**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = CHANDATA parameter

**Definitions:**        With a CHANDATA instruction, the data input for a channel is selected that has not been activated.

**Reaction:**            NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.



**Remedy:** This is an informational alarm referring to the fact that the file loaded into the NCK contains data of an inactive channel. The number of the inactive channel is specified. Subsequently, the data of this channel are not available in the NCK. The alarm may have two causes:  
 (1) The channel is supposed to be activated by a following NCK RESET/POWER ON, i.e. the file must subsequently be reloaded. If the alarm occurs again, the reason is: (2) the specified channel is actually not supposed to be activated, however, the file contains the relevant data.  
 For the 2nd reason, please check whether the system has correctly not activated the channel mentioned. If the channel has been activated, operation may be continued after another NCK RESET/POWER ON without further measures, i.e. reloading the file is not required. If the channel has not been activated, make sure that the channel inactivated by mistake is re-activated.  
 If the settings of the channel activation are part of the file to be loaded (e.g. archive file), the file must either be modified with the relevant program or the file has to be created once more in the same system with the correct channel number. Similar alarms: 15020, 15021.

**Program Continuation:** Switch control OFF - ON.

### 15030 [Channel %1: ] Block %2 different measurement system settings

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The INCH or METRIC instruction describes the system of measurement in which the data blocks have been read from the control. In order to prevent the incorrect interpretation of data intended for a particular system of measurement, a data block is only accepted if the above instruction matches the active system of measurement.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Change the system of measurement or load a data block which matches the system of measurement.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 15100 [Channel %1: ] Block %2 REORG abort caused by log file overflow

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In order to synchronize the preprocessing run and the main run with REORG, the control accesses modification data which are maintained in a logfile. The alarm indicates that no more capacity is available in the logfile for the specified block in the channel.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. No remedial measures are available for the further execution of the current part program, however:  
 1. Reduce log file size requirement by:  
 Reducing the distance between the preprocessing and the main run via appropriate preprocessing stops STOPRE.  
 2. Increase the size of the logfile by means of the channel-specific machine data:  
 Modify MD28000 \$MC\_MM\_REORG\_LOG\_FILE\_MEM and  
 Modify MD 28010 \$MC\_MM\_NUM\_REORG\_LUD\_MODULES

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**15110 [Channel %1: ] Block %2 REORG not possible**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In order to synchronize the preprocessing run and the main run with REORG, the control accesses modification data which are maintained in a logfile. The alarm indicates that no more capacity is available in the logfile for the specified block in the channel.  
 The alarm message means that the logfile has been deleted in order to obtain additional memory for program reorganization. Consequently, it is no longer possible to REORG the preprocessing memory up to the next coincidence point.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. No remedial measures are available for the further execution of the current part program, however:  
 1. Reduce log file size requirement by:  
 Reducing the distance between the preprocessing and the main run via appropriate preprocessing stops (STOPRE).  
 2. Increase the size of the logfile by means of the channel-specific machine data:  
 Modify MD28000 \$MC\_MM\_REORG\_LOG\_FILE\_MEM and  
 Modify MD28010 \$MC\_MM\_NUM\_REORG\_LUD\_MODULES

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**15120 If a power failure occurs now, the last data changed will be lost; index/buffer size = %1**

**Parameters:** %1 = Index/buffer size

**Definitions:** Notification alarm. The alarm has no negative impact on the current machining.  
 One of the system-internal data buffers, in which the last changed, buffered data are stored, has overflowed because the current data change rate is too high.  
 The alarm warns that a spontaneous power failure in this situation (mains fault, disconnect the system from the power supply) would cause a loss of the immediately previously changed buffered data (tool data, parts programs, R parameters, GUDs,...)  
 If the system is operated in an environment in which a power failure cannot occur, then the output of this alarm can be prevented via machine data MD18232 \$MN\_MM\_ACTFILESYS\_LOG\_FILE\_MEM[ index ] = 0.  
 For information, parameter %1 specifies the index of the machine data, and the buffer size set there.

**Reaction:** Alarm display.

**Remedy:** If the alarm is present only sporadically, it can simply be regarded as a notification. The regular control behavior is not affected.  
 If one does not want to or cannot eliminate the cause, then the alarm can be suppressed by setting MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2; Bit3=1 ('H8').  
 If the alarm is permanently present, please inform the authorized personnel/service department. The value of MD18232 \$MN\_MM\_ACTFILESYS\_LOG\_FILE\_MEM[ index ] will then have to be increased.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**15122 Power ON after power failure: %1 data were restored, of which %2 machine data, %3 errors.**

**Parameters:** %1 = Number of data  
 %2 = Number of machine data  
 %3 = Number of errors occurred

---

<b>Definitions:</b>	Notification alarm. The alarm has no negative effect as long as %3 the number of errors occurred is zero. %1 indicates the number of elementary and complex data restoring steps which were taken after a power OFF during power ON orduring a power failure to restore the persistent NCK data. %2 indicates the number of restored machine data. If the value is larger than zero, another warm restart (NCK reset) may be necessary to make the - possibly configuring - machine data changes prior to the power failure effective. %3 indicates the number of errors occurred during data restoring.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	As long as %3 number of errors occurred is zero, the alarm is only informative. As long as %3 number of errors occurred is larger than zero, the alarm indicates a software error. Further machining with the data is not recommended. Please load a suitable archive file before continuing machining to avoid subsequent problems. Please inform the authorized personnel/service department. File /_N_MPF_DIR/_N_SIEMDIAGMEMPF_MPF contains information that may help Siemens for error diagnosis.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15150</b>	<b>[Channel %1: ] Block %2 reload from external aborted</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Execution from external was aborted because the reload buffer does not have enough machine function blocks (traversing blocks, auxiliary function, dwell time etc.). Background: When already executed machine function blocks are released, memory becomes available in the reload buffer. If machine function blocks are no longer released, nothing can be reloaded - this results in a deadlock situation. Example: Definition of extremely long curve tables via execution from external.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Insert machine function blocks in the part program. - Increase the size of the reload buffer (MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE). - Decrease the size of the curve table (Note: Blocks within CTABDEF/CTABEND are not machine function blocks).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15160</b>	<b>[Channel %1: ] Block %2 wrong preprocessing configuration</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A block element is required, but the block element memory is empty.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify the block search configuration in MD28060 \$MC_MM_IPO_BUFFER_SIZE (decrease size of IPO buffer if necessary) or MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**15165**                    **[Channel %1: ] Block %2 error when translating or interpreting Asup %3**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = String

**Definitions:**            At part program start and at start of an ASUB under Reset condition, the relevant data of all the ASUBs that can be activated at that time are processed:  
                               - PLC ASUBs  
                               - With MD20108 \$MC\_PROG\_EVENT\_MASK configured event-controlled program calls  
                               - ASUB after block search (MD11450 \$MN\_SEARCH\_RUN\_MODE bit 1=1)  
                               - Editable system ASUB (\$MN\_ASUP\_EDITABLE)  
                               If an error occurs (converter or interpreter), alarm 15165 will be output first and then a converter or interpreter alarm that describes more details of the error. Alarm 15165 will cause an interpreter stop. A compensation block will not be possible.

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15166**                    **[Channel %1: ] User system asup \_N\_ASUP\_SPF not available**

**Parameters:**            %1 = Channel number

**Definitions:**            By means of the MD11610 \$MN\_ASUP\_EDITABLE the function "User-defined system asup" has been activated. However, the relevant user program could not be found in the specified search path:  
                               - 1. /\_N\_CUS\_DIR/\_N\_ASUP\_SPF  
                               - 2. /\_N\_CMA\_DIR/\_N\_ASUP\_SPF  
                               The default system asups are used.

**Reaction:**                Interface signals are set.  
                               Alarm display.

**Remedy:**                 Load the user-defined system asup in /\_N\_CUS\_DIR/\_N\_ASUP\_SPF or /\_N\_CMA\_DIR/\_N\_ASUP\_SPF laden.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15170**                    **[Channel %1: ] Block %2 program %3 could not be compiled**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = String

**Definitions:**            An error has occurred in compile mode. The (compiler) error message refers to the program specified here.

**Reaction:**                Alarm display.

**Remedy:**                 Modify part program.

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

**15171**                    **[Channel %1: ] Block %2 compiled program %3 older than the relevant subroutine**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Compiled program file name

---

<b>Definitions:</b>	When calling a precompiled subroutine, it was noticed that the compiled program is older than the relevant SPF file. The compiled program was deleted and during start the subroutine is executed instead of the compiled program.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Perform another precompilation.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>15172</b>	<b>[Channel %1: ] Block %2 subroutine %3. No interface available at time of preprocessing.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Subroutine name
<b>Definitions:</b>	In compilation mode no program interface of the subroutine to be called was available at the time of pre-compilation.
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify parts program or recreate program interfaces and pre-compile programs again.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15173</b>	<b>[Channel %1: ] Block %2 variable %3 was unknown at the time of preprocessing.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Variable
<b>Definitions:</b>	At the time of program precompilation, variable %3 was not known to the control.
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the part program or introduce the variable at the time of precompilation, i.e. activate the new GUD variable prior to precompilation. Then restart precompilation.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15175</b>	<b>[Channel %1: ] Block %2 program %3. Interfaces could not be built</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = String
<b>Definitions:</b>	An error has occurred in interface generation mode. The (compiler) error message refers to the program specified here. In particular when loading new cycle program on the NCK, problems can occur if the value settings in MD18170 \$MN_MM_NUM_MAX_FUNC_NAMES and MD18180 \$MN_MM_NUM_MAX_FUNC_PARAM are too small.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	- Modify part program. - If new cycle programs have been loaded on the NCK, you will normally need to increase the values of MD18170 \$MN_MM_NUM_MAX_FUNC_NAMES and MD18180 \$MN_MM_NUM_MAX_FUNC_PARAM. See also the explanations for alarm 6010.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**15176**                    **[Channel %1: ] Block %2 Program%3 may only be executed after Power ON**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = File name

**Definitions:**            If an encrypted program is loaded to the NCK, an NCK reset (restart) must be performed afterwards, because internal data for efficient processing of the encrypted program are preprocessed during NCK power-up. On calling an encrypted NC program it has now been detected that these data do not exist or are obsolete compared to the current version of the encrypted NC program.

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Perform an NCK reset (restart).

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15177**                    **[Channel %1: ] Block %2 Error on preprocessing of program %3, error code: %4**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = File name  
                               %4 = Error code

**Definitions:**            If an encrypted program is loaded to the NCK, an NCK reset (restart) must be performed afterwards, because internal data for efficient processing of the encrypted program are preprocessed during NCK power-up. The following problem has occurred:  
                               Error code 1: Error on read-in of program %4  
                               Error code 2: There is not enough DRAM memory available for storing the preprocessed data.

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Error code 1: Encrypt and load program %4 again. Then perform an NCK reset (restart).  
                               Error code 2: Increase system SL 710-740, 802D, 828D: \$MN\_MM\_T\_FILE\_MEM\_SIZE.  
     Increase system SL 840 DI: \$MN\_MM\_DRAM\_FILE\_MEM\_SIZE.  
     Then perform an NCK reset (restart).

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15180**                    **[Channel %1: ] Block %2: Error on editing program %3 as INI/DEF file.**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = String

**Definitions:**            Errors were found when processing an initialization program (INI file), or a GUD or macro definition file (DEF file). The error message which is then displayed refers to the program specified here.

**Reaction:**                Alarm display.

**Remedy:**                 Correct the initialization program (INI file), or the GUD or macro definition file (DEF file).  
                               In connection with Alarm 12380 or 12460, also change the memory configuration.

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

---

<b>15182</b>	<b>[channel %1: ] cycle alarm from the modified SIEMENS cycle %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Is not used %3 = Path and file name of the modified SIEMENS cycle
<b>Definitions:</b>	When executing a SIEMENS cycle modified by the user, a cycle alarm was output with SETAL() (see follow-up alarm in the alarm output). Since the SIEMENS cycle was modified by the user (e.g. machine manufacturer), the cause for the cycle alarm must be determined / eliminated by the user who modified the cycle.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	The error cause leading to the cycle alarm cannot be investigated by SIEMENS since the know-how of the modified cycle sequence is with those who are responsible for the cycle change.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>15185</b>	<b>[Channel %1: ] %2 errors in INI file</b>
<b>Parameters:</b>	%1 = Channel number %2 = Number of detected errors
<b>Definitions:</b>	Errors were found when processing initialization program _N_INITIAL_INI. This alarm will also be output, if errors are found during editing of _N_INITIAL_INI in the GUD definition files or if errors are found on ramp-up in the macro definition files.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Correct the INI or DEF file or correct the MD and create a new INI file (via "Upload").
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>15186</b>	<b>[Channel %1: ] %2 errors in GUD, macro or INI file</b>
<b>Parameters:</b>	%1 = Channel number %2 = Number of detected errors
<b>Definitions:</b>	%2 errors were found when processing GUD/macro definition files (DEF files) or initialization files (INI files) Alarm 15180 has already informed about the corresponding file. Prior to that the errors shown were reported by error-specific alarms, e.g. 12080 "syntax error".
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify definition file or initialization file
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15187</b>	<b>[Channel %1: ] Error during execution of PROGEVENT file %3.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Is not used %3 = PROGEVENT file name

**Definitions:** An error has occurred on executing PROGEVENT.  
With alarm 15187, the name of the program that was started as PROGEVENT is displayed. Alarm 15187 is displayed together with the alarm that describes the error cause. Alarm 15187 is also output when the alarm occurs in a subroutine started from PROGEVENT.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Correct the PROGEVENT file (subroutine).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**15188 [Channel %1: ] Error during execution of ASUB file %3.**

**Parameters:** %1 = Channel number  
%2 = Is not used  
%3 = ASUB file name

**Definitions:** An error has occurred on executing an ASUB.  
Alarm 15188 displays the name of the program that was started as ASUB. Alarm 15188 is output together with the alarm that describes the error cause. Alarm 15188 is also output when the alarm occurs in a subroutine started from the ASUB.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Correct the ASUB file (subroutine).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**15189 [Channel %1: ] Error executing SAFE.SPF**

**Parameters:** %1 = Channel number

**Definitions:** An error occurred while processing the NC initialization program for Safety Integrated /\_N\_CST\_DIR/\_N\_SAFE\_SPF. This alarm is output together with the alarm describing the cause of the error.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct /\_N\_CST\_DIR/\_N\_SAFE\_SPF and perform an NCK reset.

**Program Continuation:** Switch control OFF - ON.

---

**15190 [Channel %1: ] Block %2 not enough free memory for subroutine call**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The following deadlock has been found in the interpreter: Memory is needed for calling a subroutine. The module memory is, however, empty and there is no prospect of module memory becoming free again by executing the preprocessing/main run queue, because this queue is empty.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.



**Remedy:** Please inform the authorized personnel/service department. Increase machine data MD28010 \$MC\_MM\_NUM\_REORG\_LUD\_MODULES / MD28040 \$MC\_MM\_LUD\_VALUES\_MEM / MD18210 \$MN\_MM\_USER\_MEM\_DYNAMIC or program a preprocessing stop STOPRE before calling the subroutine.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### **15300 [Channel %1: ] Block %2 invalid number-of-passed-blocks during block search**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the function "Block search with calculation" a negative number of passes has been entered in column P (number of passes). The permissible range of values is P 1 - P 9 999.

**Reaction:** Alarm display.

**Remedy:** Enter only positive number of passes within the range of values.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### **15310 [Channel %1: ] Block %2 file requested during block search is not available**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During block search, a target has been specified with a program that has not been loaded.

**Reaction:** Alarm display.

**Remedy:** Correct the specified search target accordingly or reload the file.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### **15320 [Channel %1: ] Block %2 invalid block search command**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The block search command (type of search target) is smaller than 1 or greater than 5. It is entered in column type of the block search window. The following block search orders are allowed.

Type	Meaning
1	Search for block number
2	Search for label
3	Search for string
4	Search for program name
5	Search for line number in a file

**Reaction:** Alarm display.

**Remedy:** Modify the block search command.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### **15330 [Channel %1: ] Block %2 invalid block number as search target**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Syntax error! Positive integers are allowed as block numbers. Block numbers must be preceded by ":" and subblocks by an "N".

**Reaction:** Alarm display.

**Remedy:** Repeat the input with corrected block number.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**15340 [Channel %1: ] Block %2 invalid label as search target**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Syntax error! A label must have at least 2 but no more than 32 characters, and the first two characters must be alphabetic or underscore characters. Labels must be concluded with a colon.  
**Reaction:** Alarm display.  
**Remedy:** Repeat the input with corrected label.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**15350 [Channel %1: ] Block %2 search target not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The specified program has been searched to the end of the program without the selected search target having been found.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Check the part program, change the block search (typing error in the part program) and restart the search.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**15360 [Channel %1: ] Illegal target of block search (syntax error)**

**Parameters:** %1 = Channel number  
**Definitions:** The specified search target (block number, label or string) is not allowed in block search.  
**Reaction:** Alarm display.  
**Remedy:** Correct target of block search.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**15370 [Channel %1: ] Target of block search not found**

**Parameters:** %1 = Channel number  
**Definitions:** In a block search, an impermissible search target has been specified (e.g. negative block number).  
**Reaction:** Alarm display.  
**Remedy:** Check the specified block number, label or character string. Repeat entry with correct search target.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

<b>15380</b>	<b>[Channel %1: ] Block %2 illegal incremental programming in axis %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis
<b>Definitions:</b>	The first axis programming after "search to block end point" is performed incrementally. This is not allowed in the following situations: - After searching the target a transformation change has taken place. - A frame with rotation component is active. The programmed axis is involved in the rotation.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Find search destination in which the axes are programmed using an absolute reference. Deactivate adding of the accumulated search position with SD42444 \$SC_TARGET_BLOCK_INCR_PROG = FALSE. Use search run with calculation "at contour".
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15390</b>	<b>[Channel %1: ] Block %2 %3 not executed during block search</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Source symbol
<b>Definitions:</b>	During block search, commands for switching, deleting and defining of the electronic gear are not executed and not gathered but simply skipped.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Set the desired gear status via asynchronous subprogram.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>15395</b>	<b>[Channel %1: ] Master-slave not executable during block search</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	A master-slave coupling is to be closed in the part program via the instruction MASLON. The position offset \$P_SEARCH_MASLD, however, cannot be correctly calculated during block search, as the axes to be coupled are located in different channels.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Make sure that all relevant axes are in the same channel.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>15400</b>	<b>[Channel %1: ] Block %2 selected initial INIT block does not exist</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label

**Definitions:** The operator has selected an INI block for a read, write or execution function which:  
 1. Does not exist in the NCK range or  
 2. Does not have the necessary protection level required for performing the function.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 Check whether the selected INI block is contained in the file system of the NCK. The present protection level must be selected to be at least equal to (or greater than) the protection level that has been defined for the read, write or execution function at the time of creating the file.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**15410 [Channel %1: ] Block %2 initialization file contains invalid M function**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The only M function allowed in an Init block is the M02, M17 or M30 end-of-program function.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Remove all M functions from the Init block except for the end identifier.  
 An Init block may contain value assignments only (and global data definitions if they are not defined again in a program that can be executed later) but no motion or synchronous actions.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**15420 [Channel %1: ] Block %2 instruction in current mode not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The alarm is output in the following situations:  
 - The interpreter has detected an illegal instruction (e.g. a motion command) while processing an INI file or a definition file (macro or GUD).  
 - In a GUD file, the access security for a machine data item is to be changed with REDEF, although an ACCESS file (\_N\_SACCESS\_DEF, \_N\_MACCESS\_DEF, \_N\_UACCESS\_DEF) is available. Access rights for machine data can then only be changed via one of the ACCESS files with REDEF.  
 - When processing the safety initialization program /\_N\_CST\_DIR/\_N\_SAFE\_SPF an illegal instruction was detected due to the reduced language scope configured.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Correct the INI, GUD or macro file.  
 - Correct part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**15450 [Channel %1: ] Block %2 compiled program cannot be stored**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In the compile mode, a compiled program could not be stored. One of the following reasons applies:  
 - Not enough memory  
 - Intermediate code line (compile) too large

**Reaction:** Alarm display.

**Remedy:** Create space in work memory or modify part program (make it less complex).  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### **15460 [Channel %1: ] Block %2 syntax error when locking**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The addresses programmed in the block are not compatible with the modal syntax-determining G function.  
 Example:  
 N100 G01 ... I .. J.. K.. LF

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct the displayed block and ensure that the G functions and addresses in the block are in agreement.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### **15500 [Channel %1: ] Block %2 illegal angle of shear**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The function CSHEAR has been called with an illegal (impossible) angle of shear, e.g. when the sum of angles between the axis vectors is greater than 360 degrees.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program the angle of shear in accordance with the geometrical conditions of the machine and workpiece system.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### **15700 [Channel %1: ] Block %2 illegal cycle alarm number %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Cycle alarm number

**Definitions:** A SETAL command has been programmed with a cycle alarm number smaller than 60 000 or greater than 69 999.  
 Alarm reaction of Siemens standard cycles:  
 Nos. 61 000 -61 999: Interpreter stop; delete with Reset  
 Nos. 62 000 - 62 999: Compensation block; delete with NC Start

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program alarm number in the SETAL instruction in the correct range.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**15701 [Channel %1: ] Block %2 motion synchronous action: %3 illegal cycle alarm number %4**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Cycle alarm number

**Definitions:** A SETAL command has been programmed with a cycle alarm number smaller than 60 000 or greater than 69 999.  
Alarm reaction of Siemens standard cycles:  
Nos. 61 000 -61 999: Interpreter stop; delete with Reset  
Nos. 62 000 - 62 999: Compensation block; delete with NC Start

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Program alarm number in the SETAL instruction in the correct range.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15800 [Channel %1: ] Block %2 wrong starting conditions for CONTPRON/CONTDCON**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** There is an error in the start conditions for CONTPRON/CONDCON:  
- G40 not active  
- SPLINE or POLY active  
- Unknown machining type programmed  
- Transferred machining direction not defined  
- Definition of LUDs in incorrect subroutine level  
- Transferred circle coordinates

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15810 [Channel %1: ] Block %2 wrong array dimension for CONTPRON/CONTDCON**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The number of columns for the array created for CONTPRON/CONTDCON does not conform to the current programming guide.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**15900 [Channel %1: ] Block %2 touch probe not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Measure with deletion of distance-to-go In the part program, an illegal probe has been programmed with the command MEAS (measure with deletion of distance-to-go). The probe numbers 0 ... no probe 1 ... probe 1 2 ... probe 2 are allowed, whether the probe is actually connected or not. Example: N10 MEAS=2 G01 X100 Y200 Z300 F1000 Probe 2 with deletion of distance-to-go
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Include a probe number within the limits given above in the keyword MEAS=... This must correspond to the hardware connection of the probe.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**15910 [Channel %1: ] Block %2 touch probe not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Measure without deletion of distance-to-go In the part program, an illegal probe has been programmed with the command MEAW (measure without distance-to-go). The probe numbers 0 ... no probe 1 ... probe 1 2 ... probe 2 are allowed, whether the probe is actually connected or not. Example: N10 MEAW=2 G01 X100 Y200 Z300 F1000 Probe 2 without deletion of distance-to-go
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Include a probe number within the limits given above in the keyword MEAW=... This must correspond to the hardware connection of the probe.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**15950 [Channel %1: ] Block %2 no traverse motion programmed**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Measure with deletion of distance-to-go In the part program, no axis or a traversing path of zero has been programmed with the command MEAS (measure with deletion of distance-to-go).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the part program and add the axis address or the traversing path to the measurements block.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**15960 [Channel %1: ] Block %2 no traverse motion programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Measure without deletion of distance-to-go  
In the part program, no axis or a traversing path of zero has been programmed with the command MEAW (measure without deletion of distance-to-go).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the part program and add the axis address or the traversing path to the measurements block.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**16000 [Channel %1: ] Block %2 invalid value for lifting direction**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During the "rapid lift from contour" (keyword: LIFTFAST), a code value for the lifting direction (keyword: ALF=...) which lies outside the permissible range (permissible value range: 0 to 8) was programmed .  
With active cutter radius compensation:  
Code numbers 2, 3 and 4 cannot be used in G41  
Code numbers 6, 7 and 8 cannot be used in G42 because they code the direction to the contour.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the lifting direction under ALF=... within the permissible limits.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**16005 [Channel %1: ] Block %2 invalid value for lifting distance**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Mistake in programming: the value for the lifting path must not be negative.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**16010 [Channel %1: ] Block %2 machining stop after lift fast**

**Parameters:** %1 = Channel number  
%2 = Block number, label



---

<b>Definitions:</b>	LIFTFAST without interrupt routine (Asup) has been programmed. The channel is stopped after the lift motion has been carried out.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	After the channel stop, the axes must be retracted manually in JOG and the program aborted with Reset.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>16015</b>	<b>[Channel %1: ] Block %2 wrong axis identifier %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
<b>Definitions:</b>	Axis names from different coordinate systems were used to program axes for LIFTFAST. The retraction movement is no longer clear.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Use axis names from one coordinate system.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16016</b>	<b>[Channel %1: ] Block %2 no retraction position programmed for axis %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name
<b>Definitions:</b>	The retraction enable was programmed for LIFTFAST without defining a retraction position for the axis. The retraction movement is no longer clear.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program a retraction position for the relevant axis.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16017</b>	<b>[Channel %1: ] Axis %2 Identifier %3, LIFTFAST ignores this axis, current axis not capable of retraction</b>
<b>Parameters:</b>	%1 = Channel %2 = Axis, spindle %3 = Identifier

**Definitions:**

LIFTFAST cannot be applied to the axis.  
 Alarm can be suppressed via MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 11.  
 Identifier (parameter 3) is bit-coded and displays some possible causes for the alarm:  
 0x01Axis is in another channel  
 0x02Axis is in spindle mode (e.g. SPOS)  
 0x04Axis is PLC axis  
 0x08Axis is oscillating axis  
 0x10Axis is neutral axis  
 0x20Axis is coupled slave axis  
 0x40Axis is in static synchronized action  
 Overview of reactions of common programming to LIFTFAST:  
 Axis | Synact | Reaction to LIFTFAST

Path		STOP + LIFTFAST
POS		STOP + LIFTFAST
POS	non-modal	STOP + LIFTFAST
POS	modal	STOP + LIFTFAST
POS	stati.	RUN + SHOWALARM 16017
POSA		STOP + LIFTFAST
MOV	non-modal	STOP + LIFTFAST
MOV	modal	STOP + LIFTFAST
MOV	stati.	RUN + SHOWALARM 16017
PLC		RUN + SHOWALARM 16017
Oscill.		RUN + SHOWALARM 16017
SPOS		STOP + SHOWALARM 16017
SPOS	non-modal	STOP + SHOWALARM 16017
SPOS	modal	STOP + SHOWALARM 16017
SPOS	stati.	RUN + SHOWALARM 16017
SPOSA		STOP + SHOWALARM 16017

**Reaction:**

Alarm display.

**Remedy:**

Remove axis from POLFMLIN or POLFMASK.  
 Alarm can be suppressed via MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 11.  
 At the time of LIFTFAST, an axis for LIFTFAST is programmed, but the status of the axis does not allow LIFTFAST (e.g. oscillating axis or spindle), or the axis is not in the channel. LIFTFAST should only be applied to those axes that are capable of retracting at that time; POLFMASK or POLFMLIN should be adapted accordingly.

**Program**

Clear alarm with the Delete key or NC START.

**Continuation:**

**16020 [Channel %1: ] Repositioning in block %2 is not possible**

**Parameters:**

%1 = Channel number  
 %2 = Block number, label

**Definitions:**

Programming or operator action incorrect:  
 Repositioning via REPOS command is only possible in an asynchronous subprogram (interrupt routine).  
 If the REPOS command was programmed, e.g. in the main program or in a cycle, part program execution is aborted with alarm 16020.  
 In addition, the alarm is output in the following situations:  
 - Access to \$AC\_RETPOINT (repositioning point) outside an ASUP (e.g. in the main program)  
 - An axis to be repositioned was an oscillating axis with synchronous infeed (OSCILL) in the interrupted block and is now in a state that does not allow it to be traversed as an oscillating axis. Remedy: Change the axis to "neutral axis" state before repositioning with WAITP.  
 - An axis to be repositioned was an infeed axis for an oscillating axis in the interrupted block; now it can no longer be traversed as one. Remedy: Change the axis back to "POS axis" state before repositioning.

**Reaction:**

Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:**

Modify the part program if necessary.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**16025 [Channel %1: ] Block %2 impermissible axis exchange in REPOS command by axis %3.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis identifier

**Definitions:** With the REPOS command, an axis or spindle was programmed that was in the NEUTRAL state at that time. As the REPOS command cannot execute any implicit GET, these axes/spindles cannot be repositioned. Part program editing is therefore aborted.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Assign the axes/spindles that are to be repositioned to the channel via GET command prior to the REPOS command.  
 Example:  
 GET(A); assign the A axis to the channel  
 REPOS L A; reposition the geometry axes and A axis

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**16100 [Channel %1: ] Block %2 spindle %3 not available in the channel**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = String

**Definitions:** Incorrect programming:  
 This channel does not recognize the spindle number.  
 The alarm can occur together with a dwell or a spindle function.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 Check the part program to determine whether the programmed spindle number is correct and whether the program is run in the correct channel.  
 Check MD35000 \$MA\_SPIND\_ASSIGN\_TO\_MACHAX for all machine axes to see whether one of them contains the programmed spindle number. This machine axis number must be entered in a channel axis of the machine data MD20070 \$MC\_AXCONF\_MACHAX\_USED.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**16105 [Channel %1: ] Block %2 spindle %3 cannot be assigned**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = String

**Definitions:** Mistake in programming: The programmed spindle is not assigned a real spindle by the spindle number converter. The alarm can be issued after improper use of SD42800 \$SC\_SPIND\_ASSIGN\_TAB[].

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Correct setting data or modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**16110 [Channel %1: ] Block %2 spindle %3 for dwell time not in control mode**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis, spindle

**Definitions:** The spindle can be in the positioning mode, oscillating mode and control mode. With the M command M70 it can be changed from a spindle to an axis. The control mode is divided into the speed-controlled and position-controlled mode, and it is possible to alternate between these with the keywords SPCON and SPCOF.  
 Positioning mode:  
 Position control (spindle position under SPOS/SPOSA)  
 Oscillating mode:  
 Speed control (M41 - M45 or M40 and S...)  
 Control mode:  
 Speed control (spindle speed under S..., M3/M4/M5)  
 Position control (SPCON/SPCOF, spindle speed under S..., M3/M4/M5)  
 Axis mode:  
 Position control (M70/M3, M4, M5, axis position under user-selectable axis name)

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check part program for correct spindle number.  
 With M3, M4 or M5 put the required spindle into control mode before calling the dwell time.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16111 [Channel %1: ] Block %2 spindle %3 No speed programmed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle

**Definitions:** Programming of a speed is expected.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program speed with S[spindle number]=..

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16112 [Channel %1: ] Block %2 following spindle %3 Impermissible programming**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle

**Definitions:** With synchronous spindle-VV-coupling an additional motion for the following spindle can only be programmed with M3, M4, M5 and S... The paths created by specified positions cannot be maintained safely for a velocity coupling, especially if a position control is missing. If dimensional accuracy or reproducibility are not important, the alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK Bit27 = 1.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Use synchronous spindle-DV-coupling or program direction of rotation and speed.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 16120 [Channel %1: ] Block %2 invalid index for tool fine compensation

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Mistake in programming: The 2nd parameter in the PUTFTOC command indicates for which tool parameter the value is to be corrected (1 - 3 tool lengths, 4 tool radius). The programmed value is beyond the permitted range. Permissible values are 1 - 4 if on-line tool radius compensation is allowed (see MD20254 \$MC\_ONLINE\_CUTCOM\_ENABLE), otherwise values 1 - 3.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program: Length 1 - 3 or 4 permissible for radius.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 16130 [Channel %1: ] Block %2 command not allowed with FTOCON

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

- Case 1: A plane change is not allowed if the modal G function FTOCON: "fine tool compensation" is active.
- Case 2: Transformation selection is allowed only for zero transformation or transformation inclined axis, Transmit or Tracyl if FTOCON is active.
- Case 3: Tool change is not allowed with M06 if FTOCON has been active since the last tool change.
- Case 4: Orientable tool holder is active.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program: Deselect fine tool compensation with FTOCOF.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 16140 [Channel %1: ] Block %2 FTOCON not allowed

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool fine compensation (FTOC) is not compatible with the currently active transformation.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program: Deselect fine tool compensation with FTOCOF.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 16150 [Channel %1: ] Block %2 invalid spindle number with PUTFTOCF

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The spindle number programmed for PUTFTOC or PUTFTOCF is beyond the permitted range for the spindle numbers.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** Modify part program. Is the programmed spindle number available?  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16200 [Channel %1: ] Block %2 spline and polynomial interpolation not available**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The spline and polynomial interpolation are options that are not contained in the basic version of the control.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** Do not program spline and polynomial interpolation, or retrofit the necessary option.  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16300 [Channel %1: ] Block %2 denominator polynomial with zero places within parameter range not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The programmed denominator polynomial (with PL [ ] = ... , i.e. without specification of geometry axis) has a zero place within the defined parameter range (PL = ...). This means that the quotient of the numerator polynomial and the denominator polynomial is infinite or indeterminate.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** Modify the polynomial block so that there is no zero place within the polynomial length in the denominator polynomial.  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16400 [Channel %1: ] Block %2 positioning axis %3 cannot participate in spline**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number  
**Definitions:** An axis assigned to a spline grouping (n) with SPLINEPATH (n, AX1, AX2, ...) has been programmed as positioning axis with POS or POSA.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** Do not assign the positioning axis to the spline grouping.  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>16410</b>	<b>[Channel %1: ] Block %2 axis %3 is not a geometry axis</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A geometry axis has been programmed that cannot be imaged on any machine axis in the current transformation (possibly there is no transformation active at the moment). Example: Without transformation: Polar coordinate system with X, Z, and C axis With transformation: Cartesian coordinate system with X, Y, and Z, e.g. with TRANSMIT.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Activate transformation type with TRAORI (n) or do not program geometry axes that do not participate in the transformation grouping.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16420</b>	<b>[Channel %1: ] Block %2 axis %3 programmed repeatedly</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	It is not allowed to program an axis more than once.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Delete the axis addresses that have been programmed more than once.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16421</b>	<b>[Channel %1: ] Block %2 angle %3 programmed repeatedly in the block</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Angle
<b>Definitions:</b>	It is not allowed to program more than one PHI or PSI angle for an orientation vector in the same block.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16422</b>	<b>[Channel %1: ] Block %2 angle %3 programmed repeatedly in the block</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Angle

**Definitions:** It is not allowed to program more than one rotation angle THETA for the orientation in one block. The angle of rotation can either be programmed explicitly with THETA or by programming with Euler angles or RPY angles.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16423 [Channel %1: ] Block %2 angle %3 programmed repeatedly in the block**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Angle

**Definitions:** It is not allowed to program more than one polynomial for the orientation rotation angle with PO[THT] in one block.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16424 [Channel %1: ] Block %2 coordinate %3 programmed repeatedly in the block**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Coordinate

**Definitions:** It is not allowed to program a coordinate of the 2nd contact point of the tool for description of the tool orientation several times in one block.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16430 [Channel %1: ] Block %2 geometry axis %3 cannot traverse as positioning axis in rotated coordinate system**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** In the rotated coordinate system, traversing of a geometry axis as positioning axis (i.e. along its axis vector in the rotated coordinate system) would mean traversing of several machine axes. This is in conflict with the positioning axis concept, however, in which one axis interpolator runs in addition to the path interpolator!

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Traverse geometry axes as positioning axes only with rotation deactivated.  
Deactivate rotation:  
Keyword ROT without further specification of axis and angle.  
Example: N100 ROT



**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### 16440 [Channel %1: ] Block %2 rotation programmed for non-existent geometry axis

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A rotation of a geometry axis which does not exist was programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### 16500 [Channel %1: ] Block %2 chamfer or rounding negative

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** A negative chamfer or rounding has been programmed under the keywords CHF= ..., RND=... or RNDM=...

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Values for chamfers, roundings and modal roundings must be programmed with positive values only.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### 16510 [Channel %1: ] Block %2 no facing axis for diameter programming available

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Diameter programming has been activated although no transverse axis with diameter programming has been applied. Transverse axes can be applied with MD20100 \$MC\_DIAMETER\_AX\_DEF or MD30460 \$MA\_BASE\_FUNCTION\_MASK bit2 for diameter programming. Diameter programming can be applied through:

- basic position DIAMON or DIAM90 of the G 29 group during booting
- programming of DIAMON or DIAM90
- programming of DIAMONA[AX], DIAM90A[AX] or DAC, DIC, RAC, RIC

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 When programming DIAMON/DIAM90, a transverse axis must be configured via MD20100 \$MC\_DIAMETER\_AX\_DEF. When programming DIAMONA[AX], DIAM90A[AX] or DAC, DIC, RAC, RIC, the AX axis must be a transverse axis for diameter programming configured via MD30460 \$MA\_BASE\_FUNCTION\_MASK bit2.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

**16520 [Channel %1: ] Axis %2, diameter programming active, function %3 is not executed**

**Parameters:** %1 = Channel  
 %2 = Axis, spindle  
 %3 = NC function

**Definitions:** The function is not executed with diameter programming active for the stated axis. The following functions may be affected:  
 1 - Axis exchange  
 2 - Axis container rotation

**Reaction:** Interpreter stop  
 Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Disable diameter programming of the axis before activating the function.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16600 [Channel %1: ] Block %2 spindle %3 gear stage change not possible**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle number

**Definitions:** The programmed speed is outside the speed range of the set gear stage. In order to execute the programmed speed, the gear stage must be changed. In order to be able to execute the automatic gear stage change (M40 is active), the spindle must be in speed control operation.  
 The alarm will no longer be output after having set bit 30 (0x40000000) in MD11410 \$MN\_SUPPRESS\_ALARM\_MASK. However, the function will not be affected by this.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The changeover to speed control operation is performed by programming M3, M4 or M5. The M functions can be written together with the S word in the same block.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16605 [Channel %1: ] Block %2 Spindle %3 Gear stage change in %4 not possible**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle number  
 %4 = Gear stage

**Definitions:** A gear stage change for the spindle will not be possible, if:  
 - thread cutting (G33, G34, G35) is active  
 - the spindle is active as master or slave spindle in a coupling  
 - the spindle is being positioned

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The gear stage is to be set prior to the corresponding machining step.  
 If it is necessary, however, to change the gear stage within one of the above mentioned functions, this function must be switched off for the time of the gear stage change. Thread cutting is deselected with G1; synchronous spindle coupling is switched off with COUPOF; the spindle positioning operation is exited with M3, M4 or M5.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16670 [Channel %1: ] Block %2 following axis/spindle %3 maximum number of CP modules (%4) has been exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP modules
<b>Definitions:</b>	An attempt was made to activate more generic couplings than are configured in MD18450 \$MN_MM_NUM_CP_MODULES.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN_MM_NUM_CP_MODULES. If necessary, buy another option stage of the generic coupling.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16671 [Channel %1: ] Block %2 following axis/spindle %3 maximum number of CP modules (%4) has been exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP modules
<b>Definitions:</b>	An attempt was made to activate more generic couplings than are configured in MD18450 \$MN_MM_NUM_CP_MODULES.
<b>Reaction:</b>	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN_MM_NUM_CP_MODULES. If necessary, buy another option stage of the generic coupling.
<b>Program Continuation:</b>	Clear alarm with the RESET key in all channels. Restart part program.

---

**16672 [Channel %1: ] Block %2 leading axis/spindle %3 maximum number of CP master values (%4) exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP master values
<b>Definitions:</b>	An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD. If necessary, buy another option stage of the generic coupling.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**16673 [Channel %1: ] Block %2 leading axis/spindle %3 maximum number of CP master values (%4) exceeded**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number  
 %4 = Max. number of CP master values

**Definitions:** An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN\_MM\_NUM\_CP\_MODUL\_LEAD.

**Reaction:** NC not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN\_MM\_NUM\_CP\_MODUL\_LEAD.  
 If necessary, buy another option stage of the generic coupling.

**Program Continuation:** Clear alarm with the RESET key in all channels. Restart part program.

---

**16674 [Channel %1: ] Block %2 motion synchronous action: %3 following axis/spindle %4 maximum number of CP modules exceeded**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name, spindle number

**Definitions:** An attempt was made to activate more generic couplings than are configured in MD18450 \$MN\_MM\_NUM\_CP\_MODULES.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN\_MM\_NUM\_CP\_MODULES.  
 If necessary, buy another option stage of the generic coupling.

**Program Continuation:** Clear alarm with the RESET key in all channels. Restart part program.

---

**16675 [Channel %1: ] block %2 following axis/spindle %3 coupling module already defined in channel %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis/spindle  
 %4 = Channel number

**Definitions:** An attempt was made to define or activate a CP coupling, although a coupling had already been defined or activated on this following axis/spindle in another channel.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Change the part program: A CP coupling module must not be simultaneously defined in multiple channels for the same following axis/spindle.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**16676 [Channel %1: ] Block %2 motion synchronous action: %3 leading axis/spindle %4 maximum number of CP modules exceeded**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name, spindle number

**Definitions:** An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN\_MM\_NUM\_CP\_MODUL\_LEAD.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN\_MM\_NUM\_CP\_MODUL\_LEAD.  
 If necessary, buy another option stage of the generic coupling.

**Program** Clear alarm with the RESET key in all channels. Restart part program.  
**Continuation:**

**16677 [Channel %1: ] Block %2 motion synchronous action %3 coupling module is already defined in the channel %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Channel number

**Definitions:** An attempt was made to define or activate a CP coupling, although a coupling had already been defined or activated on this following axis/spindle in another channel.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Change the part program: A CP coupling module must not be simultaneously defined in multiple channels for the same following axis/spindle.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**16678 [Channel %1: ] Block %2 following axis/spindle %3 status %4 impermissible traversing instruction**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number  
 %4 = Status

**Definitions:** An additional traversing in the following axis/spindle is not permitted in the current status of the generic coupling.  
 Example: CPOF=X G0 X100 is not permitted.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.  
 A motion in the following axis/spindle can be programmed with CPFPOS, CPON or CPOF

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16680 [Channel %1: ] Block %2 following axis/spindle %4 instruction %3 programmed repeatedly**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = CP instruction  
 %4 = Axis name, spindle number

**Definitions:** The stated instruction has been programmed repeatedly in the block for the same following axis/spindle of a generic coupling.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16681 [Channel %1: ] Block %2 following axis/spindle %3 CPFPOS not permitted (reason %4)**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number  
 %4 = Reason

**Definitions:** CPFPOS must not be declared for a following axis/spindle of a generic coupling in the current status. The reasons for this may be:  
 - Reason 1: The coupling does not completely switch off, at least one leading axis/spindle remains active in the coupling.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The following remedies are available for the reasons stated below:  
 - Reason 1: Only declare CPFPOS when switching off the coupling, if it is completely closed.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16682 [Channel %1: ] Block %2 following axis/spindle %3 instructions %4 are not possible.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number  
 %4 = CP instruction

**Definitions:** The stated instructions are not permitted together in one block for a following axis/spindle of a generic coupling.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>16684</b>	<b>[Channel %1: ] Block %2 following axis/spindle %3 instructions %4 are not possible separately.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
<b>Definitions:</b>	The stated instructions are only permitted together in one block for a following axis/spindle of a generic coupling.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>16685</b>	<b>[Channel %1: ] Block %2 following axis/spindle %3 instructions %4 are not possible separately.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
<b>Definitions:</b>	The stated instructions are only permitted together in one block for a following axis/spindle of a generic coupling.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>16686</b>	<b>[Channel %1: ] Block %2 following axis/spindle %3 type of coupling/instruction %4 is not possible.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
<b>Definitions:</b>	The stated instruction is not permitted for the stated type of generic coupling.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**16687 [Channel %1: ] Block %2 motion synchronous action %3 type of coupling/instruction %4 is not possible.**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Coupling type

**Definitions:** The stated instruction is not permitted for the stated type of generic coupling.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16688 [Channel %1: ] Block %2 following axis/spindle %3 coupling type %4 maximum number of master values exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number  
%4 = Coupling type

**Definitions:** The maximum number of master values has been exceeded for the stated type of generic coupling.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program, reduce number of master values or use a different type of coupling.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16689 [Channel %1: ] Block %2 following axis/spindle %3 coupling type %4 maximum number of master values exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number  
%4 = Coupling type

**Definitions:** The maximum number of master values has been exceeded for the stated type of generic coupling.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program, reduce number of master values or use a different type of coupling.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

**16690 [Channel %1: ] Block %2 following axis/spindle %3 changing the reference system %4 is not possible.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Reference system
<b>Definitions:</b>	An attempt was made to change the reference system with generic coupling active.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part programm. End coupling and reactivate with desired reference system.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16691 [Channel %1: ] Block %2 following axis/spindle %3 changing the reference system %4 is not possible.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Reference system
<b>Definitions:</b>	An attempt was made to change the reference system with generic coupling active.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part programm. End coupling and reactivate with desired reference system.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16692 [Channel %1: ] Block %2 following axis/spindle %3 maximum number of couplings in the block %4 has been exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Maximum number of couplings
<b>Definitions:</b>	The maximum number of generic couplings in the block has been exceeded.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program. Reduce the number of generic couplings programmed in the block.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16694 [Channel %1: ] Block %2 following axis/spindle %3 status/instruction %4 is not possible.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number  
%4 = Status, instruction

**Definitions:** The stated instruction is not permitted for the current status of the generic coupling.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16695 [Channel %1: ] Block %2 following axis/spindle %3 status/instruction %4 is not possible.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number  
%4 = Status, instruction

**Definitions:** The stated instruction is not permitted for the current status of the generic coupling.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16696 [Channel %1: ] Block %2 following axis/spindle %3 coupling has not been defined.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** An instruction to an undefined coupling is to be executed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.  
Define the coupling and activate, if necessary, before the instruction.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16697 [Channel %1: ] Block %2 following axis/spindle %3 coupling has not been defined.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

---

<b>Definitions:</b>	An instruction to an undefined coupling is to be executed.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part programm. Define the coupling and activate, if necessary, before the instruction.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16698 [Channel %1: ] Block %2 following axis/spindle %3 leading axis/spindle %4 has not been defined.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Axis name, spindle number
<b>Definitions:</b>	An instruction to an undefined leading axis/spindle of a coupling is to be executed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part programm. Define the leading axis/spindle and activate, if necessary, before the instruction.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16699 [Channel %1: ] Block %2 motion synchronous action %3 leading axis/spindle %4 has not been defined.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
<b>Definitions:</b>	An instruction to an undefined leading axis/spindle of a coupling is to be executed.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part programm. Define the leading axis/spindle and activate, if necessary, before the instruction.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**16700 [Channel %1: ] Block %2 axis %3 invalid feed type**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
--------------------	---

**Definitions:** In a thread cutting function, the feed has been programmed in a unit that is impermissible. G33 (thread with constant lead) and the feed have not been programmed with G94 or G95. G33 (thread with constant lead) is active (modal) and G63 is programmed additionally in a following block. (Conflict situation! G63 is in the 2nd G group, G33, G331 and G332 are in the 1st G group). G331 or G332 (rigid tapping) and the feed have not been programmed with G94.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Use only the feed type G94 or G95 in the thread cutting functions.  
After G33 and before G63, deselect the thread cutting function with G01.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16701 [Channel %1: ] Block %2 motion synchronous action %3 following axis/spindle %4 coupling is not defined**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Axis name, spindle number

**Definitions:** An instruction to an undefined coupling is to be executed.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part programm.  
Define the coupling and activate, if necessary, before the instruction.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16710 [Channel %1: ] Block %2 axis %3 master spindle not programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** A master spindle function has been programmed (G33, G331, G95, G96) but the speed or the direction of rotation of the master spindle is missing.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Add S value or direction of rotation for the master spindle in the displayed block.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**16715 [Channel %1: ] Block %2 axis %3 spindle not in standstill**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Spindle number

---

<b>Definitions:</b>	In the applied function (G74, reference point approach), the spindle must be stationary.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program M5 or SPOS/SPOSA in front of the defective block in the part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16720 [Channel %1: ] Block %2 axis %3 thread pitch is zero

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	No pitch was programmed in a thread block with G33 (thread with constant pitch) or G331 (rigid tapping).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	The thread pitch must be programmed for the specified geometry axis under the associated interpolation parameters. X -> I Y -> J Z -> K
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16730 [Channel %1: ] Block %2 axis %3 wrong parameter

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	In G33 (tapping with constant pitch) the pitch parameter was not assigned to the axis that determines the velocity. For longitudinal and face threads, the thread pitch for the specified geometry axis must be programmed under the associated interpolation parameter. X -> I Y -> J Z -> K For taper threads, the address I, J, K depends on the axis with the longer path (thread length). A 2nd lead for the other axis is, however, not specified.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Assign lead parameters to the axis that determines the velocity.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16740 [Channel %1: ] Block %2 no geometry axis programmed

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** No geometry axis was programmed for tapping (G33) or for rigid tapping (G331, G332). The geometry axis is, however, essential if an interpolation parameter has been specified.  
 Example:  
 N100 G33 Z400 K2 ; thread pitch 2mm, thread end Z=400 mm  
 N200 SPOS=0 ; position spindle in axis mode  
 N201 G90 G331 Z-50 K-2 ; tapping to Z=-50, counterclockwise  
 N202 G332 Z5 ; retraction, direction reversal automatic  
 N203 S500 M03 ; spindle again in spindle mode

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Specify geometry axis and corresponding interpolation parameters.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16746 [Channel %1: ] Block %2 spindle %3 selected gear stage %4 not installed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle number  
 %4 = Gear stage

**Definitions:** The first gear stage data block is active. The required gear stage is not installed in the 1st gear stage data block. The number of gear stages installed is configured in MD35090 \$MA\_NUM\_GEAR\_STEPS.  
 Examples of the occurrence of the alarm with 3 three gear stages installed (MD 35090 \$MA\_NUM\_GEAR\_STEPS = 3):  
 \* ... M44 or M45 has been programmed for the spindle concerned  
 \*...M70 has been programmed and MD35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE is larger than 3.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program: Only those valid gear stages can be entered which have also been installed according to MD35090 \$MA\_NUM\_GEAR\_STEPS.  
 Limit M70 configuration (MD 35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE) to MD35090 \$MA\_NUM\_GEAR\_STEPS.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16747 [Channel %1: ] Block %2 spindle %3 inserted gear stage %4 for tapping not installed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle number  
 %4 = Gear stage

**Definitions:** The second gear stage data block has been activated for tapping with G331.  
 However, the current gear stage has not been installed in the second gear stage data block. The number of gear stages installed is configured in MD35092 \$MA\_NUM\_GEAR\_STEPS2. The gear stage cannot be changed in traversing blocks. The gear stage appropriate for the speed must be loaded before the traversing block.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Procedure for automatically engaging the suitable gear stage prior to thread cutting:  
 \* Program the spindle speed (S) in a G331 block without axis motions and prior to thread cutting, e.g. G331 S1000.  
 \* Activate M40 for the spindle.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>16748</b>	<b>[Channel %1: ] Block %2 spindle %3 gear stage %4 expected</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Gear stage
<b>Definitions:</b>	G331 activates the second gear stage data block for tapping. The programmed speed (S) of the master spindle lies outside the speed range of the active gear stage in the current traversing block. The gear stage cannot be changed in the traversing block. The gear stage appropriate for the speed must be loaded prior to the traversing block.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Procedure for automatically engaging the suitable gear stage prior to thread cutting: * Program the spindle speed (S) in a G331 block without axis motions and prior to thread cutting, e.g. G331 S1000. * Activate M40 for the spindle.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16750</b>	<b>[Channel %1: ] Block %2 axis %3 SPCON not programmed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	For the programmed function (rotary axis, positioning axis), the spindle must be in position control mode.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program position control of the spindle with SPCON in the previous block.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16751</b>	<b>[Channel %1: ] Block %2 spindle/axis %3 SPCOF not executable</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	For the programmed function, the spindle must be in the open-loop control mode. In the positioning or axis mode, the position control must not be deselected.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Put the spindle into open-loop control mode in the preceding block. This can be done with M3, M4 or M5 for the relevant spindle.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16755</b>	<b>[Channel %1: ] Block %2 no stop required</b>
--------------	---

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
--------------------	---

**Definitions:** No Stop is needed for the programmed function. A Stop is necessary after SPOSA or after M5 if the next block is to be loaded only after a spindle stop.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Do not write instruction.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16757 [Channel %1: ] Block %2 for following spindle %3 coupling as leading spindle/axis already existing**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Following spindle number

**Definitions:** A coupling has been switched on in which the following spindle/axis has already been active as leading spindle/axis in another coupling. Chained couplings cannot be processed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check in the parts program whether the following spindle/axis is already active as leading spindle/axis in another coupling.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16758 [Channel %1: ] Block %2 for leading spindle %3 coupling as following spindle/axis already existing**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Leading spindle number

**Definitions:** A coupling has been switched on in which the leading spindle/axis has already been active as following spindle/axis in another coupling. Chained couplings cannot be processed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check in the parts program whether the leading spindle/axis is already active as following spindle/axis in another coupling.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16760 [Channel %1: ] Block %2 axis %3 S value missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** No spindle speed has been given for rigid tapping (G331 or G332).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.



---

**Remedy:** Program the spindle speed under address S in [rpm] (in spite of axis mode); the direction of rotation is given by the sign of the spindle lead:  
 - Positive thread pitch: Rotational direction as M03.  
 - Negative thread pitch: Rotational direction as M04 N2.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

### 16761 [Channel %1: ] Block %2 axis/spindle %3 not programmable in the channel

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** Mistake in programming: The axis/spindle cannot be programmed in the channel at this time. This alarm can occur when the axis/spindle is being used by another channel or by the PLC.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program. Use "GET()".

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

### 16762 [Channel %1: ] Block %2 spindle %3 thread function is active

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle number

**Definitions:** Incorrect programming: the spindle function can currently not be executed. This alarm occurs when the spindle (master spindle) is linked with the axes by an interpolation function.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program. Deselect thread cutting or tapping.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

### 16763 [Channel %1: ] Block %2 axis %3 programmed speed is illegal (zero or negative)

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** A spindle speed (S value) was programmed with the value zero or with a negative value.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** The programmed spindle speed (S value) must be positive. Depending on the application case, the value zero can be accepted (e.g. G25 S0).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**16765 [Channel %1: ] Block %2 motion synchronous action: %3 following spindle/axis missing**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID

**Definitions:** The following spindle/axis has not been written in the part program.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16766 [Channel %1: ] Block %2 motion synchronous action: %3 string cannot be interpreted**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID

**Definitions:** A coupling has been switched on in which a non-interpretable string has been written (e.g. block change behavior).

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16767 [Channel %1: ] Block %2 motion synchronous action: %3 leading spindle/axis missing**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID

**Definitions:** The master spindle/axis has not been programmed in the part program.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16769 [Channel %1: ] Block %2 motion synchronous action: %3 too many couplings for axis %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name, spindle number

---

<b>Definitions:</b>	For the specified axis/spindle, more master axes/spindles have been defined than are allowed.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 16770 **[Channel %1: ] Block %2 axis %3 no measuring system available**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	One of the following spindle functions has been programmed, the position control requires: SPCON, SPOS, SPOSA, COUPON, G331/G332. The position control requires at least one measuring system. No measuring system has been configured in MD30200 \$MA_NUM_ENCS of the programmed spindle.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Retrofit a measuring system.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 16771 **[Channel %1: ] Block %3 following axis %2 overlaid movement not enabled**

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
<b>Definitions:</b>	No gear synchronization and no overlay movement can be executed because this is not enabled at the VDI interface. This alarm can be suppressed with bit17 in MD11415 \$MN_SUPPRESS_ALARM_MASK_2.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Set the NC/PLC interface signal DB31, ... DBX26.4 (enable following axis overlay).
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

---

### 16772 **[Channel %1: ] Block %2 axis %3 is the slave axis, the coupling is being opened**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis, spindle
<b>Definitions:</b>	The axis is active as a following axis in a coupling. In REF operating mode, the coupling is opened. The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 29 = 1 or with CP programming by setting CPMALARM[FAx] bit 0 = 1.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The coupling will be closed again after having exited the REF operation mode.
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

**16773 [Channel %1: ] Axis %2 is the following axis. The axis/spindle disables of leading axes %3 and %4 differ from one another.**

**Parameters:** %1 = Channel number  
 %2 = Axis, spindle  
 %3 = Axis, spindle  
 %4 = Axis, spindle

**Definitions:** The axis is active in a coupling as a following axis. The leading axes have different states regarding axis/spindle disable. The alarm can be suppressed with MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2, bit 0 = 1 or with CP programming by setting CPMALARM[Fax] bit 1 = 1.

**Reaction:** Alarm display.

**Remedy:** Set the same axis/spindle disable for all master axes.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**16774 [Channel %1: ] Synchronization aborted for slave axis/spindle %2**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** For the indicated axis, the synchronization procedure (EGONSYN or EGONSYNE) was canceled. There are several reasons for aborting the synchronization process:

- RESET
- End of program
- Axis goes to follow-up mode
- Rapid stop caused by an alarm

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** If canceling the synchronization procedure can be tolerated or is intended, the alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit 31 = 1 or with CP programming by setting CPMALARM[Fax] bit 2 = 1.  
 Only applicable for electronic gear (EG):  
 If it is not possible to cancel the synchronization procedure, specify the block change criterion FINE in EGONSYN or EGONSYNE.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16775 [Channel %1: ] Block %2 motion synchronous action: %3 axis %4 no measuring system available**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name, spindle number

---

<b>Definitions:</b>	One of the following spindle functions has been programmed, the position control requires: SPCON, SPOS, SPOSA, COUPON, G331/G332. The position control requires at least one measuring system. No measuring system has been configured in MD30200 \$MA_NUM_ENC5 of the programmed spindle.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Retrofit a measuring system.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### **16776 [Channel %1: ] Block %2 curve table %3 does not exist for axis %4**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of curve table %4 = Axis name, spindle number
<b>Definitions:</b>	An attempt was made to couple axis %4 with curve table number %3, but no curve table of this number exists.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify the NC part program so that the required curve table exists when axis link is to be activated.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### **16777 [Channel %1: ] Block %2 coupling: following axis %3 for lead axis %4 not available**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Axis name, spindle number
<b>Definitions:</b>	A coupling has been switched on in which the slave spindle/axis is currently not available. Possible causes: - The spindle/axis is active in the other channel. - The spindle/axis has been accessed by the PLC and has not yet been released.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Put the master spindle/axis with spindle/axis exchange into the necessary channel or release from the PLC.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**16778**                    **[Channel %1: ] Block %2 coupling: Ring coupling at following axis %3 and leading axis %4 impermissible**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Axis name, spindle number  
                               %4 = Axis name, spindle number

**Definitions:**            A coupling has been switched on which results in a cyclic coupling, allowance being made for further couplings. This cyclic coupling cannot be uniquely computed.

**Reaction:**                NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.

**Remedy:**                 Please inform the authorized personnel/service department. Configure link in accordance with the MD or correct NC part program (MD21300 \$MC\_COUPLE\_AXIS\_1).

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**16779**                    **[Channel %1: ] Block %2 coupling: too many couplings for axis %3, see active leading axis %4**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Axis name, spindle number  
                               %4 = Axis name, spindle number

**Definitions:**            More leading axes and spindles were defined for the specified axis/spindle than are allowed. The last parameter to be specified is a leading value object/leading axis to which the specified axis/spindle is already linked.

**Reaction:**                NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.

**Remedy:**                 Modify part program.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**16780**                    **[Channel %1: ] Block %2 following spindle/axis missing**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The following spindle/axis has not been written in the part program.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**16781**                    **[Channel %1: ] Block %2 master spindle/axis missing**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

---

<b>Definitions:</b>	The master spindle/axis has not been programmed in the part program.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16782 [Channel %1: ] Block %2 following spindle/axis %3 not available

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A coupling has been switched on in which the slave spindle/axis is currently not available. Possible causes: - The spindle/axis is active in the other channel. - The spindle/axis has been accessed by the PLC and has not yet been released.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Put the master spindle/axis with spindle/axis exchange into the necessary channel or release from the PLC.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16783 [Channel %1: ] Block %2 master spindle/axis %3 not available

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A coupling has been switched on in which the master spindle/axis is currently not available. Possible causes: - Setpoint linkage has been selected and spindle/axis is active in the other channel. - The spindle/axis has been accessed by the PLC and has not yet been released.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Put the master spindle/axis with spindle/axis exchange into the necessary channel or release from the PLC.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 16785 [Channel %1: ] Block %2 identical spindles/axes %3

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A coupling has been switched on in which the following spindle/axis is identical to the master spindle/axis.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Configure link accordingly in MD21300 \$MC_COUPLE_AXIS_1 - or modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16786 [Channel %1: ] Block %2 coupling to master spindle %3 already exists**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Leading spindle number

**Definitions:** A coupling is to be switched on, in which the slave axis is already actively coupled with the other master axis. Only one master spindle is allowed for the synchronous spindle function. The already active master spindle is displayed as last alarm parameter.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Prior to switching on the new coupling, separate the existing coupling. If several master spindels/axes are required, the ELG function will have to be used.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**16787 [Channel %1: ] Block %2 coupling parameter not changeable**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The specified coupling is write-protected. Therefore, the coupling parameters cannot be modified.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
- Remove write protection (see channel MD21340 \$MC\_COUPLE\_IS\_WRITE\_PROT\_1)  
- or modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16788 [Channel %1: ] Block %2 cyclic coupling**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A coupling has been switched on which results in a cyclic coupling, allowance being made for further couplings. This cyclic coupling cannot be uniquely computed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
- Configure link accordingly in MD21300 \$MC\_COUPLE\_AXIS\_1  
- or modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

<b>16789</b>	<b>[Channel %1: ] Block %2 multiple link</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A coupling has been switched on in which the axes/spindles have already been assigned by another coupling. Parallel couplings cannot be processed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check in the part program whether another link already exists for the axes.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>16790</b>	<b>[Channel %1: ] Block %2 Parameter is zero or missing</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A coupling has been switched on in which a relevant parameter has been specified with zero or has not been written (e.g. denominator in the transmission ratio, no slave axis).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Configure link accordingly in SD42300 \$SC_COUPLE_RATIO_1 - or correct part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>16791</b>	<b>[Channel %1: ] Block %2 parameter is not relevant</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A coupling has been switched on in which a non-relevant parameter has been written (e.g. parameter for ELG).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>16792</b>	<b>[Channel %1: ] Block %2 too many couplings for axis/spindle %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	For the specified axis/spindle, more master axes/spindles have been defined than are allowed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

**16793**                    **[Channel %1: ] Block %2 coupling of axis %3 prohibits transformation change**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Axis name, spindle number

**Definitions:**            The specified axis is a slave axis in a transformation grouping. When the coupling is switched on, the transformation cannot be changed to another one.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program. Switch off coupling(s) of this axis before changing transformation or do not change the transformation.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**16794**                    **[Channel %1: ] Block %2 coupling of axis/spindle %3 prohibits reference point approach**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Axis name, spindle number

**Definitions:**            The specified axis is a (gantry) slave axis and cannot therefore approach the reference point.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program. Switch off coupling(s) of this axis before reference point approach or do not reference. A gantry slave axis cannot reference for itself.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**16795**                    **[Channel %1: ] Block %2 string cannot be interpreted**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            A coupling has been switched on in which a non-interpretable string has been written (e.g. block change behavior).

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Modify part program.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**16796**                    **[Channel %1: ] Block %2 coupling not defined**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            A coupling is to be switched the parameters of which have neither been programmed nor configured.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department. Correct NC part program or MD, program the coupling with COUPDEF or configure by means of MD.

---

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**16797 [Channel %1: ] Block %2 coupling is active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An operation is to be performed in which no coupling may be active, e.g. COUPDEL or TANGDEL must not be used on active couplings.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct NC part program, deselect the link with COUPOF or TANGOF.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**16798 [Channel %1: ] Block %2 axis %3 is following axis and prohibits axis container rotation**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** The programmed axis/spindle is active as a slave axis/spindle in a coupling. When the coupling is active, the axis container cannot be rotated.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program. Deactivate the coupling(s) for this axis/spindle before rotating the axis container or execute the axis container rotation at a later time.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**16799 [Channel %1: ] Block %2 axis %3 is master axis and prohibits axis container rotation**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** The programmed axis/spindle is active as a master axis/spindle in a coupling. When the coupling is active, the axis container cannot be rotated.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program. Deactivate the coupling(s) for this axis/spindle before rotating the axis container or execute the axis container rotation at a later time.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

---

**16800 [Channel %1: ] Block %2 traverse instruction DC/CDC for axis %3 not allowed**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** The keyword DC (Direct Coordinate) can only be used for rotary axes. This causes approach of the programmed absolute position along the shortest path.  
 Example:  
 N100 C=DC(315)

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 Replace the keyword DC in the displayed NC block by specifying AC (Absolute Coordinate).  
 If the alarm display is the result of an error in the axis definition, the axis can be declared as a rotary axis by means of the axis-specific MD30300 \$MA\_IS\_ROT\_AX.  
 Corresponding machine data:  
 Modify MD30310: \$MA\_ROT\_IS\_MODULO  
 Modify MD30320: \$MA\_DISPLAY\_IS\_MODULO

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16810 [Channel %1: ] Block %2 traverse instruction ACP for axis %3 not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** The keyword ACP (Absolute Coordinate Positive) is only allowed for "modulo axes". It causes approach of the programmed absolute position in the specified direction.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 In the displayed NC block, replace the keyword ACP by specifying AC (Absolute Coordinate).  
 If the alarm display is based on an incorrect axis definition, the axis with the axis-specific MD30300 \$MA\_IS\_ROT\_AX and MD30310 \$MA\_ROT\_IS\_MODULO can be declared a rotary axis with modulo change.  
 Corresponding machine data:  
 Modify MD30320 \$MA\_DISPLAY\_IS\_MODULO

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**16820 [Channel %1: ] Block %2 traverse instruction ACN for axis %3 not allowed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** The keyword ACN (Absolute Coordinate Negative) is only allowed for "modulo axes". It causes approach of the programmed absolute position in the specified direction.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 In the displayed NC block, replace the keyword ACN by specifying AC (Absolute Coordinate).  
 If the alarm display is based on an incorrect axis definition, the axis with the axis-specific machine data MD30300: \$MA\_IS\_ROT\_AX and MD30310: \$MA\_ROT\_IS\_MODULO can be declared a rotary axis with modulo change.  
 Corresponding machine data:  
 MD30320: \$MA\_DISPLAY\_IS\_MODULO

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16830 [Channel %1: ] Block %2 incorrect position programmed for axis/spindle %3**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A position beyond the range of 0 - 359.999 has been programmed for a modulo axis.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program position in the range 0 - 359.999.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

**16903 [Channel %1: ] Program control: action %2<ALNX> not allowed in the current state**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	The relevant action cannot be processed now. This can occur, for instance, during read-in of machine data.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Wait until the procedure is terminated or abort with Reset and repeat the operation.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16904 [Channel %1: ] Program control: action %2<ALNX> not allowed in the current state**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	The operation (program, JOG, block search, reference point, etc.) cannot be started or continued in the current status.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Check the program status and channel status.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16905 [Channel %1: ] Program control: action %2<ALNX> not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	Operation cannot be started or continued. A start is only accepted when an NCK function can be started. Example: A start is accepted in JOG mode when, for example, the function generator is active or a JOG movement has first been stopped with the Stop key.
<b>Reaction:</b>	Alarm reaction in Automatic mode.
<b>Remedy:</b>	Check the program status and channel status.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16906 [Channel %1: ] Program control: action %2<ALNX> is aborted due to an alarm**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
--------------------	---

**Definitions:** The action was aborted due to an alarm.  
**Reaction:** Alarm display.  
**Remedy:** Eliminate the error and acknowledge the alarm. Then repeat the operation.  
**Program**  
**Continuation:** Clear alarm with the Delete key or NC START.

---

**16907 [Channel %1: ] Action %2<ALNX> only possible in stop state**

**Parameters:** %1 = Channel number  
%2 = Action number/action name  
**Definitions:** This action may only be performed in Stop state.  
**Reaction:** Alarm display.  
**Remedy:** Check the program status and channel status.  
**Program**  
**Continuation:** Clear alarm with the Delete key or NC START.

---

**16908 [Channel %1: ] Action %2<ALNX> only possible in reset state or at the block end**

**Parameters:** %1 = Channel number  
%2 = Action number/action name  
**Definitions:** This action may only be performed in Reset state or at end of block.  
In JOG mode, no axis that is traversed as geometry axis in the switched coordinate system, must be active as PLC or command axis (started through static synchronized action) on mode change. This means that axes like that must be in the state 'neutral axis' again.  
**Reaction:** Alarm display.  
**Remedy:** Check the program status and channel status.  
Check in JOG mode whether the axes are PLC or command axes.  
**Program**  
**Continuation:** Clear alarm with the Delete key or NC START.

---

**16909 [Channel %1: ] Action %2<ALNX> not allowed in current mode**

**Parameters:** %1 = Channel number  
%2 = Action number/action name  
**Definitions:** A different operating mode must be activated for the activated function.  
**Reaction:** Alarm display.  
**Remedy:** Check operation and operating state.  
**Program**  
**Continuation:** Clear alarm with the Delete key or NC START.

---

**16911 [Channel %1: ] Mode change is not allowed**

**Parameters:** %1 = Channel number  
**Definitions:** The change from overstoring into another operating mode is not allowed.  
**Reaction:** Alarm display.  
**Remedy:** After overstoring is terminated, it is possible to change to another operating state again.  
**Program**  
**Continuation:** Clear alarm with the Delete key or NC START.

---

**16912 [Channel %1: ] Program control: action %2<ALNX> only possible in reset state**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	This action can only be performed in Reset state. Example: Program selection through HMI or channel communication (INIT) can only be performed in Reset state.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Reset or wait until processing is terminated.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16913 [Mode group %1: ] [Channel %2: ] Mode change: action %3<ALNX> not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Mode group number %3 = Action number/action name
<b>Definitions:</b>	The change to the desired mode is not permitted. The change can only take place in the Reset state. Example: Program processing is halted in AUTO mode by NC Stop. Then there is a mode change to JOG mode (program status interrupted). From this operating mode, it is only possible to change to AUTO mode and not to MDI mode!
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Either activate the Reset key to reset program processing, or activate the mode in which the program was being processed previously.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16914 [Mode group %1: ] [Channel %2: ] Mode change: action %3<ALNX> not allowed**

<b>Parameters:</b>	%1 = Channel number %2 = Mode group number %3 = Action number/action name
<b>Definitions:</b>	Incorrect mode change, e.g.: Auto -> MDIREF.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Check operation or selected mode.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16915 [Channel %1: ] Action %2<ALNX> not allowed in the current block**

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	If traversing blocks are interrupted by asynchronous subroutines, then it must be possible for the interrupted program to continue (reorganization of block processing) after termination of the asynchronous subroutine. The 2nd parameter describes which action wanted to interrupt block processing.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Let the program continue to a reorganized NC block or modify part program.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

**16916 [Channel %1: ] Repositioning: action %2<ALNX> not allowed in the current state**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** Repositioning of block processing is presently not possible. A mode change cannot take place. The 2nd parameter describes which action should be used to perform repositioning.

**Reaction:** Alarm display.

**Remedy:** Let the program continue to a repositioned NC block or modify part program.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16918 [Channel %1: ] For action %2<ALNX> all channels must be in reset state**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** All channels must be in the initial setting in order to carry out the action! (For example, for machine data loading)

**Reaction:** Alarm display.

**Remedy:** Either wait until the channel status is aborted or press the Reset key.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16919 [Channel %1: ] Action %2<ALNX> is not allowed due to a pending alarm**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** This action cannot be performed due to an alarm, or the channel is in the fault condition.

**Reaction:** Alarm display.

**Remedy:** Press the RESET key.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16920 [Channel %1: ] Action %2<ALNX> is already active**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** An identical action is still being processed.

**Reaction:** Alarm display.

**Remedy:** Wait until the previous procedure has been terminated and then repeat the operation.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16921 [Mode group %2: ] [Channel %1: ] Machine data: channel/mode group assignment not allowed or assigned twice**

**Parameters:** %1 = Channel number  
%2 = Mode group number



---

<b>Definitions:</b>	On powering up, an illegal channel/mode group assignment was detected.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP.
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

<b>16922</b>	<b>[Channel %1: ] Subprograms: action %2&lt;ALNX&gt; maximum nesting depth exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	Various actions can cause the current procedure to be interrupted. Depending on the action, asynchronous subroutines are activated. These asynchronous subroutines can be interrupted in the same manner as user programs. Unlimited nesting depth is not possible for asynchronous subroutines due to memory limitations. Example: An interrupt interrupts the current program processing. Other interrupts with higher priorities interrupt processing of the previously activated asynchronous subroutines. Possible actions are: DryRunOn/Off, DecodeSingleBlockOn, delete distance-to-go, interrupts .....
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Do not trigger the event on this block.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>16923</b>	<b>[Channel %1: ] Program control: action %2&lt;ALNX&gt; not allowed in the current state</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	The current processing cannot be stopped since a preprocessing process is active. This applies, for example, to the loading of machine data, and in block searches until the search target is found.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Cancel by pressing RESET!
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>16924</b>	<b>[Channel %1: ] Caution: program test modifies tool management data</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	Tool management data is changed during program testing. It is not possible to automatically rectify the data after termination of the program testing. This error message prompts the user to make a backup copy of the data or to reimport the data after the operation is terminated.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Save tool data on HMI and reimport data after "ProgtestOff".

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**16925 [Channel %1: ] Program control: action %2<ALNX> not allowed in the current state, action %3<ALNX> active**

**Parameters:** %1 = Channel number  
%2 = Action number/action name  
%3 = Action number/action name

**Definitions:** The action has been refused since a mode or sub-mode change (change to automatic mode, MDI, JOG, overstoreing, digitizing, etc.) is taking place.  
Example: This alarm message is output if the Start key is pressed during a mode or sub-mode change from, for example, automatic to MDI, before the NCK has confirmed selection of the mode.

**Reaction:** Alarm display.  
**Remedy:** Repeat action.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**16926 [Channel %1: ] Channel coordination: action %2 not allowed in block %3, marker %4 is already set**

**Parameters:** %1 = Channel number  
%2 = Aktion  
%3 = Block number  
%4 = Marker number

**Definitions:** The action was denied, the marker was already set. Check the program.  
Example:  
SETM(1) ; CLEARM(1) ; Marker must be reset first.  
SETM(1)

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Repeat action.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**16927 [Channel %1: ] Action %2<ALNX> at active interrupt treatment not allowed**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** This action may not be activated during interrupt processing (e.g. mode change).

**Reaction:** Alarm display.  
**Remedy:** Reset or wait until interrupt processing is terminated.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**16928 [Channel %1: ] Interrupt treatment: action %2<ALNX> not possible**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

---

<b>Definitions:</b>	A program interrupt has been activated in a non REORG capable block. Examples of possible program interrupts in this case: - Traversing to fixed stop - Vdi channel delete distance-to-go - Vdi axial delete distance-to-go - Measuring - Software limit - Axis interchange - Axis comes from tracking - Servo disable - Gear stage change at actual gear stage unequal to setpoint gear stage. The block affected is a: - collection block from block search (except for the last collection block) - Block in overstore interrupt.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Do not trigger the event on this block.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>16930</b>	<b>[Channel %1: ] Preceding block and current block %2 must be separated through an executable block</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number
<b>Definitions:</b>	The language functions WAITMC, SETM, CLEARM and MSG must be packed in separate NC blocks due to the language definition. To avoid velocity drops, these blocks are attached to the next NC block internally in the NCK (for MSG only in path control mode, for WAITMC to the previous NC block). For this reason, there must always be an executable block (not a calculation block) between the NC blocks. An executable NC block always includes e.g. travel movements, a help function, Stopre, dwell time etc.
<b>Reaction:</b>	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Program an executable NC block between the previous and the current NC block. Example: N10 SETM. N15 STOPRE ; insert executable NC block. N20 CLEARM.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>16931</b>	<b>[Channel %1: ] Subprograms: action %2&lt;ALNX&gt; maximum nesting depth exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	Various actions can cause the current procedure to be interrupted. Depending on the action, asynchronous subroutines (ASUBs) are activated. These ASUBs can be interrupted in the same manner as the user program. Unlimited nesting depth is not possible for ASUBs due to memory limitations. Example: In the case of an approach block in a repositioning procedure do not interrupt repeatedly, instead wait until processing is completed. Possible actions are: mode change, SlashOn/Off, overstoreing.
<b>Reaction:</b>	Interface signals are set. Alarm display. NC Stop on alarm.

**Remedy:** Initiate a block change and repeat the action.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

**16932 [Channel %1: ] Conflict when activating user data type %2**

**Parameters:** %1 = Channel number  
 %2 = Data type

**Definitions:** The "activate user data" function (PI service \_N\_SETUDT) modifies a data block (tool offset, settable zero offset or base frame) which is also written by the NC blocks in preparation. In the event of a conflict, the value entered by the HMI is reset. Parameter %2 specifies which data block is affected:  
 1: Active tool offset  
 2: Base frame  
 3: Active zero offset

**Reaction:** Alarm display.

**Remedy:** Check the inputs on the HMI and repeat if necessary.

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

**16933 [Channel %1: ] Interrupt treatment: action %2<ALNX> not allowed in the current state**

**Parameters:** %1 = Channel number  
 %2 = Action number/action name

**Definitions:** If a temporary standstill has occurred because of a Reorg event across block boundaries, it is possible that a block without Reorg capability has been loaded. In this situation, it is unfortunately necessary to abort the Reorg event handling! Reorg events are, e.g. abort subprogram, delete distance-to-go and interrupts.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Abort program with the RESET key.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**16934 [Channel %1: ] Interrupt treatment: action %2<ALNX> not possible due to stop**

**Parameters:** %1 = Channel number  
 %2 = Action number/action name

**Definitions:** Reorg events are, e.g. abort subprogram, delete distance to go and interrupts, axis exchange, termination of follow-up mode. Two Reorg events overlap in this situation. The 2nd Reorg event coincides with the 1st block generated by the previous event. (e.g. an axis exchange is induced twice in rapid succession). Axis exchange leads to Reorg in the channels in which an axis is removed without preparation. This block must be stopped in the above sequence in order to prevent the interpolator buffer from overflowing. This can be achieved by pressing the Stop or StopAll key, configuring an alarm with INTERPRETERSTOP or by decode single block.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** The program must be aborted with Reset.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

<b>16935</b>	<b>[Channel %1: ] Action %2&lt;ALNX&gt; not possible due to search run</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	The action is not allowed as block search is currently running via program test. Block search via program test: "PI Service _N_FINDBL with mode parameter 5_". With this block search type, it is not permissible to activate program test or dry run feedrate.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Activate the action after block search is terminated.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>16936</b>	<b>[Channel %1: ] Action %2&lt;ALNX&gt; not possible due to active dry run</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	This action is not allowed as dry run feedrate is currently active. Example: It is not permissible to activate block search via program test (PI service _N_FINDBL with mode parameter 5) when dry run feedrate is active.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Abort program with the RESET key.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>16937</b>	<b>[Channel %1: ] Action %2&lt;ALNX&gt; not possible due to program test</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	This action is not allowed as program test is currently active. Example: It is not permissible to activate block search via program test (PI service _N_FINDBL with mode parameter 5) when program test is active.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Deactivate program test.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>16938</b>	<b>[Channel %1: ] Action %2&lt;ALNX&gt; aborted due to active gear change</b>
<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	Reorganization events are, among others, subprogram abort, delete distance-to-go and interrupts, axis exchange, exiting the correction state. These events wait for the end of a gear change. However, the maximum waiting period has elapsed.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Program must be aborted with Reset and, if necessary, MD10192 \$MN_GEAR_CHANGE_WAIT_TIME must be increased.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

**16939**                    **[Channel %1: ] Action %2<ALNX> rejected due to active gear change**

**Parameters:**            %1 = Channel number  
                               %2 = Action number/action name

**Definitions:**           Reorganization events that are possible in Stop state, e.g mode change, are waiting for the end of the gear change. However, the maximum waiting period has elapsed.

**Reaction:**                Interface signals are set.  
                               Alarm display.

**Remedy:**                  Repeat action or increase MD10192 \$MN\_GEAR\_CHANGE\_WAIT\_TIME.

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

**16940**                    **[Channel %1: ] Action %2<ALNX> wait for gear change**

**Parameters:**            %1 = Channel number  
                               %2 = Action number/action name

**Definitions:**            Reorganization events are waiting for the end of a gear change. The alarm is displayed during the waiting period.

**Reaction:**                Alarm display.  
                               Warning display.

**Remedy:**                  Alarm is suppressed by means of MD11411 \$MN\_ENABLE\_ALARM\_MASK bit 1 = 0.

**Program**                    Alarm display showing cause of alarm disappears. No further operator action necessary.

**Continuation:**

---

**16941**                    **[Channel %1: ] Action %2<ALNX> rejected because no program event has been executed yet**

**Parameters:**            %1 = Channel number  
                               %2 = Action number/action name

**Definitions:**            The setting of the MD20108 \$MC\_PROG\_EVENT\_MASK forces an asynchronous subprogram to be triggered automatically on RESET or PowerOn. The implicitly triggered asynchronous subprograms are normally called "Event-triggered program call" or "Program event".  
                               In the alarm situation, this asynchronous subprogram could not yet be activated; that is why the action (normally start of part program) must be rejected.  
                               Reasons for the fact that the asynchronous subprogram could not be triggered:  
                               1. The asynchronous subprogram does not exist (/N\_CMA\_DIR/N\_PROG\_EVENT\_SPF)  
                               2. The asynchronous subprogram is allowed to start in the referenced state only (see MD11602 \$MN\_ASUP\_START\_MASK)  
                               3. READY is missing (because of alarm)

**Reaction:**                Alarm display.

**Remedy:**                  Load program  
                               Check MD11602 \$MN\_ASUP\_START\_MASK  
                               Acknowledge alarm

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

**16942**                    **[Channel %1: ] Start program command action %2<ALNX> not possible**

**Parameters:**            %1 = Channel number  
                               %2 = Action number/action name

---

<b>Definitions:</b>	Currently, the alarm occurs only in combination with the SERUPRO action. SERUPRO stands for search via program test. SERUPRO is currently searching the search target and has therefore switched this channel to the program test mode. With the START program command in channel 1, another channel 2 would actually be started, which means that axes would really be started during the search action. If this alarm is switched off (see help), the user can make use of the above behavior by initially selecting via PLC the program test mode in channel 2, leaving channel 2 executing until its natural end, stopping channel 2 in order to deselect program test again.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Alarm can be switched off with MD10708 \$MN_SERUPRO_MASK bit 1.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 16943 [Channel %1: ] Action %2<ALNX> not possible due to ASUP

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
<b>Definitions:</b>	The action in the 2nd parameter was rejected, since an asynchronous subprogram is currently active. Currently, only the integrated search run is rejected with this alarm. The integrated search run is activated, if search run is triggered in the Stop program state. In other words: Parts of a program have already been executed and a following program part is "skipped" with search run in order to continue the program afterwards. The event is not possible if the program is stopped within an asynchronous subprogram or if an asynchronous subprogram had been selected before the event. An asynchronous subprogram is selected, when the triggering asynchronous subprogram event arrives, but the asynchronous subprogram cannot be started (e.g. the asynchronous start program is not started because of a read-in disable or because the Stop key is active). In this case, it is irrelevant whether a user ASUP or a system ASUP has been triggered. User ASUPs are activated via FC-9 or via the fast inputs. The following events lead to system ASUPS: <ul style="list-style-type: none"> <li>- Mode change</li> <li>- Overstore on</li> <li>- Canceling subprogram level</li> <li>- Switching on of single block, type 2</li> <li>- Setting machine data effective</li> <li>- Setting user data effective</li> <li>- Change skip levels</li> <li>- Dry run on/off</li> <li>- Program test off</li> <li>- Correction block alarms</li> <li>- Editing modi in Teach</li> <li>- External zero offset</li> <li>- Axis exchange</li> <li>- Delete distance-to-go</li> <li>- Measuring</li> </ul>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Repeat the action after the end of the asynchronous subprogram.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 16944 [Channel %1: ] Action %2<ALNX> not possible due to active search blocks

<b>Parameters:</b>	%1 = Channel number %2 = Action number/action name
--------------------	---

**Definitions:** The NCK is currently processing either the action blocks of the search run or the approach motion after the search run. In this situation, the action (2nd parameter of the alarm) must be rejected. Currently, only the integrated search run is rejected with this alarm. The integrated search run is activated, if search run is triggered in the Stop program state. In other words: Parts of a program have already been executed and a following program part is "skipped" with search run in order to continue the program afterwards.

**Reaction:** Alarm display.

**Remedy:** Repeat the action after the approach motion of the search run.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16945 [Channel %1: ] Action %2<ALNX> delayed up to the block end**

**Parameters:** %1 = Channel number  
%2 = Action number/action name

**Definitions:** The currently executing action (e.g. dry run on/off, change skip levels, etc.) should be active immediately, but it can become active not earlier than at the end of the block, since a thread is currently being machined. The action is activated with a slight delay.  
Example: Dry run is started in the middle of the thread, then traversing at high speed does not start before the next block.

**Reaction:** Alarm display.

**Remedy:** Alarm can be switched off via MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit17==1.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16946 [Channel %1: ] Start via START is not allowed**

**Parameters:** %1 = Channel ID

**Definitions:** This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN\_SERUPRO\_MASK, Bit 2 and enables the retrace support of entire channel groups during block search. The MD22622 \$MC\_DISABLE\_PLC\_START specifies which channel is generally started from the PLC and which channel is only allowed to be started from another channel via the START part program command. This alarm occurs if the channel was started via the START part programm command and MD22622 \$MC\_DISABLE\_PLC\_START==FALSE was set.

**Reaction:** Alarm display.

**Remedy:** Modify MD22622 \$MC\_DISABLE\_PLC\_START of switch off "Group Serupro" (see MD10708 \$MN\_SERUPRO\_MASK).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16947 [Channel %1: ] Start via PLC is not allowed**

**Parameters:** %1 = Channel ID

**Definitions:** This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN\_SERUPRO\_MASK, Bit 2 and enables the retrace support of entire channel groups during block search. The machine data MD22622 \$MC\_DISABLE\_PLC\_START specifies which channel is generally started from the PLC and which channel is only allowed to be started from another channel via the START part program command. This alarm occurs if the channel was started via the PLC and MD22622 \$MC\_DISABLE\_PLC\_START==TRUE was set.

**Reaction:** Alarm display.

**Remedy:** Modify MD22622 \$MC\_DISABLE\_PLC\_START of switch off "Group Serupro" (see MD10708 \$MN\_SERUPRO\_MASK).

**Program Continuation:** Clear alarm with the Delete key or NC START.



**16948 [Channel %1: ] dependent channel %2 still active**

**Parameters:** %1 = Channel ID  
%2 = Channel ID

**Definitions:** This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN\_SERUPRO\_MODE, bit 2 and enables the retrace support of entire channel groups during block search. A `_dependent channel_` is a channel that had indirectly been started by the currently active channel. The currently active channel was started via PLC.  
This channel `m_u_s_t` be terminated (i.e. reached M30) before the current channel is terminated.  
This alarm occurs if the currently active channel is terminated before the dependent channel.

**Reaction:** Alarm display.

**Remedy:** Switch off "Group Serupro" (see MD10708 \$MN\_SERUPRO\_MASK) or install WAITE.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**16949 Correspondence between marker of channel %1 and channel %2 is invalid.**

**Parameters:** %1 = Channel ID  
%2 = Channel ID

**Definitions:** This channel defines a WAIT marker with other channels, which on their part have no correspondence with this wait marker.  
This channel's WAIT marker has no explicit counterpart in the other channel; i.e. the channels do not mutually wait.  
=====

**Example**  
Ch 3Ch 5Ch 7  
WAITM(99,3,5) WAITM(99,3,5) WAITM(99,5,7)  
The wait markers in channels 3 and 5 mutually wait for each other and channel 7 only waits for channel 5. Therefore, channel 7 may continue when 5 and 7 have reached the wait marker, but channel 3 is still far in front of the wait marker. When it continues, channel 7 deletes its wait marker. When wait marker 99 is reached again, you can no longer determine the behavior precisely.  
=====

**Reaction:** Alarm display.

**Remedy:** In each wait marker, list all channels with which you want to synchronize, or suppress the alarm with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK, bit 23.  
=====

**Sample solution A:**  
Ch 3Ch 5Ch 7  
WAITM(99,3,5,7) WAITM(99,3,5,7) WAITM(99,3,5,7)  
=====

**Sample solution B:**  
Ch 3Ch 5Ch 7  
WAITM(99,3,5) WAITM(99,3,5)  
WAITM(88,5,7) WAITM(88,5,7)  
=====

**Sample solution C:**  
Ch 3Ch 5Ch 7  
WAITM(88,5,7) WAITM(88,5,7)  
WAITM(99,3,5) WAITM(99,3,5)

**Program Continuation:** Clear alarm with the Delete key or NC START.

**16950 [Channel %1: ] Search run with hold block**

**Parameters:** %1 = Channel number

**Definitions:** Informational alarm.  
 The search run was not performed on the interruption block, instead, it touches down shortly before that. This so-called "hold block" is generated by the part program command IPTRLOCK, or implicitly defined by MD22680 \$MC\_AUTO\_IPTR\_LOCK. This is to prevent you from performing a search run in critical program areas (e.g. gear hobbing). The alarm also displays that, instead of searching for the block that actually was interrupted before, another block is being searched for. This behavior is desired and the alarm serves only informational purposes.

**Reaction:** Alarm display.

**Remedy:** MD11410 \$MN\_SUPPRESS\_ALARM\_MASK, MD22680 \$MC\_AUTO\_IPTR\_LOCK and language command IPTRLOCK

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16951 [Channel %1: ] Search run in a protected program section.**

**Parameters:** %1 = Channel number

**Definitions:** A part programmer can define protected part program sections with the language commands IPTRLOCK and IPTRUNLOCK. Every search run in these program sections will then be acknowledged with alarm 16951. In other words: When the alarm appears, the user has started a search run (Serupro type) and the search target lies in a protected area. A protected area can also be defined implicitly with the MD22680 \$MC\_AUTO\_IPTR\_LOCK.  
 Note:  
 The alarm can only be generated if the simulation has been completed during the search run. The alarm cannot be output immediately at the start of the search run.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** MD11410 \$MN\_SUPPRESS\_ALARM\_MASK, MD22680 \$MC\_AUTO\_IPTR\_LOCK and language command IPTRLOCK

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16952 [Channel %1: ] Start program command not possible due to MDI**

**Parameters:** %1 = Channel number

**Definitions:** NCK is currently executing an ASUB in MDI mode. In this constellation, parts program command "Start" is not allowed for another channel. Attention: If an asup is started from JOG, the NCK can internally change to MDI, if the NCK was previously in MDI and not in RESET. Note: Without this alarm, the MDI buffer of the other channel would always be started.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Start ASUB in AUTO or ->JOG in AUTO

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**16953 [Channel %1: ] For slave axis %2 SERUPRO not allowed, as master axis %3 not subject to axis/spindle disable**

**Parameters:** %1 = Channel number  
 %2 = Slave axis name, following spindle number  
 %3 = Master axis name, master spindle number

---

<b>Definitions:</b>	Currently, the alarm occurs only in combination with the SERUPRO action. SERUPRO stands for search via program test. SERUPRO is possible only with an active coupling, if the axis/spindle disable is active for all master axes/spindles of the slave axis/spindle
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Set axis/spindle disable of the master axis
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 16954 [Channel %1: ] Block %2 programmed stop prohibited in stop delay area

<b>Parameters:</b>	%1 = Channel ID %2 = Block number, label
<b>Definitions:</b>	In a program area (stop delay area) that is bracketed with DELAYFSTON and DELAYFSTOF, a program command was used that causes a stop. No commands other than G4 are permissible that might cause a stop even though only shortly. A stop delay area can also be defined by MD11550 \$MN_STOP_MODE_MASK.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	MD11550 \$MN_STOP_MODE_MASK and language command DELAYFSTON DELAYFSTOF
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 16955 [Channel %1: ] Stop in stop delay area is delayed

<b>Parameters:</b>	%1 = Channel ID
<b>Definitions:</b>	In a program area (stop delay area) that is bracketed by DELAYFSTON and DELAYFSTOF, an event has been detected that causes a stop. The stop is delayed and executed after DELAYFSTOF. A stop delay area can also be defined by MD11550 \$MN_STOP_MODE_MASK.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	MD11550 \$MN_STOP_MODE_MASK and language command DELAYFSTON DELAYFSTOF
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

### 16956 [Channel %1: ] Program %2 cannot be started due to global start disable.

<b>Parameters:</b>	%1 = Channel ID %2 = (path with program name)
<b>Definitions:</b>	The program selected in this channel cannot be started as "Global start disable" had been set.  Note: PI "_N_STRTLK" sets the "Global start disable" and PI "_N_STRTUL" deletes the "Global start disable". The alarm is switched on with MD11411 \$MN_ENABLE_ALARM_MASK bit 6.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Delete the "Global start disable" and restart.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16957 [Channel %1: ] Stop-Delay area is suppressed**

**Parameters:** %1 = Channel ID

**Definitions:** The program area (Stop-Delay area), which is bracketed by DELAYFSTON and DELAYFSTOF, could not be activated. Every stop therefore becomes effective immediately and is not delayed!  
 This occurs every time, when braking into a stop Stop-Delay area, i.e. a braking process starts before the Stop-Delay area and ends not earlier than in the Stop-Delay area.  
 If the Stop-Delay area is entered with override 0, the Stop-Delay area can also not be activated  
 Example: a G4 before the Stop-Delay area allows the user to reduce the override to 0. The next block in the Stop-Delay area then starts with override 0 and the alarm situation described occurs.  
 MD11411 \$MN\_ENABLE\_ALARM\_MASK, bit 7 switches on this alarm.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** MD11550 \$MN\_STOP\_MODE\_MASK and language command DELAYFSTON DELAYFSTOF

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**16959 [Channel %1: ] Action %2<ALNX> prohibited during simulation block search.**

**Parameters:** %1 = Channel number  
 %2 = Action number/action name

**Definitions:** The function (2nd parameter) must not be activated during simulation search.

**Reaction:** Alarm display.

**Remedy:** Wait for search end.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16960 [Channel %1: ] Action %2<ALNX> prohibited during EXECUTE PROGRAM AREA.**

**Parameters:** %1 = Channel number  
 %2 = Action number/action name

**Definitions:** The function (2nd parameter) must not be activated during EXECUTE PROGRAM AREA.

**Reaction:** Alarm display.

**Remedy:** Wait for end of program area EXECUTE.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**16961 [Channel %1: ] Action %2<ALNX> prohibited during syntax check.**

**Parameters:** %1 = Channel number  
 %2 = Action number/action name

**Definitions:** The function (2nd parameter) must not be activated during the syntax check.  
 Comment: The syntax check is served by the following PI services:  
 \_N\_CHKSEL \_N\_CHKRUN \_N\_CHKABO

**Reaction:** Alarm display.

**Remedy:** Wait for the end of the syntax check, or  
 Cancel the syntax check with reset, or  
 Cancel the syntax check with PI \_N\_CHKABO.

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 16962 [Channel %1: ] NCK computing time reduced, start is not allowed.

**Parameters:** %1 = Channel number  
**Definitions:** The computing time available to the NCK has been reduced, starts have therefore been locked. The computer performance is inadequate for smooth program execution. The computing time of the NCK may have been reduced by the HMI because of an HMI part program simulation.  
**Reaction:** Alarm display.  
**Remedy:** Wait for the simulation to end or press RESET in any channel.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 16963 [Channel %1: ] ASUB start declined

**Parameters:** %1 = Channel number  
**Definitions:** An external ASUB start from the ABORTED program state has been declined for the following reasons:  
 - Bit 0 is not set in MD11602 \$MN\_ASUP\_START\_MASK  
 - ASUB priority has been set too low or MD11604 \$MN\_ASUP\_START\_PRIO\_LEVEL has been set too high  
**Reaction:** Alarm display.  
**Remedy:** Correct the machine data or change the priority of the ASUB to be executed.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 16964 [Channel %1: ] Executing of init blocks not fully completed

**Parameters:** %1 = Channel number  
**Definitions:** Init blocks are processed during ramp-up; they ensure that the control is initialized correctly. The alarm is set if processing could not be completed correctly (usually due to alarms which were already pending).  
**Reaction:** Alarm display.  
**Remedy:** Eliminate pending alarms.  
**Program** Switch control OFF - ON.  
**Continuation:**

### 16965 [channel %1: ] SAFE.SPF ramp-up not completed

**Parameters:** %1 = Channel number  
**Definitions:** The alarm is triggered if the safety program /N\_CST\_DIR/N\_SAFE\_SPF needs to be executed during ramp-up and this has not been completed after four times the time set in MD \$MN\_SAFE\_SPL\_START\_TIMEOUT has elapsed. This can be caused by SAFE.SPF taking a very long time to execute. The channel number indicates which channel is causing the problem.  
**Reaction:** NC not ready.  
 NC Start disable in this channel.  
 Channel not ready.  
 Interface signals are set.  
 NC Stop on alarm.  
 Alarm display.  
**Remedy:** Increase MD \$MN\_SAFE\_SPL\_START\_TIMEOUT.  
**Program** Clear alarm with the RESET key in all channels. Restart part program.  
**Continuation:**

**17000**                    **[Channel %1: ] Block %2 maximum number of symbols exceeded**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The maximum number of symbols defined by machine data MD28020 \$MC\_MM\_NUM\_LUD\_NAMES\_TOTAL has been exceeded.

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department.  
                               - Modify machine data  
                               - Reduce the number of symbols (variables, subroutines, parameters)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**17001**                    **[Channel %1: ] Block %2 no memory left for tool/magazine data**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            The number of the following tool/magazine data variables in the NC is specified using machine data:  
                               - Number of tools + number of grinding data blocks: MD18082 \$MN\_MM\_NUM\_TOOL  
                               - Number of cutting edges: MD18100 \$MN\_MM\_NUM\_CUTTING\_EDGES\_IN\_TOA  
                               Tools, grinding data blocks, cutting edges can be used independently of the tool management.  
                               The memory for the following data is available only if the corresponding bit has been set in MD18080 \$MN\_MM\_TOOL\_MANAGEMENT\_MASK.  
                               - Number of monitoring data blocks: MD18100 \$MN\_MM\_NUM\_CUTTING\_EDGES\_IN\_TOA  
                               - Number of magazines: MD18084 \$MN\_MM\_NUM\_MAGAZINE  
                               - Number of magazine locations: MD18086 \$MN\_MM\_NUM\_MAGAZINE\_LOCATION  
                               The following variable is determined by the software configuration: Number of magazine spacing data blocks: P2 permits 32 such spacing data blocks.  
                               Definition:  
                               - 'Grinding data blocks': Grinding data can be defined for a tool of type 400 to 499. A data block of this type occupies as much additional memory as that provided for a cutting edge.  
                               - 'Monitoring data blocks': Each cutting edge of a tool can be supplemented with monitoring data.  
                               - If the alarm occurs while writing one of the parameters \$TC\_MDP1/\$TC\_MDP2/\$TC\_MLSR, check whether machine data MD18077 \$MN\_MM\_NUM\_DIST\_REL\_PER\_MAGLOC / MD18076 \$MN\_MM\_NUM\_LOCS\_WITH\_DISTANCE has been set correctly.  
                               MD18077 \$MN\_MM\_NUM\_DIST\_REL\_PER\_MAGLOC defines the number of different Index1 statements that may be made for an Index2 value.  
                               MD18076 \$MN\_MM\_NUM\_LOCS\_WITH\_DISTANCE defines the number of different buffer locations that may be named in Index2.  
                               If a multitool is to be generated or its locations, the alarm indicates that either more multitools need to be generated than are permitted by the setting of MD18083 \$MN\_MM\_NUM\_MULTITOOLO or, if the alarm occurs when the multitool locations are being generated, that more multitool locations need to be generated than is permitted by the setting of MD18085 \$MN\_MM\_NUM\_MULTITOOLOLOCATIONS.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department.  
                               - Modify machine data  
                               - Modify NC program, i.e. reduce number of rejected variable.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17010 [Channel %1: ] Block %2 no memory left**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	When executing/reading files from the active working memory, it was found that there is not enough memory space (e.g. for large multidimensional arrays or when creating tool offset memory).
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Make arrays smaller or make more memory space available for memory management of subroutine calls, tool offsets and user variables (machine data MM_...). See /FB/, S7 Memory Configuration
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**17018 [Channel %1: ] Block %2 incorrect value for parameter %3**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Parameter name
<b>Definitions:</b>	An incorrect value has been assigned to the stated parameter. Only the following values are permissible for the parameter \$P_WORKAREA_CS_COORD_SYSTEM =1 for workpiece coordinate system =3 for settable zero system.
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Assign another value.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**17020 [Channel %1: ] Block %2 illegal array index 1**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	General: Read or write access has been programmed to an array variable with an illegal 1st array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32,766). PROFIBUS I/O: An illegal slot / I/O area index was used while reading/writing data. Cause: 1.: Slot / I/O area index >= max. number of available slot / I/O areas. 2.: Slot / I/O area index references a slot / I/O area that has not been configured. 3.: Slot / I/O area index references a slot / I/O area that has not been released for system variables. The following applies specifically: If the alarm occurs while writing one of the parameters \$TC_MDP1/\$TC_MDP2/\$TC_MLSR, check whether MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC has been set correctly. MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC defines the number of different Index1 statements that may be made for an Index2 value. If an MT number is programmed, the value may collide with a previously defined T number or a previously defined magazine number.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Correct the specification of array elements in the access instruction to match the defined size. If an SPL is used in Safety Integrated, the field index via optional data may be subject to additional restrictions.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17030 [Channel %1: ] Block %2 illegal array index 2**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** General:  
A read or write access has been programmed to an array variable with an invalid 2nd array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32,766).  
PROFIBUS I/O:  
An attempt was made to read/write data outside the slot / I/O area limits of the stated slot / I/O area.  
The following applies specifically: If the alarm occurs while writing one of the parameters \$TC\_MDP1/\$TC\_MDP2/\$TC\_MLSR, check whether MD18076 \$MN\_MM\_NUM\_LOCS\_WITH\_DISTANCE has been set correctly.  
\$MN\_MM\_NUM\_LOCS\_WITH\_DISTANCE defines the number of different buffer storage locations that may be named in Index2.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the specification of array elements in the access instruction to match the defined size.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17035 [Channel %1: ] Block %2 illegal array index 1**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** General:  
A read or write access has been programmed to an array variable with an invalid 3rd array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32,766).

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the specification of array elements in the access instruction to match the defined size.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17040 [Channel %1: ] Block %2 illegal axis index**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A read or write access has been programmed to an axial variable in which the axis name cannot be unambiguously imaged on a machine axis.  
Example:  
Writing of an axial machine data  
\$MA\_... [X]= ... ; but geometry axis X cannot be imaged on a machine axis because of a transformation!

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Deselect transformation before writing into the axial data (keyword: TRAF00F) or use the machine axis names as axis index.



**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17050 [Channel %1: ] Block %2 illegal value

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A value has been programmed that exceeds the value range or the limit value of a variable or a machine data item.  
Example: In a string variable (e.g. GUD or LUD) a string needs to be written that exceeds the string length agreed upon in the variable definition.  
- If an illegal value is to be written to a tool or magazine management variable (e.g. illegal cutting edge number in \$TC\_DPCE[x,y] or illegal magazine location number in \$TC\_MDP2[x,y])  
- An illegal value is to be written to \$P\_USEKT or \$A\_DPB\_OUT[x,y]  
- An illegal value is to be written to a machine data (e.g. MD10010 \$MN\_ASSIGN\_CHAN\_TO\_MODE\_GROUP[0] = 0)  
- On accessing an individual frame element, a frame component other than TRANS, ROT, SCALE or MIRROR was addressed or the CSCALE function was assigned a negative scale factor  
A multitool number has been programmed which collides with a previously defined T number or a previously defined magazine number.  
When programming DELMLOWNER: The command cannot be programmed with the T number of a tool that is part of a multitool.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Address frame components only with the keywords provided; program the scale factor between the limits of 0.000 01 to 999.999 99.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 17052 [channel %1: ] block %2 impermissible value / parameter value of the STRING type

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A STRING type programmed value is already being used.  
E.g. - the name of the multitool to be generated is already assigned to another multitool, tool or magazine.  
- the name of a tool to be generated is already assigned to another tool with the same duplo number or to a multitool.  
- the name of a magazine to be generated is already assigned to a multitool.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Programmed value of STRING type not permitted

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 17055 [Channel %1: ] Block %2 GUD variable not existing

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The required GUD variable was not found for a MEACALC procedure during read or write access.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check whether all the GUDs were created for MEACALC.  
 DEF CHAN INT \_MVAR, \_OVI[11]  
 DEF CHAN REAL \_OVR[32], \_EV[20], \_MV[20], \_SPEED[4], \_SM\_R[10], \_ISP[3]  
 DEF NCK REAL \_TP[3,10], \_WP[3,11], \_KB[3,7], \_CM[8], \_MFS[6]  
 DEF NCK BOOL \_CBIT[16]  
 DEF NCK INT \_CVAL[4].

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**17060 [Channel %1: ] Block %2 requested data area too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The maximum memory space of 8 KB available for a symbol has been exceeded.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Reduce array dimensions.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17070 [Channel %1: ] Block %2 data is write-protected**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** An attempt was made to write into a write-protected variable (e.g. a system variable). Safety Integrated: Safety system variables can only be written into via the safety SPL program.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17071 [Channel %1: ] Block %2 data read-protected**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** An attempt has been made to read a read-protected variable (e.g. a system variable).

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please set the corresponding access right or modify the part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17080 [Channel %1: ] Block %2 %3 value below lower limit**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = MD
<b>Definitions:</b>	An attempt was made to write into a machine data with a value smaller than the defined lower limit.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Determine the input limits of the machine data and assign a value within these limits.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**17090 [Channel %1: ] Block %2 %3 value exceeds upper limit**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = MD
<b>Definitions:</b>	An attempt was made to write into a machine data with a value greater than the defined upper limit.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Determine the input limits of the machine data and assign a value within these limits.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**17095 [Channel %1: ] Block %2 invalid value**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An attempt was made to write an invalid value, e.g. zero, into a machine data.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct the value assignment, e.g. a value within the value range not equal to zero.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**17100 [Channel %1: ] Block %2 digital input/comparator no. %3 not activated**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Input number
<b>Definitions:</b>	Either an attempt was made to read a digital input n via the system variable \$A_IN[n] and this input has not been activated via NCK MD10350 \$MN_FASTIO_DIG_NUM_INPUTS; or to read a comparator input via system variable \$A_INCO[n] and this input belongs to a comparator which has not been activated.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify part program or machine data accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17110 [Channel %1: ] Block %2 digital output no. %3 not activated**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = No. of output

**Definitions:** An attempt was made to read or set a digital NCK output (connector X 121) via the system variable \$A\_OUT [n] with the index [n] greater than the specified upper limit in MD10360 \$MN\_FASTIO\_DIG\_NUM\_OUTPUTS.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Program index [n] of the system variable \$A\_OUT [n] only between 0 and the value in MD10360 \$MN\_FASTIO\_DIG\_NUM\_OUTPUTS.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17120 [Channel %1: ] Block %2 analog input no. %3 not activated**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Input number

**Definitions:** An attempt has been made by means of the system variable \$A\_INA[n] to read an analog input n that has not been activated by the MD10300 \$MN\_FASTIO\_ANA\_NUM\_INPUTS.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Modify part program or machine data accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17130 [Channel %1: ] Block %2 analog output no. %3 not activated**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = No. of output

**Definitions:** An attempt has been made by means of the system variable \$A\_OUTA[n] to write or read an analog output n that has not been activated by the MD10310 \$MN\_FASTIO\_ANA\_NUM\_OUTPUTS.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Modify part program or machine data accordingly.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17140 [Channel %1: ] Block %2 NCK output %3 is assigned to a function via machine data**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = No. of output

---

<b>Definitions:</b>	The programmed digital/analog output is assigned to an NC function (e.g. software cams).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Use another output or deactivate concurrent NC function via MD.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17150            **[Channel %1: ] Block %2 maximum of %3 NCK outputs programmable in the block**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Quantity
<b>Definitions:</b>	No more than the specified number of outputs may be programmed in an NC block. The quantity of hardware outputs is defined in the MDs: MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS and MD10310 \$MN_FASTIO_ANA_NUM_OUTPUTS
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program fewer digital/analog outputs in a block. The specified maximum number applies in each case separately for analog or digital outputs. If necessary, program two NC blocks.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17160            **[Channel %1: ] Block %2 no tool selected**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An attempt has been made to access the current tool offset data via the system variables: \$P_AD [n]: Contents of the parameter (n: 1 - 25) \$P_TOOL: Active D number (tool edge number) \$P_TOOLL [n]: Active tool length (n: 1- 3) \$P_TOOLR: Active tool radius although no tool had been selected previously.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program or activate a tool offset in the NC program before using the system variables. Example: N100 G.. ... T5 D1 ... LF With the channel-specific machine data: Modify MD22550 \$MC_TOOL_CHANGE_MODE New tool offset for M function Modify MD22560 \$MC_TOOL_CHANGE_M_CODE M function with tool change It is established whether a tool offset is activated in the block with the T word or whether the new offset values are allowed for only when the M word for tool change occurs.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**17170 [Channel %1: ] Block %2 number of symbols too large**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The predefined symbols could not be read in during power-up.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**17180 [Channel %1: ] Block %2 illegal D number**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** In the displayed block, access is made to a D number that is not defined and therefore is not available.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check tool call in the NC parts program:  
 - Correct tool correction number D programmed? If no D number is specified with the tool change command, then the D number set by MD20270 \$MC\_CUTTING\_EDGE\_DEFAULT will be active automatically. It is D1 by default.  
 - Tool parameters (tool type, length,...) defined? The dimensions of the tool edge must have been entered previously either through the operator panel or through a tool data file in NCK.  
 Description of the system variables \$TC\_DPx[t, d] as included in a tool data file.  
 x ... Correction parameter number P  
 t ... Associated tool number T  
 d ... Tool correction number D

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17181 [Channel %1: ] Block %2 T no.= %3, D no.= %4 not existing**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = T number  
 %4 = D number

**Definitions:** A programmed D number was not recognized by the NC. By default, the D number refers to the specified T number. If the flat D number function is active, T= 1 is output.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** If the program is incorrect, remedy the error with a correction block and continue the program.  
 If the data block is missing, download a data block for the specified T/D values onto the NCK (via HMI with overstore) and continue the program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>17182</b>	<b>[Channel %1: ] Block %2 illegal sum correction number</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An attempt was made to access a non-defined total offset of the current tool edge.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Access the total offset memory with \$TC_SCP*, \$TC_ECP*, check the total offset selection DLx or tool selection Ty or offset selection Dz.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>17183</b>	<b>[Channel %1: ] Block %2 H number already available in T no.= %3, D no.= %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = T number %4 = D number
<b>Definitions:</b>	Each H number (except for H=0) must be assigned in a TO unit only once. The indicated edge already has the H number. If the H number shall be assigned more than once, MD10890 \$MN_EXTERN_TOOLPROG_MODE, bit 3 must be set = 1.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Change program: - Select different H number
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>17188</b>	<b>[Channel %1: ] D number %2 defined in tool T no. %3 and %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Offset number D %3 = T number of first tool %4 = T number of second tool
<b>Definitions:</b>	The specified D number %2 in the TO unit of channel %1 is not unique. The specified T numbers %3 and %4 each have an offset with number %2. If tool management is active: The specified T numbers belong to tool groups with different names.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	1. Ensure that the D numbers within the TO unit are unique. 2. If unique numbering is not necessary for subsequent operations, do not use the command.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>17189</b>	<b>[Channel %1: ] D number %2 of tools defined on magazine/location %3 and %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Offset number D %3 = Magazine/location number of first tool, '/' as separator %4 = Magazine/location number of second tool, '/' as separator

**Definitions:** The specified D number %2 in the TO unit of channel %1 is not unique. The specified T numbers %3 and %4 each have an offset with number %2.  
 If tool management is active:  
 The specified T numbers belong to tool groups with different names.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** 1. Ensure that the D numbers within the TO unit are unique, e.g. by renaming the D numbers.  
 2. If unique numbering is not necessary for subsequent operations, do not use the command.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17190 [Channel %1: ] Block %2 illegal T number %3**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = T number

**Definitions:** In the displayed block, access is made to a tool that is not defined and therefore not available. The tool has been named by its T number, its name or its name and duplo number.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Check tool call in the NC part program:  
 - Correct tool number T.. programmed?  
 - Tool parameters P1 - P25 defined? The dimensions of the tool edge must have been entered previously either through the operator panel or through the V.24 interface.  
 Description of the system variables \$P\_DP x [n, m]  
 n ... Associated tool number T  
 m ... Tool edge number D  
 x ... Parameter number P

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17191 [Channel %1: ] Block %2 T= %3 not existing, program %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = T number or T identifier  
 %4 = Program name

**Definitions:** A tool identifier which the NCK does not recognize was programmed.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** If the program pointer is at an NC block which contains the specified T identifier: If the program is incorrect, remedy the error with a correction block and continue the program. If the data block is missing, create one. You can do this by downloading a data block with all the defined D numbers onto the NCK (via MMC with overstore) and continue the program.  
 If the program pointer is at an NC block which does not contain the specified T identifier: The error occurred at an earlier point in the program where the T command appeared, but the alarm was not output until the change command was detected.  
 If the program is incorrect - T5 programmed instead of T55 - the current block can be corrected with a correction block; i.e. if only M06 is entered, you can correct the block with T55 M06. The incorrect T5 line remains in the program until it is terminated by a RESET or end of program.  
 In complex program structures with indirect programming, it may not be possible to correct the program. In this case, you can only intervene locally with an overstore block - with T55 in the example. If the data block is missing, create one. You can do this by downloading the data block of the tool with all the defined D numbers onto the NCK (via MMC with overstore), program the T command with overstore, and continue the program.



**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**17192**                    **[TO unit %1: ] Invalid tool designation of '%2', duplo no. %3. No more replacement tools possible in '%4'.**

**Parameters:**            %1 = TO unit  
                               %2 = Tool identifier  
                               %3 = Duplonummer  
                               %4 = Group identifier

**Definitions:**            The tool with the specified tool identifier, duplo number cannot accept the group identifier. Reason: The maximum number of replacement tools allowed has already been defined. The name allocation causes the tool to be reallocated to a tool group which already contains the maximum number of replacement tools allowed on this machine.

**Reaction:**                Interface signals are set.  
                               Alarm display.

**Remedy:**                 Use fewer replacement tools or request a different maximum setting from the machine manufacturer.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17193**                    **[Channel %1: ] Block %2 the active tool is no longer on toolholder no./spindle no. %3, program %4**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Toolholder no., spindle no.  
                               %4 = Program name

**Definitions:**            The tool at the specified toolholder/spindle at which the last tool change was carried out as master toolholder or master spindle, has been replaced.  
 Example:  
 N10 SETHTH(1)  
 N20 T="Wz1" ; Tool change at master toolholder 1  
 N30 SETMTH(2)  
 N40 T1="Wz2" ; Toolholder 1 is only a secondary toolholder.  
 Changing the tool does not result in correction deselection.  
 N50 D5; New correction selection. At present, there is no active tool which D can refer to, i.e. D5 refers to T no. = 0, which results in zero correction.

**Reaction:**                Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Modify program:  
                               - Set desired spindle as master spindle or toolholder as master toolholder.  
                               - Then, if required, reset master spindle or master toolholder.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17194**                    **[Channel %1: ] Block %2 no suitable tool found**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            - An attempt was made to access a tool which has not been defined.  
                               - The specified tool does not permit access.  
                               - A tool with the desired properties is not available.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:** Check access to tool:  
- Are the parameters of the command correctly programmed?  
- Does the status of the tool prevent access?

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17195 [Channel %1: ] block %2 illegal tool holder number %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Tool holder number

**Definitions:** In the displayed block, a tool holder that is not defined is accessed.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check the programming of the tool holder in the NC program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17200 [Channel %1: ] Block %2: Data of tool %3 cannot be deleted.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = T number

**Definitions:** An attempt has been made to delete from the part program the tool data for a tool currently being processed. Tool data for tools involved in the current machining operation may not be deleted. This applies both for the tool preselected with T or that has been changed in place of another, and also for tools for which the constant grinding wheel peripheral speed or tool monitoring is active.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Check access to tool offset memory by means of \$TC\_DP1[t,d] = 0 or deselect tool.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17202 [Channel %1: ] Block %2 deleting magazine data not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An attempt was made to delete magazine data which cannot currently be deleted. A magazine with the 'tool in motion' status active cannot be deleted. A tool adapter which is currently allocated to a magazine location cannot be deleted. A tool adapter cannot be deleted if MD18104 \$MN\_MM\_NUM\_TOOL\_ADAPTER has the value -1.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** If an attempt to delete a magazine fails  
 \$TC\_MAP1[ m ] = 0 ; Delete magazine with m=magazine no.  
 \$TC\_MAP1[ 0 ] = 0 ; Delete all magazines  
 \$TC\_MAP6[ m ] = 0 ; Delete magazines and all their tools you must ensure that the magazine does not have the 'tool in motion' status at the time of the call.  
 If an attempt to delete a tool adapter fails  
 \$TC\_ADPTT[ a ] = -1 ; Delete adapter with number a  
 \$TC\_ADPTT[ 0 ] = -1 ; Delete all adapters  
 then the data association with the magazine location or locations must first be canceled with \$TC\_MPP7[ m,p ] = 0 ;  
 m = magazine no., p = no. of the location to which the adapter is assigned.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17210 [Channel %1: ] Block %2 access to variable not possible

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The variable cannot be written/read directly from the part program. It is allowed only in motion synchronous actions.  
 Example for variable:  
 \$P\_ACTID (which planes are active)  
 \$AA\_DTEPB (axial distance-to-go for reciprocating infeed)  
 \$A\_IN (test input)  
 Safety Integrated: Safety PLC system variables can only be read during the safety SPL setup phase.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17212 [Channel %1: ] Tool management: Load manual tool %3, duplo no. %2 onto spindle/toolholder %4

**Parameters:** %1 = Channel number  
 %2 = Duplo no.  
 %3 = Tool identifier  
 %4 = Toolholder number (spindle number)

**Definitions:** Indicates that the specified manual tool must be loaded in the specified toolholder or spindle before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool can also be a tool in a multitool. In this case the multitool has to be changed.

**Reaction:** Alarm display.

**Remedy:** Make sure that the specified tool is loaded in the toolholder. The alarm is cleared automatically after PLC acknowledgement of the tool change on command.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

### 17214 [Channel %1: ] Tool management: remove manual tool %3 from spindle/toolholder %2

**Parameters:** %1 = Channel number  
 %2 = Toolholder number (spindle number)  
 %3 = Tool identifier

**Definitions:** Indicates that the specified manual tool must be removed from the specified toolholder or spindle before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool may be a tool in a multitool. In this case the multitool has to be removed.

**Reaction:** Alarm display.

**Remedy:** Make sure that the specified tool is removed from the toolholder. The alarm is cleared automatically after PLC acknowledgement of the tool change on command. Manual tools can only be used efficiently if this is supported by the PLC program.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**17215 [Channel %1: ] Tool management: Remove manual tool %3 from buffer location %2**

**Parameters:** %1 = Channel number  
 %2 = Buffer location number  
 %3 = Tool identifier

**Definitions:** Indicates that the specified manual tool must be removed from the specified buffer location before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool may also be included in a multitool. In this case the multitool has to be removed.

**Reaction:** Alarm display.

**Remedy:** Make sure that the specified manual tool is removed from the buffer location. The alarm is cleared automatically after PLC acknowledgment of the tool change OFF command. Manual tools can only be used efficiently if this is supported by the PLC program.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**17216 [Channel %1: ] Remove manual tool from toolholder %4 and load manual tool %3 %2**

**Parameters:** %1 = Channel number  
 %2 = Duplo no.  
 %3 = Tool identifier  
 %4 = Toolholder number (spindle number)

**Definitions:** Indicates that the specified manual tool must be loaded in the specified toolholder or spindle before the program is continued and that the manual tool located there must be removed. A manual tool is a tool whose data are known to the NCK but which is not assigned to a magazine location and is thus not fully accessible to the NCK, and usually also to the machine, for an automatic tool change.

**Reaction:** Alarm display.

**Remedy:** Make sure that the manual tools are exchanged. The alarm is cleared automatically after PLC acknowledgement of the tool change on command. Manual tools can only be used efficiently if this is supported by the PLC program.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**17218 [Channel %1: ] Block %2 Tool %3 cannot become a manual tool**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Tool identifier

**Definitions:** The specified tool has a dedicated location and/or a location has been reserved for this tool in an actual magazine. Therefore, it cannot become a manual tool.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Correct the NC program  
 - Use the programming of "DELRMRES" to check that there is no reference to an actual magazine location  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17220 [Channel %1: ] Block %2 tool not existing

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** -  
 The tool which does not exist can also be a multitool (the multitool is treated like a tool).  
**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Correct the NC program.  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17224 [Channel %1: ] Block %2 tool T/D= %3 - tool type %4 is not permitted

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Incorrect T no. / D no.  
 %4 = Incorrect tool type  
**Definitions:** On this system, it is not possible to select tool offsets of the indicated tool types.  
 The variety of tool types can both be limited by the machine OEM and be reduced on individual control models.  
 Only use tools of the tool types permitted for this system.  
 Check whether an error has occurred on defining the tool.  
**Reaction:** Correction block is reorganized.  
 Interpreter stop  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Correct the NC program or correct the tool data  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 17230 [Channel %1: ] Block %2 Duplo no. already assigned

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
**Definitions:** If an attempt is made to write a tool Duplo number to the name of which another tool (another T number) already exists with the same Duplo number.  
**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
**Remedy:** Correct the NC program.  
**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17240**                    **[Channel %1: ] Block %2 illegal tool definition**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            If an attempt is made to modify a tool data that would subsequently damage the data consistency or lead to a conflicting definition, this alarm will appear.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Correct the NC program.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**17250**                    **[Channel %1: ] Block %2 illegal magazine definition**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            If an attempt is made to modify a magazine data that would subsequently damage the data consistency or lead to a conflicting definition, this alarm will appear.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Correct the NC program.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**17260**                    **[Channel %1: ] Block %2 illegal magazine location definition**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**            This alarm occurs if an attempt is made to change a magazine location data which would subsequently damage data consistency irreparably or lead to a conflicting definition.  
                               Example: If parameter \$TC\_MPP1 (= type of location) is written with 'spindle/toolholder location', this may conflict with the limiting MD18075 \$MN\_MM\_NUM\_TOOLHOLDERS.  
                               The remedy is then either - if permitted by the control model - to increase the value of MD18075 \$MN\_MM\_NUM\_TOOLHOLDERS  
                               or to correct the magazine definition.  
                               It is not permitted to assign one tool to two different magazine locations at the same time. Neither may a tool be part of a multitool and in a magazine location at the same time.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Correct the NC program.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**17262**                    **[Channel %1: ] Block %2 illegal tool adapter operation**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

---

<b>Definitions:</b>	If an attempt is made to define or cancel a tool adapter assignment with reference to a magazine location and this magazine location already has another tool adapter and/or a tool is located in the adapter or - when canceling an assignment - a tool is still at the location, this alarm will appear. If machine data MD18108 \$MN_MM_NUM_SUMCORR has the value -1, adapters cannot be generated by a write operation to an adapter which is not already defined. While the machine data has this value, you can only write adapter data to adapters which have already been (automatically) assigned to magazine locations.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Assign max. one adapter to a magazine location. - The magazine location must not contain a tool. - MD18108 \$MN_MM_NUM_SUMCORR has value -1: If an alarm occurs when writing one of the system variables \$TC_ADPTx (x=1,2,3,T), the write operation must be modified such that only adapter data which are already associated with the magazine locations are written.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17270 [Channel %1: ] Block %2 call-by-reference: illegal variable

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Machine data and system variables must not be transferred as call-by-reference parameters.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify NC program: Assign the value of the machine data or of the system variable to a program-local variable and transfer this as parameter.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17500 [Channel %1: ] Block %2 axis %3 is not an indexing axis

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	An indexing axis position has been programmed for an axis with the keywords CIC, CAC or CDC that has not been defined as indexing axis in the machine data.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Remove programming instruction for indexing axis positions (CIC, CAC, CDC) from the NC part program or declare the relevant axis to be an indexing axis. Indexing axis declaration: Modify MD30500: \$MA_INDEX_AX_ASSIGN_POS_TAB (indexing axis assignment) The axis will become an indexing axis when an assignment to an indexing position table was made in the stated MD. 2 tables are possible (input value 1 or 2). Modify MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 Modify MD10920 \$MN_INDEX_AX_LENGTH_POS_TAB_2 (Number of positions for 1st/2nd indexing axis) Standard value: 0 Maximum value: 60 Modify MD10910 \$MN_INDEX_AX_POS_TAB_1 [n] Modify MD10930 \$MN_INDEX_AX_POS_TAB_2 [n] (Positions of the 1st indexing axis) The absolute axis positions are entered. (The list length is defined via MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1).
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**17501 [Channel %1: ] Block %2 indexing axis %3 with Hirth tool system is active**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name

**Definitions:** The 'Hirth tooth system' function is activated for the indexing axis. This axis can therefore approach only indexing positions, another travel movement of the axis is not possible.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
 Correct part program.  
 Correct FC16 or FC18 call.  
 Deselect machine data MD30505 \$MA\_HIRTH\_IS\_ACTIVE.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**17502 [Channel %1: ] Block %2 indexing axis %3 with Hirth tooth system stop is delayed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name

**Definitions:** For the indexing axis, the 'Hirth tooth system' function is activated and the override has been set to 0 or another stop condition (e.g. VDI interface signal) is active. Since it is possible to stop only on indexing axes, the next possible indexing position is approached. The alarm is displayed until this position is reached or the stop condition is deactivated.

**Reaction:** Alarm display.

**Remedy:** Wait until the next possible indexing position is reached or set override > 0 or deactivate another stop condition.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**17503 [Channel %1: ] Block %2 indexing axis %3 with Hirth tooth system and axis not referenced**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name

**Definitions:** The 'Hirth tooth system' function is activated for the indexing axis and the axis is to be traversed although it is not referenced.

**Reaction:** Alarm display.

**Remedy:** Reference axis.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

**17505 [Channel %1: ] Block %2 motion synchronous action: %3 indexing axis %4 is active with Hirth tooth system**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
<b>Definitions:</b>	The 'Hirth tooth system' function is activated for the indexing axis. This axis can therefore approach only indexing positions, another travel movement of the axis is not possible.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Correct part program. Correct FC16 or FC18 call. Deselect machine data MD30505 \$MA_HIRTH_IS_ACTIVE.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**17510 [Channel %1: ] Block %2 invalid index for indexing axis %3**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	The programmed index for the indexing axis is beyond the position table range. Example: Perform an absolute approach of the 56th position in the list allocated via the axis-specific MD30500 \$MA_INDEX_AX_ASSIGN_POS_TAB with the 1st positioning axis, the number of positions is e.g. only 40 (MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 = 40). N100 G.. U=CAC (56) Or, with equidistant distances, the programmed index is smaller or equal 0. Or, an attempt is made with a MOV movement to travel to a position outside the permitted area.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program the indexing axis position in the NC part program in accordance with the length of the current position table, or add the required value to the position table and adjust the length of the list.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**17600 [Channel %1: ] Block %2 preset on transformed axis %3 not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
--------------------	---

**Definitions:** The programmed PRESET axis is involved in the current transformation. This means that setting the actual value memory (PRESET) is not possible for this axis.  
**Example:**  
 Machine axis A should be set to the new actual value A 100 at the absolute position A 300.  
 :  
 N100 G90 G00 A=300  
 N101 PRESETON A=100

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Avoid preset actual value memory for axes which are participating in a transformation or deselect the transformation with the keyword TRAF00F.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17601**                    **[Channel %1: ] Block %2 motion synchronous action: %3 preset not possible on axis %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name, spindle number

**Definitions:** The actual value cannot be preset for this axis because the axis is in motion or the axis is linked in a transformation.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Avoid setting actual value.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17605**                    **[Channel %1: ] Block %2 axis %3 transformation active: inhibits rotation of axis container**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** The programmed axis/spindle is active in a transformation and the axis container cannot be rotated for this reason.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Modify part program. Deactivate the transformation for this axis/spindle before rotating the axis container or perform the axis container rotation later.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17610**                    **[Channel %1: ] Block %2 axis %3 involved in the transformation, action cannot be carried out**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

---

<b>Definitions:</b>	The axis is involved in the active transformation. It can therefore not execute the demanded action, traversing as positioning axis, enable for axis exchange.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Deselect the transformation with TRAFOOF ahead of time or remove the action from the part program block
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17620      **[Channel %1: ] Block %2 approaching fixed point for transformed axis %3 not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	In the displayed block, an axis is programmed for the fixed point approach (G75) that is involved in the active transformation. Fixed point approach is not performed with this axis!
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Remove G75 instruction from the part program block or previously deselect transformation with TRAFOOF.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17630      **[Channel %1: ] Block %2 referencing for transformed axis %3 not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	In the displayed block, an axis is programmed for reference point approach (G74) that is involved in the active transformation. Reference point approach is not performed with this axis!
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Remove G74 instruction, or the machine axes involved in transformation, from the part program block or previously deselect the transformation with TRAFOOF.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 17640      **[Channel %1: ] Block %2 spindle operation for transformed axis %3 not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	The axis programmed for the spindle operation is involved in the current transformation as geometry axis. This is not allowed.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	First switch off the transformation function.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

**17650 [Channel %1: ] Block %2 machine axis %3 not programmable**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number

**Definitions:** The machine axis cannot be used in an active transformation. You may be able to program the function in a different coordinate system. For example, it may be possible to specify the retraction position in the basic coordinate system or the workpiece coordinate system. The axis identifier is used to select the coordinate system.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Deactivate the transformation or use another coordinate system.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17800 [Channel %1: ] Block %2 illegally coded position programmed**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The position number n specified with the keyword FP=n is not permissible. Two (2) absolute axis positions can be directly defined as fixed points by the axis-specific machine data MD30600 \$MA\_FIX\_POINT\_POS[n]. Or, if position numbers 3 and/or 4 are to be used, then machine data MD30610 \$MA\_NUM\_FIX\_POINT\_POS must be set accordingly.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Program keyword FP with machine fixed points 1 or 2.  
 Example:  
 Approach fixed point 2 with machine axes X1 and Z2.  
 N100 G75 FP=2 X1=0 Z2=0  
 Or modify MD30610 \$MA\_NUM\_FIX\_POINT\_POS and, if necessary, MD30600 \$MA\_FIX\_POINT\_POS[].

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**17810 [Channel %1: ] Axis %2 not referenced**

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** A function has been activated for the axis in JOG mode, e.g. fixed-point approach, JOG to position, JOG in circles, but the axis has not been referenced.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** Reference axis.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**17811 [Channel %1: ] Fixed-point approach not possible for axis %2 in JOG, reason %3**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Cause

---

<b>Definitions:</b>	A 'fixed-point approach in JOG' has been requested for an axis. This is not possible because: Reason 1: The axis is involved in the active transformation. Reason 2: The axis is a following axis in an active coupling. The fixed point approach will therefore not be executed.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Deselect fixed-point approach in JOG, or previously deselect the transformation with TRAFOOF or disband the coupling.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 17812 [Channel %1: ] Axis %2 fixed-point approach in JOG: Fixed point %3 changed

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Fixed-point number
<b>Definitions:</b>	'Fixed-point approach in JOG' is active for the axis, but another fixed point has been selected, or the fixed-point approach has been deactivated. The approach motion is canceled.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Trigger JOG motion again.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 17813 [Channel %1: ] Axis %2 fixed-point approach in JOG and override motion active

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	'Fixed-point approach in JOG' is active for the axis, but another offset motion - for example a synchronization offset \$AA_OFF - has been interpolated simultaneously. The position of the selected fixed-point is not reached if offset values are changed during the traversing motion. The target point then becomes "fixed-point position + change in offset value". The end point will be reached if the traversing motion is restarted after the offset value has been changed. (For example: incremental traversing in which the traversing motion stops intermittently). Reason: Restarting the motion takes the current offset value into account.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Trigger JOG motion again.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 17814 [Channel %1: ] Axis %2 fixed-point position not available

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Number of fixed-point position
<b>Definitions:</b>	No fixed-point position is available for the fixed point selected in JOG mode. See MD30610 \$MA_NUM_FIX_POINT_POS.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** Adapt MD30610 \$MA\_NUM\_FIX\_POINT\_POS and, if necessary, MD30600 \$MA\_FIX\_POINT\_POS[].  
Deselect fixed-point approach or select a valid fixed point, and restart the JOG motion.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17815 Indexing axis %1 fixed point %2 unequal indexing position**

**Parameters:** %1 = Axis number  
%2 = Array index of machine data

**Definitions:** The axis is a referenced indexing axis, and the fixed-point number %2 to be approached in JOG mode (defined in MD30600 \$MA\_FIX\_POINT\_POS) does not coincide with an indexing position. In JOG mode, referenced indexing axes approach indexing positions.

**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** MD30600 \$MA\_FIX\_POINT\_POS[] or adapt the indexing positions.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**17820 [Channel %1: ] JOG to position not possible for axis %2, reason %3**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Cause

**Definitions:** A 'JOG to position' has been requested for an axis. This is not possible because:  
Reason 1: The axis is involved in the active transformation.  
Reason 2: The axis is a following axis in an active coupling.  
The JOG to position will therefore not be executed.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Deselect 'JOG to position', or previously deselect the transformation with TRAF00F or disband the coupling.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17821 [Channel %1: ] Axis %2 JOG to position and override motion active**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** 'JOG to position' is active for the axis, but an offset motion - for example a synchronization offset \$AA\_OFF - has been interpolated simultaneously.  
The position of the SD43320 \$SA\_JOG\_POSITION is not reached if offset values are changed during the traversing motion.  
The target point then becomes "Jog position + change in offset value".  
The position SD43320 \$SA\_JOG\_POSITION will be reached if the traversing motion is restarted after the offset value has been changed.  
(For example: incremental traversing in which the traversing motion stops intermittently).  
Reason:  
Restarting the motion takes the current offset value into account.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Trigger JOG motion again.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### 17822 [Channel %1: ] Axis %2 JOG to position: Position changed

**Parameters:** %1 = Channel number  
**Definitions:** An axis motion is active for the axis with 'JOG to position' but the position, that is the content of SD43320 \$SA\_JOG\_POSITION, has been changed. The approach motion is canceled.  
**Reaction:** Interface signals are set.  
 Alarm display.  
**Remedy:** Trigger JOG motion again.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

### 17823 [Channel %1: ] Axis %2 JOG to position deactivated

**Parameters:** %1 = Channel number  
**Definitions:** An axis motion is active for the axis with 'JOG to position' but 'JOG to position' has been deactivated. The approach motion is canceled.  
**Reaction:** Interface signals are set.  
 Alarm display.  
**Remedy:** Trigger JOG motion again.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

### 17825 Indexing axis %1 \$SA\_JOG\_POSITION unequal indexing position

**Parameters:** %1 = Axis number  
**Definitions:** The axis is a referenced indexing axis and 'JOG to position' is activated in JOG mode, but SD43320 \$SA\_JOG\_POSITION does not coincide with an indexing position. In JOG mode, referenced indexing axes approach indexing positions.  
**Reaction:** NC not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Modify SD43320 \$SA\_JOG\_POSITION or indexing positions.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 17830 [Channel %1: ] JOG in a circle is activated, but the axis %2 required for this is not a geometry axis.

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
**Definitions:** The function JOG in circles has been activated, but the axis required for this has not been defined as a geometry axis.  
**Reaction:** Interface signals are set.  
 Alarm display.  
**Remedy:** Define axis as geometry axis.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**17831 [Channel %1: ] JOG a circle is not possible, reason %2**

**Parameters:** %1 = Channel number  
%2 = Cause

**Definitions:** The JOG in circles was activated, but this is not possible because:

1. The current positions of the axes involved lie outside the selected pitch circle.
2. The current positions of the axes involved, with pitch circle selected and tool radius offset active, are too near to the center of the circle.
3. The current positions of the axes involved, with tool radius offset active, are too near to the limiting circle during internal machining.
4. The current positions of the axes involved, with tool radius offset active, are too near to the limiting circle during external machining.
5. The current positions of the axes involved in internal machining are outside the defined circle.
6. The current positions of the axes involved in external machining are inside the defined circle.
10. A rotation is acting on the current plane, that is the current plane is inclined in space. This is not currently supported.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Define axis as geometry axis.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

**17833 [Channel %1: ] JOG a circle is active and JOG circles deactivated**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** A circular motion is active but 'JOG in circles' has been deactivated. The circular motion is canceled.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Reactivate 'JOG circles' and trigger JOG motion again.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

**17900 [Channel %1: ] Block %2 motion synchronous action: %3 axis %4 is not a machine axis**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Axis name

**Definitions:** At this point, the block context calls for a machine axis. This is the case with:

- G74 (reference point approach)
- G75 (fixed point approach)

If a geometry or additional axis identifier is used, then it must also be allowed as machine axis identifier (MD10000 \$MN\_AXCONF\_MACHAX\_NAME\_TAB).

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Use machine axis identifier when programming.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program



---

<b>18000</b>	<b>[Channel %1: ] Block %2 NCK-specific protection zone %3 wrong. Error code %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of NCK protection zone %4 = Error specification
<b>Definitions:</b>	There is an error in the definition of the protection zone. The error number gives the specific reason for the alarm: No.Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection zone is not convex. 4: If both boundaries are active in the 3rd dimension of the protection zone and both limits have the same value. 5: The number of the protection zone does not exist (negative number, zero or greater than the maximum number of protection zones). 6: Protection zone definition consists of more than 10 contour elements. 7: Tool-related protection zone is defined as inside protection zone. 8: Incorrect parameter used. 9: Protection zone to be activated is not defined. 10: Incorrect modal G code used for protection zone definition. 11: Contour definition incorrect or frame activated. 12: Other, not further specified errors.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify definition of the protection zone and check MD.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>18001</b>	<b>[Channel %1: ] Block %2 channel-specific protection zone %3 incorrect. Error code %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of the channel-specific protection zone %4 = Error specification
<b>Definitions:</b>	There is an error in the definition of the protection zone. The error number gives the specific reason for the alarm. No.Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection zone is not convex. 4: If both boundaries are active in the 3rd dimension of the protection zone and both limits have the same value. 5: The number of the protection zone does not exist (negative number, zero or greater than the maximum number of protection zones). 6: Protection zone definition consists of more than 10 contour elements. 7: Tool-related protection zone is defined as inside protection zone. 8: Incorrect parameter used. 9: Protection zone to be activated is not defined. 10: Incorrect modal G code used for protection zone definition. 11: Contour definition incorrect or frame activated. 12: Other, not further specified errors.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify definition of the protection zone and check MD.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

**18002 [Channel %1: ] Block %2 NCK protection zone %3 cannot be activated. Error code %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of NCK protection zone  
 %4 = Error specification

**Definitions:** An error has occurred on activating the protection zone. The error number gives the specific reason for the alarm.  
 No.Meaning  
 1: Incomplete or conflicting contour definition.  
 2: Contour encompasses more than one surface area.  
 3: Tool-related protection zone is not convex.  
 4: If both boundaries are active in the 3rd dimension of the protection zone and both limits have the same value.  
 5: The number of the protection zone does not exist (negative number, zero or greater than the maximum number of protection zones).  
 6: Protection zone definition consists of more than 10 contour elements.  
 7: Tool-related protection zone is defined as inside protection zone.  
 8: Incorrect parameter used.  
 9: Protection zone to be activated is not defined or number of contour element <2 or >MAXNUM\_CONTOURNO\_PROTECTAREA.  
 10: Error in internal structure of the protection zones.  
 11: Other, not further specified errors.  
 12: The number of protection zones simultaneously active exceeds the maximum number (channel-specific machine data).  
 13,14: Contour element for protection zones cannot be created.  
 15,16: No more memory space for the protection zones.  
 17: No more memory space for the contour elements.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.  
 If the alarm is output on ramp-up (2nd parameter: "INIT" instead of block number), "Channel not ready to operate" will be set.

**Remedy:** Please inform the authorized personnel/service department.  
 1. Reduce the number of simultaneously active protection zones (MD).  
 2. Modify part program:  
 - Delete other protection zones.  
 - Preprocessing stop.  
 When the alarm occurs during control ramp-up, the system variables \$SN\_PA\_... have to be corrected for the specified protection zone. Afterwards perform a restart. If the erroneous data cannot be recognized, the protection zone's immediate activation can be removed, and the system variables of the protection zone can be written again by means of NPROTDEF.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.  
 If the alarm occurs during NC program execution, the current block can be changed. This way, the NPROT parameters can also be adjusted. However, if there is an error in the definition of the protection zone, the NC program must be aborted and the definition must be corrected under NPROTDEF.  
 If the alarm occurs on control ramp-up, system variables \$SN\_PA\_... must be corrected for the specified protection zone. This can be done by downloading an Initial.ini file that includes the relevant corrected data. If afterwards a restart is performed again, the alarm will have been removed provided that the data are consistent.

---

**18003 [Channel %1: ] Block %2 channel-specific protection zone %3 cannot be activated. Error code %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of the channel-specific protection zone  
 %4 = Error specification

<b>Definitions:</b>	<p>An error has occurred on activating the protection zone. The error number gives the specific reason for the alarm.</p> <p>No.Meaning</p> <p>1: Incomplete or conflicting contour definition.</p> <p>2: Contour encompasses more than one surface area.</p> <p>3: Tool-related protection zone is not convex.</p> <p>4: If both boundaries are active in the 3rd dimension of the protection zone and both limits have the same value.</p> <p>5: The number of the protection zone does not exist (negative number, zero or greater than the maximum number of protection zones).</p> <p>6: Protection zone definition consists of more than 10 contour elements.</p> <p>7: Tool-related protection zone is defined as inside protection zone.</p> <p>8: Incorrect parameter used.</p> <p>9: Protection zone to be activated is not defined or number of the contour element &lt;2 or &gt;MAXNUM_CONTOURNO_PROTECTAREA.</p> <p>10: Error in internal structure of the protection zones.</p> <p>11: Other, not further specified errors.</p> <p>12: The number of protection zones simultaneously active exceeds the maximum number (channel-specific machine data).</p> <p>13,14: Contour element for protection zones cannot be created.</p> <p>15,16: No more memory space for the protection zones.</p> <p>17: No more memory space for the contour elements.</p>
<b>Reaction:</b>	<p>Correction block is reorganized.</p> <p>Interface signals are set.</p> <p>Alarm display.</p> <p>If the alarm is output on ramp-up (2nd parameter: "INIT" instead of block number), "Channel not ready to operate" will be set.</p>
<b>Remedy:</b>	<p>Please inform authorized personnel / the service department.</p> <p>1. Reduce the number of simultaneously active protection zones (MD).</p> <p>2. Modify part program:</p> <ul style="list-style-type: none"> <li>- Delete other protection zones.</li> <li>- Preprocessing stop.</li> </ul> <p>When the alarm occurs on control ramp-up, system variables \$\$SC_PA_... must be corrected for the specified protection zone. Afterwards perform a restart. If the erroneous data cannot be recognized, the protection zone's immediate activation can be removed, and the system variables of the protection zone can be written again by means of CPROTDEF.</p>
<b>Program Continuation:</b>	<p>Clear alarm with NC START or RESET key and continue the program.</p> <p>The current block can be changed if the alarm occurs during NC program execution. The CPROT parameters can also be adjusted. However, if the error lies in the definition of the protection zone, the NC program must be aborted and the definition corrected under CPROTDEF.</p> <p>If the alarm occurs on control power-up, the system variables \$\$SC_PA_... must be corrected for the specified protection zone. This can be done by downloading an Initial.ini file that includes the relevant corrected data. If another restart is then made, the alarm will have been eliminated provided that the data are now consistent.</p>

---

<b>18004</b>	<b>[Channel %1: ] Block %2 orientation of workpiece-related protection zone %3 does not correspond to the orientation of tool-related protection zone %4</b>
<b>Parameters:</b>	<p>%1 = Channel number</p> <p>%2 = Block number, label</p> <p>%3 = Number of workpiece-related protection zone</p>
<b>Definitions:</b>	<p>The orientation of the workpiece-related protection zone and the orientation of the tool-related protection zone differ.</p> <p>If the protection zone number is negative, then this is an NCK protection zone.</p>
<b>Reaction:</b>	<p>Correction block is reorganized.</p> <p>Interface signals are set.</p> <p>Alarm display.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Modify the protection zone definition or do not simultaneously activate protection zones that have different orientations.</li> <li>- Check machine data and modify the protection zone definition if necessary.</li> </ul>
<b>Program Continuation:</b>	<p>Clear alarm with NC START or RESET key and continue the program.</p>

---

**18005 [Channel %1: ] Block %2 serious error in definition of NCK-specific protection zone %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Protection zone number

**Definitions:** The protection zone definition must be terminated with EXECUTE before a preprocessing stop is performed. This also applies to any that are initiated implicitly such as with G74, M30, M17.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**18006 [Channel %1: ] Block %2 serious error in definition of channel-specific protection zone %3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Protection zone number

**Definitions:** The protection zone definition must be terminated with EXECUTE before a preprocessing stop is performed. This also applies to any that are initiated implicitly such as with G74, M30, M17.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**18100 [Channel %1: ] Block %2 invalid value assigned to FXS[]**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The following values are valid at the present time:  
0: "Deselect traverse against fixed stop"  
1: "Select traverse against fixed stop" valid.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**18101 [Channel %1: ] Block %2 invalid value assigned to FXST[]**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Only the range 0.0 - 100.0 is valid at the present time.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** --  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### 18102 [Channel %1: ] Block %2 invalid value assigned to FXSW[]

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Only positive values including zero are valid at the present time.  
**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.  
**Remedy:** --  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

### 18200 [Channel %1: ] Block %2 curve table: block search stop not allowed with definition CTABDEF

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Program instructions that lead to a preprocessing stop are not allowed within a curve table definition. The system variable \$P\_CTABDEF can be queried to check whether a table definition is currently active.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Put the block in parenthesis using "IF NOT(\$P\_CTABDEF) ... ENDIF" or remove the instruction that causes the preprocessing stop. Then start the part program again.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### 18201 [Channel %1: ] Block %2 curve table: table %3 does not exist

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Number of curve table  
**Definitions:** An attempt was made to use a curve table whose table number is not known in the system \par.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Change the table number in the program instruction or define the curve table with the desired table number.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**18202**            **[Channel %1: ] Block %2 curve table: instruction CTABEND without CTABDEF not allowed**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**        The CTABEND instruction, which is used to terminate the definition, has been programmed in the program without starting a curve table definition with CTABDEF, or the CTABDEF and CTABEND instructions were not programmed in the same program level.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Remove the CTABEND command or add the CTABDEF (..) command at the appropriate program location. The CTABDEF and CTABEND instructions must be programmed in the same program level (main or subprogram). Start the program again.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**18203**            **[Channel %1: ] Block %2 curve table: instruction CTABDEF not within CTABDEF**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**        In the program, the instruction CTABDEF that starts the definition of curve tables, is programmed within the definition part of a curve table. This is not allowed, as the current curve table must be completed with CTABEND first.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Remove command CTABEND from program or insert instruction CTABDEF (..) at the relevant point in the program. The CTABDEF and CTABEND instructions must be programmed on the same program level (main program or subroutine). Restart the program.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**18204**            **[Channel %1: ] Block %2 curve table: instruction SUPA not within CTABDEF**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**        G code SUPA is not allowed for the definition of a curve table, as it triggers a preprocessing stop.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Remove G code SUPA from the curve table definition. If possible, use G codes G53 or G153 instead of SUPA.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

**18205**            **[Channel %1: ] Block %2 motion synchronous action: %3 curve table %4 does not exist**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, line number  
                          %3 = Synact ID  
                          %4 = Number of curve table

---

<b>Definitions:</b>	An attempt was made to use a curve table whose table number is not known in the system \par.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Change the table number in the program instruction or define the curve table with the desired table number.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 18300 [Channel %1: ] Block %2 frame: fine shift not possible

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Allocation of a fine shift to settable frames or the basic frame is not possible since MD18600 \$MN_MM_FRAME_FINE_TRANS is not equal to 1.
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Modify program or set MD18600 \$MN_MM_FRAME_FINE_TRANS to 1.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 18310 [Channel %1: ] Block %2 frame: illegal rotation

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Rotations are not possible with NCU global frames.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 18311 [Channel %1: ] Block %2 frame: illegal instruction

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	An attempt was made to read or write a frame which does not exist.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**18312 [Channel %1: ] Block %2 frame: fine shift not configured**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Fine shift must be configured with G58 and G59.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify machine data.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**18313 [Channel %1: ] Block %2 frame: illegal switchover of geometry axes**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** It is not allowed to change the geometry axis assignment because the current frame contains rotations.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change NC program or set other mode with MD10602 \$MN\_FRAME\_GEOAX\_CHANGE\_MODE.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**18314 [Channel %1: ] Block %2 frame: type conflict**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** It is not possible to chain global frames and channel-specific frames. The alarm occurs if a global frame is programmed with a channel axis name and no machine axis on this NCU is assigned to the channel axis. Channel-specific frames cannot be programmed with machine axis names if there is no corresponding channel axis on this NCU.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**18400 [Channel %1: ] Block %2 language change not possible:%3**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Cause



---

<b>Definitions:</b>	The selection of an external NC language is not possible due to the reason specified. The following reasons are possible (see parameter 3): 1. Invalid machine data settings 2. Active transformation
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Remedy the specified cause of the error before selecting the language.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 20000 [Channel %1: ] Axis %2 reference cam not reached

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	After starting the reference point approach, the rising edge of the reduction cam must be reached within the section defined in the MD34030 \$MA_REFP_MAX_CAM_DIST (phase 1 of referencing). (This error occurs only with incremental encoders).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. There are 3 possible causes of error: 1. The value entered in MD34030 \$MA_REFP_MAX_CAM_DIST is too small. Determine the maximum possible distance from the beginning of reference motion up to the reduction cam and compare with the value in MD34030 \$MA_REFP_MAX_CAM_DIST, increase the value in the MD if necessary. 2. The cam signal is not received by the PLC input module. Operate the reference point switch manually and check the input signal on the NC/PLC interface (route: Switch! Connector! Cable! PLC input! User program). 3. The reference point switch is not operated by the cam. Check the vertical distance between reduction cam and activating switch.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 20001 [Channel %1: ] Axis %2 no cam signal present

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	At the beginning of phase 2 of reference point approach, the signal from the reduction cam is no longer available. Phase 2 of reference point approach begins when the axis remains stationary after deceleration to the reduction cam. The axis then starts in the opposite direction in order to select the next zero marker of the measuring system on leaving the reduction cam or approaching it again (negative/positive edge).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check whether the deceleration path after the approach velocity is greater than the distance to the reference point cam - in which case the axis cannot stop until it is beyond the cam. Use a longer cam or reduce the approach velocity in MD34020 \$MA_REFP_VELO_SEARCH_CAM. When the axis has stopped at the cam, it must be checked whether the signal DB31, ... DBX12.7 (Deceleration reference point approach) is still available at the interface to the NCK. - Hardware: Wire break? Short circuit? - Software: User program?

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20002 [Channel %1: ] Axis %2 zero mark not found**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The hardware zero mark of the incremental position encoder or the substitute zero mark of the absolute position encoder is not within a defined section.  
Phase 2 of the reference point approach ends when the zero mark of the encoder has been detected after the rising/falling edge of the NC/PLC interface signal DB31, ... DBX12.7 (Deceleration reference point approach) has given the trigger start. The maximum distance between the trigger start and the zero mark that follows is defined in the MD34060 \$MA\_REFP\_MAX\_MARKER\_DIST.  
The monitor prevents a zero mark signal from being overtraveled and the next being evaluated as reference point signal. (Faulty cam adjustment or excessive delay by the PLC user program).

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Check the cam adjustment and make sure that the distance is sufficient between the end of the cam and the zero marker signal that follows. The path must be greater than the axis can cover in the PLC cycle time.  
Increase the MD34060 \$MA\_REFP\_MAX\_MARKER\_DIST, but do not select a value greater than the distance between the 2 zero markers. This might result in the monitor being switched off.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20003 [Channel %1: ] Axis %2 measuring system error**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** In a measuring system with distance-coded reference marks, the distance between two adjacent markers has been found to be more than twice the value entered in MD34300 \$MA\_ENC\_REFP\_MARKER\_DIST. The control does not issue the alarm until it has again detected a distance that is too long after having made a 2nd attempt in reverse direction with half the traversing velocity.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Determine the distance between 2 odd reference marks (reference mark interval). This value (which is 20.00 mm on Heidenhain scales) must be entered in MD34060 \$MA\_REFP\_MAX\_MARKER\_DIST.  
Check the reference track of the scale including the electronics for the evaluation.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20004 [Channel %1: ] Axis %2 reference mark missing**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

---

<b>Definitions:</b>	In the distance-coded length measurement system, 2 reference marks were not found within the defined searching distance (axis-specific MD34060 \$MA_REFP_MAX_MARKER_DIST). A reduction cam is not required for distance-coded scales (but an existing cam will be evaluated). The conventional direction key determines the direction of search. The searching distance MD34060 \$MA_REFP_MAX_MARKER_DIST, within which the two reference marks are expected is counted commencing at the start point.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Determine the distance between 2 odd reference point markers (reference point marker interval). This value (which is 20.00 mm on Heidenhain scales) must be entered in the MD34060 \$MA_REFP_MAX_MARKER_DIST. Check the reference point track of the scale including the electronics for the evaluation.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 20005 [Channel %1: ] Axis %2 reference point approach aborted

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	Referencing could not be completed for all stated axes (e.g., abort caused by missing servo enable, measuring system switchover, release of direction key, etc.). In distance-coded measuring systems, the alarm will also be displayed if the value 1 has been set in MD34000 \$MA_REFP_CAM_IS_ACTIV (reference cams) and one of the conditions stated in the remedy has been fulfilled.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check the possible reasons for termination: <ul style="list-style-type: none"> <li>- Servo enable missing: NC/PLC interface signal DB31, ... DBX2.1 (Servo enable)</li> <li>- Measuring system switchover: NC/PLC interface signal DB31, ... DBX1.5 / 1.6 (Position measuring system 1/2)</li> <li>- Traversing key + or - missing: NC/PLC interface signal DB31, ... DBX4.7 / 4.6 (Traversing keys plus/minus)</li> <li>- Feed override = 0</li> <li>- The feed disable is active</li> <li>- Exact stop not reached within MD36020 \$MA_POSITIONING_TIME.</li> </ul> The axis-specific MD34110 \$MA_REFP_CYCLE_NR determines which axes are involved in the channel-specific referencing. ValueMeaning -1: No channel-specific referencing, NC Start without referencing. 0: No channel-specific referencing, NC Start with referencing. 1-8: Channel-specific referencing. The number entered here corresponds to the referencing sequence. (When all axes with contents 1 have reached the reference point, then the axes with contents 2 start, etc.).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 20006 [Channel %1: ] Axis %2 reference point creep velocity not reached

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
--------------------	---

**Definitions:** In phase 2 of reference point approach (wait for zero mark), the cam end was reached but the reference point approach velocity was not within the tolerance window. (This can occur when the axis is already at the end of the cam at the beginning of reference point approach. Phase 1 is therefore considered as being already concluded and will not be started.)  
 Phase 2 has been interrupted (this time before the cam) and the reference point approach will be started once again automatically with phase 1. If the approach velocity is not reached at the 2nd attempt either, referencing will be stopped and the alarm displayed.  
 Approach velocity: MD34040 \$MA\_REFP\_VELO\_SEARCH\_MARKER  
 Velocity tolerance: MD35150 \$MA\_SPIND\_DES\_VELO\_TOL.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
 Reduce the MD for the approach velocity MD34040 \$MA\_REFP\_VELO\_SEARCH\_MARKER and/or increase the MD for the velocity tolerance MD35150 \$MA\_SPIND\_DES\_VELO\_TOL.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20007 [Channel %1: ] Axis %2 reference point approach requires 2 measuring systems**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** 2 encoders are needed for setting MD34200 \$MA\_ENC\_REFP\_MODE = 6!

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
 Modify reference mode MD34200 \$MA\_ENC\_REFP\_MODE or install and configure a second encoder.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20008 [Channel %1: ] Axis %2 reference point approach requires second referenced measuring system**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** When setting MD34200 \$MA\_ENC\_REFP\_MODE = 6 the 2nd encoder must first be referenced.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify referencing mode MD34200 \$MA\_ENC\_REFP\_MODE or reference 2nd encoder.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20050 [Channel %1: ] Axis %2 handwheel mode active**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

---

<b>Definitions:</b>	The axes cannot be traversed in JOG mode using the traversing keys because traversing is still taking place via the handwheel.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Decide whether the axis is to be traversed by means of the direction keys or the handwheel. End handwheel travel and delete the axial distance-to-go if necessary (NC/PLC interface signal DB31, ... DBX2.2 (Delete distance-to-go/ Spindle reset)).
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

### 20051 [Channel %1: ] Axis %2 handwheel mode not possible

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	The axis is already traveling via the traversing keys, so handwheel mode is no longer possible.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Decide whether the axis is to be traversed by means of the jog keys or via the handwheel.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

### 20052 [Channel %1: ] Axis %2 already active

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	The axis is to traverse as a machine axis in JOG mode using the direction keys on the machine control panel. However, this is not possible because: <ol style="list-style-type: none"> <li>1. It is already traversing as a geometry axis (through the channel-specific interface DB21-30 DBX12.6 / 12.7 (Traversing keys -/+) or DB21-30 DBX16.6 / 16.7 (Traversing keys -/+) or DB21-30 DBX20.6 / 20.7 (Traversing keys -/+) or</li> <li>2. It is already traversing as a machine axis (through the axis-specific interface DB31, ... DBX4.7 / 4.6 (Traversing keys plus/minus)) or</li> <li>3. A frame is valid for a rotated coordinate system, and another geometry axis involved in this is already traversing in JOG mode by means of the direction keys.</li> </ol>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Stop traversing through the channel or axis interface or stop the other geometry axis.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 20053 [Channel %1: ] Axis %2 DRF, FTOCON, external zero point offset not possible

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	The axis is traversed in a mode (e.g. referencing) that allows no additional overlaid interpolation.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Wait until the axis has reached its reference position or terminate reference point approach with "Reset" and start DRF once again.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**20054 [Channel %1: ] Axis %2 wrong index for indexing axis in JOG mode**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** 1. The displayed indexing axis is to be traversed incrementally in JOG mode (by 1 indexing position). However, no further indexing position is available in the selected direction.  
 2. The axis is stationary at the last indexing position. In incremental traversing the working area limitation or the software limit switch is reached without an indexing position being located in front of it at which a stop could be made.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Correct (add to) the list of indexing positions by means of the machine data  
 MD10900 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_1  
 MD10910 \$MN\_INDEX\_AX\_POS\_TAB\_1  
 MD10920 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_2  
 MD10930 \$MN\_INDEX\_AX\_POS\_TAB\_2  
 or set the working area limits or the software limit switches to other values.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20055 [Channel %1: ] Master spindle not present in JOG mode**

**Parameters:** %1 = Channel number

**Definitions:** The displayed axis is to be traversed as machine axis in JOG mode with revolutional feed, but no master spindle has been defined from which the actual speed could have been derived.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 If the revolutional feed is also to be active in JOG mode, then a master spindle must be declared via the channel-specific MD20090 \$MC\_SPIND\_DEF\_MASTER\_SPIND. In this case you have to open a screen in the PARAMETER operating area with the softkeys "SETTINGDATA" and "JOG DATA" and preselect the G function G95 there. The JOG feedrate can then be entered in [mm/rev]. (If 0 mm/rev is set as JOG feed, the control takes the value assigned in the axis-specific MD 32050 \$MA\_JOG\_REV\_VELO or in the case of rapid traverse overlay MD32040 \$MA\_JOG\_REV\_VELO\_RAPID).  
 The revolutional feed in JOG mode is deactivated by changing the G function from G95 to G94.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20056 [Channel %1: ] Axis %2 no revolutional feedrate possible. Axis/spindle %3 stationary**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Axis name, spindle number

**Definitions:** An axis is to travel in JOG with revolutional feed, but the spindle/axis the feed is to be derived from is 0.

**Reaction:** Alarm display.

**Remedy:** Traverse the spindle/axis from which the feed is to be derived.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>20057</b>	<b>[Channel %1: ] Block %2 revolutional feedrate for axis/spindle %3 is &lt;= zero</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	Revolutional feed has been programmed for an axis/spindle, but the velocity was not programmed or the programmed value is smaller than or equal to zero.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Correct the part program or - Specify the correct feed for PLC axes at the VDI interface, - Specify feed for oscillating axes in the SD43740 \$SA_OSCILL_VELO.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20058</b>	<b>[Channel %1: ] Axis %2 revolutional feedrate: illegal feed source</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	An axis/spindle is to be traversed at revolutional feedrate. The reference axis/spindle defined in SD 43300 \$SA_ASSIGN_FEED_PER_REV_SOURCE refers to itself. The coupling caused cannot be executed.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The reference axis/spindle must be modified accordingly in SD 43300.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>20059</b>	<b>[Channel %1: ] Axis %2 already active due to %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Cause
<b>Definitions:</b>	The axis (machine axis, geometry axis or orientation axis) is to be traversed in operation mode "Automatic&Jog" (see MD10735 \$MN_JOG_MODE_MASK) by using the direction keys or a handwheel. This is not possible, as (see parameter 3): 1. the axis is active as a rotating spindle 2. the axis is a PLC axis 3. the axis is active as an asynchronous reciprocating axis 4. the axis is active as a command axis 5. the axis is active as a slave axis 6. a frame applies for a rotated coordinate system and an axis involved in the required JOG movement of the geometry axis is not available for this 7. an axis container rotation is activated via NCU link Note: This alarm identifies an axis not capable of JOG which received a JOG order. In this case, the NCK will not proceed according to "Internal JOG".
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Wait for the axis to traverse or abort with distance-to-go delete or RESET.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**20060 [Channel %1: ] Axis %2 cannot be traversed as geometry axis**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The axis is currently not in "Geometry axis" state. Therefore, it cannot be traversed in JOG mode as geometry axis. If the abbreviation WCS (workpiece coordinate system) is displayed in the "Position" screen, then only the geometry axes can be traversed by means of the direction keys! (MCS ... Machine coordinate system; all machine axes can now be traversed by using the direction keys on the machine control panel).

**Reaction:** Alarm display.

**Remedy:** Check the operating steps to establish whether geometry axes really must be traversed, otherwise switch over to the machine axes by activating the "WCS/MCS" key on the machine control panel.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20061 [Channel %1: ] Axis %2 cannot be traversed as orientation axis**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The axis is not an orientation axis and can therefore not be traversed as an orientation axis in JOG mode.

**Reaction:** Alarm display.

**Remedy:** Register the axis as an orientation axis.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20062 [Channel %1: ] Axis %2 already active**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The displayed axis is already traversing as a machine axis. Therefore, it cannot be operated as a geometry axis. Traversing an axis can take place in JOG mode through 2 different interfaces.  
 1. As a geometry axis: via the channel-specific interface DB21-30 DBX12.6 / 12.7 (Traversing keys -/+)  
 2. As a machine axis: via the axis-specific interface DB31, ... DBX4.7 / 4.6 (Traversing keys plus/minus)  
 With the standard machine control panel, it is not possible to operate an axis as a machine axis and as a geometry axis at the same time.

**Reaction:** Alarm display.

**Remedy:** Do not start the geometry axis until the traversing motion as machine axis has been concluded.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20063 [Channel %1: ] Axis %2 orientation axes cannot be traversed without transformation**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** An attempt was made to move an orientation axis in JOG mode without an active orientation transformation.

**Reaction:** Alarm display.

**Remedy:** Activate an orientation transformation.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>20064</b>	<b>[Channel %1: ] Axis %2 selection of several axes with an active taper angle is not permitted.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	With an active taper angle, only one geometry axis at the time can be traversed in JOG mode by pressing traversing keys. Simultaneous traversing of a geometry axis as a machine axis is not permitted either.
<b>Reaction:</b>	NC not ready. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Starting the geometry axis only if traversing of the other geometry axis or machine axis completed.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20065</b>	<b>[Channel %1: ] Master spindle not defined for geometry axes in JOG mode</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	The displayed axis is to be traversed as geometry axis in JOG mode with rotary feed, but no master spindle has been defined from which the actual speed could be derived.
<b>Reaction:</b>	Local alarm reaction. Interface signals are set. Alarm display.
<b>Remedy:</b>	If the revolutional feedrate is to be active in JOG mode too, then a master spindle must be declared in the channel-specific machine data MD20090 \$MC_SPIND_DEF_MASTER_SPIND. In this case, you have to open a screen in the PARAMETER operating area with the softkeys "SETTINGDATA" and "JOG DATA", and preselect the G function G95 there. The JOG feedrate can then be entered in [mm/rev]. (If 0 mm/rev is set as JOG feedrate, the control takes the value assigned in the axis-specific machine data MD32050 \$MA_JOG_REV_VELO or in the case of rapid traverse override MD32040 \$MA_JOG_REV_VELO_RAPID). The revolutional feedrate in JOG mode is deactivated by changing the G function from G95 to G94.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>20070</b>	<b>[Channel %1: ] Axis %2 software limit switch %3 programmed end position %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis number %3 = "1+" or "1-" for software limit switches 1, "2+" or "2-" for software limit switch 2, %4 = Programmed end position
<b>Definitions:</b>	The axis is to be traversed by the PLC as a concurrent positioning axis to the limit position. This would violate the corresponding software limit switch for the axis. No traversing takes place. With an additional message to alarm 20140, the axis is to be traversed as a command axis.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Specify smaller target position. Modify MD for SW limit switch. Possibly activate another SW limit switch. Retract axis via JOG.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

**20071 [Channel %1: ] Axis %2 working area limit %3 end position %4**

**Parameters:** %1 = Channel number  
 %2 = Axis number  
 %3 = "+" or "-"  
 %4 = Programmed end position

**Definitions:** The displayed axis is to be traversed as a "concurrent positioning axis" to the programmed limit position and the corresponding working area limitation active for the axis is violated. No traversing takes place. With an additional message to alarm 20140, the axis is traversed as a command axis.

**Reaction:** Alarm display.

**Remedy:**

- Specify smaller target position.
- Deactivate working area limitation.
- Set working area limitation differently.
- Retract axis with JOG.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**20072 [Channel %1: ] Axis %2 is not an indexing axis**

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** The displayed axis is operated as a concurrent positioning axis. Its target position is parameterized in the FC INDEX-AXIS as indexing position number, but the axis is not an indexing axis.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. The FC POS-AXIS for linear and rotary axes should be used or the axis should be declared as an indexing axis. Corresponding machine data for indexing axis declaration:  
 Modify MD30500 \$MA\_INDEX\_AX\_ASSIGN\_POS\_TAB  
 Modify MD10900 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_1  
 Modify MD10910 \$MN\_INDEX\_AX\_POS\_TAB\_1  
 Modify MD10920 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_2  
 Modify MD10930 \$MN\_INDEX\_AX\_POS\_TAB\_2

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**20073 [Channel %1: ] Axis %2 cannot be repositioned**

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** The concurrent positioning axis cannot be positioned because it has already been restarted via the VDI interface and is still active. No repositioning motion takes place and the motion initiated by the VDI interface is not affected.

**Reaction:** Alarm display.

**Remedy:** None.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**20074 [Channel %1: ] Axis %2 wrong index position**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** For a concurrent positioning axis declared as indexing axis, the PLC has given an index number that is not available in the table.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check the indexing axis number given by the PLC and correct this if necessary. If the indexing axis number is correct and the alarm results from an indexing position table that has been set too short, check the machine data for indexing axis declaration.  
 Modify MD30500 \$MA\_INDEX\_AX\_ASSIGN\_POS\_TAB  
 Modify MD10900 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_1  
 Modify MD10910 \$MN\_INDEX\_AX\_POS\_TAB\_1  
 Modify MD10920 \$MN\_INDEX\_AX\_LENGTH\_POS\_TAB\_2  
 Modify MD10930 \$MN\_INDEX\_AX\_POS\_TAB\_2

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

### 20075 [Channel %1: ] Axis %2 can currently not oscillate

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** The axis cannot perform an oscillating movement now because it is already being traversed, e.g. in JOG mode.

**Reaction:** Alarm display.

**Remedy:** End the other traversing motion.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### 20076 [Channel %1: ] Axis %2 oscillating - mode change not possible

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** The axis is performing an oscillating movement. Mode change is not possible because oscillation is not allowed in the selected mode.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Do not initiate mode change. Cause the PLC to check the axis and make sure in the PLC program that the axis ends oscillation if such mode changes take place.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 20077 [Channel %1: ] Axis %2 programmed position %4 is behind software limit switch %3

**Parameters:** %1 = Channel number  
 %2 = Axis number  
 %3 = "+" or "-"  
 %4 = Target position

**Definitions:** The axis is traversed as an oscillating axis and the target position (reversal position or end position) is located behind the corresponding software limit switch. The axis is not traversed.

**Reaction:** Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Specify smaller target position.  
 Modify MD for SW limit switch.  
 Possibly activate another SW limit switch.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20078 [Channel %1: ] Axis %2 programmed position %4 is behind working area limit %3**

**Parameters:** %1 = Channel number  
 %2 = Axis number  
 %3 = "+" or "-"  
 %4 = Target position

**Definitions:** The axis is traversed as an oscillating axis and the target position (reversal position or end position) is located behind the corresponding effective working area limitation. The axis is not traversed.

**Reaction:** Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Specify smaller target position.  
 Deactivate working area limitation.  
 Set working area limitation differentially.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20079 [Channel %1: ] Axis %2 oscillation path %3 <= 0**

**Parameters:** %1 = Channel number  
 %2 = Axis number  
 %3 = Length

**Definitions:** The axis is traversed as an oscillating axis and the distance to be traversed is smaller than or equal to zero. For example, both reversal points are situated on an identical position, one reversal point was shifted against the oscillating direction beyond the other reversal point. The axis is not traversed.

**Reaction:** Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Specify correct target position (reversal position, end position).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20080 [Channel %1: ] Axis %2 no handwheel assigned for override**

**Parameters:** %1 = Channel number  
 %2 = Axis number

**Definitions:** No handwheel has been assigned for this specified axis after handwheel overlay has been started in automatic mode. If the axis identifier is missing in the alarm with active velocity overlay  $FD > 0$ , then the 1st geometry axis has not been defined in the NC channel. In this case the block is executed without handwheel control.

**Reaction:** Alarm display.

**Remedy:** If handwheel control is required, a handwheel must be activated.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**20081 [Channel %1: ] Axis %2 braking position cannot be accepted as a new reversing position**

**Parameters:** %1 = Channel number  
 %2 = Axis number

---

<b>Definitions:</b>	On changing the reciprocation reversal from external sources, the braking position cannot be accepted as a new reversing position, since changing the reversal point via handwheel or JOG key is active.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Deselect VDI signal "Change reversal point" and reselect it either - with "Reciprocation reversal from external sources" or - by changing the reversal point by means of handwheel or - by changing the reversal point via JOG key.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>20082</b>	<b>[Channel %1: ] Axis %2 coordinate system-specific working area limit %3 end position %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = End position
<b>Definitions:</b>	The displayed axis is operated as a "concurrent positioning axis", and the corresponding active coordinate system-specific working area limitation for the axis is violated. No traversing movement. With an additional message to alarm 20140, the axis is traversed as a command axis.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	- Specify smaller target position. - Deactivate working area limitation. - Set working area limitation differently. - Retract axis with JOG.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>20083</b>	<b>[Channel %1: ] Axis %2 programmed position %4 lies behind the coordinate system-specific working area limit %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = End position
<b>Definitions:</b>	The axis is traversed as a reciprocating axis, and the target position (reversal position or end position) is located behind the corresponding, valid, coordinate system-specific working area limitation. The axis is not traversed.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Specify smaller target position. Deactivate working area limitation. Set working area limitation differentially.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20085</b>	<b>[Channel %1: ] Contour handwheel: traverse direction or overtravel of beginning of block not allowed</b>
<b>Parameters:</b>	%1 = Channel number

**Definitions:** Travel takes place on the path with the contour handwheel in the opposite direction to the programmed travel direction and the starting point of the path has been reached at the start of the block.

**Reaction:** Alarm display.

**Remedy:** Turn the contour handwheel in the opposite direction.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**20090 Axis %1 travel to fixed stop not possible. Check programming and axis data.**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** 1. The "Traverse against fixed stop" function has been programmed with FXS[AX]=1 but the axis does not (yet) support this. Check MD37000 \$MA\_FIXED\_STOP\_MODE. This function is not available for gantry axes and simulated axes.  
 2. On selection, no movement was programmed for axis AX. AX is a machine axis identifier.  
 3. It is always necessary to program a traversing movement in the selection block for the axis/spindle for which the "Traverse against fixed stop" function is activated.  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
 - Check the axis type.  
 - Check MD37000 \$MA\_FIXED\_STOP\_MODE.  
 - Is a machine axis movement missing in the approach block?

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**20091 Axis %1 has not reached fixed stop**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** On attempting to traverse against a fixed stop, the programmed end position has been reached or the traversing movement has been aborted. The alarm can be concealed by means of the MD37050 \$MA\_FIXED\_STOP\_ALARM\_MASK.  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** Correct the part program and the settings:  
 - Has the traversing block been aborted?  
 - If the axis position does not correspond to the programmed end position, then correct the end position.  
 - If the programmed end position is in the part, the triggering criterion must be checked.  
 - Has the contour deviation leading to triggering been dimensioned too large? Has the torque limit been set too high?

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**20092 Axis %1 travel to fixed stop still active****Parameters:** %1 = Axis name, spindle number**Definitions:** An attempt has been made to move an axis while it is in fixed stop or while the deselection function has not yet been completed.

The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.**Remedy:** Please inform the authorized personnel/service department.  
Check the following:

- Has the axis at the fixed stop also been moved by a traversing movement of geometry axes?
- Is a selection carried out even though the axis is stationary at the stop?
- Has the deselection process been interrupted by a RESET?
- Has the PLC switched the acknowledgement signals?

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**20093 Axis %1 standstill monitoring at fixed-stop end point has been triggered****Parameters:** %1 = Axis name, spindle number**Definitions:** The position of the axis has been beyond the zero speed window ever since selection has been completed.

The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.**Remedy:** Please inform the authorized personnel/service department.

- Check the mechanical components, e.g. has the stop broken away? Has the part to be clamped given way?
- Position window for zero speed control too small (MD37020 \$MA\_FIXED\_STOP\_WINDOW\_DEF) (SD43520 \$SA\_FIXED\_STOP\_WINDOW). Default is 1 mm in each case.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**20094 Axis %1 function has been aborted****Parameters:** %1 = Axis name, spindle number**Definitions:** The function has been aborted. The possible reasons for this are:

- Because a pulse disable has occurred, the torque can no longer be provided.
- The PLC has removed the acknowledgments.

The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Check whether  
 - there is a pulse disable from the infeed/regenerative-feedback unit or from the PLC?  
 - the acknowledgement bits have been deleted by the PLC even though NCK has not requested deselection?

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**20095 Axis %1 illegal torque, current torque %2**

**Parameters:** %1 = Axis name, spindle number  
 %2 = Current holding torque when brake test selected

**Definitions:** The current holding torque, when brake test selected, cannot be attained with the present parameterization of the brake test.

**Reaction:** Alarm display.

**Remedy:** Check the parameterization for the brake test function check:  
 - The torque for the counterweight in the drive machine data p1532 should be nearly the same as the current holding torque. The current holding torque is displayed in the alarm text.  
 - The torque set for the brake test MD36966 \$MA\_SAFE\_BRAKETEST\_TORQUE must be greater than the current holding torque.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**20096 Axis %1 brake test aborted, additional information %2**

**Parameters:** %1 = Axis name, spindle number  
 %2 = Error information based on \$VA\_FXS\_INFO

**Definitions:** The brake test has detected a problem. The additional info provides more detailed information on the cause of the alarm. The explanation can be found in the \$VA\_FXS\_INFO system variable documentation.  
 Additional information:  
 0: No additional information available.  
 1: Axis type is not a PLC or command axis.  
 2: End position reached, motion completed.  
 3: Cancel by NC RESET (key reset).  
 4: Moved out of monitoring window.  
 5: Torque reduction rejected by drive.  
 6: PLC has cancelled enables.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** Note the supplementary conditions of the brake test, see additional info.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**20097 Axis %1 incorrect travel direction brake test**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** Due to the selected travel direction, the brake test for the current load torque is performed with an incorrect torque.

**Reaction:** Alarm display.

**Remedy:**  
 - Perform the brake test for the other travel direction  
 - Adjust drive parameter p1532 better to the current weight ratio. The alarm will occur only if the current torque deviates from drive parameter p1532 by more than 7.5% of MD36966 \$MA\_SAFE\_BRAKETEST\_TORQUE when the brake is released.  
 - Activate the automatic determination of the load torque at the beginning of the brake test via MD36968 \$MA\_SAFE\_BRAKETEST\_CONTROL, bit 0 = 1.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>20100</b>	<b>[Channel %1: ] :Invalid configuration for digitizing</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	- The digitizing function expects the definition of 3 geometry axes in the channel. - At the available baud rate for a transmission of the actual positions and setpoint velocities between the NC and the digitizing device, the interpolation cycle must be set to a minimum of 5ms.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Please inform authorized personnel / the service department. - Define 3 geometry axes for the digitizing channel by means of machine data. - Use an interpolation cycle greater than 5ms.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>20101</b>	<b>Timeout during initialization of communication with the digitizer</b>
<b>Definitions:</b>	The attempt to synchronize the communications link to the digitizing unit and to transfer the machine parameters was aborted after the preset timeout limit of 15 seconds was exceeded.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the connection to the digitizing unit (RS422 cable, supply voltage) and whether the digitizing unit is switched on.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>20102</b>	<b>[Channel %1: ] No or invalid trafo at digitizing active</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	Prerequisite for the 3+2 axis digitizing is an active kinematic transformation. Permitted transformations are the general 5-axis transformation and the universal swivel head.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	- Before digitizing, activate a permitted transformation. - Select 3-axis mode for digitizing via machine data.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>20103</b>	<b>[Channel %1: ] Digitizing module does not support 3+2 axes digitizing</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	Prerequisite for 3+2 axis digitizing is that the NCU and the digitizing module both have the 3+2 axis mode.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	- SW update for the digitizing module. - Select 3-axis mode for the digitizing via machine data.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

**20105**                    **[Channel %1: ] Axes stopped by digitizer. Error code: %2**

**Parameters:**            %1 = Channel number  
                              %2 = Error code of digitizing unit

**Definitions:**            The digitizing unit has recognized an error in the communication and signaled this to the NC.

**Reaction:**                Channel not ready.  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm.

**Remedy:**                 Please inform the authorized personnel/service department. Error code 1: Check cable connection leading to the digitizing unit. Other error codes: See manual for digitizing unit.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20106**                    **The digitizer has triggered an emergency stop.**

**Definitions:**            The digitizing unit has recognized a serious error and triggered an emergency stop. Cause: See display on the digitizing unit.

**Reaction:**                Channel not ready.  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm.

**Remedy:**                 -

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20108**                    **Invalid data package received from the digitizer. Error codes %1, %2**

**Parameters:**            %1 = Error code of cyclic packet  
                              %2 = Error code of out-of-band packet

**Definitions:**            A data packet received by the digitizing unit could not be evaluated.

**Reaction:**                Channel not ready.  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm.

**Remedy:**                 Please inform the authorized personnel/service department. Error code: 0, 0: Check cable connection leading to the NC. Other error codes: e.g. wrong header, incorrect checksum (development documentation).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20109**                    **Error in communication with the digitizer: status code of com-circuit: %1**

**Parameters:**            %1 = Status byte

**Definitions:**            The circuit for serial communication with the digitizing unit signals a transmission error via its status byte (framing error, parity etc.).

**Reaction:**                Channel not ready.  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.  
                              NC Stop on alarm.

---

**Remedy:** Please inform the authorized personnel/service department. Check connection cable leading to the digitizing unit: In particular screening.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 20120 **Axis %1: too many compensation relations**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** Interpolatory compensation with tables. For each axis, the maximum number of compensation relationships defined may be no more than the number of axes in the system. In this alarm, the interpolatory compensation in the axis is switched off automatically.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Check table parameters \$AN\_CEC\_OUTPUT\_AXIS and correct and/or switch off one or more tables (SD41300 \$SN\_CEC\_TABLE\_ENABLE).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 20121 **Axis %1: Configuration error in compensation table %2**

**Parameters:** %1 = Axis name, spindle number  
%2 = Compensation table

**Definitions:** Interpolatory compensation with tables. The settings for the specified table are not allowed. \$AN\_CEC\_MAX >= \$AN\_CEC\_MIN and \$AN\_CEC\_STEP != 0 apply to system variables. This table is switched off automatically.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check and correct the characteristic data in the compensation table. If the error cannot be found, the alarm can be suppressed by switching off the table (\$SN\_CEC\_TABLE\_ENABLE) or switching off compensation in the axis (\$MA\_CEC\_ENABLE).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 20122 **Compensation table %1: invalid axis assignment**

**Parameters:** %1 = Compensation table

**Definitions:** Interpolatory compensation with tables. The input or output axes assignment in the given table is not allowed. \$AN\_CEC\_INPUT\_AXIS and \$AN\_CEC\_OUTPUT\_AXIS != 0 apply to system variables. This table is automatically switched off.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check and correct the axis assignment in the compensation table. If the error cannot be found, the alarm can be suppressed by switching off the table (\$SN\_CEC\_TABLE\_ENABLE) or switching off compensation in the axis (\$MA\_CEC\_ENABLE).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 20123 **Axis %1: different output assignment of multiplied tables**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** Interpolatory compensation with tables. The two tables whose outputs are to be multiplied together have different output axes assigned to them. The compensation in this axis is automatically switched off.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check and correct the characteristic data in the compensation table (\$AN\_CEC\_OUTPUT\_AXIS and \$AN\_CEC\_MULT\_BY\_TABLE).  
If the error cannot be found, the alarm can be suppressed by switching off the compensation in the axis (\$MA\_CEC\_ENABLE) or the tables, (\$SN\_CEC\_TABLE\_ENABLE).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20124 Axis %1: sum of compensation values too large**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The sum of the compensation values from all tables assigned to the axis had exceeded the limit value MD32720 \$MA\_CEC\_MAX\_SUM and had to be limited. Contour errors could have occurred as a result.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Check characteristic data of the compensation tables assigned to the axis.  
Check characteristic curves in the tables (\$AN\_CEC).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20125 Axis %1: change of compensation value is too rapid**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The compensation value has changed more rapidly than has been allowed for in MD32730 \$MA\_CEC\_MAX\_VELO. It had to be limited temporarily. The missing section is repeated later but contour errors might have occurred.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Check characteristic data of the compensation tables assigned to the axis.  
Check characteristic curves in the tables (\$AN\_CEC). Possibly one of the input axes has moved more rapidly than provided for.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**20130 [Channel %1: ] Contour tunnel monitoring**

**Parameters:** %1 = Channel number

**Definitions:** The tool tip has exited the tunnel placed around the desired contour, i.e. the distance between tool tip and desired contour was greater than specified in the MD21050 \$MC\_CONTOUR\_TUNNEL\_TOL.  
The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department. Check the following points in turn:  
 1. Is the machine in working order? That is, has the alarm been tripped by a sluggish axis, tool breakage or collision?  
 2. If the machine is in working order, reduce the velocity or improve the controller setting.  
 3. Possibly increase the size of the tunnel and monitor errors via analog output in order to ascertain the cause.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**20138 [Channel %1: ] Block %2 motion synchronous action %3 command axis %4 cannot be traversed**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name

**Definitions:** An NC alarm was detected for a command axis which is to be traversed from a synchronous action.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20139 [Channel %1: ] Block %2 motion synchronous action: %3 invalid marker**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID

**Definitions:** Setting or deleting of a marker in the motion-synchronous action is not possible.  
 Possible causes:  
 SETM(): Maximum number of markers exceeded; marker has already been set.  
 CLEARM(): Specified marker is not within permissible value range.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** SETM(): use marker in valid value range; do not set the marker again.  
 CLEARM(): use marker in valid value range.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20140 [Channel %1: ] Traversing of command axis %2 see NC alarm %3 parameter %4**

**Parameters:** %1 = Channel number  
 %2 = Axis  
 %3 = NC alarm  
 %4 = Additional parameter

**Definitions:** An NC alarm was detected for a command axis which is to be traversed from a synchronized action. The NC alarm is indicated by an MMC alarm number in the 3rd parameter. If there is any additional information, this will be provided in a 4th parameter.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** See help information for the additional alarms.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**20141 [Channel %1: ] Block %2 motion synchronous action: %3 axis %4 has illegal axis type**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name

**Definitions:** The requested command is not permissible in the current axis status for the command axis or spindle. This alarm occurs with command axes (POS, MOV), spindle commands from motion synchronous actions (M3/M4/M5, SPOS), coupled motion (TRAILON, TRAILOF) and lead value coupling (LEADON, LEADOF).

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** First stop the axis or deactivate the coupling, then select a new status.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**20142 [Channel %1: ] Block %2 motion synchronous action: %3: command axis %4: rotation of axis container already enabled**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name

**Definitions:** The synchronized action instruction is not allowed on a spindle enabled for the axis container rotation. The alarm only occurs if the spindle is handed to another NCU.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Initiate the synchronized action instruction before the axis container rotation enable or after the end of the rotation (depending on the application).  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**20143 [Channel %1: ] Block %2 motion synchronous action: %3 command axis %4 cannot be started as it is controlled by the PLC**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Axis name

**Definitions:** An attempt has been made to start a command axis by means of a block-related or modal synchronous action. This start is not possible as the axis is controlled by the PLC.

**Reaction:** Alarm display.

**Remedy:** End control of the axis by the PLC and therefore return it to the channel or start the command axis with a static synchronous action.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

<b>20144</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 system variable cannot be accessed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID
<b>Definitions:</b>	When using system variables, it is assumed that a read/write operation can access the required data successfully. In accesses to encoder actual values or digital I/Os, the result depends on the availability of the corresponding hardware components. If an access within synchronized actions does not return a valid value, alarm 20144 is output. Outside synchronized actions, such a read/write access causes block execution to be interrupted until the result is available. Block execution is subsequently continued.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Before reading/writing system variables, ensure that it is possible to access the required hardware components.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20145</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 arithmetic error</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID
<b>Definitions:</b>	In calculating an arithmetic expression for a motion synchronous action, an overflow has occurred (e.g. division by zero).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct error in expression.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20146</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 nesting depth exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID
<b>Definitions:</b>	For calculating arithmetic expressions in motion synchronous blocks, an operand stack with a fixed set size is used. With very complex expressions, this stack can overflow.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct error in expression.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**20147 [Channel %1: ] Block %2 motion synchronous action: %3 command %4 not executable**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Program command

**Definitions:** One of the commands for the synchronous action block cannot be executed, e.g. it is not possible to perform a Reset to the synchronous action.  
Measurement level 2  
- Embargo version does not allow measurement from a synchronized action  
- MEASA was programmed in a synchronized action  
- Measurement is already active  
- Programming error (see alarm 21701)

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change synchronous action.  
Measurement level 2  
Execute the measurement task from an NC program first, in order to improve the error diagnostics. Only include it in the synchronized action when the first error-free run has been performed.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20148 [Channel %1: ] Block %2 motion synchronous action: %3 internal error %4**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Error code

**Definitions:** An internal error has occurred during processing of a synchronous action. The error code is for diagnostics purposes. Please make a note and contact the manufacturer.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change synchronous action.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**20149 [Channel %1: ] Block %2 motion-synchronous action: %3 Index %4 is illegal**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID  
%4 = Index



---

<b>Definitions:</b>	An illegal index was used to access a variable in the motion-synchronous action. The illegal index is displayed. Example: ... DO \$R[\$AC_MARKER[1]] = 100 The error occurs if the value of marker 1 is greater than the maximum permissible R-parameter number. PROFIBUS/PROFINET I/O: An illegal slot / I/O area index was used while reading/writing data. Cause: 1.: Slot / I/O area index >= max. number of available slots / I/O areas. 2.: Slot / I/O area index references a slot / I/O area that has not been configured. 3.: Slot / I/O area index references a slot / I/O area that has not been released for system variables.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Use a valid index.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>20150</b>	<b>[Channel %1: ] Tool management: PLC terminates interrupted command</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	Indication that the PLC has terminated an interrupted command (with alarm output) from the tool management - tool change.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>20160</b>	<b>[Channel %1: ] Tool management: PLC can terminate only incorrectly aborted commands</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	Indication that the PLC wanted to interrupt an active command from the tool management (tool change); or that there is no command active for cancel. NCK refuses because the channel status is either 'active' (cancel is then not allowed), or 'reset' (then there is nothing to cancel).
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	For information only.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>20170</b>	<b>[Channel %1: ] Machine data \$AC_FIFO invalid</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	the structure of the FIFO variable \$AC_FIFO1 - \$AC_FIFO10 determined by machine data MD28260 \$MC_NUM_AC_FIFO, MD28262 \$MC_START_AC_FIFO, MD28264 \$MC_LEN_AC_FIFO, MD28266 \$MC_MODE_AC_FIFO cannot be stored in the R parameter field defined in MD28050 \$MC_MM_NUM_R_PARAM.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Increase the number of the R parameters or reduce the FIFO elements.  
 MD28050 \$MC\_MM\_NUM\_R\_PARAM = MD28262 \$MC\_START\_AC\_FIFO + MD28260 \$MC\_NUM\_AC\_FIFO \* (MD28264 \$MC\_LEN\_AC\_FIFO + 6)

**Program Continuation:** Switch control OFF - ON.

**20200 [Channel %1: ] Invalid spindle number %2 with tool fine compensation**

**Parameters:** %1 = Channel number target channel  
 %2 = Spindle number

**Definitions:** There is no spindle/axis assignment in the target channel for the spindle specified in the PUTFTOC command.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify program in channel that writes the tool fine compensation.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20201 [Channel %1: ] Spindle %2 no tool assigned**

**Parameters:** %1 = Channel number  
 %2 = Spindle number

**Definitions:** In order to make allowance for the fine tool compensation for the tool currently in the spindle, a spindle/tool assignment must be active. This is not presently the case for the programmed spindle in the target channel of fine tool compensation.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** 1. Modify the part program (write the tool fine compensation).  
 2. Establish spindle/tool assignment by programming:  
 - TMON (tool monitoring)  
 - GWPSON (tool selection)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**20203 [Channel %1: ] No active tool**

**Parameters:** %1 = Channel number

**Definitions:** A tool fine compensation has been written for the active tool of channel %1 with PUTFTOC. No tool is active in this channel. Therefore, the compensation cannot be assigned.

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Correct the program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>20204</b>	<b>[Channel %1: ] PUTFTOC command not allowed with FTOCOF</b>
<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	A tool fine compensation has been written for channel %1 with PUTFTOC. The tool fine compensation is not active in this channel. FTOCON must be active in the target channel of the PUTFTOC command.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct the program in the machining channel: Select FTOCON so that the channel is ready to receive the PUTFTOC command.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20205</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 invalid spindle number %4</b>
<b>Parameters:</b>	%1 = Channel number target channel %2 = Block number, line number %3 = Synact ID %4 = Spindle number
<b>Definitions:</b>	There is no spindle/axis assignment in the target channel for the specified spindle.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify program.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>20210</b>	<b>[Channel %1: ] Block %3 spindle %2 wrong values for centerless grinding</b>
<b>Parameters:</b>	%1 = Channel number %2 = Spindle number %3 = Block number, label
<b>Definitions:</b>	It was not possible to calculate a tool diameter (no speed specified for the spindle) for centerless grinding because it was not allowed by the input positions. The old S value still applies.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	- Modify program - Select new traversing positions for centerless axes - or suppress computation by G00.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>20211</b>	<b>[Channel %1: ] Block %3 spindle %2 support point beyond range limits</b>
<b>Parameters:</b>	%1 = Channel number %2 = Spindle number %3 = Block number, label

**Definitions:** The support point calculated for centerless grinding is beyond the range limits.  
 Machine data:  
 Modify MD21518 \$MC\_TRACLG\_CONTACT\_UPPER\_LIMIT  
 Modify MD21520 \$MC\_TRACLG\_CONTACT\_LOWER\_LIMIT

**Reaction:** Alarm display.

**Remedy:**

- Check centerless axis positions and machine data.
- Modify program.
- Select new traversing positions for centerless axes
- or suppress computation by G00.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**20300 [Channel %1: ] Axis %2 orientation not possible**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** On traversing the displayed (virtual) orientation axis, a tool orientation is to be set for which the kinematics of this machine are not possible.

**Reaction:** Alarm display.

**Remedy:** Cancel the JOG movement and specify another (possible) change of orientation.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**21550 [Channel %1: ] Axis %2 Travel from hardware limit switch not possible. Reason: %3**

**Parameters:** %1 = Channel number  
 %2 = Axis name  
 %3 = Cause

**Definitions:** It has been tried to retract a following axis of an axis coupling or an output axis of a transformation through the master axis or input axis of a transformation. This is not permitted in the current situation.  
 Possible reasons:

- 1 No permissible direction of retraction
- 2 Coupling not synchronous
- 3 Retraction not permitted for the active coupling
- 4 Reserved
- 5 Retraction not permitted for the active transformation

**Reaction:** NC Start disable in this channel.  
 Alarm display.

**Remedy:** Remedy for error cause:

- 1 Define another travel direction
- 2 Deactivate the coupling and travel the axis/axes separately
- 3 Deactivate the coupling and travel the axis/axes separately
- 4 Reserved
- 5 Deactivate the transformation and travel the axis/axes separately

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**21610 [Channel %1: ] Axis %2 encoder %3 frequency exceeded**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = String (encoder number)

---

<b>Definitions:</b>	The maximum permissible frequency of the currently active encoder (axis-specific interface signal DB31, ... DBX1.5 / 1.6 (position measuring system 1/2)) in the axis-specific MD36300 \$MA_ENC_FREQ_LIMIT [n] (n ... encoder number, 1 or 2) has been exceeded. The reference of the actual value to the mechanical slide position may have been lost. The alarm can be reprogrammed in MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Check MD36300 \$MA_ENC_FREQ_LIMIT [n] and NC/PLC interface signal DB31, ... DBX1.5 / 1.6 (position measuring system 1/2).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

## 21612 [Channel %1: ] Axis %2: enable reset, cause %3

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Cause of the alarm
<b>Definitions:</b>	Causes of alarm: 0: The cause of the alarm cannot be precisely determined. 1: The interface signal DB31, ... DBX2.1 (Servo enable) is missing 2: The interface signal DB31, ... DBX21.7 (Pulse enable) is missing 3: Drive signal DB31, ... DBX93.7 (Impulses enabled) is not set 4: Drive signal DB31, ... DBX93.5 (Drive ready) is not set One of the motion-enabling signals (e.g. "Servo enable", "Pulse enable", parking/encoder selection (only for axes) or drive-specific enables (such as terminal 663 with SIMODRIVE 611D) has been reset for the displayed axis. The alarm can be reported with positioning axes, spindles and for axes from the geometry grouping. The axes entered in the channel-specific MD array MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB are regarded as axes belonging to the geometry grouping. Servo enable must exist for all available geometry axes, regardless of whether or not they are currently in motion. Occurs in connection with SAFETY function: If a test stop is performed with linked axes, the alarm is issued if a motion command from the ELG grouping is pending during the test stop of the slave axis.
<b>Reaction:</b>	The NC switches to follow-up mode. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check the interface signals DB31, ... DBX2.1 (Servo enable), DB31, ... DBX21.7 (Pulse enable), check the drive signals DB31, ... DBX93.7 (Pulses enabled), DB31, ... DBX93.5 (Drive ready) for example with the PLC status display in the DIAGNOSTICS operating area. Check the encoder selection (for axes) as well as other signals enabling motion (such as SIMODRIVE 611D terminal 663 etc.) according to the drive type used. When the terminal enables of the drive have failed, trace back the wiring or hardware function (for example relay function) or proceed as stated in the relevant drive documentation. With SAFETY: With active actual-value linkage, output of the error message on the slave axis can be prevented by increasing MD36060 \$MA_STANDSTILL_VELO_TOL (default value is 5 mm).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

## 21613 Axis %1 measuring system changing

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The measuring system for this axis is changing.
<b>Reaction:</b>	Alarm display.

**Remedy:** -  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

---

**21614 [Channel %1: ] Axis %2 hardware limit switch %3**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = String (+, - or +/-)

**Definitions:** The signal DB31, ... DBX12.1 / 12.0 (Hardware limit switch plus/minus) has been set at the NC/PLC interface.

**Reaction:** NC Start disable in this channel.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
 1. With axes that have already been referenced, the software limit switch 1 or 2 should respond before the hardware limit switch is reached. Check MD36110 \$MA\_POS\_LIMIT\_PLUS, MD36100 \$MA\_POS\_LIMIT\_MINUS, MD36130 \$MA\_POS\_LIMIT\_PLUS2 and MD36120 \$MA\_POS\_LIMIT\_MINUS2 and the NC/PLC interface signal for the selection DB31, ... DBX12.3 / 12.2 (1st/2nd software limit switch plus/minus) and correct, if necessary (PLC user program).  
 2. If the axis has not yet been referenced, it is possible to depart from the hardware limit switch in the opposite direction in JOG mode.  
 3. Check the PLC user program and the connection from the switch to the PLC input module, provided the axis has not reached the hardware limit switch at all.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**21615 [Channel %1: ] Axis %2 taken from traverse mode to follow-up mode**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** This axis has been taken from traverse mode and put into "Follow-up" mode, for instance because the pulse enable for the drive has been reset.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** -

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**21616 [Channel %1: ] Block %2 overlaid motion active at transformation switchover**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** The overlaid motion in the BCS changes its significance because of the transformation change and can therefore lead to undesired axis movements.

**Reaction:** Local alarm reaction.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Take out the overlaid movement.

**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**21617 [Channel %1: ] Block %2 transformation does not allow to traverse the pole**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The preset curve passes through the pole or a forbidden area of the transformation.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify the part program (if the alarm has occurred in AUTO mode). To escape from the alarm position, transformation must be deselected (it is not enough to try a RESET if the transformation remains active when RESET is applied).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**21618 [Channel %1: ] As from block %2 transformation active: overlaid motion too great**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The share of overlaid motion on the transformation-related axes is so high that the path movement planned by the preparation no longer sufficiently corresponds to the actual ratio for the interpolation. Strategy of singularities, monitoring of working range limitation and dynamic Look Ahead are possibly no longer correct.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	With overlaid motion it is necessary to keep a sufficiently large path safety distance with regard to poles and working range limitations.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

**21619 [Channel %1: ] Block %2 transformation active: motion not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The machine kinematics does not allow the specified motion. Transformation-dependent error causes can be in: TRANSMIT: A (circular) area exists around the pole, where positioning is not possible. The area is caused by the fact that the tool reference point cannot be traversed as far as into the pole. The area is defined by: - the machine data (MD249.. \$MC_TRANSMIT_BASE_TOOL...) - the active tool length compensation (see \$TC_DP..). Whether the tool length compensation is included in the calculation depends on the working plane selected (see G17,..). The machine stops at the edge of the area where positioning is not possible.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Modify part program. Change the incorrectly specified tool length compensation. Note: RESET alone is not enough if transformation also remains active during RESET.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**21620 [Channel %1: ] Axis %2 Emergency braking ramp activated**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The axial emergency braking ramp has been activated for the specified axis/spindle  
The following causes are possible for activation of the emergency braking ramp:  
Alarm 26052: Path velocity for auxiliary function output too high  
Alarm 1012 : System error with ID 550006  
Alarm 1016 : System error with ID 550003, 550005 and 550010  
Context-sensitive braking request with priority 13 is active

**Reaction:** NC Start disable in this channel.  
Local alarm reaction.  
The NC switches to follow-up mode.  
Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Remove or reset the cause of the alarm.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**21650 [Channel %1: ] Axis %2 overlaid motion not allowed**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** An overlaid motion was requested for the axis, however, this is not allowed due to the MD32074  
\$MA\_FRAME\_OR\_CORRPOS\_NOTALLOWED.

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Deselect the overlaid motion or change MD32074  
\$MA\_FRAME\_OR\_CORRPOS\_NOTALLOWED.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**21660 [Channel %1: ] Block %2 axis %3 conflict between SYNACT: \$AA\_OFF and CORROF**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name

**Definitions:** When deselecting the position offset (\$AA\_OFF) via the part program command CORROF (<axis>, "AA\_OFF") an active synchronized action is detected that immediately sets \$AA\_OFF for the axis (DO\_\$AA\_OFF [<axis>] =<value>). Deselection is executed and \$AA\_OFF not set again.

**Reaction:** Correction block is reorganized.  
Local alarm reaction.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm at block end.

**Remedy:** Modify part program.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

**21665 [Channel %1: ] \$AA\_TOFF cleared**

<b>Parameters:</b>	%1 = Channel number
<b>Definitions:</b>	If the tool position is changed with RESET and \$AA_TOFF is active during RESET, the position offset (\$AA_TOFF) is cleared.
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Modify the RESET setting in \$AA_TOFF_MODE.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**21670 [Channel %1: ] Block %2 illegal change of tool direction with \$AA\_TOFF active**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	If an offset has been activated in tool direction by means of \$AA_TOFF[i], no block is allowed to be activated in which the offset axis assignment i is modified (plane change, tool change cutting tool <=> turning tool, transformation change, TRAFOOF, TCARR=0, geometry axis exchange)
<b>Reaction:</b>	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	- Modify part program - Program TOFFOF()
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**21700 [Channel %1: ] Block %3 axis %2 touch probe already deflected, edge polarity not possible**

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Block number
<b>Definitions:</b>	The probe programmed under the keyword MEAS or MEAW is already deflected and has switched. For a further measuring operation, the probe signal must first be canceled (quiescent state of the probe). The axis display is of no significance at the present time but an axis-specific evaluation has been planned for later stages of development.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Verify the starting position of the measuring operation or check the probe signals in the PLC interface DB10 DBX107.0 / 107.1 (Probe actuated key 1/key 2). Are the cables and connectors in good order?
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**21701 [Channel %1: ] Block %3 axis %2 measurement not possible**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number

**Definitions:** Measurement level 2 (MEASA, MEAWA, MEAC).  
 There is an error in the programmed measurement task.  
 Possible causes:  
 - Invalid measurement mode  
 - Invalid probe  
 - Invalid encoder  
 - Invalid number of measurement signal edges  
 - Identical measurement signal edges are only programmable in mode 2  
 - Invalid FIFO number  
 - Mismatch between the number of FIFOs programmed and the number of probes used in the measurement task.  
 Further causes:  
 A measurement task is already active (e.g. from a synchronized action).

**Reaction:** Local alarm reaction.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Correct the measurement tasks.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**21702 [Channel %1: ] Block %3 axis %2 measurement aborted**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number

**Definitions:** The measurement block has ended (the programmed end position of the axis has been reached) but the activated touch probe has not yet responded.  
 Measurement level 2 (MEAWA, MEASA, MEAC)  
 Measured values cannot be converted to the workpiece coordinate system. The measured values of the GEO axes programmed in the measurement task are only available in the machine coordinate system.  
 Causes:  
 Not all GEO axes were programmed in the measurement task. At least one measured value is therefore missing for conversion back into the workpiece coordinate system.  
 Further causes:  
 The measurement tasks programmed for all GEO axis are not identical.

**Reaction:** Alarm display.

**Remedy:** Verify the traversing movement in the measurements block.  
 - Is it necessary in all cases for the activated probe to have switched up to the specified axis position?  
 - Are the probe, cable, cable distributor, terminal connections in good order?  
 Either program all GEO axes explicitly or program the traversing movement with the POS[axis] command.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**21703 [Channel %1: ] Block %3 axis %2 touch probe not deflected, illegal edge polarity**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number

---

<b>Definitions:</b>	The selected probe is not (!) deflected and therefore cannot record any measured value from the deflected to the non-deflected state. Measurement level 2 (MEAWA, MEASA, MEAC) The degree of deflection of the probe at the start of the measurement task is identical to the first programmed measurement signal edge. The test is only performed in mode 2.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	- Check probe - Check start positioning for measuring - Check program
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 21740 Output value at analog output no. %1 has been limited

<b>Parameters:</b>	%1 = No. of output
<b>Definitions:</b>	The value range of the analog output n is limited by MD10330 \$MN_FASTIO_ANA_OUTPUT_WEIGHT[n].
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	With \$A_OUTA[.] = x no greater values can be programmed than permitted in the respective machine data.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 21750 Error during output of cam switching signals via timer

<b>Definitions:</b>	The signal output activated by the MD10480 \$MN_SW_CAM_TIMER_FASTOUT_MASK via the hardware timer (independent of the clock grid) did not work. Cause: interpolation cycle is greater than 15 ms. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Shorten interpolation cycle (if at all possible).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 21751 Limit velocity %2 deg/min on modulo axis %1 has been exceeded (incorrect cam output)

<b>Parameters:</b>	%1 = Axis, spindle %2 = Limit velocity
<b>Definitions:</b>	Reliable cam output on the modulo axis can no longer be assured. This is because: The velocity of the axis exceeds the permissible velocity range Reliable calculation of the cam output on the modulo axis can only be assured below the limit speed
<b>Reaction:</b>	Alarm display.

**Remedy:** - Reduce the traversing speed of the axis  
- Alarm can be suppressed with SUPPRESS\_ALARM\_MASK\_2 bit 15

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**21752 Axis %1 minimum cam width cam %3 undershot at curr. velocity %2**

**Parameters:** %1 = Axis, spindle  
%2 = Limit velocity  
%3 = Cam number

**Definitions:** The width of the cam signal undershoots the time  $t=50\mu s$  and as a result can no longer be output. This is because:  
The cam signal width of  $t=50\mu s$  must not be undershot.  
A configured cam width and reliable time results in a limit velocity for the cam ( $v=s/t$ ). If the limit velocity is exceeded, cam signals will be lost.

**Reaction:** Alarm display.

**Remedy:** - Reduce the traversing speed of the axis  
- Increase the cam width  
- Alarm can be suppressed with SUPPRESS\_ALARM\_MASK\_2 bit 15

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**21760 [Channel %1: ] Block %2 motion synchronous action: %3 too many auxiliary functions programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, line number  
%3 = Synact ID

**Definitions:** The number of programmed auxiliary functions has exceeded the maximum permissible amount. This alarm can occur in conjunction with motion synchronous actions: The maximum number of auxiliary functions must not be exceeded in motion block and motion synchronous actions.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**21800 [Channel %1: ] Workpiece setpoint %2 reached**

**Parameters:** %1 = Channel number  
%2 = Workpiece setpoint

---

<b>Definitions:</b>	This alarm is activated via MD27880 \$MC_PART_COUNTER, bit 1: The number of counted workpieces (\$AC_ACTUAL_PARTS or \$AC_SPECIAL_PARTS) is equal or already greater than the programmed value for the number of required workpieces (\$AC_REQUIRED_PARTS). At the same time, the channel VDI signal "Workpiece setpoint reached" is output. The value for the number of counted workpieces (\$AC_ACTUAL_PARTS) is reset, while the value of \$AC_SPECIAL_PARTS is retained. Note: The setpoint/actual comparisons of the workpieces are only made after an NC start under the condition that \$AC_REQUIRED_PARTS > 0. If \$AC_REQUIRED_PARTS has a negative value, all workpiece counts activated through MD27880 \$MC_PART_COUNTER are frozen at the values they have reached, and the nominal/actual comparison is discontinued.
<b>Reaction:</b>	NC not ready. Interface signals are set. Alarm display.
<b>Remedy:</b>	No program interrupt. Delete alarm display.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

## 22000 [Channel %1: ] Block %2 Spindle %3 Gear stage change in %4 not possible

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Gear stage
<b>Definitions:</b>	A gear stage change for the spindle will not be possible, if: <ul style="list-style-type: none"> <li>- thread cutting (G33, G34, G35) is active</li> <li>- the spindle is active as master or slave spindle in a coupling</li> <li>- the spindle is being positioned</li> </ul>
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. NC Stop on alarm. Interface signals are set. Alarm display.
<b>Remedy:</b>	The gear stage is to be set prior to the corresponding machining step. If it is necessary, however, to change the gear stage within one of the above mentioned functions, this function must be switched off for the time of the gear stage change. Thread cutting is deselected with G1; synchronous spindle coupling is switched off with COUPOF; the spindle positioning operation is exited with M3, M4 or M5.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 22001 [Channel %1: ] Block %2 Axis %3: Brake ramp longer than Stop D time. Reason: %4.

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Identification of cause
<b>Definitions:</b>	The current axis dynamic response is not sufficient to come to a standstill on time when a Stop D is triggered. The reasons specified in parameter 4 are: <ol style="list-style-type: none"> <li>1. \$MA_MAX_AX_ACCEL too small</li> <li>2. \$MA_MAX_AX_JERK too small</li> <li>3. Excessive acceleration reduction programmed with ACC</li> <li>4. Excessive jerk reduction programmed with JERKLIMA</li> </ol>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Increase SAFE_STOP_SWITCH_TIME_D. Increase MAX_AX_ACCEL and MAX_AX_JERK. Increase programmed acceleration (ACC) or jerk (JERKLIMA). Alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 13.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22002 [Channel %1: ] Spindle %2: Brake ramp longer than Stop D time with reduction stage %3. Reason %4**

**Parameters:** %1 = Channel number  
 %2 = Spindle number  
 %3 = Gear stage  
 %4 = Reason

**Definitions:** The dynamic response values configured for the spindle are not sufficient to come to a standstill on time when a Stop D is triggered. Parameter 3 contains the gear stage whose braking time from the configured dynamic response values overshoots the Stop D time the most. Parameter 4 contains a code identifying the corresponding MD:  
 10: Dynamic response for speed control: MD35130 \$MA\_GEAR\_STEP\_MAX\_VELO\_LIMIT, MD35200 \$MA\_GEAR\_STEP\_SPEEDCTRL\_ACCEL  
 11: Dynamic response for position control: MD35135 \$MA\_GEAR\_STEP\_PC\_MAX\_VELO\_LIMIT, MD35210 GEAR\_STEP\_POSCTRL\_ACCEL  
 21: Dynamic response for tapping with G331, G332: MD35135 \$MA\_GEAR\_STEP\_PC\_MAX\_VELO\_LIMIT, MD35212 GEAR\_STEP\_POSCTRL\_ACCEL2

**Reaction:** Alarm display.

**Remedy:** Increase MD36953 SAFE\_STOP\_SWITCH\_TIME\_D or reduce the braking time by changing the spindle's dynamic response configuration. The alarm can be suppressed with MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 13.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22005 [Channel %1: ] Block %2 motion synchronous action %3 spindle %4 selected gear stage not installed**

**Parameters:** %1 = Channel number  
 %2 = Block number, line number  
 %3 = Synact ID  
 %4 = Spindle number

**Definitions:** The first gear stage data block is active. The required gear stage is not installed in the 1st gear stage data block. The number of installed gear stages is configured in MD35090 \$MA\_NUM\_GEAR\_STEPS.  
 Examples for the occurrence of the alarm with 3 gear stages installed (MD35090 \$MA\_NUM\_GEAR\_STEPS = 3):  
 \* ...DO M44 or DO 45 was programmed in synchronized action for the spindle concerned.  
 \* ...DO M70 was programmed and MD35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE was larger than 3.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program: Only those valid gear stages can be entered which have also been installed according to MD35090 \$MA\_NUM\_GEAR\_STEPS.  
 Limit M70 configuration (MD 35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE) to MD35090 \$MA\_NUM\_GEAR\_STEPS.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22010 [Channel %1: ] Block %3 spindle %2 actual gear stage differs from requested gear stage**

**Parameters:** %1 = Channel number  
 %2 = Spindle number  
 %3 = Block number, label

---

<b>Definitions:</b>	The requested gear stage change has been concluded. The actual gear stage reported by the PLC as being engaged is not the same as the required gear stage called for by the NC. Note: Wherever possible, the requested gear stage should always be engaged.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Correct the PLC program.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

### 22011 [Channel %1: ] Block %3 spindle %2 change to programmed gear stage not possible

<b>Parameters:</b>	%1 = Channel number %2 = Spindle number %3 = Block number, label
<b>Definitions:</b>	With the 'DryRun', 'ProgramTest' and 'SearchRunByProgTest' functions deselected, it is not possible in the Repos module to carry out a gear stage change to a previously programmed gear stage. This is the case, if the spindle is in the deselection block not active in speed control mode, as a slave axis or in a transformation. Execution of a gear stage change is avoided if the above mentioned functions are deselected by resetting bit 2 of MD35035 \$MA_SPIND_FUNCTION_MASK.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Change deselection block or block search target block to speed control mode (M3, M4, M5, SBCOF). Set bit 2 of MD35035 \$MA_SPIND_FUNCTION_MASK to 0.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

### 22012 [Channel %1: ] Block %2 leading spindle %3 is in simulation.

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Leading spindle number
<b>Definitions:</b>	When coupling, no synchronism can be achieved if the lead spindle/axis is in simulation mode and the following spindle/axis is not.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Switch the following spindle/axis to simulation mode or do not simulate the lead spindle/axis (MD30130\$MA_CTRL_OUT_TYPE). If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 3 = 1.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

### 22013 [Channel %1: ] Block %2 dependent spindle %3 is in simulation.

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of following spindle
<b>Definitions:</b>	When coupling, no synchronism can be achieved if the following spindle/axis is in simulation mode and the lead spindle/axis is not.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Switch the leading spindle/axis to simulation mode or do not simulate the following spindle/axis (MD30130 \$MA_CTRL_OUT_TYPE). If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 4 = 1.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

**22014 [Channel %1: ] Block %2. The dynamics of leading spindle %3 and dependent spindle %4 is too variably**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Leading spindle number  
 %4 = Number of following spindle

**Definitions:** If the spindles / axes differ strongly in their dynamic behavior during coupling, synchronism cannot be achieved. The dynamics are dependent on many settings: default feedforward control, parameter block data, first of all the servo gain factor, symmetrizing time, etc., feedforward control mode and feedforward setting parameter, FIPO mode, jerk filter and dynamic filter settings, DSC on/off. Among these are the following machine data: MD32620 \$MA\_FFW\_MODE, MD32610 \$MA\_VELO\_FFW\_WEIGHT, MD33000 \$MA\_FIPO\_TYPE, VEL\_FFW\_TIME, MD32810 \$MA\_EQUIV\_SPEEDCTRL\_TIME, MD32200 \$MA\_POSCTRL\_GAIN, MD32410 \$MA\_AX\_JERK\_TIME, MD32644 \$MA\_STIFFNESS\_DELAY\_TIME, MD37600 \$MA\_PROFIBUS\_ACTVAL\_LEAD\_TIME, MD37602 \$MA\_PROFIBUS\_OUTVAL\_DELAY\_TIME, MD10082 \$MN\_CTRLLOUT\_LEAD\_TIME

**Reaction:** Alarm display.

**Remedy:** Use spindles/axes with identical dynamic responses. If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 5 = 1.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22015 [Channel %1: ] Block %2 following spindle %3 No dynamic response for supplementary motion**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of following spindle

**Definitions:** The differential motion of the following spindle cannot be executed due to a lack of available velocity. The coupling consumes the entire available dynamic response. The following spindle is already rotating at maximum speed. In the part program a deadlock might occur. The alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit 26 = 1 or with CP programming by setting CPMALARM[FAx] bit 6 = 1.

**Reaction:** Alarm display.

**Remedy:** Reduce the speed of the master spindle

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22016 [Channel %1: ] Block %2 following spindle %3 in the range of reduced acceleration capability**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of following spindle

**Definitions:** The following spindle is driven with position control. Additional motion components of the following spindle should not leave the linear range of the motor used. If they do, deviations may occur in the contour and servo alarms could even be output. Monitoring is based on the configuration in MD35220 \$MA\_ACCEL\_REDUCTION\_SPEED\_POINT. If the situation is being managed by the user, the alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK bit 25 = 1 or with CP programming by setting CPMALARM[FAx] bit 7 = 1.

**Reaction:** Alarm display.

**Remedy:** Use coupling type VV and safeguard SPCOF for master and following spindle.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>22018</b>	<b>[Channel %1: ] Block %2 following axis/spindle %3 time monitoring: 'Synchronism fine' not reached</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Following axis/spindle number
<b>Definitions:</b>	After reaching the setpoint-side synchronism, the time until reaching the actual value-side synchronism is fine monitored. The tolerance is not reached within the time window defined in MD37240 \$MA_COUP_SYNC_DELAY_TIME[0]: MD37210 \$MA_COUPLE_POS_TOL_FINE and MD37230 \$MA_COUPLE_VELO_TOL_FINE
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The interrelation between MD37240 \$MA_COUP_SYNC_DELAY_TIME[0] and MD37210 \$MA_COUPLE_POS_TOL_FINE or MD37230 \$MA_COUPLE_VELO_TOL_FINE must be adapted to the mechanical conditions.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>22019</b>	<b>[Channel %1: ] Block %2 following axis/spindle %3 time monitoring: 'Synchronism coarse' not reached</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Following axis/spindle number
<b>Definitions:</b>	After reaching the setpoint-side synchronism, the time until reaching the actual value-side synchronism is coarsely monitored. The tolerance is not reached within the time window defined in MD37240 \$MA_COUP_SYNC_DELAY_TIME[0]: MD37200 \$MA_COUPLE_POS_TOL_COARSE or MD37220 \$MA_COUPLE_VELO_TOL_COARSE
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The interrelation between MD37240 \$MA_COUP_SYNC_DELAY_TIME[1] and MD37200 \$MA_COUPLE_POS_TOL_COARSE or MD37220 \$MA_COUPLE_VELO_TOL_COARSE must be adapted to the mechanical conditions.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>22020</b>	<b>[Channel %1: ] Block %3 spindle %2 gear step change position not reached</b>
<b>Parameters:</b>	%1 = Channel number %2 = Spindle number %3 = Block number, label
<b>Definitions:</b>	Through the configuration of MD35010 \$MA_GEAR_STEP_CHANGE_ENABLE[AXn] = 2, the spindle is traversed to the position stored in MD35012 \$MA_GEAR_STEP_CHANGE_POSITION[AXn] before the actual gear step change. The required gear step change position has not been reached.
<b>Reaction:</b>	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct sequence in the PLC.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

**22022 [Channel %1: ] Block %2 spindle %3 gear stage %4 is expected for axis mode.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle  
 %4 = Gear stage

**Definitions:** The gear stage required for axis mode has not been installed.  
 A gear stage has been configured in MD35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE, in which the spindle is to be in axis mode. This gear stage is checked whenever the spindle is switched into axis mode. The configured gear stage is compared with the gear stage output by the PLC (NC/PLC interface signal DB31, ... DBX16.0. - .2 (Actual gear stage A through C)).  
 This alarm will be output if the gear stages are not the same.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** Program M70 before the switch to axis mode. The gear stage configured in MD35014 \$MA\_GEAR\_STEP\_USED\_IN\_AXISMODE is then automatically loaded.  
 No gear stage change is required if the configured gear stage is already active. M40 remains active beyond the gear stage change.  
 Consider MD20094 \$MC\_SPIND\_RIGID\_TAPPING\_M\_NR.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22024 [Channel %1: ] Block %2 Spindle %3 tapping: PLC signal 'invert M3/M4' changed after %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Spindle  
 %4 = Value

**Definitions:** When loading a G331 block it was detected that the NC/PLC interface signal DB31, ... DBX17.6 (invert M3/M4) had changed during part program execution. An alarm was output to prevent a tool break. The current value of the NC/PLC interface signal is displayed as parameter 4.

**Reaction:** Channel not ready.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** A change in the NC/PLC interface signal DB31, ... DBX17.6 (invert M3/M4) during part program execution should be avoided.  
 If MD35035 SPIND\_FUNCTION\_MASK bit 22 is set, the NC/PLC interface signal DB31, ... DBX17.6 (invert M3/M4) is then no longer evaluated during tapping with G331, G332. The alarm is no longer output. Notice! Setting bit 22 means a change in function.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**22025 [Channel %1: ] Block %2 Following axis/spindle %3 synchronism (2): Fine tolerance overshoot**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Following axis/spindle number

**Definitions:** Synchronism is monitored once the 'FINE' block-change criterion has been met. The 'fine' threshold value defined with MD37212 \$MA\_COUPLE\_POS\_TOL\_FINE\_2 has been exceeded by the synchronism difference on the actual value side. The alarm can be suppressed with MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 12 = 1 or with CP programming by setting CPMALARM[FAx] bit 8 = 1.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
The following axis/spindle was not able to follow the leading axis(axis)/spindle(s).

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22026 [Channel %1: ] Block %2 Following axis/spindle %3 synchronism(2): Coarse tolerance overshoot**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Following axis/spindle number

**Definitions:** Synchronism is monitored once the 'COARSE' block-change criterion has been met. The 'coarse' threshold value defined with MMD37202 \$MA\_COUPLE\_POS\_TOL\_COARSE\_2 has been exceeded by the synchronism difference on the actual value side. The alarm can be suppressed with MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 12 = 1 or with CP programming by setting CPMALARM[FAx] bit 9 = 1.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department.  
The following axis/spindle was not able to follow the leading axis(axis)/spindle(s).

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22030 [Channel %1: ] Block %2 following spindle %3 Impermissible programming**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Spindle

**Definitions:** With synchronous spindle-VV-coupling an additional motion for the following spindle can only be programmed with M3, M4, M5 and S... The paths created by specified positions cannot be maintained safely for a velocity coupling, especially if a position control is missing. If dimensional accuracy or reproducibility are not important, the alarm can be suppressed with MD11410 \$MN\_SUPPRESS\_ALARM\_MASK Bit27 = 1.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Use synchronous spindle-DV-coupling or program direction of rotation and speed.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**22033 [Channel %1: ] Block %2 Axis/spindle %3 'Correct synchronism' diagnostics %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis/spindle number  
%4 = Diagnostics

**Definitions:** The following situation occurred during 'Correct synchronism':

- Diagnosis 1: An existing override motion is terminated on key reset.
- Diagnosis 2: The override motion has been deleted.
- Diagnosis 3: Writing of override value not allowed. Synchronism override is deleted.
- Diagnosis 4: Override motion is stopped temporarily (e.g. G74 reference point approach)
- Diagnosis 5: Delay of override motion: acceleration capacity used up by other motions.
- Diagnosis 6: Delay of override motion: velocity used up by other motions.
- Diagnosis 7: Delay of override motion: the maximum speed is limited to 0. System variable \$AC\_SMAXVELO\_INFO[n] shows the reason for this.
- Diagnosis 8: Delay of override motion: the maximum acceleration capacity is limited to 0. \$AC\_SMAXACC\_INFO[n] shows the reason for this.

MD11411 \$MN\_ENABLE\_ALARM\_MASK activates this alarm:

- Bit 9 = 1 for diagnosis 1 to 6
- Bit 12 = 1 for diagnosis 7 to 8

**Reaction:** Alarm display.

**Remedy:** Deactivate the alarm with MD 11411 \$MN\_ENABLE\_ALARM\_MASK Bit9 = 0 or Bit12 = 0.

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**22034 [Channel %1: ] Block %2 following spindle %3 PLC signal 'Enable override' has been set.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Number of following spindle

**Definitions:** PLC signals DB31..., DBX31.6 'Correct synchronism' and DB31..., DBX26.4 'Override enable' must not be set at the same time with CPSETTYPE="COUP". If an overlaid movement exists for the following spindle, override value \$AA\_COUP\_CORR[Sn] cannot be calculated properly.

**Reaction:** Alarm display.

**Remedy:** Set PLC signal DB31..., DBX26.4 'Override enable' to 0.

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**22035 [Channel %1: ] Block %2 following axis/spindle %3 unable to determine the offset value (reason %4).**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Following axis/spindle number  
 %4 = Reason

**Definitions:** The determination of the offset value (\$AA\_COUP\_CORR[Sn]) intended by the NC/PLC signal DB31, ... DBX31.6 (correct synchronism) cannot be executed. The offset value cannot be calculated properly. The reasons for this may be:

- Reason 1: The following axis is not configured as a spindle.
- Reason 2: The coupling has more than one active leading axis.
- Reason 3: The leading axis is not configured as a spindle.
- Reason 4: The coupling factor (the quotient from CPLNUM and CPLDEN) is neither 1 nor -1.
- Reason 5: CPLSETVAL = "cmdvel".
- Reason 6: An independent motion component (NC/PLC interface signal DB31, ... DBX98.4(overlaid motion) = 1) of the following spindle is active.
- Reason 7: There is no following spindle synchronism on the setpoint side.
- Reason 8: The synchronism on the setpoint side has decreased again.
- Reason 9: The following or leading spindle is a link axis (NCU\_LINK).

**Reaction:** Alarm display.

<b>Remedy:</b>	The following remedies are available for the indicated reasons: - Reasons 1 to 5: The coupling has to be reconfigured / reprogrammed. - Reasons 6 and 7: Wait until NC/PLC interface signals DB31, ... DBX99.4 (Synchronization running) = 0 and DB31, ... DBX98.4 (Overlaid motion) = 0 before setting NC/PLC DB31, ... DBX31.6 (Correct synchronism) . - Reason 8: Wait until the following axle / spindle can follow the leading values before setting NC/PLC interface signal DB31, ... DBX31.6 (Correct synchronism).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

<b>22036</b>	<b>[Channel %1: ] Block %2 Axis/spindle %3 Synchronism override not possible (reason %4)</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number %4 = Reason
<b>Definitions:</b>	The synchronism override intended by setting the VDI interface signal DB31...DBX31.6 'Correct synchronism' or writing variable \$AA_COUP_CORR[Sn] cannot currently be considered. The reasons may be: - Reason 1: Reference point approach or zero mark synchronization for spindles is active. - Reason 2: Deletion of synchronism override is active. - Reason 3: Writing is not allowed.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Wait until the conditions for override value processing are available again prior to setting VDI interface signal DB31...DBX31.6 'Correct synchronism' or writing variable \$AA_COUP_CORR[Sn]: - Reason 1: Reference point approach / zero mark synchronization completed. - Reason 2: Deletion of synchronism override completed. - Reason 3: Writing allowed.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

<b>22037</b>	<b>[Channel %1: ] Block %2 Axis/spindle %3 'Correct synchronism' is being ignored</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number
<b>Definitions:</b>	VDI interface signal DB31...DBX31.6 'Correct synchronism' is being ignored, because VDI interface signal DB31...DBX31.7 'Delete synchronism override' has been set.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Reset the two VDI interface signals DB31...DBX31.7 'Delete synchronism override' and DB31...DBX31.6 'Correct synchronism', before the latter signal can be set again.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

<b>22038</b>	<b>[Channel %1: ] Block %2 Axis/Spindle %3 'Delete synchronism override' is being ignored</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number
<b>Definitions:</b>	VDI interface signal DB31...DBX31.7 'Correct synchronism' is being ignored, because VDI interface signal DB31...DBX31.6 'Delete synchronism override' has been set.
<b>Reaction:</b>	Alarm display.

**Remedy:** Reset the two VDI interface signals DB31...,DBX31.6 'Correct synchronism' and DB31...,DBX31.7 'Delete synchronism override', before the latter signal can be set again.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22040 [Channel %1: ] Block %3 spindle %2 is not referenced with zero marker**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number, label

**Definitions:** The current position is not referenced with the measuring system position although reference is made to it.

**Reaction:** Alarm display.

**Remedy:** Correct NC part program. Create the zero mark synchronization by positioning, by rotation (at least 1 revolution) in speed control mode or G74 before switching the alarm generating function on.  
 If this has been intentionally programmed, the alarm can be suppressed in the cyclic check with position control already enabled by means of MD11410 \$MN\_SUPPRESS\_ALARM\_MASK Bit21 = 1.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22045 Block %2 spindle/axis %3 not available in channel %1 because active in channel %4**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Axis name, spindle number  
 %4 = Number of the channel in which the spindle/axis is currently active.

**Definitions:** The specified spindle/axis is required in channel %1 for the correct execution of a function. The spindle/axis is currently active in the %4 channel. The constellation can only occur with replacement axes.  
 Problem case: A synchronized spindle coupling was programmed. The master spindle/axis is not contained in the channel programmed for the coupling at the time the coupling is activated. The master spindle/axis can be moved by FC18 or synchronized actions. When using FC18, please note that the master spindle/axis must be assigned to the channel which activates the coupling. When FC18 terminates, the master spindle/axis must not be assigned to another channel via PLC while the coupling is still active (VDI interface signals).

**Reaction:** Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** - Program a GET for the master spindle/axis in the NC program before activating the coupling, or  
 - Assign the master spindle/axis to the channel that activated the coupling via PLC.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22050 [Channel %1: ] Block %3 spindle %2 no transition from speed control mode to position control mode**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number, label

**Definitions:** - An oriented spindle stop (SPOS/SPOSA) has been programmed or the position control of the spindle was switched on with SPCON but no spindle encoder has been defined.  
 - When switching on the position control, the spindle speed is greater than the limiting speed of the measuring system.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Spindle without attached encoder: Any NC language elements requiring the encoder signals must not be used.  
Spindle with attached encoder: Enter the number of spindle encoders used in the MD30200 \$MA\_NUM\_ENCS.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 22051 [Channel %1: ] Block %3 spindle %2 reference mark not found

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** When referencing, the spindle turned through a greater distance than given in the axis-specific MD34060 \$MA\_REFP\_MAX\_MARKER\_DIST, without receiving a reference mark signal. The check is performed for spindle positioning with SPOS or SPOSA when the spindle has not previously run with speed control (S=...).

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check and correct the MD34060 \$MA\_REFP\_MAX\_MARKER\_DIST. The value entered states the distance in [mm] or [degrees] between 2 zero markers.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 22052 [Channel %1: ] Block %3 spindle %2 no standstill on block change

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** The displayed spindle has been programmed as spindle or as axis even though a positioning operation is still running from the previous block (with SPOSA ... spindle positioning beyond block limits).  
Example:  
N100 SPOSA [2] = 100  
:  
N125 S2 = 1000 M2 = 04 ; Error, if spindle S2 from block N100 is still running!

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Before programming the spindle/axis again using the SPOSA instruction, a WAITS command should be activated in order to wait for the programmed spindle position.  
Example:  
N100 SPOSA [2] = 100  
:  
N125 WAITS (2)  
N126 S2 = 1000 M2 = 04

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 22053 [Channel %1: ] Block %3 spindle %2 reference mode not supported

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** In the case of SPOS/SPOSA with an absolute encoder, only the referencing mode MD34200 \$MA\_ENC\_REFP\_MODE = 2 is supported! SPOS/SPOSA does not support MD34200 \$MA\_ENC\_REFP\_MODE = 6 at all!

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify setting of MD34200 \$MA\_ENC\_REFP\_MODE or change to JOG+REF and then reference.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22054 [Channel %1: ] Block %3 spindle %2 improper punching signal**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** If the punching signal is irregular between the punching strokes, this alarm is generated according to a machine data.

**Reaction:** Alarm display.

**Remedy:** Indicates poor condition of the punching hydraulics.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22055 [Channel %1: ] Block %3 spindle %2 configured positioning speed is too high**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** The current position is not referenced with the measuring system position although reference is made to it.

**Reaction:** Alarm display.

**Remedy:** Correct NC part program. Create the zero mark synchronization by positioning, by rotation (at least 1 revolution) in speed control mode or G74 before switching the alarm generating function on.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22057 [Channel %1: ] Block %2 for following spindle %3 coupling as leading spindle/axis already existing**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Axis name, spindle number

**Definitions:** A coupling has been switched on in which the following spindle/axis has already been active as leading spindle/axis in another coupling. Chained couplings cannot be processed.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check in the parts program whether the following spindle/axis is already active as leading spindle/axis in another coupling.

**Program Continuation:** Clear alarm with the RESET key. Restart part program



---

<b>22058</b>	<b>[Channel %1: ] Block %2 for leading spindle %3 coupling as following spindle/axis already existing</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
<b>Definitions:</b>	A coupling has been switched on in which the leading spindle/axis has already been active as following spindle/axis in another coupling. Chained couplings cannot be processed.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check in the parts program whether the leading spindle/axis is already active as following spindle/axis in another coupling.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>22060</b>	<b>[Channel %1: ] Position control expected for axis/spindle %2</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	The programmed coupling type (DV, AV) or the programmed function requires position control.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Activate position control, e.g. by programming SPCON.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>22062</b>	<b>[Channel %1: ] Axis %2 reference point approach: zero marker search velocity (MD) is not reached</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	The configured zero marker search velocity is not reached.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check active spindle speed limitations. Configure a lower zero marker search velocity MD34040 \$MA_REFP_VELO_SEARCH_MARKER. Check the tolerance range for the actual velocity MD35150 \$MA_SPIND_DES_VELO_TOL. Set a different referencing mode MD34200 \$MA_ENC_REFP_MODE != 7.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>22064</b>	<b>[Channel %1: ] Axis %2 reference point approach: zero marker search velocity (MD) is too high</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number

**Definitions:** The configured zero marker search velocity is too high. The encoder limit frequency is exceeded for the active measuring system.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
Configure a lower zero marker search velocity MD34040 \$MA\_REFP\_VELO\_SEARCH\_MARKER. Check the encoder frequency configuration MD36300 \$MA\_ENC\_FREQ\_LIMIT and MD36302 \$MA\_ENC\_FREQ\_LIMIT\_LOW. Set a different referencing mode MD34200 \$MA\_ENC\_REFP\_MODE=7.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**22065 [Channel %1: ] Tool management: Tool motion is not possible as tool %2 is not in magazine %4.**

**Parameters:** %1 = Channel number  
%2 = String (identifier)  
%3 = -Not used-  
%4 = Magazine no.

**Definitions:** The desired tool motion command - triggered from the MMC or PLC - is not possible. The specified tool is not contained in the specified magazine. (NCK cannot contain tools that are not assigned to a magazine. With this kind of tool, no operations (motion, change) can be performed.)

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check that the specified tool is contained in the desired magazine, or program another tool to be changed.

**Program Continuation:** Clear alarm with the Delete key or NC START.

**22066 [Channel %1: ] Tool management: Tool change is not possible as tool %2 is not in magazine %4.**

**Parameters:** %1 = Channel number  
%2 = String (identifier)  
%3 = -Not used-  
%4 = Magazine no.

**Definitions:** The desired tool change is not possible. The specified tool is not contained in the specified magazine. (NCK cannot contain tools that are not assigned to a magazine. With this kind of tool, no operations (motion, change) can be performed.)

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department.  
- Check that the specified tool is contained in the desired magazine, or program another tool to be changed.  
- Check whether the settings in machine data MD20110 \$MC\_RESET\_MODE\_MASK, MC20112 \$MC\_START\_MODE\_MASK and the associated machine data MD20122 \$MC\_TOOL\_RESET\_NAME match the current definition data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>22067</b>	<b>[Channel %1: ] Tool management: tool change not possible since there is no tool available in tool group %2</b>
<b>Parameters:</b>	%1 = Channel number %2 = String (identifier)
<b>Definitions:</b>	The desired tool change is not possible. The specified tool group does not contain a tool which is ready for use and could be used for tool change. It is possible that all of the tools in question have been set to the 'Disabled' state by the tool monitoring function.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	- Ensure that the specified tool group contains a tool that is ready for use when tool change is requested. - This can be achieved, for example, by replacing disabled tools, or - by releasing a disabled tool manually. - Check whether the tool data are correctly defined. Have all intended tools in the group been defined with the specified identifier and loaded?
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>22068</b>	<b>[Channel %1: ] Block %2 tool management: no tool available in tool group %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = String (identifier)
<b>Definitions:</b>	The specified tool group does not contain a tool which is ready for use and could be used for tool change. It is possible that all of the tools in question have been set to the 'Disabled' state by the tool monitoring function. The alarm can occur for example in conjunction with the alarm 14710 (error on INIT block generation). In this specific situation, NCK attempts to replace the disabled tool located on the spindle with an available replacement tool (which does not exist in this error condition). The user must resolve this conflict, for example, by removing the tool located on the spindle from the spindle by issuing a movement command (e.g. through MMC operation).
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Ensure that the specified tool group contains a tool that is ready for use when tool change is requested. - This can be achieved, for example, by replacing disabled tools, or - by releasing a disabled tool manually. - If an alarm occurs on programming TCA: Has the duplo number been programmed >0? - Check whether the tool data are correctly defined. Have all intended tools in the group been defined/loaded with the specified identifier?
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>22069</b>	<b>[Channel %1: ] Block %2 tool management: No tool available in tool group %3, program %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = String (identifier) %4 = Program name

**Definitions:** The specified tool group does not contain a tool which is ready for use and could be used for tool change. It is possible that all of the tools in question have been set to the 'Disabled' state by the tool monitoring function. Parameter %4 = program name facilitates the identification of the program containing the programming command (tool selection) that caused the error. This can be a subprogram or cycle, etc., which can no longer be identified from the display. If the parameter is not specified, it is the currently displayed program.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:**

- Ensure that the specified tool group contains a tool that is ready for use when tool change is requested.
- This can be achieved, for example, by replacing disabled tools, or
- by releasing a disabled tool manually.
- Check whether the tool data are correctly defined. Have all intended tools in the group been defined with the specified identifier and loaded?

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**22070 [TO unit %1: ] Please change tool %2 into magazine. Repeat data backup**

**Parameters:** %1 = TO unit  
%2 = T number of tool

**Definitions:** The alarm can only occur when the tool management function is active in the NCK. (TOOLMAN = tool management) A data backup of the tool/magazine data has been started. During the backup, the system detected that tools are still located in the buffer magazine (= spindle, gripper, ...). During the backup, these tools will lose the information which defines the magazine and location to which they are allocated. It is therefore practical -assuming that the data are to be stored exactly as before - to ensure that all tools have been deposited in the magazine before the data backup!! If this is not the case, some magazine locations will have the 'reserved' status when the data are loaded again. This 'reserved' status must then be reset manually. For tools with fixed location coding, the loss of the information allocating their location in the magazine has the same effect as a general empty location search when they are returned to the magazine.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Ensure that no tools are located in the buffer magazine before the data backup. Repeat the data backup after removing the tools from the buffer magazine.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22071 [TO unit %1: ] Tool %2 is active, but not in the magazine area under consideration**

**Parameters:** %1 = TO unit  
%2 = Tool identifier  
%3 = -Not used-

**Definitions:** The alarm can only occur when the tool management function is active in the NCK. Either the language command SETTA has been programmed or the corresponding operator action has been carried out via MMC, PLC, .... The alarm can also be triggered automatically by the NCK in the wear grouping function. It is detected that more than one tool from the tool group (tools with the same name/identifier) has the status "active". The specified tool is either from a non-considered magazine, from a non-considered wear grouping, or from a non-active wear grouping in a buffer location (is neither magazine nor wear grouping).

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** The alarm is intended for information purposes. If only one tool in a group can be active at a time for technological reasons or for reasons of display, the "active" status must be canceled for the tool causing the error. Otherwise, the alarm can be ignored or even suppressed via the MD11410 \$MN\_SUPPRESS\_ALARM\_MASK. Typical reasons of display are present, if the operator works with the function 'definite D numbers', which can be displayed on Siemens MMC in a definite form only, if exactly one tool from a tool group has the status 'active'. Before machining can be started or before the SETTA (or corresponding MMC operation, ...) language command is used, all tools of the magazine should have the status "not active". One option to achieve this is programming SETTIA (or corresponding MMC operation, ...).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

## 22100 [Channel %1: ] Block %3 spindle %2 chuck speed exceeded

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** The actual spindle speed is higher than the maximum speed configured in MD35100 \$MA\_SPIND\_VELO\_LIMIT plus a tolerance of 10 percent (fixed setting).  
The alarm should not occur after correct optimization of the drive actuator and gear configuration.  
This alarm can be reconfigured with MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready to operate) to 'BAG not ready'.  
Note: Reconfiguring affects all alarms with alarm response 'Chan not ready'.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department. Check the setup and optimization data of the drive actuator in accordance with the Installation and Start-up Guide and make corrections.  
Increase the tolerance window in MD35150 \$MA\_SPIND\_DES\_VELO\_TOL.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

## 22101 [Channel %1: ] Block %3 spindle %2 maximum speed for encoder resynchronization exceeded

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Block number, label

**Definitions:** The maximum encoder speed was exceeded with G33, G95, G96 or G97. Reference to actual speed and actual position is no longer possible. The NC reduces the setpoint speed with the above functions until the active encoder is able to measure again. The alarm is issued if the encoder still reports the fault.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Program speed limit with G26.  
- Reduce the maximum speed in the appropriate machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**22150 [Channel %1: ] Block %3 spindle %2 maximum speed for position control exceeded**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number  
 %3 = Block number, label

**Definitions:** The maximum encoder speed was exceeded with SPCON. Position control is no longer possible. The NC reduces the setpoint speed with the above functions until the active encoder is able to measure again. The alarm is issued if the encoder still reports the fault.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** - Program speed limit with G26.  
 - Reduce the maximum speed in the appropriate machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22200 [Channel %1: ] Spindle %2 axis stopped during tapping**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** When tapping with compensating chuck (G63) the drilling axis was stopped via the NC/PLC interface and the spindle continues to rotate. The thread and possibly also the tap were damaged as a result.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Provide an interlock in the PLC user program so that no axis stop can be initiated when tapping is active. If the tapping operation is to be terminated under critical machine conditions, the spindle and the axis should be stopped simultaneously if at all possible. Slight differences are then accommodated by the compensating chuck.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22250 [Channel %1: ] Spindle %2 axis stopped during thread cutting**

**Parameters:** %1 = Channel number  
 %2 = Axis name, spindle number

**Definitions:** The thread cutting axis has been stopped while a thread block was active.  
 The stop can be caused by VDI signals that cause the feed to be interrupted.

**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Check the axis-specific/spindle-specific stop DB31, ... DBX4.3 (Spindle stop).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22260 [Channel %1: ] Spindle %2 thread might be damaged**

**Parameters:** %1 = Channel number  
 %2 = Axis name  
 %3 = Block number

---

<b>Definitions:</b>	When DECODING SINGLE BLOCK has been selected and there is a chain of thread blocks, then machining pauses occur at the block limits until the next block is executed with the new NC Start. In normal single block mode, the program is stopped by a higher-level logic only at the block boundaries at which no contour distortions or contour errors can occur. With chained thread blocks, this is the last thread block!
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	If only one thread block has been programmed, the alarm message can be ignored. If there are several consecutive thread blocks, this machining section must not be executed in the automatic DECODING SINGLE BLOCK mode.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### 22270 [Channel %1: ] Block %2 thread cutting: Maximum speed axis %3 exceeded %4

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Velocity
<b>Definitions:</b>	Thread cutting with G33, G34, G35: The thread axis (pitch axis) velocity calculated exceeds the maximum permissible axis velocity MD32000 \$MA_MAX_AX_VELO. The calculated axis velocity is displayed. The velocity of the thread axis is dependent upon: <ul style="list-style-type: none"> <li>- The current spindle speed</li> <li>- The programmed thread pitch</li> <li>- The programmed thread pitch change and thread length (G34, G35)</li> <li>- The spindle override (path and individual axis overrides are ineffective)</li> </ul>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Reduce the spindle speed or thread pitch (thread pitch change).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 22271 [Channel %1: ] Block %2 thread cutting: Maximum speed axis %3 exceeded %4

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Velocity
<b>Definitions:</b>	Thread cutting with G33, G34, G35: The thread axis (pitch axis) velocity calculated exceeds the maximum permissible axis velocity MD32000 \$MA_MAX_AX_VELO. The calculated axis velocity is displayed. The velocity of the thread axis is dependent upon: <ul style="list-style-type: none"> <li>- The current spindle speed</li> <li>- The programmed thread pitch</li> <li>- The programmed thread pitch change and thread length (G34, G35)</li> <li>- The spindle override (path and individual axis overrides are ineffective)</li> </ul>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Reduce the spindle speed or thread pitch (thread pitch change).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 22272 [channel %1: ] block %2 axis %3 thread cutting: block length %4 too short for predefined thread pitch

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Block length
--------------------	--

**Definitions:** Thread cutting with G33, G34, G35: Block length too short for predefined thread pitch. Block length is displayed.  
**Reaction:** Alarm display.  
**Remedy:** Reduce thread pitch (thread pitch change).  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**22275 [Channel %1: ] Block %2 zero velocity of thread axis at position %3 reached**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Position

**Definitions:** An axis standstill was reached at the specified position during thread cutting with G35 due to the linear decrease in the thread pitch. The standstill position of the thread axis depends on:  
- Programmed thread pitch decrease  
- Thread length

**Reaction:** Alarm display.  
**Remedy:** Change at least one of the above factors.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**22280 [Channel %1: ] In block %2: Prog. acceleration path too short %3, %4 required**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Prog. acceleration path  
%4 = Required acceleration path

**Definitions:** In order to stay within the programmed acceleration path, the acceleration caused an overload on the thread axis. In order to accelerate the axis with the programmed dynamic response, the length of the acceleration path must be at least as large as the value in parameter %4.  
The alarm is of the technological type and is output whenever bit 2 in MD11411 \$MN\_ENABLE\_ALARM\_MASK is enabled. The HMI softkey 'Technology support' sets and clears this bit in the MD.

**Reaction:** Alarm display.  
**Remedy:** Modify part program or reset MD11411 \$MN\_ENABLE\_ALARM\_MASK bit 2.  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

**22290 [Channel %1: ] Spindle operation for transformed spindle/axis %2 not possible (reason: error code %3).**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Error code



---

<b>Definitions:</b>	It is impermissible to start a spindle as long as it is being used by a transformation. Reason: spindle usage in a transformation requires axis operation, which must not be exited. This alarm may have the following reasons: - Error code 1 : M3, M4 or M5 per synchronized action; - Error code 2 : M41 through M45 per synchronized action; - Error code 3 : SPOS, M19 per synchronized action; - Error code 11 : DB31, ... DBX30.0 (Spindle stop); - Error code 12 : DB31, ... DBX30.1 (Spindle start clockwise rotation); - Error code 13 : DB31, ... DBX30.2 (Spindle start counterclockwise rotation); - Error code 14 : DB31, ... DBX30.4 (Spindle positioning).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Resolve the conflict, for example by deactivating transformation prior to spindle start.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

### **22291 [Channel %1: ] Block %2 motion synchronous action %3 spindle mode is not possible for transformed spindle/axis %4**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
<b>Definitions:</b>	It is impermissible to start a spindle as long as it is being used by a transformation. Reason: spindle usage in a transformation requires axis operation, which must not be exited. This alarm may have the following reasons: - Error code 1 : M3, M4 or M5 per synchronized action; - Error code 2 : M41 through M45 per synchronized action; - Error code 3 : SPOS, M19 per synchronized action; - Error code 11 : DB31, ... DBX30.0 (Spindle stop); - Error code 12 : DB31, ... DBX30.1 (Spindle start clockwise rotation); - Error code 13 : DB31, ... DBX30.2 (Spindle start counterclockwise rotation); - Error code 14 : DB31, ... DBX30.4 (Spindle positioning).
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Resolve the conflict, for example by deactivating transformation prior to spindle start.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

### **22295 [Channel %1: ] Spindle %2 DBB30 function not possible (cause: error code %3)**

<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Error code
--------------------	--

**Definitions:** The function request by PLC via DBB30 interface could not be executed. The cause is specified by the error code.  
Error codes:  
- Error code 1 : internal use  
- Error code 2 : internal use  
- Error code 3 : internal use  
- Error code 4 : internal use  
- Error code 5 : Switchover to command axis not possible  
- Error code 6 : Switchover to PLC axis not possible  
- Error code 20 : internal use  
- Error code 21 : internal use  
- Error code 22 : internal use  
- Error code 23 : MD 30132 IS\_VIRTUAL\_AX has been set  
- Error code 50 : internal use  
- Error code 51 : internal use  
- Error code 70 : internal use

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Remedy conflict.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22296 [Channel %1: ] Spindle %2 Error on gear stage change (cause: error code %3)**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Error code

**Definitions:** An error occurred during gear stage change. The cause is specified by the error code.  
Error codes:  
- Error code 1 : internal use  
- Error code 2 : internal use  
- Error code 3 : internal use  
- Error code 4 : internal use  
- Error code 5 : Switchover to command axis not possible  
- Error code 6 : Switchover to PLC axis not possible  
- Error code 20 : internal use  
- Error code 21 : internal use  
- Error code 22 : internal use  
- Error code 23 : MD 30132 IS\_VIRTUAL\_AX has been set  
- Error code 50 : internal use  
- Error code 51 : internal use  
- Error code 70 : internal use

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Remedy conflict.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**22297 [Channel %1: ] Spindle %2 FC18 function not possible (cause: error code %3)**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number  
%3 = Error code

---

<b>Definitions:</b>	The function request by PLC via FC18 interface could not be executed. The cause is specified by the error code. Error codes: - Error code 1 : internal use - Error code 2 : internal use - Error code 3 : internal use - Error code 4 : internal use - Error code 5 : Switchover to command axis not possible - Error code 6 : Switchover to PLC axis not possible - Error code 20 : internal use - Error code 21 : internal use - Error code 22 : internal use - Error code 23 : MD 30132 IS_VIRTUAL_AX has been set - Error code 50 : internal use - Error code 51 : internal use - Error code 70 : internal use
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Remedy conflict.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>22320</b>	<b>[Channel %1: ] Block %2 motion synchronous action: %3 PUTFTOCF command could not be transferred</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, line number %3 = Synact ID
<b>Definitions:</b>	The cyclic transfer of the PUTFTOCF data block (fine tool compensation) could not be performed because the transfer area is already occupied.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check the part program, in particular with regard to the other channels. Is a data block being transferred by another channel?
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>22321</b>	<b>[Channel %1: ] Axis %2 PRESET not allowed during traverse motion</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	A preset command was sent from the HMI or PLC while an axis was traveling in JOG mode.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Wait until the axis is stationary.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>22322</b>	<b>[Channel %1: ] Axis %2 PRESET: illegal value</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number

**Definitions:** The entered Preset value is too large (number format overflow).  
**Reaction:** NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Use more realistic (smaller) Preset values.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**22400 [Channel %1: ] Option 'contour handwheel' not set**

**Parameters:** %1 = Channel number  
**Definitions:** The function 'contour handwheel' was activated without the necessary option.  
 If the alarm occurs  
 - on selection of the contour handwheel via the PLC, then the contour handwheel has to be deselected in order to continue with the program  
 - on account of programming FD=0, then the program can be corrected and continued with the compensation block and NCSTART.  
**Reaction:** Alarm display.  
**Remedy:** Please inform the authorized personnel/service department.  
 - Set option  
 - Cancel the activation of the function 'contour handwheel'  
 - Modify part program.  
**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**25000 Axis %1 hardware fault of active encoder**

**Parameters:** %1 = Axis name, spindle number  
**Definitions:** The signals of the currently active position actual value encoder (NC/PLC interface signal DB31, ... DBX1.5 = 1 (Position measuring system 1) or DB31, ... DBX1.6 = 1 (Position measuring system 2)) are missing, do not have the same phase, or exhibit grounding/short-circuit.  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).  
 For PROFIdrive only:  
 MD36310 \$MA\_ENC\_ZERO\_MONITORING >100 replaces the existing PowerOn alarm by the Reset alarm 25010.  
**Reaction:** Mode group not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Axes of this channel must be re-referenced.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.  
**Remedy:** Please inform the authorized personnel/service department. Check measuring circuit connectors for correct contacting. Check encoder signals and replace the encoder if faults are found.  
 Monitoring can be switched off by setting MD36310 \$MA\_ENC\_ZERO\_MONITORING[n] to 100 (n = encoder number: 1,2).  
**Program Continuation:** Switch control OFF - ON.

---

**25001 Axis %1 hardware fault of passive encoder**

**Parameters:** %1 = Axis name, spindle number

---

<b>Definitions:</b>	The signals from the currently inactive position actual value encoder are missing, or they are not of the same phase, or they exhibit grounding/short-circuit. For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 replaces the existing PowerOn alarm by the Reset alarm 25011. MD36310 \$MA_ENC_ZERO_MONITORING >100 replaces the existing Reset alarm by the Cancel alarm 25011.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check measuring circuit connectors for correct contacting. Check encoder signals and replace the encoder if faults are found. Switch off monitoring with the corresponding interface signal DB31, ... DBX1.5 / 1.6 = 0 (Position measuring system 1/2 ). Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 25010 Axis %1 pollution of measuring system

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The encoder used for position control sends a contamination signal (only in measuring systems with contamination signal). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready). For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 returns the existing Reset alarm instead of the Power-on alarm 25000.
<b>Reaction:</b>	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check the measuring system in accordance with the instructions given by the measuring device manufacturer. Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

### 25011 Axis %1 pollution of passive encoder

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The encoder not used for position control sends a contamination signal (only in measuring systems with contamination signal). For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 returns the existing Reset alarm instead of the Power-on alarm 25001. MD36310 \$MA_ENC_ZERO_MONITORING >100 returns the existing Cancel alarm instead of the Reset alarm 25001.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check the measuring system in accordance with the instructions given by the measuring device manufacturer. Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**25020                    Axis %1 zero mark monitoring of active encoder**

**Parameters:**            %1 = Axis name, spindle number

**Definitions:**            For PROFIdrive:  
 The position encoder pulses between 2 zero mark pulses are counted, and the plausibility is assessed (The functionality and possibly the parameterization of the plausibility check is done on the drive side. Please refer to the relevant drive documentation for details.), and reported in a PROFIdrive message frame (encoder interface) to the control, which then issues the present alarm.  
 The alarm can be reprogrammed in MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:**                Mode group not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Axes of this channel must be re-referenced.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:**                 Please inform the authorized personnel/service department.  
 The differences can result from transmission errors, disturbances, encoder hardware faults or from the evaluation electronics in the encoder used for position control. The actual value branch must therefore be checked:  
 1. Transmission path: Check the actual-value connectors for correct contacting, encoder cable for continuity, and also check for short-circuits and grounding (loose contact?).  
 2. Encoder pulses: Is the encoder power supply within the tolerance limits?  
 3. Evaluation electronics: Replace or reconfigure the drive or encoder module used.  
 Monitoring can be switched off by setting MD36310 \$MA\_ENC\_ZERO\_MONITORING [n] to 0 or 100 (n = encoder number: 1, 2).

**Program Continuation:**    Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**25021                    Axis %1 zero mark monitoring of passive encoder**

**Parameters:**            %1 = Axis name, spindle number

**Definitions:**            Monitoring relates to the encoder that is not used by the position control. (NC-PLC interface signal DB31, ... DBX1.5 = 0 (Position measuring system 1) or DB31, ... DBX1.6 = 0 (Position measuring system 2))  
 More detailed explanations are similar to those for alarm 25020.

**Reaction:**                Alarm display.

**Remedy:**                 Please inform the authorized personnel/service department. The differences can result from transmission errors, disturbances, encoder hardware faults or from the evaluation electronics in the encoder not used for position control. The actual value branch must therefore be checked:  
 1. Transmission path: Check the actual-value connectors for correct contacting, encoder cable for continuity, and also check for short-circuits and grounding (loose contact?).  
 2. Encoder pulses: Is the encoder power supply within the tolerance limits?  
 3. Evaluation electronics: Replace or reconfigure the drive or encoder module used.  
 Monitoring can be switched off by setting MD36310 \$MA\_ENC\_ZERO\_MONITORING[n] to 0 or 100 (n = encoder number: 1, 2).

**Program Continuation:**    Clear alarm with the Delete key or NC START.

---

**25022                    Axis %1 encoder %2 warning %3**

**Parameters:**            %1 = Axis name, spindle number  
 %2 = Encoder number  
 %3 = Error fine coding

<b>Definitions:</b>	<p>This alarm only occurs with absolute encoders:</p> <p>a. Warning notice of missing absolute encoder adjustment (on the SIMODRIVE 611D or with PROFIdrive drives), that is if MD34210 \$MA_ENC_REFP_STATE equals 0. In this case, fine error code 0 is returned.</p> <p>b. If, on the SIMODRIVE 611D only, zero mark monitoring has been activated for the absolute encoder (see MD36310 \$MA_ENC_ZERO_MONITORING): In this case, the absolute position of the absolute encoder could not be read without error:</p> <p>Breakdown of fine error codes:</p> <p>(Bit 0 not used)</p> <p>Bit 1 Parity error</p> <p>Bit 2 Alarm bit of the encoder</p> <p>Bit 3 CRC error</p> <p>Bit 4 Timeout - start bit for EnDat transfer is missing</p> <p>This alarm is only displayed, as the absolute position itself is not required at this time for control/contour.</p> <p>A frequent occurrence of this alarm indicates that the absolute encoder transfer or the absolute encoder itself is faulty, and that an incorrect absolute value could be determined in one of the next encoder selection or power on situations.</p>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	<p>a. Verify encoder adjustment (machine reference ) or readjust encoder.</p> <p>b. Replace the encoder, replace or screen the encoder cable (or deactivate zero mark monitoring).</p>
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 25030 Axis %1 actual velocity alarm limit

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	<p>If the axis has at least one active encoder, then the actual speed of the axis is cyclically checked in the IPO cycle. If there are no errors, the actual velocity can never become greater than specified in the axis-specific MD36200 \$MA_AX_VELO_LIMIT (threshold for velocity monitoring). This threshold value in [mm/min, rev/min] is input by an amount that is about 5 to 10% greater than that which can occur at maximum traversing velocity. Drive errors can result in the velocity being exceeded and the alarm is then triggered.</p> <p>The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).</p>
<b>Reaction:</b>	<p>Mode group not ready.</p> <p>The NC switches to follow-up mode.</p> <p>Channel not ready.</p> <p>NC Start disable in this channel.</p> <p>Interface signals are set.</p> <p>Alarm display.</p> <p>NC Stop on alarm.</p> <p>Channel not ready.</p>
<b>Remedy:</b>	<p>Please inform the authorized personnel/service department.</p> <ul style="list-style-type: none"> <li>- Check the speed setpoint cable (bus cable).</li> <li>- Check the actual values and direction of position control.</li> <li>- Change the position control direction if the axis rotates uncontrollably -&gt; axis-specific MD32110 \$MA_ENC_FEEDBACK_POL [n] = &lt; -1, 0, 1 &gt;.</li> <li>- Increase the monitoring limit value in MD 36200 \$MA_AX_VELO_LIMIT.</li> </ul>
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

### 25031 Axis %1 actual velocity warning limit

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	<p>The present velocity actual value is more than 80% of the limit value defined in the machine data. (Internal test criterion activated by MD36690 \$MA_AXIS_DIAGNOSIS, bit0)</p>
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	-
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

**25040 Axis %1 standstill monitoring**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The NC monitors to ensure that the position is held at zero speed. Monitoring is started after a time that can be set for a specific axis in the MD36040 \$MA\_STANDSTILL\_DELAY\_TIME after interpolation has ended. A constant check is made to determine whether the axis remains within the tolerance range given in MD36030 \$MA\_STANDSTILL\_POS\_TOL.  
The following cases are possible:  
1. The NC/PLC interface signal DB31, ... DBX2.1 (Servo enable) is zero because the axis has jammed mechanically. Due to mechanical influences (e.g. high machining pressure), the axis is pushed outside the permissible position tolerance.  
2. With closed position control loop (without jamming) - NC/PLC interface signal DB31, ... DBX2.1 (Servo enable) is "1" - the axis is pushed away from its position by mechanical forces with a small gain in the position control loop. The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
- Check MD36040 \$MA\_STANDSTILL\_DELAY\_TIME and MD36030 \$MA\_STANDSTILL\_POS\_TOL; increase if necessary. The value must be greater than the machine data "Exact stop - coarse" (MD36000 \$MA\_STOP\_LIMIT\_COARSE).  
- Estimate machining forces and reduce if necessary by setting a lower feed or a higher rotational speed.  
- Increase clamping pressure.  
- Increase the gain in the position control loop by improved optimization (Kv factor MD32200 \$MA\_POSCTRL\_GAIN, SIMODRIVE611D drive).

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**25042 Axis %1 standstill monitoring during torque/force limitation**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The defined end position was not reached within the time specified in the machine data.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** - If the drive torque (FXST) was set too low with the result that the force of the motor was not sufficient to reach the end position -> increase FXST.  
- If the machined part is slowly deformed, there may be a delay in reaching the end position -> increase MD36042 \$MA\_FOC\_STANDSTILL\_DELAY\_TIME.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**25050 Axis %1 contour monitoring**

**Parameters:** %1 = Axis name, spindle number



---

<b>Definitions:</b>	The NCK calculates for each interpolation point (setpoint) of an axis the actual value that should result based on an internal model. If this calculated actual value and the true machine actual value differ by a larger amount than given in the MD36400 \$MA_CONTOUR_TOL, then the program is aborted and the alarm message is issued. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Please inform the authorized personnel/service department. - Check whether the tolerance value set in MD36400 \$MA_CONTOUR_TOL is too small. - Check optimization of the position controller (Kv factor in the MD32200 \$MA_POSCTRL_GAIN) to establish whether the axis follows the given setpoint without overshooting. Otherwise, the speed controller optimization must be improved or the Kv servo gain factor must be reduced. - Improvement of speed controller optimization - Check the mechanics (smooth running, inertial masses).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

## 25060 Axis %1 speed setpoint limitation

<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The speed setpoint has exceeded its upper limit for a longer period than allowed. The maximum speed setpoint is limited to a certain percentage by the axis-specific MD36210 \$MA_CTRLLOUT_LIMIT. The input value of 100% corresponds to the rated speed of the motor and hence the rapid traverse velocity (exemplary default value: 840D=110%). For SINAMICS: Drive parameter p1082 also has a limiting effect. If the values are exceeded for a short time, then this is tolerated provided they do not last longer than allowed for in the axis-specific MD36220 \$MA_CTRLLOUT_LIMIT_TIME. The setpoint is limited during this time to the maximum value that has been set in (MD36210 \$MA_CTRLLOUT_LIMIT). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Please inform the authorized personnel/service department. This alarm should not occur if the drive controller has been set correctly and the machining conditions are those that normally prevail. - Check actual values: Local sluggishness of the carriage, speed dip by torque surge due to contact with workpiece/tool, travel against fixed obstacle, etc. - Check direction of position control: Does the axis continue to rotate without control (not on SIMODRIVE 611D drives)?
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

## 25070 Axis %1 drift value too large

<b>Parameters:</b>	%1 = Axis name, spindle number
--------------------	--------------------------------

**Definitions:** Only with analog drives!  
 The permissible maximum value of drift (internal, integrated drift value of automatic drift compensation) was exceeded during the last compensation operation. The permissible maximum value is defined in the axis-specific MD36710 \$MA\_DRIFT\_LIMIT. The drift value itself is not limited.  
 Automatic drift compensation: MD36700 \$MA\_DRIFT\_ENABLE=1  
 The difference between actual and setpoint position (drift) is checked cyclically in the IPO cycle when the axes are at zero speed. The difference is automatically compensated to zero by slowly integrating an internal drift value.  
 Drift compensation by hand: MD36700 \$MA\_DRIFT\_ENABLE=0  
 A static offset can be added to the speed setpoint in the MD36720 \$MA\_DRIFT\_VALUE. This is not included in the drift monitoring because it acts like a voltage zero offset.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Adjust the drift compensation with the automatic drift compensation switched off at the drive until the position lag is approximately zero. Then reactivate the automatic drift compensation in order to balance out the dynamic drift changes (effects of heating up).

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**25080 Axis %1 positioning monitoring**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** For blocks in which "exact stop" is effective, the axis must have reached the exact stop window after the positioning time given in the axis-specific MD36020 \$MA\_POSITIONING\_TIME.  
 Exact stop coarse: MD36000 \$MA\_STOP\_LIMIT\_COARSE  
 Exact stop fine: MD36010 \$MA\_STOP\_LIMIT\_FINE  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** Please inform the authorized personnel/service department. Check whether the exact stop limits (coarse and fine) correspond to the dynamic possibilities of the axis, otherwise increase them, if necessary in connection with the positioning time set in MD36020 \$MA\_POSITIONING\_TIME.  
 Check speed controller/position controller optimization; select highest possible gain.  
 Check setting of Kv factor (MD32200 \$MA\_POSCTRL\_GAIN) and increase, if required.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**25100 Axis %1 measuring system switchover not possible**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The prerequisites are not satisfied for the required encoder switchover:  
 1. The newly selected encoder must be in the active state: (DB31, ... DBX1.5 / 1.6 = 1 (Position measuring system 1/2)).  
 2. The actual value difference between the two encoders is greater than the value in the axis-specific MD36500 \$MA\_ENC\_CHANGE\_TOL ("Maximum tolerance for position actual value switchover").  
 Activation of the measuring system concerned takes place in accordance with the NC/PLC interface signals DB31, ... DBX1.5 (Position measuring system 1) and DB31, ... DBX1.6 (Position measuring system 2), i.e. the position control is now operated with this measuring system. The other measuring system is switched over to follow-up mode. If both interface signals are set to "1", then only the 1st measuring system is active; if both interface signals are set to "0", the axis is parked.  
 Changeover takes place as soon as the interface signals have changed, even if the axis is in motion.

---

<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Please inform the authorized personnel/service department. When referencing the active position actual value encoder, the actual value system of the inactive encoder is set to the same reference point value as soon as phase 3 has been concluded. A later positional difference between the two actual value systems can have occurred only as the result of an encoder defect or a mechanical displacement between the encoders. - Check the encoder signals, actual value cable, connectors. - Check the mechanical fastenings (displacement of the measuring head, mechanical twisting possible). - Increase the axis-specific MD 36500 \$MA_ENC_CHANGE_TOL. Program continuation is not possible. The program must be aborted with "RESET", then program execution can be reinitiated with NC START, if necessary at the interruption point after "Block search with/without calculation".
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>25105</b>	<b>Axis %1 measuring systems differ considerably</b>
<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The two measuring systems differ considerably, i.e. the cyclically monitored actual value difference between the two measuring systems is greater than the associated tolerance value set in the machine data MD36510 \$MA_ENC_DIFF_TOL. This can only occur when both measuring systems are active (MD30200 \$MA_NUM_ENC_S = 2) and referenced. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Check machine data for the active, selected encoders. Check the machine data relating to encoder (MD36510 \$MA_ENC_DIFF_TOL) tolerance.
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

<b>25110</b>	<b>Axis %1 selected encoder not available</b>
<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	The selected encoder does not correspond to the maximum number of encoders in the axis-specific MD30200 \$MA_NUM_ENC_S, i.e. the 2nd encoder does not exist.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. Enter the number of actual value encoders used for this axis in the MD30200 \$MA_NUM_ENC_S ("Number of encoders"). Input value 0: Axis without encoder -> e.g. spindle Input value 1: Axis with encoder -> default setting Input value 2: Axis with 2 encoders -> e.g. direct and indirect measuring system
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>25200</b>	<b>Axis %1 requested set of parameters invalid</b>
--------------	--

<b>Parameters:</b>	%1 = Axis name, spindle number
--------------------	--------------------------------

**Definitions:** A new parameter set has been requested for the positioning control. The number of this parameter set is beyond the permissible limit.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Check the axis-specific/spindle-specific interface signals DB31, ... DBX9.0 - .2 (Select parameter set servo A, B, C).  
One parameter set includes the following machine data:  
- MD31050 \$MA\_DRIVE\_AX\_RATIO\_DENOM [n]  
- MD31060 \$MA\_DRIVE\_AX\_RATIO\_NUMERA [n]  
- MD32200 \$MA\_POSCTRL\_GAIN [n]  
- MD32800 \$MA\_EQUIV\_CURRCTRL\_TIME [n]  
- MD32810 \$MA\_EQUIV\_SPEEDCTRL\_TIME [n]  
- MD32910 \$MA\_DYN\_MATCH\_TIME [n]  
- MD36200 \$MA\_AX\_VELO\_LIMIT [n]

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**25201 Axis %1 drive fault**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** For PROFIdrive:  
The drive signals a serious fault which prevents the drive from being ready. The exact cause of the fault can be found by evaluating the additionally output drive alarms (It may be necessary to activate these diagnostic alarms by parameterizing the MDs DRIVE\_FUNCTION\_MASK, PROFIBUS\_ALARM\_ACCESS etc):  
Alarms 380500 and 380501 (or the corresponding alarm numbers implemented on the HMI side).  
The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Evaluation of the drive alarms listed above.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**25202 Axis %1 waiting for drive**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** Drive group error (self-clearing).

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** For PROFIdrive only:  
Wait for the drive. This alarm reveals similar problems to alarm 25201 (see that alarm). It is continuously active during power-up if the drive does not communicate (e.g. if the PROFIBUS connector has fallen out). Otherwise, the alarm is active only briefly and is replaced by alarm 25201 after an internal timeout in the event of a permanent problem.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>25220</b>	<b>Axis %1 gear ratio changed with ESR enabled</b>
<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	<p>Because a change in the gear ratio has an effect on the retraction path traveled by the drive, no changes may be made to the gear ratio during the following periods of time:</p> <ul style="list-style-type: none"> <li>- Between the last programming of the retraction path with ESRR and the ESR enable</li> <li>- As from ESR enable</li> </ul> <p>The following machine data define the gear ratios of an axis</p> <p>MD31050 \$MA_DRIVE_AX_RATIO_DENOM  MD31060 \$MA_DRIVE_AX_RATIO_NUMERA  MD31064 \$MA_DRIVE_AX_RATIO2_DENOM  MD31066 \$MA_DRIVE_AX_RATIO2_NUMERA</p> <p>The gear ratio must not be changed during the periods of time described above, e.g. by changing the parameter set.</p>
<b>Reaction:</b>	<p>NC Start disable in this channel.  Interface signals are set.  Alarm display.  NC Stop on alarm.</p>
<b>Remedy:</b>	<p>If ESR enable is missing:</p> <ul style="list-style-type: none"> <li>- Change the gear ratio before programming the retraction path with ESRR</li> </ul> <p>or</p> <ul style="list-style-type: none"> <li>- Reprogram the retraction path with ESRR after changing the gear ratio</li> </ul> <p>Then re-enable ESR.</p>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>26000</b>	<b>Axis %1 clamping monitoring</b>
<b>Parameters:</b>	%1 = Axis name, spindle number
<b>Definitions:</b>	<p>The clamped axis has been pushed out of its setpoint position. The permissible difference is defined in the axis-specific MD36050 \$MA_CLAMP_POS_TOL.</p> <p>Clamping an axis is activated with the axis-specific interface signal DB31, ... DBX2.3 (Clamping process active).  The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).</p>
<b>Reaction:</b>	<p>Mode group not ready.  The NC switches to follow-up mode.  Channel not ready.  NC Start disable in this channel.  Interface signals are set.  Alarm display.  NC Stop on alarm.  Channel not ready.</p>
<b>Remedy:</b>	Determine the position deviation to the setpoint position and, depending on the results, either increase the permissible tolerance in the MD or mechanically improve the clamping (e.g. increase clamping pressure).
<b>Program Continuation:</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

<b>26001</b>	<b>Axis %1 parameterization error: friction compensation</b>
--------------	--

<b>Parameters:</b>	%1 = Axis name, spindle number
--------------------	--------------------------------

**Definitions:** The parameterization of the adaptation characteristic in the quadrant error compensation is not allowed because acceleration value 2 (MD32560 \$MA\_FRICT\_COMP\_ACCEL2 is not between acceleration value 1 (MD32550 \$MA\_FRICT\_COMP\_ACCEL1) and acceleration value 3 (MD32570 \$MA\_FRICT\_COMP\_ACCEL3). The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
Check the setting parameters of the quadrant error compensation (friction compensation), if necessary switch off the compensation with MD32500 \$MA\_FRICT\_COMP\_ENABLE.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**26002 Axis %1 encoder %2 parameterization error: number of encoder marks**

**Parameters:** %1 = Axis name, spindle number  
%2 = Encoder number

**Definitions:** 1. Rotary measuring system (MD31000 \$MA\_ENC\_IS\_LINEAR[]==FALSE)  
The number of encoder marks set in MD31020 \$MA\_ENC\_RESOL[] does not correspond to the value in the drive machine data (SIMODRIVE 611D: MD1005 \$MD\_ENC\_RESOL\_MOTOR; PROFIdrive: p979) or zero has been entered in one of the two machine data.  
2. Absolute measuring system with EnDat interface (MD30240 \$MA\_ENC\_TYPE[]==4)  
On absolute encoders, the resolution of the incremental and absolute tracks supplied by the drive is also checked for consistency.  
For PROFIdrive drives:  
Compare drive parameter p979 (and possibly other internal drive, manufacture-specific parameters stated in the relevant drive documentation) or compare images in NC-MDs \$MA\_ENC\_RESOL, \$MA\_ENC\_PULSE\_MULT, \$MA\_ENC\_ABS\_TURNS\_MODULO etc.  
Conditions leading to triggering the alarm are:  
\* Number of encoder pulses in the drive!= \$MA\_ENC\_RESOL  
\* PROFIdrive interface standardization/high resolution in p979 not permitted (permitted pushing factor 0...30 bits)  
\* With absolute encoders: Interface formats in p979 for absolute and incremental information does not fit together (i.e. the absolute position in XIST2 is supplied in too coarse resolution for a complete position reconstruction)  
\* In the case of rotary absolute encoders behind the gears (and activer traversing range extension in accordance with \$MA\_ENC\_ABS\_BUFFERING): Absolute position format (in Gx\_XIST2) is complete/sufficient for position reconstruction via PowerOff in accordance with the following condition:  
\$MA\_ENC\_RESOL\*\$MA\_ENC\_PULSE\_MULT\*\$MA\_ENC\_ABS\_TURNS\_MODULO must not be smaller than 2\*\*32.  
A remedy against alarm triggering in the latter case may be to increase \$MA\_ENC\_PULSE\_MULT (or the associated drive-side parameterization e.g. p418/419 with SINAMICS) or (when the necessary conditions prevail) by deactivating the traversing range extension - see \$MA\_ENC\_ABS\_BUFFERING

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
Adjust machine data.  
For absolute encoders, possibly pending drive alarms indicating encoder problems should be evaluated. They could be the cause of incorrect entries of MD1022 \$MD\_ENC\_ABS\_RESOL\_MOTOR/MD1032 \$MD\_ENC\_ABS\_RESOL\_DIRECT, which the drive reads out of the encoder itself.

---

**Program Continuation:** Switch control OFF - ON.

---

---

**26003 Axis %1 parameterization error: lead screw pitch**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The pitch of the ballscrew/trapezoidal leadscrew set in the axis-specific MD31030 \$MA\_LEADSCREW\_PITCH is zero. The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Determine the leadscrew pitch (specify the machine manufacturer or pitch measurement with spindle cover removed) and enter it in the MD31030: \$MA\_LEADSCREW\_PITCH (mostly 10 or 5 mm/rev.).

**Program Continuation:** Switch control OFF - ON.

---

---

**26004 Axis %1 encoder %2 parameterization error: grid point distance with linear encoders**

**Parameters:** %1 = Axis name, spindle number  
%2 = Encoder number

**Definitions:** The scale division of the linear scale set in the axis-specific MD31010 \$MA\_ENC\_GRID\_POINT\_DIST is zero or differs from the corresponding drive parameters. For a better understanding of the interrelations see the explanations for alarm 26002, which refer to rotatory encoders. The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
Enter the encoder grid point distance according to the data given by the machine (or measuring device) manufacturer in the MD31010 \$MA\_ENC\_GRID\_POINT\_DIST.

**Program Continuation:** Switch control OFF - ON.

---

---

**26005 Axis %1 parameterization error: output rating**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** For analog drives:  
 The output evaluation of the analog speed setpoint set in the MD32250 \$MA\_RATED\_OUTVAL or in MD 32260 \$MA\_RATED\_VELO is zero.  
 For PROFIdrive drives: (ADI4, SIMODRIVE 611U, SINAMICS):  
 The effective output evaluation of the speed setpoint interface is zero:  
 -  
 b. The corresponding drive-side standardizing parameter is zero, invalid or unreadable/unavailable although an automatic interface scaling adjustment has been selected on account of MD32250 \$MA\_RATED\_OUTVAL=0.  
 The drive parameter defining the standard is not determined by PROFIdrive, but is specific to the manufacturer (see the relevant drive documentation: For SIMODRIVE 611U: p880; for SINAMICS: p2000).  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** Please inform the authorized personnel/service department. The nominal output voltage in [%] of the maximum setpoint value (10 V) is entered in the MD32250 \$MA\_RATED\_OUTVAL, at which the rated motor speed in [degrees/s] is to be reached (MD32260 \$MA\_RATED\_VELO).

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**26006 Axis %1 encoder %2 encoder type/output type %3 not possible**

**Parameters:** %1 = Axis name, spindle number  
 %2 = Encoder number  
 %3 = Encoder type/output type

**Definitions:** Not every encoder type or output type can be used with every control or drive variant.  
 Permissible settings:  
 MD30240 \$MA\_ENC\_TYPE  
 = 0 Simulation (always permissible)  
 = 1 Raw signal incremental encoder (SIMODRIVE 611D and PROFIdrive)  
 = 4 Absolute encoder (EnDat with SIMODRIVE 611D; all drive-side absolute encoders supported by PROFIdrive)  
 MD30130 \$MA\_CTRLOUT\_TYPE  
 = 0 Simulation  
 = 1 Standard (SIMODRIVE 611D and PROFIdrive drives)  
 The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 The NC switches to follow-up mode.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Channel not ready.

**Remedy:** Please inform the authorized personnel/service department.  
 Check machine data MD30240 \$MA\_ENC\_TYPE and/or MD30130 \$MA\_CTRLOUT\_TYPE and make the necessary corrections.

**Program Continuation:** Switch control OFF - ON.

---

**26007 Axis %1 QEC: invalid coarse step size**

**Parameters:** %1 = Axis name, spindle number



**Definitions:** The course step width for QEC must be within the range  $1 \leq \text{course step width} \leq \text{maximum value of MD18342 } \$MN\_MM\_QEC\_MAX\_POINTS$  (currently 1025), because a greater number of values would exceed the available memory space.

**Reaction:** Alarm display.

**Remedy:** Modify the system variable  $\$AA\_QEC\_COARSE\_STEPS$  accordingly.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

### 26008 Axis %1 QEC: invalid fine step size

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The fine step size for quadrant error compensation  $\$AA\_QEC\_FINE\_STEPS$  must be in the range  $1 \leq \text{fine step size} \leq 16$  because this value has an influence on the computation time of the QEC.

**Reaction:** Alarm display.

**Remedy:** Modify the system variable  $\$AA\_QEC\_FINE\_STEPS$  accordingly.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

### 26009 Axis %1 QEC: memory overflow

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The product of the data  $\$AA\_QEC\_COARSE\_STEPS+1$  and  $\$AA\_QEC\_FINE\_STEPS$  must not exceed the maximum number of the characteristic curve points (MD38010  $\$MA\_MM\_QEC\_MAX\_POINTS$ ). With a direction-dependent characteristic, this criterion applies to  $2 * (\$AA\_QEC\_COARSE\_STEPS+1) * \$AA\_QEC\_FINE\_STEPS!$

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Either increase MD38010  $\$MA\_MM\_QEC\_MAX\_POINTS$  or reduce  $\$AA\_QEC\_COARSE\_STEPS$  and/or  $\$AA\_QEC\_FINE\_STEPS$ .

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

### 26010 Axis %1 QEC: invalid acceleration characteristic

**Parameters:** %1 = Axis name, spindle number

**Definitions:**  $\$AA\_QEC\_ACCEL\_1/2/3$ : The acceleration characteristic is divided into three areas. In each area there is a different quantization of the acceleration steps. The defaults should be changed only if compensation is inadequate in these acceleration areas.  
The defaults are as follows:  
-  $\$AA\_QEC\_ACCEL\_1$  with approx. 2% of maximum acceleration ( $\$AA\_QEC\_ACCEL\_3$ ),  
-  $\$AA\_QEC\_ACCEL\_2$  with approx. 60% of maximum acceleration ( $\$AA\_QEC\_ACCEL\_3$ ),  
-  $\$AA\_QEC\_ACCEL\_3$  with maximum acceleration (MD32300  $\$MA\_MAX\_AX\_ACCEL$ ).

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Enter the values correctly:  
 $0 < \$AA\_QEC\_ACCEL\_1 < \$AA\_QEC\_ACCEL\_2 < \$AA\_QEC\_ACCEL\_3$ .

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

### 26011 Axis %1 QEC: invalid measuring periods

**Parameters:** %1 = Axis name, spindle number

**Definitions:** \$AA\_QEC\_MEAS\_TIME\_1/2/3: measuring time to determine the error criterion.  
 The measuring period begins when the criterion for activating the compensation value has been satisfied (the desired velocity changes the sign). The end is defined by the machine data values. In general, different measuring times are required for the three characteristic ranges. The presettings should be changed only if a problem occurs. The three data apply in each case for the three corresponding acceleration ranges.  
 1. \$AA\_QEC\_MEAS\_TIME\_1 specifies the measuring time (for determining the error criterion) for accelerations in the range between 0 and \$AA\_QEC\_ACCEL\_1.  
 2. \$AA\_QEC\_MEAS\_TIME\_2 specifies the measuring time in the range from \$AA\_QEC\_ACCEL\_1 to \$AA\_QEC\_ACCEL\_2.  
 3. \$AA\_QEC\_MEAS\_TIME\_3 specifies the measuring time in the range from \$AA\_QEC\_ACCEL\_2 to \$AA\_QEC\_ACCEL\_3 and beyond.

**Reaction:** Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Enter the values correctly:  $0 < \$AA\_QEC\_MEAS\_TIME\_1 < \$AA\_QEC\_MEAS\_TIME\_2 < \$AA\_QEC\_MEAS\_TIME\_3$ .

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**26012 Axis %1 QEC: feed forward control not active**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The error criterion for determining the quadrant error necessitates a correctly set feedforward control. The alarm can be reprogrammed in the MD11412 \$MN\_ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Alarm display.  
 Channel not ready.

**Remedy:** Switch on feedforward control and set it correctly.

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

**26014 Axis %1 machine data %2 invalid value**

**Parameters:** %1 = Axis name, spindle number  
 %2 = String: MD identifier

**Definitions:** Machine data includes a value that is not valid.

**Reaction:** NC not ready.  
 The NC switches to follow-up mode.  
 Mode group not ready, also effective for single axes.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Repeat entry with correct value and then Power On.

**Program Continuation:** Switch control OFF - ON.

**26015 Axis %1 machine data %2[%3] invalid value**

**Parameters:** %1 = Axis name, spindle number  
 %2 = String: MD identifier  
 %3 = Index: MD array index

---

<b>Definitions:</b>	Machine data includes a value that is not valid.
<b>Reaction:</b>	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Repeat entry with correct value and then Power On.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

### **26016            Axis %1 machine data %2 invalid value**

<b>Parameters:</b>	%1 = Axis name, spindle number %2 = String: MD identifier
<b>Definitions:</b>	Machine data includes a value that is not valid.
<b>Reaction:</b>	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Repeat entry with correct value and then Reset.
<b>Program</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
<b>Continuation:</b>	

---

### **26017            Axis %1 machine data %2[%3] invalid value**

<b>Parameters:</b>	%1 = Axis name, spindle number %2 = String: MD identifier %3 = Index: MD array
<b>Definitions:</b>	Machine data includes a value that is not valid.
<b>Reaction:</b>	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Repeat entry with correct value and then Reset.
<b>Program</b>	Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
<b>Continuation:</b>	

---

### **26018            Axis %1 setpoint output drive %2 used more than once**

<b>Parameters:</b>	%1 = Axis name, spindle number %2 = Drive number
--------------------	---

**Definitions:** The same setpoint assignment has been allocated more than once.  
MD30110 \$MA\_CTRLLOUT\_MODULE\_NR contains the same value for different axes.  
PROFIdrive: The stated MDs contain the same values for different axes, or different entries in \$MN\_DRIVE\_LOGIC\_ADDRESS contain the same values.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please inform the authorized personnel/service department. Avoid dual assignment of the setpoint by correcting MD30110 \$MA\_CTRLLOUT\_MODULE\_NR. Also check the selected bus type MD30100 \$MA\_CTRLLOUT\_SEGMENT\_NR.

**Program Continuation:** Switch control OFF - ON.

**26019 Axis %1 encoder %2 measurement not possible with this controller module**

**Parameters:** %1 = NC axis number  
%2 = Encoder number

**Definitions:** If the MD MD13100 \$MN\_DRIVE\_DIAGNOSIS[8] contains a value not equal to zero, then the control has found at least one control module which does not support measuring. Measuring was programmed from the part program for the associated axis.

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** If possible, modify the measuring motion such that the axis concerned does not have to travel; do not program this axis in the MEAS block again. However, it is then no longer possible to query a measured value for this axis. Otherwise, exchange the controller module for one that supports measuring. See MD13100 \$MN\_DRIVE\_DIAGNOSIS[8].

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**26022 Axis %1 encoder %2 measurement with simulated encoder not possible**

**Parameters:** %1 = NC axis number  
%2 = Encoder number

**Definitions:** Alarm occurs on the control when a measurement was made without the encoder hardware (simulated encoder).

**Reaction:** Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Please inform the authorized personnel/service department.  
- If possible, modify the measuring motion such that the axis concerned does not have to travel; do not program this axis in the MEAS block again. However, it is then no longer possible to query a measured value for this axis.  
- Ensure that measurement is not taking place with simulated encoders (MD30240 \$MA\_ENC\_TYPE).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**26024 Axis %1 machine data %2 value changed**

**Parameters:** %1 = Axis name, spindle number  
%2 = String: MD identifier

**Definitions:** The machine data contains an invalid value and therefore has been changed by the software.

**Reaction:** Alarm display.

**Remedy:** Check MD.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**26025 Axis %1 machine data %2[%3] value changed**

**Parameters:** %1 = Axis name, spindle number  
%2 = String: MD identifier  
%3 = Index: MD array index

**Definitions:** The machine data contains an invalid value. It was therefore changed by the software internally to a valid value.

**Reaction:** Alarm display.

**Remedy:** Check MD.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**26026 Axis %1 SINAMICS drive parameter P2038 value is not allowed.**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** For SINAMICS drives only:  
The interface mode, which is set via drive parameter P2038, has not been set to SIMODRIVE 611 universal.  
The alarm can be disabled by MD13070 \$MN\_DRIVE\_FUNCTION\_MASK - bit15.  
However, the following must be noted:  
- The device-specific assignment of the bits in the control and status words may be different.  
- The drive data sets can be created at will, and need not be subdivided into groups of 8. (For details see also SINAMICS Commissioning Manual). So the parameters of motors 2-4 may be incorrectly assigned.

**Reaction:** NC not ready.  
The NC switches to follow-up mode.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Set P2038 = 1 or  
- Set P0922 = 100...199 or  
- Set bit 15 of MD13070 \$MN\_DRIVE\_FUNCTION\_MASK (note the boundary conditions, see above) and execute a Power ON in each case.

**Program** Switch control OFF - ON.

**Continuation:**

---

**26030 Axis %1 encoder %2 absolute position lost**

**Parameters:** %1 = Axis name, spindle number  
%2 = Encoder number

**Definitions:** The absolute position of the absolute encoder has become invalid because  
- on changing parameter block a changed gear stage ratio was identified between encoder and processing or  
- the encoder has been replaced (the absolute encoder's serial number has changed, see MD34230 \$MA\_ENC\_SERIAL\_NUMBER, and drive-specific parameters).

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Axes of this channel must be re-referenced.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.

**Remedy:** Please inform the authorized personnel/service department. Rereferencing/resynchronization of the absolute encoder; attach absolute encoder on the load side and configure correctly (e.g. MD 31040 \$MA\_ENC\_IS\_DIRECT).

**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**26031 Axis %1 configuration error master-slave**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** The alarm is output when the same machine axis has been configured as a master and a slave axis. Each of the axes in the master/slave link can be operated either as master or slave.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Check machine data for all linked axes and correct if necessary:  
- MD 37250 \$MA\_MS\_ASSIGN\_MASTER\_SPEED\_CMD  
- MD 37252 \$MA\_MS\_ASSIGN\_MASTER\_TORQUE\_CTR.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**26032 [Channel %1:] Axis %2 master-slave not configured**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** The master-slave coupling could not be activated because of incomplete configuration.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the current configuration of the master-slave coupling.  
The configuration can be modified via the MASLDEF instruction or the machine data MD37250 \$MA\_MS\_ASSIGN\_MASTER\_SPEED\_CMD and MD37252 \$MA\_MS\_ASSIGN\_MASTER\_TORQUE\_CTR.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>26050</b>	<b>Axis %1 parameter set change from %2 to %3 not possible</b>
<b>Parameters:</b>	%1 = Axis name, spindle number %2 = Index: current parameter block %3 = Index: new parameter block
<b>Definitions:</b>	The parameter block change cannot be performed without jumps. This is due to the content of the parameter block to be switched on, e.g. different load gear factors.
<b>Reaction:</b>	The NC switches to follow-up mode. Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	In the following cases, the parameter block change is carried out via MD31060 \$MA_DRIVE_AX_RATIO_NUMERA and MD31050 \$MA_DRIVE_AX_RATIO_DENOM without an alarm, even with different load gear ratio settings: 1. If no position control is active (e.g. in follow-up mode or if spindle is in speed-controlled mode). 2. For position control with the direct encoder. 3. For position control with the indirect encoder (the calculated load position difference must not exceed the value indicated in MD36500 \$MA_ENC_CHANGE_TOL).
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>26051</b>	<b>[Channel %1: ] In block %2 unanticipated stop crossed in continuous path mode</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The path interpolation did not stop, as required, at the end of the block, but will only decelerate to a standstill in the next block. This error situation occurs if the stop at block change was not planned by the path interpolation or was not detected early enough. A possible cause is that the PLC changed the spindle speed when MD35500 \$MA_SPIND_ON_SPEED_AT_IPO_START > 0, and the machine has to wait until the spindle has returned to the setpoint range. Another possible cause is that a synchronized action needs to be finished before the path interpolation continues. The alarm is only output if MD11400 \$MN_TRACE_SELECT = 'H400'. The alarm output is normally suppressed. - MD11400 \$MN_TRACE_SELECT has SIEMENS password protection.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	MD35500 \$MA_SPIND_ON_SPEED_AT_IPO_START = 1. Program G09 before the alarm output in the block to allow the path interpolation to stop as planned.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>26052</b>	<b>[Channel %1: ] In block %2: path velocity too high for auxiliary function output</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	This alarm usually occurs in a block with auxiliary function output during a movement. In this case, the wait for acknowledgement of the auxiliary function was longer than planned. The alarm also occurs if internal control inconsistencies cause continuous path mode (G64, G641, ...) to be blocked unexpectedly. The path interpolation stops abruptly at the end of the block indicated in the message (regenerative stop). On the next block change, the path continues unless the abrupt stop has caused an error in the position controller (e.g. because MD36400 \$MA_CONTOUR_TOL setting was over-sensitive).
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	- If the alarm occurred in a block with auxiliary function output during the movement: from SW 5.1 or higher, increase machine MD10110 \$MN_PLC_CYCLE_TIME_AVERAGE or - Program G09 in the block indicated in the message to allow the path interpolation to stop as planned.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**26053 [Channel %1: ] Block %2 interpolation problem in Look Ahead (module %3, identifier %4)**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Module identifier  
%4 = Error code

**Definitions:** Synchronism between interpolation and preparation is faulty.

**Reaction:** Interpreter stop  
Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Please contact Siemens.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**26054 [Channel %1: ] Block %2 interpolation warning in Look Ahead (module %3, problem %4)**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Module identifier  
%4 = Error code

**Definitions:** The computer performance is inadequate to create a smooth path velocity profile. This can lead to drops in velocity.

**Reaction:** Local alarm reaction.  
Alarm display.  
Warning display.

**Remedy:** Change parameterization. Increase interpolation cycle.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**26070 [Channel %1: ] Axis %2 cannot be controlled by the PLC, max. number exceeded**

**Parameters:** %1 = Channel number  
%2 = Axis name, spindle number

**Definitions:** An attempt was made to define more axes than allowed as PLC-controlled axes.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Check the option 'Number of PLC-controlled axes' and correct if necessary or reduce the number of requests for PLC-controlled axes.

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>26072</b>	<b>[Channel %1: ] Axis %2 cannot be controlled by the PLC</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number
<b>Definitions:</b>	Axis cannot be made a PLC-controlled axis. For the time being, the axis cannot be controlled at any state from the PLC.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	Use Release or Waitp to make the axis a neutral one.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>26074</b>	<b>[Channel %1: ] Switching off PLC control of axis %2 not allowed in the current state</b>
<b>Parameters:</b>	%1 = Channel %2 = Axis, spindle
<b>Definitions:</b>	The PLC can return the control rights for an axis to program processing only, if the axis is in READY state.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reset VDI interface signal "PLC controls axis", then activate "Axial reset" and repeat process.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

---

<b>26075</b>	<b>[Channel %1: ] Axis %2 not available for the NC program, as exclusively controlled by the PLC</b>
<b>Parameters:</b>	%1 = Channel %2 = Axis, spindle
<b>Definitions:</b>	The axis is exclusively controlled by the PLC. Therefore, the axis is not available for the NC program.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Have the axis not exclusively controlled by the PLC, but only temporarily. Change MD30460 \$MA_BASE_FUNCTION_MASK, bit 4.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>26076</b>	<b>[Channel %1: ] Axis %2 not available for NC program, firmly assigned PLC axis</b>
<b>Parameters:</b>	%1 = Channel %2 = Axis, spindle
<b>Definitions:</b>	The axis is a firmly assigned PLC axis. The axis is therefore not available for the NC program.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Do not define axis as a firmly assigned PLC axis. Change of MD30460 \$MA_BASE_FUNCTION_MASK bit5.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**26100 Axis %1 drive %2 sign of life missing**

**Parameters:** %1 = Axis name, spindle number  
%2 = Drive number

**Definitions:** Special case: The output of drive number=0 indicates that a computing timeout occurred on the IPO level (see also alarm 4240)

**Reaction:** NC not ready.  
The NC switches to follow-up mode.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Restart drive, check drive software.

**Program Continuation:** Switch control OFF - ON.

---

**26101 Axis %1 drive %2 communication failure**

**Parameters:** %1 = Axis name, spindle number  
%2 = Drive number

**Definitions:** For PROFIdrive only:  
The drive is not communicating.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Axes of this channel must be re-referenced.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Check the bus configuration.  
- Check the interface (connector removed, option module inactive, etc.).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**26102 Axis %1 drive %2 sign of life missing**

**Parameters:** %1 = Axis name, spindle number  
%2 = Drive number

**Definitions:** For PROFIdrive only:  
The sign-of-life cell is no longer being updated by the drive.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Axes of this channel must be re-referenced.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Check the cycle settings (recommendation: e.g. MD10062 \$MN\_POSCTRL\_CYCLE\_DELAY = 0.0)  
- Increase the cycle time if necessary.  
- Power-up the drive again.  
- Check drive software.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

## 26105 Drive of axis %1 not found

**Parameters:** %1 = Axis name, spindle number

**Definitions:** For PROFIdrive only:  
The drive configured for the specified axis could not be found. For example, a PROFIBUS slave was configured on the NC but is not contained in SDB-Type-2000.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Possible causes:  
- MD30130 \$MA\_CTRLOUT\_TYPE not equal to 0 as a result of an oversight; the drive should actually be simulated (= 0).  
- MD30110 \$MA\_CTRLOUT\_MODULE\_NR entered incorrectly, i.e. the logical drive numbers were exchanged and an invalid value is stored for this drive in MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS (see 3.) or a drive number which does not exist on the bus was entered (check the number for slaves, for example).  
- MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS contains values which were not configured on the Profibus (i.e. the values are not in SDB-Type-2000) or different addresses were selected for the input and output slots of the drive in the Profibus configuration.

**Program Continuation:** Switch control OFF - ON.

## 26106 Encoder %2 of axis %1 not found

**Parameters:** %1 = Axis name, spindle number  
%2 = Encoder number

**Definitions:** For PROFIdrive only:  
The encoder configured for the specified axis could not be found. For example, a PROFIBUS slave was configured on the NC but it is not contained in the SDB or defective hardware was reported for it.

**Reaction:** Mode group not ready.  
The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Possible causes:  
- MD 30240 \$MA\_ENC\_TYPE not equal to 0 as a result of an oversight; the encoder should actually be simulated (= 0).  
- MD 30220 \$MA\_ENC\_MODULE\_NR entered incorrectly, i.e. the logical drive numbers were transposed and an invalid value is stored for this drive in MD 13050 \$MN\_DRIVE\_LOGIC\_ADDRESS (see next paragraph), or a drive number which does not exist on the bus was entered (check the number for slaves, for example).  
- MD 13050 \$MN\_DRIVE\_LOGIC\_ADDRESS contains values which were not configured on the Profibus (i.e. the values are not in SDB Type 2000) or different addresses were selected for the input and output slots of the drive in the Profibus configuration.  
- A fatal encoder error was detected during the selection of the encoder (encoder defective, removed), so that park status cannot be left (in such a case, this alarm is triggered instead of alarm 25000/25001 - please refer to them for other possible causes of the error).

**Program Continuation:** Switch control OFF - ON.

**26110 Independent drive stop/retract triggered**

**Definitions:** For SINAMICS only:  
Informational alarm: At least in one axis, a "drive-autonomous shutdown or retraction" was triggered.

**Reaction:** NC not ready.  
The NC switches to follow-up mode.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Deselect drive-autonomous stop or retraction. acknowledge alarm with reset.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**26120 [Channel %1: ] Axis %2 \$AA\_ESR\_ENABLE = 1 but axis should be set to NEUTRAL**

**Parameters:** %1 = Channel  
%2 = Axis, spindle

**Definitions:** One axis with ESR configuration and \$AA\_ESR\_ENABLE[Achse] = 1 should be set to NEUTRAL.  
However, neutral axes (apart from single axes) cannot execute an ESR.

**Reaction:** Alarm display.

**Remedy:** Set \$AA\_ESR\_ENABLE[Achse] = 0 before setting axis to NEUTRAL.  
Alarm can be suppressed via MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 6 = 1.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**26121 [Channel %1: ] Axis %2 is NEUTRAL and \$AA\_ESR\_ENABLE = 1 should be set**

**Parameters:** %1 = Channel  
%2 = Axis, spindle

**Definitions:** \$AA\_ESR\_ENABLE[Achse] = 1 should not be set to neutral axes (apart from single axes).  
Neutral axes (apart from single axes) cannot execute an ESR.

**Reaction:** Alarm display.

**Remedy:** Do not apply \$AA\_ESR\_ENABLE[Achse] = 1 to neutral axes (apart from single axes).  
Alarm can be suppressed via MD11415 \$MN\_SUPPRESS\_ALARM\_MASK\_2 bit 6 = 1.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**26122 [Channel %1: ] Axis %2, \$AA\_ESR\_ENABLE = 1, axis exchange not executed in this state**

**Parameters:** %1 = Channel  
%2 = Axis, spindle

**Definitions:** With \$AA\_ESR\_ENABLE[Achse] = 1 axis exchange not permitted.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Set \$AA\_ESR\_ENABLE[axis] = 0 before axis exchange.

**Program Continuation:** Clear alarm with the RESET key. Restart part program  
Set \$AA\_ESR\_ENABLE[axis] = 0

---

<b>26124</b>	<b>[Channel %1: ] Axis %2, \$AC_ESR_TRIGGER triggered but axis is NEUTRAL and cannot execute ESR</b>
<b>Parameters:</b>	%1 = Channel %2 = Axis, spindle
<b>Definitions:</b>	Channel-specific ESR (\$AC_ESR_TRIGGER) triggered, but one axis with ESR configuration is NEUTRAL at the time of triggering. Neutral axes are ignored with ESR (apart from single axes which react only to \$AA_ESR_TRIGGER[Ax]).
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	\$AA_ESR_ENABLE[Achse] = 1 should not be set with neutral axes. Alarm can be suppressed via MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 6 = 1.
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>26126</b>	<b>[channel %1: ] block %2 axis %3: ESRR or ESRS could not be executed, error code %4</b>
<b>Parameters:</b>	%1 = Channel %2 = Block number, label %3 = Axis, spindle %4 = Error code
<b>Definitions:</b>	Writing the data of the part program commands ESRR or ESRS could not be executed. Error code: 1: The indicated axis is not assigned to any axis. 2: One or more ESR parameters in SINAMICS are not available. 3: Writing of one or more ESR parameters in SINAMICS was prevented.
<b>Reaction:</b>	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
<b>Remedy:</b>	Error code: 1: Check the assignment of the NC axes to the drives. 2: One or more ESR parameters in SINAMICS are not available. Check the assignment of the NC axes to the drives. Programming of ESRR or ESRS is possible only for SINAMICS as from V4.4. The function module "drive-autonomous stop and retract" in SINAMICS not active. 3: Writing one or more ESR parameters in SINAMICS was prevented. Activate the output of additional information alarms through MD11411 \$MN_ENABLE_ALARM_MASK, bit 1 = 1.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program Writing of the data of the part program commands ESRR or ESRS was refused. Check programming Acknowledge alarm with reset

---

<b>26200</b>	<b>[Channel %1: ] Block %2: The names of the kinematic chains \$NK_CHAIN_NAME[%3] and \$NK_CHAIN_NAME[%4] are the same]</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index of 1st chain %4 = Index of 2nd chain
<b>Definitions:</b>	There are (at least) two kinematic chains with the same name. The names of the kinematic chains must be clear and identifiable.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.

**Remedy:** - Change name of involved kinematic chains  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**26202** [Channel %1: ] Block %2: The names of the kinematic chain links \$NK\_NAME[%3] and \$NK\_NAME[%4] are the same]

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of 1st chain element  
%4 = Index of 2nd chain element

**Definitions:** There are (at least) two kinematic chain links with the same name. The names of the kinematic chain links must be clear and identifiable.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** - Change the names of the kinematic chain links involved  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**26204** [Channel %1: ] Block %2: The chain element %3 referred to in \$NK\_NEXT[%4] is already contained in the chain

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Name of the next chain link  
%4 = Index of the chain element

**Definitions:** In one chain link, the next link of the chain is indicated as a chain link already in existence in the chain. This allows you to define a not permitted closed chain.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Define the kinematic chain in such a way that no closed chain results.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

**26206** [Channel %1: ] Block %2: The chain element %3, referred to in \$NK\_1ST\_ELEM[%4], was not found

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Name of first chain link  
%4 = Index of chain

**Definitions:** The chain link indicated as the first link in a kinematic chain was not found.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate in \$NK\_1ST\_ELEM[...] the name of an existing chain link.  
**Program** Clear alarm with NC START or RESET key and continue the program.  
**Continuation:**

---

<b>26208</b>	<b>[Channel %1: ] Block %2: Chain element %3, referred to in \$NK_NEXT[%4], was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of the next chain link %4 = Index of chain link
<b>Definitions:</b>	The chain link indicated as the next link in a kinematic chain was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NK_1ST_NEXT[...] the name of an existing chain link.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26210</b>	<b>[Channel %1: ] Block %2: Chain %3, referred to in \$NK_NEXTP[%4], was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of the next chain link %4 = Index of chain link
<b>Definitions:</b>	The stated parallel chain was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Enter the name of an existing chain in \$NK_NEXTP[...]
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26212</b>	<b>[Channel %1: ] Block %2: Maximum number of %3 chain elements exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Maximum number of chain links
<b>Definitions:</b>	The maximum permitted number of chain links contained in all chains is too large. When determining the maximum number, a single chain link contained in several chains is counted several times.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce number of chain links contained in all chains. This can be achieved e.g. by deactivating individual and currently not required chains and by entering the zero string in the name of the chain.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26214</b>	<b>[channel %1: ] block %2: The maximum permitted value of the fine offset in the component \$NK_OFF_DIR_FINE of the chain element %3 was exceeded.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index of the chain element

**Definitions:** If the chain element referring to this alarm describes a constant offset, the following applies: The amount of the value in a component \$NK\_OFF\_DIR\_FINE is larger than the limit value permitted by \$NK\_OFF\_DIR\_FINE\_LIM.  
 If the chain element referring to this alarm describes an axis, the following applies: The angle between the axis direction defined by the basic vector (contents of \$NK\_OFF\_DIR) and the axis direction formed by the sum vector and defined by the basic vector and the fine offset vector (contents of \$NK\_OFF\_DIR\_FINE) is larger than the limit value permitted by \$NK\_OFF\_DIR\_FINE\_LIM.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Reduce the value in the specified component, or increase the permissible limit value in \$NK\_OFF\_DIR\_FINE\_LIM.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26215 [channel %1: ] block %2: The maximum permitted value of the fine offset in the component \$NK\_A\_OFF\_FINE of the chain element %3 was exceeded.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Index of the chain element

**Definitions:** The amount of the value in \$NK\_A\_OFF\_FINE is larger than the limit value permitted by \$NK\_A\_OFF\_FINE\_LIM.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Reduce the amount of the value in the named component or increase the permitted limit value in \$NK\_A\_OFF\_FINE\_LIM.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26216 [Channel %1: ] Block %2: The axis direction in chain element %3 has not been defined.**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Fine offset value

**Definitions:** The chain element describes an axis, the direction of which is defined by the value included in \$NK\_OFF\_DIR and \$NK\_OFF\_DIR\_FINE. The definition is valid only if the value of the sum vector and the value of the basic vector \$NK\_OFF\_DIR are higher than 1.0e-6.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Enter valid vectors in \$NK\_OFF\_DIR and/or \$NK\_OFF\_DIR\_FINE, or change the type of the chain element.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26218 [Channel %1: ] Block %2: Invalid name in %3[%4]**

**Parameters:** %1 = Channel number  
 %2 = Block number, label  
 %3 = Name of the system variable  
 %4 = Index of the system variable

**Definitions:** A system variable of type STRING contains an invalid name.

**Reaction:** Correction block is reorganized.  
 Interface signals are set.  
 Alarm display.



**Remedy:** Use a permissible name.  
The permissible names can be found in the documentation of the system variables involved.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26222 [Channel %1: ] Block %2: The names of the protection areas \$NP\_PROT\_NAME[%3] and \$NP\_PROT\_NAME[%4] are the same**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of 1st protection area  
%4 = Index of 2nd protection area

**Definitions:** Two protection areas were assigned the same name. The names of the protection areas must be clear and identifiable.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Rename one of the protection areas involved.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26224 [Channel %1: ] Block %2: The names of the protection area elements \$NP\_NAME[%3] and \$NP\_NAME[%4] are the same**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of 1st protection area element  
%4 = Index of 2nd protection area element

**Definitions:** Two protection area elements were assigned the same name. The names of the protection area elements must be clear and identifiable.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Rename one of the protection area elements involved.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

**26226 [Channel %1: ] Block %2: Invalid protection area type in \$NP\_TYPE[%3]**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of protection area element

**Definitions:** An invalid protection area type was indicated. The permitted protection area types are defined by the machine data MD18898 \$MN\_PROT\_AREA\_3D\_TYPE\_NAME\_TAB.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate valid protection area type.

**Program**  
**Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26227**                    **[Channel %1: ] Block %2: CAD file not found: %3**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = File name

**Definitions:**            A CAD file referenced with \$NP\_TYPE was not found.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Correct the name in \$NP\_TYPE or load the CAD file of this name into the control.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**26228**                    **[Channel %1: ] Block %2: The protection area element %3, referred to in \$NP\_1ST\_PROT[%4], was not found**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Name of next protection area element  
                              %4 = Index of protection area

**Definitions:**            The protection area element indicated first in a protection area was not found.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Indicate in \$NP\_1ST\_PROT[...] the name of an existing protection area element.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**26230**                    **[Channel %1: ] Block %2: Protection area element %3, referred to in \$NP\_NEXT[%4], was not found**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Name of next protection area element  
                              %4 = Index of protection area

**Definitions:**            The protection area element indicated next in a protection area was not found.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Indicate in \$NP\_NEXT[...] the name of an existing protection area element.

**Program**                    Clear alarm with NC START or RESET key and continue the program.

**Continuation:**

---

**26231**                    **[Channel %1: ] Block %2: The protection zone or the CAD file %3 referred to in \$TC\_TP\_PROTA[%4] was not found.**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Name of tool protection zone (element)  
                              %4 = T number of tool

---

<b>Definitions:</b>	Tool parameter \$TC_TP_PROTA refers to a protection zone and a CAD file. The protection zone and CAD file were not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Enter in \$TC_TP_PROTA[...] the name of an existing protection zone and the name of an existing CAD file.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### **26232 [Channel %1: ] Block %2: Maximum number of %3 protection area elements exceeded**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of next protection area element
<b>Definitions:</b>	The maximum number of permitted protection zone elements has been exceeded.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Reduce number of protection areas or protection area elements.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### **26233 [Channel %1: ] Block %2: The maximum permissible number of tool protection zone elements has been exceeded.**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The maximum permissible number of protection zone elements reserved for the tool has been exceeded.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Increase the number of protection zone elements reserved for the tool (MD18893 \$MN_MM_MAXNUM_3D_T_PROT_ELEM) or reduce the complexity of the tool descriptions.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

### **26234 [Channel %1: ] Block %2: The protection area \$NP\_PROT\_NAME[%3] does not contain any protection area elements**

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index of protection area
<b>Definitions:</b>	A protection area must contain at least one protection area element.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Change definition of protection area or delete protection area.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**26236**                    **[Channel %1: ] Block %2: Protection area element %3, referred to in \$NP\_NEXT[%4], is already contained in the definition chain**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Index of protection area element  
                              %4 = Index of protection area element

**Definitions:**            A closed definition chain was found, i.e. a protection area element contains the protection area of which it is a part.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Change definition of protection area or delete protection area.

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

**26238**                    **[Channel %1: ] Block %2: Protection area %3, referred to in \$NP\_ADD[%4], was not found**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label  
                              %3 = Name of the protection area to be added  
                              %4 = Index of protection area

**Definitions:**            The protection area to be added to the current protection area element was not found.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Indicate in \$NP\_ADD[...] the name of an existing protection area element, define a protection area with the name indicated or delete entry.

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

**26240**                    **[Channel %1: ] Block %2: The protection area indicated in \$NP\_ADD[%3] is linked with a kinematic chain**

**Parameters:**            %1 = Channel number  
                              %2 = Block number  
                              %3 = Index of protection area element

**Definitions:**            Protection areas added to an existing protection area via \$NP\_ADD[...], must not be linked to a kinematic chain, e.g. \$NP\_CHAIN\_NAME[...] and \$NP\_CHAIN\_ELEM[...] must be empty.

**Reaction:**                Correction block is reorganized.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Enter in \$NP\_ADD[...] a protection area not linked with a kinematic chain or delete the reference to a kinematic chain in the protection area to be added or delete the entry in \$NP\_ADD[...].

**Program**  
**Continuation:**            Clear alarm with NC START or RESET key and continue the program.

---

---

<b>26241</b>	<b>[Channel %1: ] Block %2: The tool protection zone %3 (\$NP_PROT_NAME[%4]) contains a reference to a kinematic chain.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Name of 1st protection area %4 = Index of protection area
<b>Definitions:</b>	Defined tool protection zones, which are referred to by the content of tool parameter \$TC_TP_PROTA[T_NUMMER], must not contain any reference to a kinematic chain.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Delete the entries in \$NP_CHAIN_NAME und \$NP_CHAIN_ELEM for the protection zone affected. In \$TC_TP_PROTA, refer to a protection zone that is not attached to a kinematic chain.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26242</b>	<b>[Channel %1: ] Block %2: Name of the kinematic chain in \$NP_CHAIN_NAME[%3] not defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Index of protection area
<b>Definitions:</b>	The name of the element of a kinematic chain was indicated in the protection area in \$NP_CHAIN_ELEM[...]. In this case, it is mandatory to indicate the name itself of the kinematic chain in \$NP_CHAIN_NAME[...].
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NP_CHAIN_NAME[...] the name of a kinematic chain or delete the entry in \$NP_CHAIN_ELEM[...].
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26244</b>	<b>[Channel %1: ] Block %2: Protection area %3, referred to in \$NP_ADD[%4], is already contained in the definition chain</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index of protection area %4 = Index of protection area element
<b>Definitions:</b>	A closed definition chain was found, i.e. a protection area element contains the protection area of which it is a part.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Change definition of the protection area or delete protection area.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**26246 [Channel %1: ] Block %2: Parameter \$NP\_PARA[%3,%4] is invalid**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of protection area element  
%4 = Index of parameters

**Definitions:** An invalid parameter value to define a protection area element was indicated.  
Parameter values must not be negative.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate valid parameter value.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26248 [Channel %1: ] Block %2: The contents (%4) of parameter \$NP\_BIT\_NO[%3] are invalid**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Programmed bit index  
%4 = Index of parameters

**Definitions:** Invalid bit number indicated for the switchover of a preactivated protection area between the states activated / deactivated.  
Bit number must have a value between -1 and 63.  
Whereby -1 means that no interface bit was assigned to the protection area.  
Values between 0 and 63 indicate the index of the interface bit through which the activation state of the protection area is switched over.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate valid index

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26250 [Channel %1: ] Block %2: The names of the protection area groups \$NP\_NAME[%3] and \$NP\_NAME[%4] are the same**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Index of 1st protection area group  
%4 = Index of 2nd protection area group

**Definitions:** Two protection area groups were assigned the same name. The names of the protection area groups must be clear and identifiable.

**Reaction:** Correction block is reorganized.  
Interface signals are set.  
Alarm display.

**Remedy:** Rename one of the protection area groups involved.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>26252</b>	<b>[Channel %1: ] Block %2: Element %4 of the protection area group %3 is not linked with a kinematic chain</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Index of 1st protection area group %4 = Index of 2nd protection area group
<b>Definitions:</b>	Protection areas being elements of a protection area group must be linked with a kinematic chain. Protection areas that are not assigned to any kinematic chain are not relevant for collision monitoring, because their position in the space has not been defined.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Defining the assignment of a protection area to a kinematic chain. Deleting the protection area from the protection area group.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26254</b>	<b>[Channel %1: ] Block %2: The protection area referred to in element %4 of protection area group %3 was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Number of protection area group %4 = Number of the element of the protection area group
<b>Definitions:</b>	The protection area to be added to the current protection area group was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NP_MEMBER_X[...] the name of an existing protection area, define a protection area with the indicated name or delete entry.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26256</b>	<b>[Channel %1: ] Block %2: The protection area group %3 referred to in \$NP_ADD_GROUP[%4] was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of the protection area group to be added %4 = Index of protection area group
<b>Definitions:</b>	The protection area group to be added to the current protection area group was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NP_ADD_GROUP[...] the name of an existing protection area group, define a protection area group with the name indicated or delete entry.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**26260 [Channel %1: ] Block %2: Collision of the two protection areas %3 and %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%3 = Name of 1st protection area  
%4 = Name of 2nd protection area

**Definitions:** The two protection areas named collide in the indicated block, i.e. the distance between the two protection areas is smaller than the value defined by MD10619 \$MN\_COLLISION\_TOLERANCE.

**Reaction:** Correction block is reorganized.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change NC program or definition of the protection areas involved.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26261 [Channel %1: ] The two protection zones %2 and %3 collide**

**Parameters:** %1 = Channel number  
%2 = Name of 1st protection area  
%3 = Name of 2nd protection area

**Definitions:** The two stated protection zones collide.

**Reaction:** Interpreter stop  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change NC program or definition of the protection areas involved.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26262 [Channel %1: ] Not enough memory space during collision test of the two protection zones %2 and %3. Currently available memory space: %4KB.**

**Parameters:** %1 = Channel number  
%2 = Name of 1st protection area  
%3 = Name of 2nd protection area  
%4 = Currently available memory

**Definitions:** The collision check of two protection zones requires temporary internal memory space, the size of which depends on the number of elements contained in the protection zones, the spacing of the protection zones, and the number of machine axes.  
The size of the available memory space can be changed in MD18896 \$MN\_MM\_MAXNUM\_3D\_COLLISION.

**Reaction:** Correction block is reorganized.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change NC program or definition of the protection areas involved.  
Adjust MD18896 \$MN\_MM\_MAXNUM\_3D\_COLLISION.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.



---

<b>26263</b>	<b>[Channel %1: ] Block %2: Not enough memory space for determining the distance between two protection zones. Currently available memory space: %3KB.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Currently available memory
<b>Definitions:</b>	The determination of the distance between two protection zones with the function PROTDFCT requires temporary internal memory space, the size of which depends on the number of elements contained in the protection zones, and their positions relative to one another. The size of the available memory space can be changed in MD18896 \$MN_MM_MAXNUM_3D_COLLISION.
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Change NC program or definition of the protection areas involved. Adjust MD18896 \$MN_MM_MAXNUM_3D_COLLISION.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26264</b>	<b>[Channel %1: ] Block %2: The protection area with the name %3 was not found.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Name of protection area
<b>Definitions:</b>	One protection area with the name indicated was not found (e.g. during function call PROTA).
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Indicate the name of an existing protection area or define the protection area with the name indicated.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26266</b>	<b>[Channel %1: ] Block %2: The protection area with the name %3 was programmed several times.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Name of protection area
<b>Definitions:</b>	The name of a protection area was programmed several times (e.g. during the function call PROTA).
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Indicate each required name of a protection area only once.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26267</b>	<b>[channel %1: ] block %2: error %3 when calling WORKPIECE or FIXTURE process.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Error code

**Definitions:** When calling the WORKPIECE or FIXTURE process, an error has incurred. The error cause is described in detail by the error code:  
 1: No memory space available to store tool protection area / workholder protection area.  
 2: The name of the specified kinematic chain could not be found.  
 3: The name of the specified kinematic chain link could not be found.  
 4: An invalid frame name was given (only identifiers of programmable frames are permitted).  
 5: The specified protection area type cannot be interpreted by the NCK.  
 6: Impermissible name of the workpiece protection area. Workpiece protection areas must start with \_\_WORKP.  
 7: No protection area definition found with the specified name.  
 8: The name of the workholder protection area was not given.  
 9: Impermissible name of the workholder protection area. Workholder protection areas must start with \_\_FIXTURE.  
 10: Indication of the protection area type missing.  
 11: Less than three parameters were given for the protection area of the "Box" type.  
 12: Less than two parameters were given for the protection area of the "CYLINDER" type.  
 n: Invalid parameter(s) (the exact meaning of the possible error code must still be defined / extended).

**Reaction:** Correction block is reorganized.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Eliminate error cause specified in error code.  
 Set bit NO\_ERROR in fifth call parameter to surpress alarm output.

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26268 [Channel %1: ] Block %2: Protection area %3 has not been assigned an interface bit**

**Parameters:** %1 = Channel number  
 %2 = Block number  
 %3 = Name of protection area

**Definitions:** An attempt was made to preactivate a protection area to which no interface bit was assigned. Protection areas can be preactivated only if an interface bit was defined in \$NP\_BIT\_NO[...] through which switchover between activated and deactivated state is possible in a preactivated protection area.

**Reaction:** Correction block is reorganized.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Assign an interface bit to the protection area or select another activation mode (active / inactive).

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

**26270 [Channel %1: ] Block %2: Invaoid activation parameter during the PROTA function call**

**Parameters:** %1 = Channel number  
 %2 = Block number

**Definitions:** The activation parameter of the PROTA function contains an invalid value.  
 Only the following values are permitted:  
 "A" or "a" (= activated)  
 "I" or "i" (= inactivated)  
 "P" or "p" (= preactivated)  
 "R" or "r" (= take over activation state from protection area definitions)

**Reaction:** Correction block is reorganized.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Indicate a valid activation parameter ("A", "a", "I", "i", "P", "p", "R", "r").

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

---

<b>26272</b>	<b>[Channel %1: ] Block %2: The contents (%3) of parameter \$NP_INIT_STAT[%4] are invalid</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number %3 = Programmed state %4 = Index of parameters
<b>Definitions:</b>	An invalid activation state was indicated for a protection area. Only the following values are permitted: "A" or "a" (= activated) "I" or "i" (= inactivated) "P" or "p" (= preactivated)
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Indicate a valid activation parameter ("A", "a", "I", "i", "P", "p").
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>26274</b>	<b>[Channel %1: ] Block %2: Chain %3 referred to in \$NP_CHAIN_NAME[%4] was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of the chain %4 = Index of protection area
<b>Definitions:</b>	The kinematic chain referred to in the protection area definition (\$NP_CHAIN_NAME[...]) was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NP_CHAIN_NAME[...] the name of an existing kinematic chain or define a chain with the name indicated.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

<b>26276</b>	<b>[Channel %1: ] Block %2: Chain element %3 referred to in \$NP_CHAIN_ELEM[%4] was not found</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Name of the chain element %4 = Index of protection area
<b>Definitions:</b>	The kinematic chain element referred to in the protection area definition (\$NP_CHAIN_ELEM[...]) was not found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Indicate in \$NP_CHAIN_ELEM[...] the name of an existing chain element or define a chain element with the name indicated.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

**26278**                    **[Channel %1: ] Block %2: The axis or frame name %3 contained in \$NK\_AXIS[%4] is unknown**

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label  
                               %3 = Axis or frame name  
                               %4 = Index of the chain element

**Definitions:**            An unknown name was entered in the element of a kinematic chain in the component \$NK\_AXIS[...].  
                               The name entered must be either an axis identifier (machine axis identifier or identifier of a manual axis) or the name of a variable made available by the OEM software.

**Reaction:**                Correction block is reorganized.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 Enter a valid name in \$NK\_AXIS[...].  
                               In a regular case (without OEM software), that is a machine axis identifier.  
                               An empty string is also a valid name. That defines a constant chain link.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**26280**                    **[Channel %1: ] Axis %2 risk of collision %3 %4**

**Parameters:**            %1 = Channel number  
                               %2 = Axis name, spindle number  
                               %3 = 1st protection zone  
                               %4 = 2nd protection zone

**Definitions:**            The indicated axis was stopped due to the risk of collision.

**Reaction:**                Alarm display.

**Remedy:**                 In JOG mode: Retract axis from danger zone.  
                               In automatic mode: Determine reason for the risk of collision and eliminate. Possible reasons: wrong NC program, too large handwheel overrides, axis couplings and vice-versa impairing of two channels.

**Program Continuation:**    Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**26281**                    **[Channel %1: ] Axis %2 risk of collision %3 %4**

**Parameters:**            %1 = Channel number  
                               %2 = Axis name, spindle number  
                               %3 = 1st protection zone  
                               %4 = 2nd protection zone

**Definitions:**            The stated axis was stopped due to the risk of collision. The programmed path may have been left because it was not possible to stop in time on the path (exceptional situation).

**Reaction:**                Local alarm reaction.  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm at block end.

**Remedy:**                 In JOG mode: Retract axis from danger zone.  
                               In automatic mode: Determine reason for the risk of collision and eliminate. Possible reasons: wrong NC program, too large handwheel overrides, axis couplings and vice-versa impairing of two channels.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program  
                               The stated axis was stopped due to the risk of collision. The programmed path may have been left because it was not possible to stop in time on the path (exceptional situation).

---

<b>26282</b>	<b>[Channel %1: ] Block %2: Invalid definition of the protection zones or the kinematic chains.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	There are no valid definitions of the protection zones and / or the kinematic chains. This alarm only occurs if an error occurred the last time the procedure PROTA was called, and its cause has not been eliminated.
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Protection zones and kinematic chains must be defined without errors. This is achieved by calling the procedure PROTA and closing it without errors.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26284</b>	<b>[Channel %1: ] Block %2: The call of the function / procedure %3 is only permissible if the function 'Collision monitoring' is present.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = Funktionsname
<b>Definitions:</b>	The function or procedure stated in the alarm text (e.g. PROTA or PROTD) can only be called if the function "Collision avoidance" is present.
<b>Reaction:</b>	Correction block is reorganized. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	The function "Collision avoidance" must be activated. For this, the MD18890 \$MN_MM_MAXNUM_3D_PROT_AREAS must contain a value greater than zero.
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

<b>26286</b>	<b>[Channel %1: ] Axis %2 risk of collision preactivated protection zones interface signal(s) %3</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis name, spindle number %3 = Interface signal(s)
<b>Definitions:</b>	A collision was detected involving at least one preactivated protection zone. Such a collision can occur if the interface signal assigned to a preactivated protection zone has been activated. That is if a preactivated protection zone has become an active protection zone. Either a preactivated and a (static) active protection zone can be involved in the collision, or two preactivated protection zones can be involved. The number(s) of the interface signals assigned to the preactivated protection zones involved are output in the alarm text.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. Alarm reaction in Automatic mode. NC Stop on alarm.
<b>Remedy:</b>	Reset activating interface signals. Redefine protection zones. Retract
<b>Program Continuation:</b>	Clear alarm with NC START or RESET key and continue the program.

---

**26290**            **[Channel %1: ] Block %2: Maximum number of %4 protection zone facets exceeded in CAD file %3**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = File name  
                         %4 = Maximum number of protection zone facets

**Definitions:**        The maximum permissible number of protection zone facets has been exceeded.

**Reaction:**            Correction block is reorganized.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Increase the number of allowed Protection Area Facet elements (MD18895 \$MN\_MM\_MAXNUM\_3D\_FACETS) or reduce the number of defined facets in the CAD file.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**26292**            **[Channel %1: ] Block %2: Maximum number of %4 input points exceeded in CAD file %3**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = File name  
                         %4 = Maximum number of input points

**Definitions:**        The maximum permissible number of input points has been exceeded.

**Reaction:**            Correction block is reorganized.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Increase the number of allowed Protection Area Facet elements (MD18895 \$MN\_MM\_MAXNUM\_3D\_FACETS) or reduce the number of defined facets in the CAD file.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**26294**            **[Channel %1: ] Block %2: CAD file %3 is not a valid VRML file**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = File name

**Definitions:**        The CAD file does not contain valid VRML data.

**Reaction:**            Correction block is reorganized.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             Check the format of the input CAD/VRML data.

**Program Continuation:**    Clear alarm with NC START or RESET key and continue the program.

---

**26296**            **[Channel %1: ] Block %2: CAD file %3 is not a valid STL file**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label  
                         %3 = File name

---

<b>Definitions:</b>	The CAD file does not contain any valid STL data
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the format of the CAD/STL file.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 26298 [channel %1: ] block %2: The Include file %4 which was to be read in the CAD file %3 could not be found.

<b>Parameters:</b>	%1 = Channel number %2 = Block number, label %3 = File name %4 = File name
<b>Definitions:</b>	The Include file which was to be read in the specified CAD file could not be found.
<b>Reaction:</b>	Correction block is reorganized. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check name and path details of the Include file.
<b>Program</b>	Clear alarm with NC START or RESET key and continue the program.
<b>Continuation:</b>	

---

### 27000 Axis %1 is not safely referenced

<b>Parameters:</b>	%1 = Axis number
<b>Definitions:</b>	There are two reasons for this alarm: - the machine position has not yet been acknowledged by the user, - the machine position has not yet been verified through follow-up referencing. Even if the axis is already referenced, there is no confirmation that referencing has supplied the correct result. For example, wrong results can occur if the axis was moved after the control was switched off, with the result that the standstill position saved prior to switching off is no longer correct. To make sure that this does not happen, the user must acknowledge the displayed actual position after the first referencing process. When the user enable has first been set, follow-up referencing must be carried out each time the control is booted (with absolute encoders, this follow-up referencing is executed automatically). This procedure is carried out to verify the standstill position saved prior to switching off of the control. Via the MD \$MN_SAFE_ALARM_SUPPRESS_LEVEL (MD>=3), the alarm display can be set in such a way that the group alarm 27100 is displayed for all SI axes.
<b>Reaction:</b>	Alarm display. SGA "Axis safely referenced" is not set. SE will be switched off, if the actual safety position has not yet been confirmed by a user agreement. If the user agreement has been set, SE will remain active. The safe cams are calculated and output. However, their significance is limited as referencing has not been confirmed.
<b>Remedy:</b>	Traverse the axis to a known position, change to operating mode "Referencing" and press softkey "Agreement". Check the positions displayed in the agreement screen on the machine. If they match the expected or known position, confirm this by using the toggle key. If the user agreement has already been set, reference the axis again. The user agreement can be changed only via keyswitch position 3 or after password entry. WARNING: If the axis is not referenced safely and the user agreement is not available, the following will apply: - the safe cams are not yet safe - the safe end positions are not yet active.
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

**27001 Axis %1 error in a monitoring channel, code %2, values: NCK %3, drive %4**

**Parameters:**  
 %1 = Axis number  
 %2 = Additional info cross-comparison index  
 %3 = NCK comparison value extension  
 %4 = Additional info comparison value drive

**Definitions:**  
 A mutual comparison of the state of the safety-related monitoring functions is made cyclically between the two monitoring channels (NCK and drive). The comparison is made separately for each NCK/drive combination. In each monitoring cycle (MD10091 \$MN\_INFO\_SAFETY\_CYCLE\_TIME), a comparison list criterion is compared between NCK and drive. In the next monitoring cycle, the next criterion is compared, etc. Once the complete comparison list has been processed, processing of the comparisons starts again. The resulting total comparison time for processing the list is displayed in MD10092 \$MN\_INFO\_CROSSCHECK\_CYCLE\_TIME (factor x MD10091 \$MN\_INFO\_SAFETY\_CYCLE\_TIME - the factor may differ in the various software versions).  
 The alarm "Fault in a monitoring channel" is output if the mutual comparison of the two monitoring channels finds a difference between input data or monitoring results. One of the monitors is no longer functioning reliably. The cross-checking index output under %2 is also called the STOP F code. The STOP F code where the NCK found the first cross-checking error is also output in alarm 27001.  
 The STOP F code of the drive (belonging to alarm F30611) can be found on the diagnostic display or in parameter r9795. If there is a difference in several comparison steps, several STOP F codes can be displayed here (the display alternates accordingly).  
 There are fault profiles that can be detected by several comparisons in the comparison list, i.e. the displayed STOP F code value does not always provide clear information about the error cause. The relevant procedure is explained with the individual error codes:

- 0 No error found in this channel; following alarm to drive alarm F01711.
- 1 Result list 1: Difference in SBH, SG, SBR or SE result, e.g. due to inconsistent activation of the monitoring channels. For further information see drive parameters r9710[0], r9710[1].
- 2 Result list 2: Difference in SN, n\_x result. For further information see drive parameters r9711[0], r9711[1].
- 3 Actual value difference greater than setting in MD36942 \$MA\_SAFE\_POS\_TOL.
- 4 Not assigned.
- 5 Function enables MD36901 \$MA\_SAFE\_FUNCTION\_ENABLE.
- 6 Velocity limit MD36931 \$MA\_SAFE\_VELO\_LIMIT[0].
- 7 Velocity limit MD36931 \$MA\_SAFE\_VELO\_LIMIT[1].
- 8 Velocity limit MD36931 \$MA\_SAFE\_VELO\_LIMIT[2].
- 9 Velocity limit MD36931 \$MA\_SAFE\_VELO\_LIMIT[3].
- 10 Tolerance for safe operational stop MD36930 \$MA\_SAFE\_STANDSTILL\_TOL.
- 11 Limit position MD36934 \$MA\_SAFE\_POS\_LIMIT\_PLUS[0].
- 12 Limit position MD36935 \$MA\_SAFE\_POS\_LIMIT\_MINUS[0].
- 13 Limit position MD36934 \$MA\_SAFE\_POS\_LIMIT\_PLUS[1].
- 14 Limit position MD36935 \$MA\_SAFE\_POS\_LIMIT\_MINUS[1].
- 15 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[0] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 16 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[0].
- 17 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[0] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 18 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[0].
- 19 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[1] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 20 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[1].
- 21 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[1] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 22 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[1].
- 23 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[2] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 24 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[2].
- 25 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[2] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 26 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[2].
- 27 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[3] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 28 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[3].
- 29 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[3] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 30 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[3].
- 31 Actual position tolerance MD36942 \$MA\_SAFE\_POS\_TOL. MD36949 \$MA\_SAFE\_SLIP\_VELO\_TOL for active actual value synchronization (slip)
- 32 Ref. position tolerance MD36944 \$MA\_SAFE\_REFP\_POS\_TOL.
- 33 Delay SG[x] -> SG[y] MD36951 \$MA\_SAFE\_VELO\_SWITCH\_DELAY.
- 34 Delay cross-check MD36950 \$MA\_SAFE\_MODE\_SWITCH\_TIME.
- 35 Delay pulse disable Stop B MD36956 \$MA\_SAFE\_PULSE\_DISABLE\_DELAY.



- 36 Delay pulse disable test stop MD36957 \$MA\_SAFE\_PULSE\_DIS\_CHECK\_TIME
- 37 Delay Stop C -> SBH MD36952 \$MA\_SAFE\_STOP\_SWITCH\_TIME\_C.
- 38 Delay Stop D -> SBH MD36953 \$MA\_SAFE\_STOP\_SWITCH\_TIME\_D.
- 39 Delay Stop E -> SBH MD36954 \$MA\_SAFE\_STOP\_SWITCH\_TIME\_E.
- 40 Stop reaction on SG exceeded MD36961 \$MA\_SAFE\_VELO\_STOP\_MODE.
- 41 Stop reaction on SE exceeded MD36962 \$MA\_SAFE\_POS\_STOP\_MODE.
- 42 Standstill speed MD36960 \$MA\_SAFE\_STANDSTILL\_VELO\_TOL.
- 43 Memory test, stop reaction.
- 44 Position actual value + SG[0] MD36931 \$MA\_SAFE\_VELO\_LIMIT[0].
- 45 Position actual value - SG[0] MD36931 \$MA\_SAFE\_VELO\_LIMIT[0].
- 46 Position actual value + SG[1] MD36931 \$MA\_SAFE\_VELO\_LIMIT[1].
- 47 Position actual value - SG[1] MD36931 \$MA\_SAFE\_VELO\_LIMIT[1].
- 48 Position actual value + SG[2] MD36931 \$MA\_SAFE\_VELO\_LIMIT[2].
- 49 Position actual value - SG[2] MD36931 \$MA\_SAFE\_VELO\_LIMIT[2].
- 50 Position actual value + SG[3] MD36931 \$MA\_SAFE\_VELO\_LIMIT[3].
- 51 Position actual value - SG[3] MD36931 \$MA\_SAFE\_VELO\_LIMIT[3].
- 52 Standstill position + tolerance MD36930 \$MA\_SAFE\_STANDSTILL\_TOL.
- 53 Standstill position - tolerance MD36930 \$MA\_SAFE\_STANDSTILL\_TOL.
- 54 Position actual value + n\_x + tolerance MD36946 \$MA\_SAFE\_VELO\_X + MD36942 \$MA\_SAFE\_POS\_TOL.
- 55 Position actual value + n\_x MD36946 \$MA\_SAFE\_VELO\_X.
- 56 Position actual value - n\_x MD36946 \$MA\_SAFE\_VELO\_X.
- 57 Position actual value - n\_x - tolerance MD36946 \$MA\_SAFE\_VELO\_X - MD36942 \$MA\_SAFE\_POS\_TOL
- 58 Active external standstill request.
- 59 SG override factor 1 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[0].
- 60 SG override factor 2 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[1].
- 61 SG override factor 3 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[2].
- 62 SG override factor 4 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[3].
- 63 SG override factor 5 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[4].
- 64 SG override factor 6 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[5].
- 65 SG override factor 7 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[6].
- 66 SG override factor 8 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[7].
- 67 SG override factor 9 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[8].
- 68 SG override factor 10 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[9].
- 69 SG override factor 11 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[10].
- 70 SG override factor 12 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[11].
- 71 SG override factor 13 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[12].
- 72 SG override factor 14 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[13].
- 73 SG override factor 15 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[14].
- 74 SG override factor 16 MD36932 \$MA\_SAFE\_VELO\_OVR\_FACTOR[15].
- 75 Velocity limit n\_x MD36946 \$MA\_SAFE\_VELO\_X.
- 76 Stop reaction SG1 MD36963 \$MA\_SAFE\_VELO\_STOP\_REACTION[0].
- 77 Stop reaction SG2 MD36963 \$MA\_SAFE\_VELO\_STOP\_REACTION[1].
- 78 Stop reaction SG3 MD36963 \$MA\_SAFE\_VELO\_STOP\_REACTION[2].
- 79 Stop reaction SG4 MD36963 \$MA\_SAFE\_VELO\_STOP\_REACTION[3].
- 80 Modulo value for safe cam MD36905 \$MA\_SAFE\_MODULO\_RANGE.
- 81 Actual velocity tolerance MD36948 \$MA\_SAFE\_STOP\_VELO\_TOL.
- 82 SG override factor SGE 0...15 = active SGE position. -1 = SG override inactive (neither SG2 nor SG4 active, or function is not selected in MD36901 \$MA\_SAFE\_FUNCTION\_ENABLE).
- 83 Acceptance test time different MD36958 \$MA\_SAFE\_ACCEPTANCE\_TST\_TIMEOUT.
- 84 Delay time Stop F -> Stop B MD36955 \$MA\_SAFE\_STOP\_SWITCH\_TIME\_F.
- 85 Delay time pulse disable bus failure MD10089 \$MN\_SAFE\_PULSE\_DIS\_TIME\_BUSFAIL.
- 86 Single encoder system MD36914 \$MA\_SAFE\_SINGLE\_ENC.
- 87 Encoder assignment MD36912 \$MA\_SAFE\_ENC\_INPUT\_NR.
- 88 Cam enable MD36903 \$MA\_SAFE\_CAM\_ENABLE.
- 89 Encoder limit frequency MD36926 \$MA\_SAFE\_ENC\_FREQ\_LIMIT.
- 90 Cam SGA outside MD36940 \$MA\_SAFE\_CAM\_TOL different
- 91 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[4] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 92 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[4].
- 93 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[4] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 94 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[4].
- 95 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[5] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 96 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[5].
- 97 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[5] + MD36940 \$MA\_SAFE\_CAM\_TOL.

- 98 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[5].
- 99 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[6] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 100 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[6].
- 101 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[6] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 102 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[6].
- 103 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[7] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 104 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[7].
- 105 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[7] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 106 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[7].
- 107 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[8] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 108 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[8].
- 109 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[8] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 110 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[8].
- 111 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[9] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 112 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[9].
- 113 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[9] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 114 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[9].
- 115 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[10] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 116 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[10].
- 117 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[10] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 118 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[10].
- 119 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[11] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 120 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[11].
- 121 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[11] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 122 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[11].
- 123 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[12] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 124 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[12].
- 125 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[12] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 126 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[12].
- 127 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[13] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 128 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[13].
- 129 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[13] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 130 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[13].
- 131 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[14] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 132 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[14].
- 133 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[14] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 134 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[14].
- 135 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[15] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 136 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[15].
- 137 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[15] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 138 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[15].
- 139 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[16] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 140 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[16].
- 141 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[16] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 142 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[16].
- 143 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[17] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 144 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[17].
- 145 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[17] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 146 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[17].
- 147 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[18] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 148 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[18].
- 149 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[18] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 150 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[18].
- 151 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[19] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 152 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[19].
- 153 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[19] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 154 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[19].
- 155 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[20] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 156 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[20].
- 157 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[20] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 158 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[20].
- 159 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[21] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 160 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[21].

- 161 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[21] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 162 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[21].
- 163 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[22] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 164 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[22].
- 165 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[22] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 166 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[22].
- 167 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[23] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 168 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[23].
- 169 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[23] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 170 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[23].
- 171 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[24] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 172 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[24].
- 173 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[24] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 174 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[24].
- 175 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[25] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 176 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[25].
- 177 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[25] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 178 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[25].
- 179 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[26] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 180 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[26].
- 181 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[26] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 182 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[26].
- 183 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[27] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 184 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[27].
- 185 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[27] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 186 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[27].
- 187 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[28] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 188 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[28].
- 189 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[28] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 190 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[28].
- 191 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[29] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 192 Cam position MD36936 \$MA\_SAFE\_CAM\_POS\_PLUS[29].
- 193 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[29] + MD36940 \$MA\_SAFE\_CAM\_TOL.
- 194 Cam position MD36937 \$MA\_SAFE\_CAM\_POS\_MINUS[29].
- 195 Cam track assignment SN1 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[0].
- 196 Cam track assignment SN2 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[1].
- 197 Cam track assignment SN3 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[2].
- 198 Cam track assignment SN4 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[3].
- 199 Cam track assignment SN5 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[4].
- 200 Cam track assignment SN6 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[5].
- 201 Cam track assignment SN7 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[6].
- 202 Cam track assignment SN8 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[7].
- 203 Cam track assignment SN9 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[8].
- 204 Cam track assignment SN10 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[9].
- 205 Cam track assignment SN11 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[10].
- 206 Cam track assignment SN12 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[11].
- 207 Cam track assignment SN13 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[12].
- 208 Cam track assignment SN14 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[13].
- 209 Cam track assignment SN15 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[14].
- 210 Cam track assignment SN16 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[15].
- 211 Cam track assignment SN17 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[16].
- 212 Cam track assignment SN18 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[17].
- 213 Cam track assignment SN19 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[18].
- 214 Cam track assignment SN20 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[19].
- 215 Cam track assignment SN21 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[20].
- 216 Cam track assignment SN22 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[21].
- 217 Cam track assignment SN23 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[22].
- 218 Cam track assignment SN24 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[23].
- 219 Cam track assignment SN25 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[24].
- 220 Cam track assignment SN26 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[25].
- 221 Cam track assignment SN27 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[26].
- 222 Cam track assignment SN28 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[27].
- 223 Cam track assignment SN29 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[28].

- 224 Cam track assignment SN30 MD36938 \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[29].
- 225 Result list 3: Inconsistent results for "Safe cam track" for cams SN1..6.
- 226 Result list 4: Inconsistent results for "Safe cam track" for cams SN7..12.
- 227 Result list 5: Inconsistent results for "Safe cam track" for cams SN13..18.
- 228 Result list 6: Inconsistent results for "Safe cam track" for cams SN19..24.
- 229 Result list 7: Inconsistent results for "Safe cam track" for cams SN25.. 30.
- 230 Filter time constant n<nx MD36945 \$MA\_SAFE\_VELO\_X\_FILTER\_TIME.
- 231 Velocity hysteresis n<nx MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 232 Safe smoothed actual velocity.
- 233 Actual velocity nx MD36946 \$MA\_SAFE\_VELO\_X.
- 234 Actual velocity nx-tolerance MD36946 \$MA\_SAFE\_VELO\_X - MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 235 Actual velocity -nx+tolerance -MD36946 \$MA\_SAFE\_VELO\_X + MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 236 Actual velocity -nx -MD36946 \$MA\_SAFE\_VELO\_X.
- 237 SGA "n<nx" different outside MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 1000 Control timer expired: If one channel informs another of an SGE change, this control timer is used to check whether the update timer in the other channel has expired.
- 1001 (only assigned on drive, see alarm F01711)
- 1002 User agreement inconsistent: Data for user agreement inconsistent in the two monitoring channels after 2 seconds.  
%3 = state of the NCK user agreement  
%4 = state of the 611D user agreement
- 1003 Reference tolerance MD36944 \$MA\_SAFE\_REFP\_POS\_TOL exceeded.
- 1004 Plausibility error in user acknowledgment.
- 1005 Pulses already disabled on test stop selection.
- 1007 (only assigned on drive, see alarm F01711)
- 1008 (only assigned on drive, see alarm F01711)
- 1009 Pulses not disabled after test stop time MD36957 \$MA\_SAFE\_PULSE\_DIS\_CHECK\_TIME.
- 1010 Pulses not disabled during test of external pulse disable after test stop time MD36957 \$MA\_SAFE\_PULSE\_DIS\_CHECK\_TIME.
- 1011 NCK/drive acceptance test states are inconsistent.
- 1012 (only assigned on drive; see alarm F01711)
- 1013 NCK user agreement from PLC SRAM and NCK user agreement from NCK machine data are inconsistent.
- 1014 NCK axis number from PLC SRAM and NCK axis number from ramp-up are inconsistent.
- 1016 (only assigned in drive, see alarm F01711)
- 1020 Communication disrupted between NCK monitoring channel and drive monitoring channel.
- 1021 (only assigned in drive, see alarm F01711)
- 1023 Error during efficiency test in Sensor Module.
- 1024 NCK standstill position from PLC SRAM and NCK standstill position from the NCK machine data are inconsistent.
- 1025 Plausibility error in park selection: Encoder reporting parking without user request.
- 1026 Plausibility error in cam synchronisation between NCK and PLC ("Safe cam track" function).

**Reaction:**

NC Start disable in this channel.  
Alarm display.  
A Stop F was triggered.  
If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:**

Find the difference between the monitoring channels. Error code %2 shows the cause of the alarm.

It may be the case that safety-relevant machine data is no longer consistent (reload if so) or that the safety-relevant inputs do not have the same level (check).

If an error of this nature cannot be found, an error may have occurred in the CPU (a memory cell may have "tipped over", for example). This error may be temporary (remove with power-on) or permanent (replace hardware if the error is displayed again after power-on).

Error codes for STOP F:

0: No errors in this channel. Look for the cause in the other channel.

1: Result list 1. Inconsistent control of the functions via the SGEs; analyze precise error coding in SINAMICS r9710[0], r9710[1].

2: Result list 2. Check cam tolerance, analyze precise error coding in SINAMICS r9711[0], r9711[1]

3: Position actual value. Incorrect encoder evaluation (check MDs). Standstill position not stored consistently.

4: No cross check.

5: Function enables. Enter MDs consistently.

6: Limit value for SG1. Enter MDs consistently.

7: Limit value for SG2. Enter MDs consistently.

8: Limit value for SG3. Enter MDs consistently.

9: Limit value for SG4. Enter MDs consistently.

10: Standstill tolerance. Enter MDs consistently.

11: Upper limit value SE1. Enter MDs consistently.

12: Lower limit value SE1. Enter MDs consistently.

13: Upper limit value SE2. Enter MDs consistently.

14: Lower limit value SE2. Enter MDs consistently.

15: Safe cam 1+ (+tolerance). Enter MDs consistently.

16: Safe cam 1+. Enter MDs consistently.

17: Safe cam 1- (+tolerance). Enter MDs consistently.

18: Safe cam 1-. Enter MDs consistently.

19: Safe cam 2+ (+tolerance). Enter MDs consistently.

20: Safe cam 2+. Enter MDs consistently.

21: Safe cam 2- (+tolerance). Enter MDs consistently.

22: Safe cam 2-. Enter MDs consistently.

23: Safe cam 3+ (+tolerance). Enter MDs consistently.

24: Safe cam 3+. Enter MDs consistently.

25: Safe cam 3- (+tolerance). Enter MDs consistently.

26: Safe cam 3-. Enter MDs consistently.

27: Safe cam 4+ (+tolerance). Enter MDs consistently.

28: Safe cam 4+. Enter MDs consistently.

29: Safe cam 4- (+tolerance). Enter MDs consistently.

30: Safe cam 4-. Enter MDs consistently.

31: Position tolerance. Enter MDs consistently.

32: Reference position tolerance. Enter MDs consistently.

33: Time velocity changeover. Enter MDs consistently.

34: Tolerance time SGE changeover. Enter MDs consistently.

35: Delay time pulse disable. Enter MDs consistently.

36: Time for checking pulse disable. Enter MDs consistently.

37: Transition time STOP C to SBH. Enter MDs consistently.

38: Transition time STOP D to SBH. Enter MDs consistently.

39: Transition time STOP E to SBH. Enter MDs consistently.

40: Stop reaction to SG. Enter MDs consistently.

41: Stop reaction to SE. Enter MDs consistently.

42: Creep speed pulse disable. Enter MDs consistently.

43: Memory test stop reaction.

44: Position actual value + limit value SG1.

45: Position actual value - limit value SG1.

46: Position actual value + limit value SG2.

47: Position actual value - limit value SG2.

48: Position actual value + limit value SG3.

49: Position actual value - limit value SG3.

50: Position actual value + limit value SG4.

51: Position actual value - limit value SG4.

52: Standstill position + tolerance.

53: Standstill position - tolerance.

54: Position actual value "+ nx" + tolerance.

- 55: Position actual value "+ nx".
- 56: Position actual value "- nx".
- 57: Position actual value "- nx" + tolerance.
- 58: Current stop request.
- 59: SG override factor 1. Enter MDs consistently.
- 60: SG override factor 2. Enter MDs consistently.
- 61: SG override factor 3. Enter MDs consistently.
- 62: SG override factor 4. Enter MDs consistently.
- 63: SG override factor 5. Enter MDs consistently.
- 64: SG override factor 6. Enter MDs consistently.
- 65: SG override factor 7. Enter MDs consistently.
- 66: SG override factor 8. Enter MDs consistently.
- 67: SG override factor 9. Enter MDs consistently.
- 68: SG override factor 10. Enter MDs consistently.
- 69: SG override factor 11. Enter MDs consistently.
- 70: SG override factor 12. Enter MDs consistently.
- 71: SG override factor 13. Enter MDs consistently.
- 72: SG override factor 14. Enter MDs consistently.
- 73: SG override factor 15. Enter MDs consistently.
- 74: SG override factor 16. Enter MDs consistently.
- 75: Velocity limit "nx". Enter MDs consistently.
- 76: Stop reaction with SG1. Enter MDs consistently.
- 77: Stop reaction with SG2. Enter MDs consistently.
- 78: Stop reaction with SG3. Enter MDs consistently.
- 79: Stop reaction with SG4. Enter MDs consistently.
- 80: Modulo value for safe cams. Enter MDs consistently.
- 81: Velocity tolerance for safe acceleration monitoring. Enter MDs consistently.
- 82: SG override factor SGEs. Control SGEs consistently.
- 83: Acceptance test duration. Enter MDs consistently.
- 84: Stop F -> Stop B delay time. Enter MDs consistently.
- 85: Bus failure pulse disable delay time. Enter MDs consistently.
- 86: Make MD36914 \$MA\_SAFE\_SINGLE\_ENC and drive parameter p9526 consistent.
- 87: Make MD36912 \$MA\_SAFE\_ENC\_INPUT\_NR and p9526 consistent.
- 88: Make MD36903 \$MA\_SAFE\_CAM\_ENABLE and drive parameter p9503 consistent.
- 89: Encoder limit frequency. Enter MDs consistently.
- 90: Check cam positions, MD36940 \$MA\_SAFE\_CAM\_TOL.
- 91: Safe cam 5+ (+ tolerance). Enter MDs consistently.
- 92: Safe cam 5+. Enter MDs consistently.
- 93: Safe cam 5- (+ tolerance). Enter MDs consistently.
- 94: Safe cam 5-. Enter MDs consistently.
- 95: Safe cam 6+ (+ tolerance). Enter MDs consistently.
- 96: Safe cam 6+. Enter MDs consistently.
- 97: Safe cam 6- (+ tolerance). Enter MDs consistently.
- 98: Safe cam 6-. Enter MDs consistently.
- 99: Safe cam 7+ (+ tolerance). Enter MDs consistently.
- 100: Safe cam 7+. Enter MDs consistently.
- 101: Safe cam 7- (+ tolerance). Enter MDs consistently.
- 102: Safe cam 7-. Enter MDs consistently.
- 103: Safe cam 8+ (+ tolerance). Enter MDs consistently.
- 104: Safe cam 8+. Enter MDs consistently.
- 105: Safe cam 8- (+ tolerance). Enter MDs consistently.
- 106: Safe cam 8-. Enter MDs consistently.
- 107: Safe cam 9+ (+ tolerance). Enter MDs consistently.
- 108: Safe cam 9+. Enter MDs consistently.
- 109: Safe cam 9- (+ tolerance). Enter MDs consistently.
- 110: Safe cam 9-. Enter MDs consistently.
- 111: Safe cam 10+ (+ tolerance). Enter MDs consistently.
- 112: Safe cam 10+. Enter MDs consistently.
- 113: Safe cam 10- (+ tolerance). Enter MDs consistently.
- 114: Safe cam 10-. Enter MDs consistently.
- 115: Safe cam 11+ (+ tolerance). Enter MDs consistently.
- 116: Safe cam 11+. Enter MDs consistently.
- 117: Safe cam 11- (+ tolerance). Enter MDs consistently.

118: Safe cam 11-. Enter MDs consistently.  
119: Safe cam 12+ (+ tolerance). Enter MDs consistently.  
120: Safe cam 12-. Enter MDs consistently.  
121: Safe cam 12- (+ tolerance). Enter MDs consistently.  
122: Safe cam 12-. Enter MDs consistently.  
123: Safe cam 13+ (+ tolerance). Enter MDs consistently.  
124: Safe cam 13+. Enter MDs consistently.  
125: Safe cam 13- (+ tolerance). Enter MDs consistently.  
126: Safe cam 13-. Enter MDs consistently.  
127: Safe cam 14+ (+ tolerance). Enter MDs consistently.  
128: Safe cam 14+. Enter MDs consistently.  
129: Safe cam 14- (+ tolerance). Enter MDs consistently.  
130: Safe cam 14-. Enter MDs consistently.  
131: Safe cam 15+ (+ tolerance). Enter MDs consistently.  
132: Safe cam 15+. Enter MDs consistently.  
133: Safe cam 15- (+ tolerance). Enter MDs consistently.  
134: Safe cam 15-. Enter MDs consistently.  
135: Safe cam 16+ (+ tolerance). Enter MDs consistently.  
136: Safe cam 16+. Enter MDs consistently.  
137: Safe cam 16- (+ tolerance). Enter MDs consistently.  
138: Safe cam 16-. Enter MDs consistently.  
139: Safe cam 17+ (+ tolerance). Enter MDs consistently.  
140: Safe cam 17+. Enter MDs consistently.  
141: Safe cam 17- (+ tolerance). Enter MDs consistently.  
142: Safe cam 17-. Enter MDs consistently.  
143: Safe cam 18+ (+ tolerance). Enter MDs consistently.  
144: Safe cam 18+. Enter MDs consistently.  
145: Safe cam 18- (+ tolerance). Enter MDs consistently.  
146: Safe cam 18-. Enter MDs consistently.  
147: Safe cam 19+ (+ tolerance). Enter MDs consistently.  
148: Safe cam 19+. Enter MDs consistently.  
149: Safe cam 19- (+ tolerance). Enter MDs consistently.  
150: Safe cam 19-. Enter MDs consistently.  
151: Safe cam 20+ (+ tolerance). Enter MDs consistently.  
152: Safe cam 20+. Enter MDs consistently.  
153: Safe cam 20- (+ tolerance). Enter MDs consistently.  
154: Safe cam 20-. Enter MDs consistently.  
155: Safe cam 21+ (+ tolerance). Enter MDs consistently.  
156: Safe cam 21+. Enter MDs consistently.  
157: Safe cam 21- (+ tolerance). Enter MDs consistently.  
158: Safe cam 21-. Enter MDs consistently.  
159: Safe cam 22+ (+ tolerance). Enter MDs consistently.  
160: Safe cam 22+. Enter MDs consistently.  
161: Safe cam 22- (+ tolerance). Enter MDs consistently.  
162: Safe cam 22-. Enter MDs consistently.  
163: Safe cam 23+ (+ tolerance). Enter MDs consistently.  
164: Safe cam 23+. Enter MDs consistently.  
165: Safe cam 23- (+ tolerance). Enter MDs consistently.  
166: Safe cam 23-. Enter MDs consistently.  
167: Safe cam 24+ (+ tolerance). Enter MDs consistently.  
168: Safe cam 24+. Enter MDs consistently.  
169: Safe cam 24- (+ tolerance). Enter MDs consistently.  
170: Safe cam 24-. Enter MDs consistently.  
171: Safe cam 25+ (+ tolerance). Enter MDs consistently.  
172: Safe cam 25+. Enter MDs consistently.  
173: Safe cam 25- (+ tolerance). Enter MDs consistently.  
174: Safe cam 25-. Enter MDs consistently.  
175: Safe cam 26+ (+ tolerance). Enter MDs consistently.  
176: Safe cam 26+. Enter MDs consistently.  
177: Safe cam 26- (+ tolerance). Enter MDs consistently.  
178: Safe cam 26-. Enter MDs consistently.  
179: Safe cam 27+ (+ tolerance). Enter MDs consistently.  
180: Safe cam 27+. Enter MDs consistently.

- 181: Safe cam 27- (+ tolerance). Enter MDs consistently.
- 182: Safe cam 27-. Enter MDs consistently.
- 183: Safe cam 28+ (+ tolerance). Enter MDs consistently.
- 184: Safe cam 28+. Enter MDs consistently.
- 185: Safe cam 28- (+ tolerance). Enter MDs consistently.
- 186: Safe cam 28-. Enter MDs consistently.
- 187: Safe cam 29+ (+ tolerance). Enter MDs consistently.
- 188: Safe cam 29+. Enter MDs consistently.
- 189: Safe cam 29- (+ tolerance). Enter MDs consistently.
- 190: Safe cam 29-. Enter MDs consistently.
- 191: Safe cam 30+ (+ tolerance). Enter MDs consistently.
- 192: Safe cam 30+. Enter MDs consistently.
- 193: Safe cam 30- (+ tolerance). Enter MDs consistently.
- 194: Safe cam 30-. Enter MDs consistently.
- 195: Cam track assignment SN1. Enter MDs consistently and check cam enable and parameterization.
- 196: Cam track assignment SN2. Enter MDs consistently and check cam enable and parameterization.
- 197: Cam track assignment SN3. Enter MDs consistently and check cam enable and parameterization.
- 198: Cam track assignment SN4. Enter MDs consistently and check cam enable and parameterization.
- 199: Cam track assignment SN5. Enter MDs consistently and check cam enable and parameterization.
- 200: Cam track assignment SN6. Enter MDs consistently and check cam enable and parameterization.
- 201: Cam track assignment SN7. Enter MDs consistently and check cam enable and parameterization.
- 202: Cam track assignment SN8. Enter MDs consistently and check cam enable and parameterization.
- 203: Cam track assignment SN9. Enter MDs consistently and check cam enable and parameterization.
- 204: Cam track assignment SN10. Enter MDs consistently and check cam enable and parameterization.
- 205: Cam track assignment SN11. Enter MDs consistently and check cam enable and parameterization.
- 206: Cam track assignment SN12. Enter MDs consistently and check cam enable and parameterization.
- 207: Cam track assignment SN13. Enter MDs consistently and check cam enable and parameterization.
- 208: Cam track assignment SN14. Enter MDs consistently and check cam enable and parameterization.
- 209: Cam track assignment SN15. Enter MDs consistently and check cam enable and parameterization.
- 210: Cam track assignment SN16. Enter MDs consistently and check cam enable and parameterization.
- 211: Cam track assignment SN17. Enter MDs consistently and check cam enable and parameterization.
- 212: Cam track assignment SN18. Enter MDs consistently and check cam enable and parameterization.
- 213: Cam track assignment SN19. Enter MDs consistently and check cam enable and parameterization.
- 214: Cam track assignment SN20. Enter MDs consistently and check cam enable and parameterization.
- 215: Cam track assignment SN21. Enter MDs consistently and check cam enable and parameterization.
- 216: Cam track assignment SN22. Enter MDs consistently and check cam enable and parameterization.
- 217: Cam track assignment SN23. Enter MDs consistently and check cam enable and parameterization.
- 218: Cam track assignment SN24. Enter MDs consistently and check cam enable and parameterization.
- 219: Cam track assignment SN25. Enter MDs consistently and check cam enable and parameterization.
- 220: Cam track assignment SN26. Enter MDs consistently and check cam enable and parameterization.
- 221: Cam track assignment SN27. Enter MDs consistently and check cam enable and parameterization.
- 222: Cam track assignment SN28. Enter MDs consistently and check cam enable and parameterization.
- 223: Cam track assignment SN29. Enter MDs consistently and check cam enable and parameterization.
- 224: Cam track assignment SN30. Enter MDs consistently and check cam enable and parameterization.
- 225: Result list 3. Check cam tolerances, evaluate precise error coding in drive r9735[0,1].
- 226: Result list 4. Check cam tolerances, evaluate precise error coding in drive r9736[0,1].
- 227: Result list 5. Check cam tolerances, evaluate precise error coding in drive r9737[0,1].
- 228: Result list 6. Check cam tolerances, evaluate precise error coding in drive r9738[0,1].
- 229: Result list 7. Check cam tolerances, evaluate precise error coding in drive r9739[0,1].
- 230: Make MD36945 \$MA\_SAFE\_VELO\_X\_FILTER\_TIME and drive parameter p9545 consistent.
- 231: Make MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS and drive parameter p9547 consistent.
- 232: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36945 \$MA\_SAFE\_VELO\_X\_FILTER\_TIME.
- 233: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 234: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 235: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 236: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 237: Check MD36946 \$MA\_SAFE\_VELO\_X, MD36947 \$MA\_SAFE\_VELO\_X\_HYSTERESIS.
- 1000: Control timer expired. Too many switching operations on the SGEs (e.g. due to contact problems, loose contact).
- 1001: Incorrect control timer initialization. See F01711.
- 1002: User agreement timer expired.
- 1003: Reference tolerance violated. Compare the reference position with the current safe actual position.
- 1004: Plausibility of user agreement is violated.



1005: Pulses already disabled during test stop selection. Test stop selection with missing pulse enable, error in the wiring of the SGE "Pulses have been deleted".  
 1007: Communication failure between PLC and drive.  
 1008: Incorrect data transfer between PLC and drive.  
 1009: Trigger a subsequent stop after test stop. Check the wiring. Check the SGE configuration via MD36976 \$MA\_SAFE\_PULSE\_STATUS\_INPUT. Check the time level for test stop.  
 1010: Pulses not disabled. Check MD.  
 1011: Acceptance test timer expired.  
 1012: Restore data consistency with power-on.  
 1013: Restore data consistency with power-on.  
 1014: Restore data consistency with power-on..  
 1016: Check communication between control and drive  
 1020: Cyclic communication between NCK and drive no longer functioning.  
 1021: Sign-of-life error Sensor Module.  
 1023: Check Sensor Module.  
 1024: Restore data consistency with power-on.  
 1025: Plausibility violation in park selection. Check encoder hardware and communication with encoder.  
 1026: Check communication between PLC and drive and between PLC and NCK.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:** If STOP B was triggered, a power OFF/ON of the control will be required.

## 27002 Axis %1 test stop is running

**Parameters:** %1 = Axis number  
**Definitions:** Proper functioning of the switch-off path is just being tested by setting of the SGE "Test stop selection".  
**Reaction:** Alarm display.  
**Remedy:** The message serves only for user information.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:** The alarm will disappear automatically after expiry of the delay time - defined in MD \$MA\_SAFE\_PULSE\_DIS\_CHECK\_TIME - and after removal of SGE "Test stop selection", if the control recognizes pulse suppression, i.e. the test has been completed successfully. An unsuccessful test can be recognized by alarm 27001 with error code 1005 or by alarm 27024.

## 27003 Checksum error found: %1 %2

**Parameters:** %1 = Note on code section or table  
 %2 = Table number  
**Definitions:** Checksum error in safety-relevant code or safety-relevant data. The safe monitoring functions (Safety Integrated) in the NCK could be affected.  
**Reaction:** Alarm display.  
**Remedy:** Continue to work very carefully. Power OFF/ON of the control required. If this error occurs again, contact your service personnel.  
**Program** Switch control OFF - ON.  
**Continuation:**

## 27004 Axis %1, difference safe input %2, NCK %3, drive %4

**Parameters:** %1 = Axis number  
 %2 = Monitoring input  
 %3 = Interface identifier NCK input  
 %4 = Interface identifier drive input

**Definitions:** A difference has been found on the specified safe input. The state of the specified input signal differed in the two monitoring channels NCK and drive during the duration set in \$MA\_SAFE\_MODE\_SWITCH\_TIME.  
 Monitoring in question (%2):  
 SS/SV = Difference in SGE "Deselection of safe operating stop/Safe velocity"  
 SS = Difference in SGE "Safe operating stop"  
 SV = Difference in SGE "Selection safe velocity"  
 SP = Difference in SGE "Selection safe limit position"  
 SVOVR = Difference in SGEs "Selection SG correction"  
 Interface identifier NCK input (%3):  
 DMP<drv><mod><bit>=<value>  
 <drv> = Drive number of terminal block (1...31)  
 <mod> = Submodule number (1...8)  
 <bit> = Terminal number (1...16)  
 <value> = Value of NCK SGE (0,1)  
 SPL For when the SGE is parameterized at the SPL interface.  
 <io> = Parameterizable system variable range (01=\$A\_INSID, 02=\$A\_INSED)  
 <dword> = System variable double word (1,2)  
 <bit> = Bit number in system variable double word (1...32)  
 <value> = Value of NCK SGE (0,1)  
 Onboard input For when the SGE is parameterized at an onboard input.  
 <bit> = Input number = 01 ...04  
 <value> = Value of NCK SGE = 0,1  
 Interface identifier drive input (%4):  
 DBX<byte><bit>=<value >  
 <byte> = Byte number in axial DB (22, 23, 32, 33)  
 <bit> = Bit number in byte (0...7)  
 <value> = Value of drive SGE (0,1)  
 This alarm can be hidden by setting MD \$MN\_SAFE\_DIAGNOSIS\_MASK, bit 0 = 0.

**Reaction:** Alarm display.

**Remedy:** Check settings for safe input signals (NCK I/Os, PLC DB parameters).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27005 Axis %1 error in data cross check: static actual value difference**

**Parameters:** %1 = Axis number

**Definitions:** Via the data cross check between NCK and drive monitoring channel, a difference in actual values was detected, which is greater than the maximum tolerance defined in MD \$MA\_SAFE\_POS\_TOL. This can be checked by means of the safe position values for the two monitoring channels displayed in the service menu.  
 The alarm is displayed only, if monitoring with absolute reference (SE/SN) has been enabled for the specified axis and if the user enable has been set. The alarm is cleared, as soon as the user enable is deleted or the actual value difference between the two monitoring channels falls again below the maximum permissible difference.

**Reaction:** Alarm display.

**Remedy:** If the alarm is present statically, the user enable must be deleted. When the control is then rebooted, the machine can be brought to the safe state again and operation resumed by a new referencing process and setting of the user enable. Prior to setting the user enable, the actual position of the axis displayed in the "User enable" screen must be compared with the current machine position. This is obligatory to ensure the proper functioning of the safe limit positions (SE) and safe cams (SN).  
 A change of the user acknowledgement is only possible with key switch position 3 or after input of a password.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**27006 Axis %1 Test ext. pulse deletion running**

**Parameters:** %1 = Axis number

---

<b>Definitions:</b>	The correct functioning of the external pulse disable is being checked now by setting the "Test stop of external shutdown" SGE.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Alarm disappears automatically when the test has been exited by deleting the "Test stop of external shutdown" SGE.
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

---

### 27007      **Axis %1 acceptance test mode is active**

<b>Parameters:</b>	%1 = Axis number
<b>Definitions:</b>	Via the operator panel, an SI acceptance test has been started for example with the acceptance test wizard. The acceptance test mode is activated via the NCK and drive for the time of this acceptance test. In the acceptance test mode, SI PowerOn alarms can be acknowledged with the Reset key.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Deselect the acceptance test, for example with the acceptance test wizard or wait until completed (acceptance test time can be parameterized via MD \$MA_SAFE_ACCEPTANCE_TST_TIMEOUT).
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

---

### 27008      **Axis %1 SW limit switch deactivated**

<b>Parameters:</b>	%1 = Axis number
<b>Definitions:</b>	Via the HMI, the SI acceptance test Safe limit position has been started, for example with the acceptance test wizard. For these acceptance tests, the single-channel software limit switches are deactivated for the axis/spindle, in order to assure that the safe limit positions can be approached.
<b>Reaction:</b>	Alarm display. Deactivation of the single-channel software limit switch for the displayed axis/spindle.
<b>Remedy:</b>	Deselect the acceptance test, for example with the acceptance test wizard, or wait until completed.
<b>Program</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.
<b>Continuation:</b>	

---

### 27010      **Axis %1 tolerance for safe standstill exceeded**

<b>Parameters:</b>	%1 = Axis number
<b>Definitions:</b>	The axis has moved too far away from the setpoint position. It is further away than allowed in MD \$MA_SAFE_STANDSTILL_TOL. The alarm can be reprogrammed in the MD \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready. Stop of the axis with the setpoint speed value=0 (STOP B). As soon as the actual speed value is smaller than defined in MD \$MA_SAFE_STANDSTILL_VELO_TOL, but the latest after time-out in MD \$MA_SAFE_PULSE_DISABLE_DELAY, the pulses will be suppressed (STOP A).
<b>Remedy:</b>	Check the tolerance of zero speed monitoring: does the value match the precision and control dynamics of the axis? If not, increase tolerance. If yes, check the machine for any damage and rectify it.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

**27011 Axis %1 safe velocity exceeded**

**Parameters:** %1 = Axis number

**Definitions:** The axis has moved too quickly and faster than allowed in MD \$MA\_SAFE\_VELO\_LIMIT. With active SBH/SG and a 1-encoder system, the velocity which corresponds to an encoder limit frequency of MD SAFE\_ENC\_FREQ\_LIMIT has been exceeded.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Axis stop with STOP A, C, D or E, depending on the configuration in MD \$MA\_SAFE\_VELO\_STOP\_MODE or MD \$MA\_SAFE\_VELO\_STOP\_REACTION.

**Remedy:** If no obvious operator error occurred: check the input value of the MD, check SGEs: was the correct safe velocity selected? If the MDs and SGEs are o.k., check the machine for any damage and rectify it.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27012 Axis %1 safe end position exceeded**

**Parameters:** %1 = Axis number

**Definitions:** The axis has exceeded the limit position entered in MD \$MA\_SAFE\_POS\_LIMIT\_PLUS or MD \$MA\_SAFE\_POS\_LIMIT\_MINUS.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Stop the axis with STOP C,D or E, depending on the configuration in MD \$MA\_SAFE\_POS\_STOP\_MODE.

**Remedy:** If no obvious operator error occurred: Check the input value of the machine data and check the SGEs: was the correct one of 2 limit positions selected? If the MDs and SGEs are o.k., check the machine for any damage and rectify it.

**Program Continuation:** Clear alarm with the RESET key. Restart part program  
Remove the user agreement for this axis. Then press the RESET key causing the program to be aborted and the alarm to be deleted. Traverse the axis in JOG mode to the valid traversing range. After fault correction of the NC program and an axis position check, the user agreement can be set again and the program can be restarted.

---

**27013 Axis %1 Safe monitoring for acceleration exceeded**

**Parameters:** %1 = Axis number

**Definitions:** After the initiation of STOP B or C, the velocity exceeded the tolerance value entered in MD \$MA\_SAFE\_STOP\_VELO\_TOL.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.  
Pulse interlock by triggering a STOP A.

**Remedy:** Check MD \$MA\_SAFE\_STOP\_VELO\_TOL. Check the braking behavior of the affected drive.

**Program Continuation:** Switch control OFF - ON.

---

**27020 Axis %1 stop E triggered****Parameters:** %1 = Axis number**Definitions:** This alarm is output together with alarms 27011 "Safe velocity exceeded" or 27012 "Safe limit position exceeded" (when configured as such in MD \$MA\_SAFE\_VELO\_STOP\_MODE, \$MA\_SAFE\_VELO\_STOP\_REACTION or MD: \$MA\_SAFE\_POS\_STOP\_MODE).**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Trigger a LIFTFAST ASUB and internal activation of the safe operational stop (SBH) after expiry of the time set in MD \$MA\_SAFE\_STOP\_SWITCH\_TIME\_E.**Remedy:** Eliminate causes of the alarms "Safe velocity exceeded" or "Safe limit position exceeded" (see description of these alarms).**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27021 Axis %1 stop D triggered****Parameters:** %1 = Axis number**Definitions:** This alarm is output together with alarms 27011 "Safe velocity exceeded" or 27012 "Safe limit position exceeded" (when configured as such in \$MA\_SAFE\_VELO\_STOP\_MODE, \$MA\_SAFE\_VELO\_STOP\_REACTION or \$MA\_SAFE\_POS\_STOP\_MODE).**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Trigger a "Deceleration on the path" and internal activation of the safe operational stop (SBH) after expiry of the time set in MD \$MA\_SAFE\_STOP\_SWITCH\_TIME\_D.**Remedy:** Eliminate causes of alarm "Safe velocity exceeded" or "Safe limit position exceeded" (see description of these alarms).**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27022 Axis %1 stop C triggered****Parameters:** %1 = Axis number**Definitions:** This alarm is output together with alarms 27011 "Safe velocity exceeded" or 27012 "Safe limit position exceeded" (when configured as such in \$MA\_SAFE\_VELO\_STOP\_MODE, \$MA\_SAFE\_VELO\_STOP\_REACTION or \$MA\_SAFE\_POS\_STOP\_MODE).**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Trigger a "Deceleration on the current limit" and internal activation of the safe operational stop (SBH) after expiry of the time set in MD \$MA\_SAFE\_STOP\_SWITCH\_TIME\_C.**Remedy:** Eliminate causes of alarm "Safe velocity exceeded" or "Safe limit position exceeded" (see description of these alarms).**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27023 Axis %1 stop B triggered****Parameters:** %1 = Axis number

**Definitions:** This alarm is output together with alarm 27010 "Tolerance for safe operational stop exceeded" or after alarm 27001 "STOP F triggered".  
The alarm can be reprogrammed in MD ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.  
Trigger a "Deceleration on the current limit" and activation of the timer for a switchover after STOP A (see MD \$MA\_SAFE\_PULSE\_DISABLE\_DELAY).

**Remedy:** Eliminate causes of alarm "Tolerance for safe standstill exceeded" or "STOP F triggered" (see description of these alarms).

**Program Continuation:** Switch control OFF - ON.

---

**27024 Axis %1 stop A triggered**

**Parameters:** %1 = Axis number

**Definitions:** This alarm follows an  
- alarm 27011 "Safe velocity exceeded" (when configured as such in \$MA\_SAFE\_VELO\_STOP\_MODE, \$MA\_SAFE\_VELO\_STOP\_REACTION),  
- alarm 27013 "Safe monitoring for acceleration exceeded",  
- alarm 27023 "Stop B triggered",  
- unsuccessful test stop.  
The alarm can be reprogrammed in the MD ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
Channel not ready.  
Trigger a "Pulse suppression".

**Remedy:** Eliminate causes of  
- alarm "Safe velocity exceeded",  
- alarm "Safe monitoring for acceleration exceeded",  
- alarm "Stop B triggered",  
- unsuccessful test stop  
(see description of these alarms).

**Program Continuation:** Switch control OFF - ON.

---

**27031 Axis %1 limit value for safe velocity %2 at gear ratio %3 too large (max. %4)**

**Parameters:** %1 = Axis number  
%2 = Limit value index  
%3 = Number of the transmission ratio  
%4 = Maximum velocity

**Definitions:** All limit values in MD \$MA\_SAFE\_VELO\_LIMIT have to be set in a way that the limit frequency of the amplitude monitoring in the measuring circuit hardware is not exceeded. The limit value which did not fulfil this condition is indicated as second parameter (1 for SG1, 2 for SG2, etc.). The third parameter indicates the gear stage, e.g. 1 for gear stage 1, 2 for gear stage 2, etc. The fourth parameter indicates the maximum velocity which can be entered to just maintain the limit frequency in safe operation.  
The alarm can be reprogrammed in the MD ALARM\_REACTION\_CHAN\_NOREADY (channel not ready).

---

<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Trigger a "Pulse suppression".
<b>Remedy:</b>	Reduce the limit value in MD \$MA_SAFE_VELO_LIMIT[x], x = (2nd alarm parameter) - 1, or correct the setting of the gear factors.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27032 Axis %1 checksum error of safe monitoring. Confirmation and acceptance test required.

<b>Parameters:</b>	%1 = Axis number
<b>Definitions:</b>	The relevant MDs for parameterization of the axial safety functionality are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check MDs. Have the checksum recalculated. Re-accept safety functions (motion monitoring).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27033 Axis %1 parameterization of MD %2[%3] invalid

<b>Parameters:</b>	%1 = Axis number %2 = MD identifier %3 = Machine data index
<b>Definitions:</b>	The parameterization of machine data %2 is incorrect. An additional indication is the array index of the machine data. If the machine data is a single machine data, a zero is specified as array index. This alarm occurs in the following contexts: <ul style="list-style-type: none"> <li>- 1. Conversion of the specified MD into the internal calculation format will cause an overflow.</li> <li>- 2. The values entered in MD \$MA_SAFE_POS_LIMIT_PLUS and \$MA_SAFE_POS_LIMIT_MINUS have been interchanged. The upper limit is less than or equal to the lower limit.</li> <li>- 3. For an axis with safety functions, the setpoint/actual channel assignment in MD \$MA_SAFE_ENC_SEGMENT_NR, MD \$MA_CTRLOUT_SEGMENT_NR was not made on the drive bus. No module number was stated for a setpoint/actual value assignment in MD \$MA_CTRLOUT_MODULE_NR, MD \$MA_SAFE_ENC_MODULE_NR.</li> <li>- 4. The number of drives has changed. On reading back the standstill position and the associated drive number, a difference has been found to the current drive configuration.</li> <li>- 5. A safety function has been enabled in MD \$MA_SAFE_FUNCTION_ENABLE without the safety functions SBH/SG having been enabled.</li> <li>- 6. Error on parameterizing the input/output assignments for the SGEs/SGAs.</li> <li>- 7. A zero has been entered in MD \$MA_SAFE_ENC_GRID_POINT_DIST.</li> <li>- 8. A zero has been entered in MD \$MA_SAFE_ENC_RESOL.</li> <li>- 9. Different settings have been made in MD \$MA_IS_ROT_AX and MD \$MA_SAFE_IS_ROT_AX.</li> <li>- 10. A non-existent measuring circuit has been parameterized in MD \$MA_SAFE_ENC_INPUT_NR.</li> </ul>

- 11. In MD \$MA\_SAFE\_ENC\_MODULE\_NR, the number of a drive has been entered that either does not exist or has been detected as inactive. With an inactive drive, MD \$MA\_SAFE\_ENC\_TYPE was not reset to 0.
- 12. In MD \$MA\_SAFE\_ENC\_TYPE, an encoder type has been parameterized that does not match the physically present type.
- 13. In MD \$MA\_SAFE\_ENC\_TYPE, an incorrect encoder type has been entered for an active drive (\$MA\_SAFE\_ENC\_TYPE = 0, 2, 3 or 5).
- 14. When setting the parameters for the motor encoder in MD \$MA\_SAFE\_ENC\_INPUT\_NR, the measuring circuit for the 2nd measuring system is also used to ensure double-redundancy. The 2nd measuring circuit of this drive module has also been parameterized in the data of another axis, therefore there is a dual assignment. The 2nd measuring circuit connection cannot be used for the actual value acquisition in this parameterization.
- 15. In MD \$MA\_SAFE\_POS\_TOL a value greater than 10mm was entered for a linear axis.
- 16. In MD \$MA\_SAFE\_REFP\_POS\_TOL, a value greater than 1mm was entered for a linear axis.
- 17. The limit values for the "n<n\_x" monitoring, calculated from MD \$MA\_SAFE\_VELO\_X and MD \$MA\_SAFE\_POS\_TOL, are of equal size.
- 18. One of the activated cam positions is outside the actual value modulo range.
- 19. The parameterized cam modulo range MD \$MA\_SAFE\_MODULO\_RANGE is not a multiple integer of 360 degrees.
- 20. The parameterized cam modulo range MD \$MA\_SAFE\_MODULO\_RANGE and the modulo range in MD \$MA\_MODULO\_RANGE cannot be divided as integers into one another.
- 21. The "Actual value synchronization 2-encoder system" function (slippage) is selected for a single-encoder system, or a function with an absolute reference (SE/SN) is active at the same time.
- 22. Alarms 27000/300950 should be suppressed for parking (MD \$MA\_SAFE\_PARK\_ALARM\_SUPPRESS!=0). The SGA "Axis safely referenced" must be configured in MD \$MA\_SAFE\_REFP\_STATUS\_OUTPUT.
- 23. An axial SGE/SGA was configured at the SPL interface (segment number = 4) and the function enable for the external stops (MD \$MA\_SAFE\_FUNCTION\_ENABLE, bit6) is missing.
- 24. An axial SGE/SGA was parameterized at the SPL interface (segment number = 4) and the SGE "Deselect ext. Stop A" (assignment via MD \$MA\_SAFE\_EXT\_STOP\_INPUT[0]) was parameterized inverted (bit31 = 1) or the SGE "Deselect ext. Stop A" was not parameterized at the SPL interface \$A\_OUTSI.
- 25. The function "Save actual value with incremental encoder" is enabled via MD \$MA\_ENC\_REFP\_STATE for the parameterizable incremental encoder, and a monitoring function with absolute reference (SE/SN) is enabled via MD \$MA\_SAFE\_FUNCTION\_ENABLE. It is not permissible to combine these functions.
- 26. A value greater than 1000 mm/min was entered for a linear axis in MD \$MA\_SAFE\_STANDSTILL\_VELO\_TOL.
- 28. A value greater than 1000 mm/min was entered for a linear axis in MD \$MA\_SAFE\_VELO\_X.
- 29. A value greater than 1000 mm/min was entered for a linear axis in \$MA\_SAFE\_SLIP\_VELO\_TOL.
- 30. A value greater than the maximum settable encoder limit frequency for the safe operation of a single-encoder system was set in MD \$MA\_SAFE\_ENC\_FREQ\_LIMIT.
- 31. A value greater than 300kHz for a Performance-1 or Standard-2 control module was set in MD \$MA\_SAFE\_ENC\_FREQ\_LIMIT.
- 32. MD \$MA\_SAFE\_EXT\_PULSE\_ENAB\_OUTPUT was not or not correctly parameterized. A parameterization of this MD is required if in MD \$MA\_SAFE\_PULSE\_ENABLE\_OUTPUT, bit30 is set to 1, i.e. internal pulse suppression is being used.
- 33. The MD \$MN\_SAFE\_SPL\_STOP\_MODE has been parameterized to the value of 4 (Stop E) without having enabled the external Stop E in all the axes with SI function enables (MD \$MA\_SAFE\_FUNCTION\_ENABLE not equal to 0).
- 34. Testing the mechanical system of the brakes was enabled in MD \$MA\_FIXED\_STOP\_MODE (bit1 = 1), without previously enabling the safe operation function for this axis in MD \$MA\_SAFE\_FUNCTION\_ENABLE. Testing the mechanical system of the brakes is permitted only with safety functions in this axis.
- 35. Illegal values have been parameterized in MD \$MA\_SAFE\_VELO\_STOP\_MODE or MD \$MA\_SAFE\_VELO\_STOP\_REACTION.
- 36. In MD \$MA\_SAFE\_FUNCTION\_ENABLE, the cam synchronization was activated via bit7 without enabling any cams via bit8...bit15.
- 37. The cam is enabled both via \$MA\_SAFE\_FUNCTION\_ENABLE and via \$MA\_SAFE\_CAM\_ENABLE
- 38. In MD \$MA\_SAFE\_DRIVE\_PS\_ADDRESS an invalid value was parameterized or the same address was assigned to several axes.
- 39. The internal default of MD \$MA\_SAFE\_ENC\_PULSE\_SHIFT from drive parameterization could not be executed, as some values outside the specified range would have to be defaulted in this case. Adjust the encoder parameterization in the drive.
- 40. The MD \$MA\_SAFE\_VELO\_OVR\_FACTOR was parameterized with digits behind the decimal point.
- 41. The logical basic address configured in the hardware configuration and that addressed via MDs \$MA\_SAFE\_CTRL\_OUT\_MODULE\_NR, \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS are not the same or the slot addressed by them has the wrong length.
- 42. The cam position \$MA\_SAFE\_CAM\_POS\_PLUS[n] or \$MA\_SAFE\_CAM\_POS\_MINUS[n] has been parameterized too close to the modulo limit.



- 43. "Safe cams" are enabled in bit 8..15 of \$MA\_SAFE\_FUNCTION\_ENABLE and at the same time the "Safe cam track" function is enabled in \$MA\_SAFE\_CAM\_ENABLE.
- 44. The minus cam position \$MA\_SAFE\_CAM\_POS\_MINUS[n] is greater than the plus cam position \$MA\_SAFE\_CAM\_POS\_PLUS[n]. This is not permitted for the "Safe cam track" function.
- 45. The distance between 2 cams on one cam track (\$MA\_SAFE\_CAM\_POS\_MINUS[n] and \$MA\_SAFE\_CAM\_POS\_PLUS[m]) is too small. ("Safe cam track" function)
- 46. The cam length, that is the distance between a plus cam position (\$MA\_SAFE\_CAM\_POS\_PLUS[n]) and a minus cam position (\$MA\_SAFE\_CAM\_POS\_MINUS[n]), is too small. ("Safe cam track" function)
- 47. Identical values have been entered in \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[n] for at least 2 cams enabled in \$MA\_SAFE\_CAM\_ENABLE. ("Safe cam track" function)
- 48. The value parameterized in \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[n] for a cam enabled in \$MA\_SAFE\_CAM\_ENABLE is invalid. ("Safe cam track" function)
- 49. More than 15 cams have been assigned to one cam track by \$MA\_SAFE\_CAM\_TRACK\_ASSIGN[n]. ("Safe cam track" function)
- 50. Cam modulo functionality has been selected in \$MA\_SAFE\_MODULO\_RANGE, however this is not supported for the "Safe cam track" function.
- 51. Setting \$MA\_SAFE\_FUNCTION\_ENABLE bit7 is not permitted if the "Safe cam track" function is enabled. The cam synchronization is implicitly enabled.
- 52. Only 840D sl: The parameterized monitoring cycle \$MN\_INFO\_SAFETY\_CYCLE\_TIME does not match the monitoring cycle (p9500) parameterized in the drive monitoring channel.
- 53. The velocity hysteresis nx in \$MA\_SAFE\_VELO\_X\_HYSTERESIS is greater than half the velocity limit nx in \$MA\_SAFE\_VELO\_X.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check and change the specified MD. Allow the checksum to be recalculated. Re-accept safety functions.

**Program** Switch control OFF - ON.

**Continuation:**

---

### 27034 Parameterization of MD %1[%2] invalid.

**Parameters:** %1 = MD identifier  
%2 = Machine data index

**Definitions:** The parameterization of machine data %1 is incorrect. This alarm occurs in the following contexts:  
- An invalid value has been set for MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL.  
- An invalid value has been set for MD \$MN\_SAFE\_RDP\_CONNECTION\_NR.  
- An invalid value has been set for MD \$MN\_SAFE\_SDP\_CONNECTION\_NR.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check and correct the specified machine data.

**Program** Switch control OFF - ON.

**Continuation:**

---

### 27035 Axis %1 new hardware component, confirmation and functional test required.

**Parameters:** %1 = Axis number

**Definitions:** The IDs for the corresponding hardware components (encoder, motor module) read out by the drive do not match the NCK parameterization.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** If the alarm occurs during setup, proceed as follows:  
- Confirm the checksum SAFE\_ACT\_CHECKSUM[1] (keyswitch position 3 or password has to be entered). Resume setup.  
If the alarm occurs after an encoder module or a DRIVE-CLiQ motor has been replaced, proceed as follows:  
- In the Diagnostics operating area, confirm the hardware checksum in SAFE\_ACT\_CHECKSUM[1] with the softkey (keyswitch position 3 or password has to be entered).  
- Readjust the actual value encoder.  
- Check SI actual value acquisition: velocities, traversing direction, absolute position (set user agreement if necessary).  
- Record the new checksum value in SAFE\_ACT\_CHECKSUM[1] and the last entry in the change history in MD SAFE\_CONFIG\_CHANGE\_DATE[0].  
- Record the hardware and software version data for the new component.

**Program Continuation:** Switch control OFF - ON.

---

**27036 Axis %1 encoder parameterization MD %2[%3] has been adjusted.**

**Parameters:** %1 = Axis number  
%2 = MD identifier  
%3 = Machine data index

**Definitions:** Encoder parameterization of the encoder read out by the drive for the SI monitoring functions does not match NCK parameterization in the displayed MD. The relevant NCK MD has been adjusted.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
In addition, a Stop F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024.  
Alarm 27001 with error code 0 can be avoided by alarm reduction (\$MA\_SAFE\_ALARM\_SUPPRESS\_LEVEL higher or equal to 1).

**Remedy:** Continue with setup, correct checksum

**Program Continuation:** Switch control OFF - ON.

---

**27037 Axis %1 and %2 with the same PROFIsafe address %3.**

**Parameters:** %1 = Axis number  
%2 = Axis number  
%3 = PROFIsafe address

**Definitions:** The PROFIsafe addresses of these two axes read out by the drive are identical.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Set the correct PROFIsafe addresses of the drives.

**Program Continuation:** Switch control OFF - ON.

**27038 Axis %1 value %2 in drive parameter %3 violates the limits of NCK MD %4.**

**Parameters:** %1 = Axis number  
 %2 = Value in drive parameter  
 %3 = Drive parameter number, for example parameter 979.  
 %4 = NCK machine data name.

**Definitions:** A SINAMICS drive delivers values in a parameter that violate the permissible value range for an NCK machine data. If several drive parameters are listed, there is a problem with the combination of these drive parameters. In this case, the result of the link is displayed as the value.

**Reaction:** Alarm display.

**Remedy:** Check why an incorrect value has been entered in the drive parameter(s) specified (979 (PROFIdrive encoder format), 470/471/472/475 (DRIVE-CLiQ format) or 9527 (encoder module type) (internal software errors in the drive, for example; see drive documentation).

**Program Continuation:** Switch control OFF - ON.

**27039 Axis %1 parameterization MD %2[%3] changed, confirmation and functional test required.**

**Parameters:** %1 = Axis number  
 %2 = MD identifier  
 %3 = Machine data index

**Definitions:** The parameterization read out by the drive for the SI monitoring functions does not match the NCK parameterization in the displayed MD. The relevant NCK MD has been adjusted. The following relation exists between the NCK MDs and the drive parameters:  
 - \$MA\_SAFE\_BRAKETEST\_TORQUE\_NORM corresponds to p2003

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Continue with setup, correct checksum.  
 - If MD \$MA\_SAFE\_BRAKETEST\_TORQUE\_NORM is displayed:  
 The change to p2003 must be taken into account in the parameterization of MD \$MA\_SAFE\_BRAKETEST\_TORQUE. The holding torque to be parameterized for the brake test must be reset.  
 \$MA\_SAFE\_BRAKETEST\_TORQUE = desired test torque of the brake / p2003 \* 100.  
 Then an acceptance test of the functioning of the brake test must be made.

**Program Continuation:** Switch control OFF - ON.

**27040 Axis %1 waiting for motor module.**

**Parameters:** %1 = Axis name, spindle number

**Definitions:** Alarm on ramp-up as long as the motor module is not yet ready for SI. Communication to the motor module is not yet active on ramp-up, the safety functions are not yet available. The alarm indication can be set in MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL so that only one alarm is displayed for all axes.

**Reaction:** Interface signals are set.  
 Alarm display.

**Remedy:** The alarm will remain present during ramp-up if the drive does not communicate. Otherwise the alarm will only be displayed briefly and then deleted automatically.  
Possible causes for the continual presence of this alarm:  
- The safe motion monitoring is only activated in \$MA\_SAFE\_FUNCTION\_ENABLE, but not in the corresponding parameter of the assigned drive (p9501).  
- The axis -> drive assignment in MD \$MA\_SAFE\_CTRL\_OUT\_MODULE\_NR, MD \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS or p0978 is incorrect.  
- PROFIBUS connector has fallen out.  
Check the correctness of parameter p9501 and the assignment of the drive in MD \$MA\_SAFE\_CTRL\_OUT\_MODULE\_NR and \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS, p0978.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**27050 Axis %1 SI communication failure.**

**Parameters:** %1 = Axis number

**Definitions:** Communication with the drive for Safety Integrated motion monitoring is additionally monitored. This monitoring has found an error.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
In addition, a STOP F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024. Alarm 27001 with error code 0 can be avoided by alarm reduction(\$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL higher or equal to 1).

**Remedy:** Check the connections between NCK and drive.  
Check the configuration of the PROFIBUS telegram (e.g. SI slot configured).  
Check the assignment of the NCK SI axis to the SI slot (\$MA\_SAFE\_CTRL\_OUT\_MODULE\_NR, \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS).  
Check for compliance with the EMC requirements.  
Check the assignment of the telegram configuration for the slave OM

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**27060 Axis %1 Drive assignment checksum error. Confirmation and acceptance test required!**

**Parameters:** %1 = Axis number

**Definitions:** The axial MDs \$MA\_SAFE\_... and \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check machine data, have the checksum recalculated and confirm. Re-accept the safety functions (connections NCK axis - drive/encoder).

**Program Continuation:** Switch control OFF - ON.

---

<b>27070</b>	<b>Checksum error parameterization SPL and SPL interfaces. Confirmation and acceptance test required!</b>
<b>Definitions:</b>	The NCK MDs \$MN_SAFE_IN/OUT..., \$MN_PROFISAFE..., \$MN_SAFE_SDP/RDP... are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check machine data, have the checksum recalculated and confirm. Re-accept the safety functions (PROFIsafe, DMP assignment SPL-I/Os, FSEND/FRECV).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>27071</b>	<b>Checksum error safe PLC parameterization. Confirmation and acceptance test required!</b>
<b>Definitions:</b>	The NCK MDs \$MN_SAFE_USER_DATA are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check machine data, have the checksum recalculated and confirm. Re-accept the safety functions
<b>Program Continuation:</b>	Switch control OFF - ON.

---

<b>27072</b>	<b>Checksum error enable safe communication. Confirmation and acceptance test required!</b>
<b>Definitions:</b>	The NCK MDs \$MN_PROFISAFE_..._ENABLE, \$MN_SAFE_RDP/SDP_ENABLE are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check machine data, have the checksum recalculated and confirm. Re-accept the safety functions (PROFIsafe, FSEND/FRECV).
<b>Program Continuation:</b>	Switch control OFF - ON.

**27073 Checksum error S7 PROFIsafe configuration. Confirmation and acceptance test required!**

**Definitions:** The F parameters required for PROFIsafe communication are protected by a checksum. The alarm indicates that the current checksum no longer corresponds to the stored checksum, this means that an MD has either been changed without authorization or is faulty.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the PROFIsafe configuration on the S7 side. Have the checksum recalculated. Re-accept safety functions (PROFIsafe I/Os).

**Program Continuation:** Switch control OFF - ON.

---

**27090 Error in data cross check NCK-PLC, %1[%2], NCK: %3; %4<ALSI>**

**Parameters:** %1 = Name of system variable in which the error was detected  
%2 = System variable array index extension  
%3 = NCK comparison value extension  
%4 = Cross-check array index extension

**Definitions:** Differences in the compared data have occurred in a cyclic data cross-check between NCK and PLC. Parameter %1 specifies the incorrect system variable (\$A\_INSI, \$A\_OUTSI, \$A\_INSE, \$A\_OUTSE or \$A\_MARKERSI) with array index %2.

Special cases:

- Display "Error in NCK-PLC data cross-check, \$MN\_PREVENT\_SYNACT\_LOCK[0], ..." means that the SPL commissioning status has been set differently in the NCK and PLC.
- Display "Error in NCK-PLC data cross-check, \$MN\_SPL\_STOP\_MODE[0], ..." means that the SPL stop reaction (Stop D or E) has been set differently in the NCK and PLC.
- Display "Error in NCK-PLC data cross-check, \$MN\_SAFE\_SPL\_USER\_DATA[n], ..." means that different user data have been set in NCK and PLC.
- Display "Error in NCK-PLC data cross-check, TIMEOUT[0], NCK: 0" means that the communication between NCK and PLC is generally disturbed and that a data cross-check can no longer be performed.
- Display "Error in NCK-PLC data cross-check, \$A\_FSDP\_ERR\_REAC[n], \$A\_FRDP\_SUBS[n], \$A\_FRDP\_ERR\_REAC[n]..." means that different system variables have been specified in NCK and PLC.

With data cross-check errors on system variables \$A\_INSE, the hardware assignment parameterized in MD \$MN\_SAFE\_IN\_HW\_ASSIGN[0...7] is displayed in addition to the affected system variables in alarm parameter %1, so that the affected hardware connection is shown directly by the specifications in the alarm line.

Example: Error in NCK-PLC data cross-check, DMP 04.03 bit 01=\$A\_INSE[2], NCK: 1;  
The specifications in the example (04.03) correspond to the entries made in the machine data \$MN\_SAFE\_IN\_HW\_ASSIGN[0...7] for the stated system variable.

They specify:

- DMP 04.xx The drive number of the affected terminal block (value range = 01...21).
- DMP xx.03 Module number of the input module (value range = 01...08).

The stated numbers are shown as hexadecimal numbers as in MD \$MN\_SAFE\_IN\_HW\_ASSIGN[0...7].  
The specification of the bit numbers begins with the value 0 (value range = 00...15), the same as the numbering of the inputs on the DMP modules.

When assigning the SPL inputs to the NC onboard inputs, the extended alarm text is as follows:  
Error in NCK-PLC data cross-check, NC-Onboard-In 01=\$A:INSE[1], NCK: 1; 2.

With parameter %4, a specific alarm message can be configured on HMI for all listed system variables:

- %4 = 0: Error SPL commissioning status (\$MN\_PREVENT\_SYNACT\_LOCK[0,1] - DB18 DBX36.0)
- %4 = 0: Error SPL stop reaction (\$MN\_SAFE\_SPL\_STOP\_MODE - DB18 DBX36.1).
- %4 = 0: Error SPL user data (\$MN\_SAFE\_SPL\_USER\_DATA - DB18 DBD256,260,264,268)
- %4 = 0: Error FSEND DP error reaction (\$A\_FSDP\_ERR\_REAC[n] - DB18 DBW190, DBW210, DBW220)
- %4 = 0: Error FRECVDP error reaction (\$A\_FRDP\_ERR\_REAC[n] - DB18 DBW222, DBW234, DBW246)
- %4 = 0: Error FRECVDP replacement values (\$A\_FRDP\_SUBS[n] - DB18 DBW220, DBW232, DBW244)
- %4 = 1... 64: Error in system variable \$A\_INSE[1...64]
- %4 = 65...128: Error in system variable \$A\_OUTSE[1...64]
- %4 = 129...192: Error in system variable \$A\_INSI[1...64]
- %4 = 193...256: Error in system variable \$A\_OUTSI[1...64]
- %4 = 257...320: Error in system variable \$A\_MARKERSI[1...64]

In order to parameterize alarm 27090, file ALSI\_xx.com must be incorporated in the data management and declared in HMI via MBDDE.INI in the section[IndexTextFiles] ALSI=f:\dh\mb.dir\alsi\_. The machine manufacturer can redefine this file, in order to incorporate additional text passages in the alarm that make sense for their system. If the file is redefined, the newly created file has to be declared in the system via MBDDE.INI.

The display of alarm 27090 can be modified via MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL: MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL = 2 : Alarm 27090 will now only displayed for the first data difference found.

<b>Reaction:</b>	Alarm display. Trigger a STOP D/E (settable via MD \$MN_SPL_STOP_MODE) on all axes with safety functionality, as soon as the SPL setup phase (MD \$MN_PREVENT_SYNACT_LOCK[0,1] unequal to 0) is completed.
<b>Remedy:</b>	Analyze the value displayed and evaluate DB18: SPL_DELTA on the PLC side. Find the difference between the monitoring channels. Possible causes: <ul style="list-style-type: none"> <li>- Incorrect wiring</li> <li>- Incorrect SPL</li> <li>- Incorrect assignment of the axial SGEs to internal interface \$A_OUTSI</li> <li>- Incorrect assignment of the axial SGAs to internal interface \$A_INSI</li> <li>- Incorrect assignment of the SPL SGEs to external interface \$A_INSE</li> <li>- Incorrect assignment of the SPL SGAs to external interface \$A_OUTSE</li> <li>- Different SPL startup status set in NCK and PLC</li> <li>- Different SPL stop reaction set in NCK and PLC</li> </ul>
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

<b>27091</b>	<b>Error in data cross check NCK-PLC, stop of %1</b>
<b>Parameters:</b>	%1 = Extension indicating the monitoring channel that triggered the stop
<b>Definitions:</b>	The monitoring channel specified in %1 (NCK or PLC) has triggered a stop D or E (depending on the parameterization in MD \$MN_SAFE_SPL_STOP_MODE). The alarm 27090 provides further information about the cause for the stop D/E.
<b>Reaction:</b>	Alarm display. Trigger a STOP D/E (settable via MD \$MN_SPL_STOP_MODE) on all axes with safety functionality, as soon as the SPL setup phase (MD \$MN_PREVENT_SYNACT_LOCK[0,1] unequal to 0) is completed.
<b>Remedy:</b>	Evaluate the alarm parameters of alarm 27090 and amend the SPL, or check the I/O modules/wiring or the internal SPL interfaces to the safety monitoring channels in the NCK and drive SIMODRIVE611D.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

<b>27092</b>	<b>Communication broken off during NCK PLC data cross check, error detected by %1</b>
<b>Parameters:</b>	%1 = Extension indicating the monitoring channel that detected the error

**Definitions:** The delay time (1s) for communication monitoring was exceeded in the monitoring channel specified in %1 (NCK or PLC). The other monitoring channel did not send a new data packet within this time.

**Reaction:** Alarm display.  
A timer of 5 secs is started, after the expiry of which  
- the external NCK SPL outputs are deleted  
- the PLC changes to stop.

**Remedy:** Check the system components (the PLC must have the correct version of FB15 and DB18).

**Program Continuation:** Switch control OFF - ON.

---

**27093 Checksum error NCK-SPL, %1, %2, %3**

**Parameters:** %1 = Extension indicating the type of error  
%2 = Extension indicating the reference variable  
%3 = Extension indicating the actual variable

**Definitions:** A checksum error has occurred in the NCK SPL. The file /\_N\_CST\_DIR/\_N\_SAFE\_SPF was subsequently modified. The safe programmable logic (SPL) in the NCK may have been corrupted. Parameter %1 provides more information about the nature of the modification:  
- %1 = FILE\_LENGTH: The file length has changed.  
- %1 = FILE\_CONTENT: The file content has changed.  
- %1 = FILE\_PROTECTED: Exiting the SPL startup phase has restricted access rights to the file, and these have been violated.  
%2 specifies the reference variable (file length, checksum of file content), %3 specifies the actual variable which is calculated cyclically.

**Reaction:** Alarm display.

**Remedy:** Check the file and the time of the last modification to the file. Reload the original file and start the monitoring system again with a Power On.

**Program Continuation:** Switch control OFF - ON.

---

**27094 Write access to system variable %1 only allowed from NCK-SPL**

**Parameters:** %1 = Name of safety system variable concerned

**Definitions:** Write access to a safety system variable is only allowed from the part program /\_N\_CST\_DIR/\_N\_SAFE\_SPF. If this error occurs, an instruction from another part program was detected.

**Reaction:** Alarm display.

**Remedy:** Check the part programs you are using for write accesses to safety system variables.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27095 %1 SPL protection not activated**

**Parameters:** %1 = Name of the component on which the protection is not activated (NCK or PLC)

**Definitions:** The protection features are not activated for the SPL. The setup phase of the SPL is not yet complete. No stop reaction (Stop D or E) was initiated on an error in data cross-comparison between NCK and PLC.

**Reaction:** Alarm display.

**Remedy:** - Remedy for NCK: Activate the protection features with MD \$MN\_PREVENT\_SYNACT\_LOCK[0,1]. The number range of the synchronized action IDs used in the SPL must be entered in this MD.  
- Remedy for PLC: Activate the protection features by setting the appropriate data bit in DB18.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---



---

**27096 SPL start not allowed**

<b>Definitions:</b>	To start the SPL in protected state (MD \$MN_PREVENT_SYNACT_LOCK[0,1] not equal 0) Safety Integrated functionality must first be activated for at least one axis (via MD \$MA_SAFE_FUNCTION_ENABLE). Without this functionality it is only possible to operate SPL in setup state.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
<b>Remedy:</b>	Setup axial Safety Integrated functionality or remove the SPL protection via MD \$MN_PREVENT_SYNACT_LOCK[0,1].
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**27097 SPL start not executed**

<b>Definitions:</b>	SPL start not executed after predefined timeout in MD SAFE_SPL_START_TIMEOUT.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Find the cause of the failure of the SPL to start. Possible causes may be: <ul style="list-style-type: none"> <li>- There is an NC or drive error (e.g. after encoder replacement, EMERGENCY STOP, PROFIsafe alarms)</li> <li>- There is a syntax error in the SPL</li> <li>- Safety Integrated alarm present (e.g. "Safe limit position overrun")</li> <li>- Name or path of SPL for PROG_EVENT Start written incorrectly; make sure upper and lower cases are used correctly</li> <li>- Simultaneous start of an ASUB and PROG_EVENT, parameterization MD 11602 (stop causes e.g. read-in disable)</li> <li>- Problems when calling FB4/FC9</li> </ul> This alarm can be masked via MD \$MN_SAFE_DIAGNOSIS_MASK, Bit 1 = 1.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**27098 SPL commissioning phase terminated**

<b>Definitions:</b>	The SPL setup phase has just been terminated by changing MD \$MN_PREVENT_SYNACT_LOCK. After the next Power ON, file /_N_CST_DIR/_N_SAFE_SPF is subject to the monitoring mechanisms defined for the SPL (access protection, checksum calculation). Changes to the SPL can only be made in the unprotected mode.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Perform a control Power ON. Check and document any changes to the logic in the SPL by means of an acceptance test.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**27099 Double assignment in SPL assignment MD %1[%2] - MD %3[%4]**

<b>Parameters:</b>	%1 = MD name 1 %2 = MD array index for MD name 1 %3 = MD name 2 %4 = MD array index for MD name 2
--------------------	--

**Definitions:** Different applications have double assigned SPL inputs (\$A\_INSE) in the displayed machine data. These could be:  
 - PROFIsafe communication  
 - F\_DP communication  
 Possible values for alarm parameters %1 and %3:  
 - \$MN\_PROFISAFE\_IN\_ASSIGN  
 - \$MN\_SAFE\_RDP\_ASSIGN

**Reaction:** Alarm display.

**Remedy:** Correct the MD.

**Program Continuation:** Switch control OFF - ON.

**27100 At least one axis is not safely referenced**

**Definitions:** There are two reasons for this alarm:  
 - the machine position of at least one of the axes monitored with SI has not yet been acknowledged by the user, or  
 - the machine position of at least one of the axes monitored with SI has not yet been verified through follow-up referencing.  
 Even if the axis is already referenced, there is no confirmation that referencing has supplied the correct result. For example, wrong results can occur if the axis was moved after the control was switched off, with the result that the standstill position saved prior to switching off is no longer correct. To make sure that this does not happen, the user must acknowledge the displayed actual position after the first referencing process.  
 When the user enable has first been set, follow-up referencing must be carried out each time the control is booted (with absolute encoders, this follow-up referencing is executed automatically). This procedure is carried out to verify the standstill position saved prior to switching off of the control.  
 Via the MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL (MD>=3), the alarm display can be set in such a way that an alarm is given for each axis individually which has not been safely referenced.

**Reaction:** Alarm display.  
 SGA "Axis safely referenced" is not set. SE will be switched off, if the actual safety position has not yet been confirmed by a user agreement. If the user agreement has been set, SE will remain active. The safe cams are calculated and output. However, their significance is limited as referencing has not been confirmed.

**Remedy:** Move all SI axes to known positions and change to "Referencing" mode. Check the positions on the machine displayed in the user confirmation field and set "User confirmation" via the selection/toggle key. If the user confirmation for the axes has already been set, reference the axes again.  
 Changing the user confirmation will be possible only in key switch position 3 or after password entry

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

**27101 Axis %1 difference in function safe operational stop, NCK: %2 drive: %3**

**Parameters:** %1 = Axis number  
 %2 = Monitoring status safe operating stop  
 %3 = Monitoring status safe operating stop

**Definitions:** During cross-comparison of result list 1 a difference was detected between the NCK and drive monitoring channels in the status of safe operating stop monitoring.  
 Safe operating stop: Bit 0,1 in result list 1  
 Monitoring status (%2, %3):  
 - OFF = Monitoring is inactive in this monitoring channel  
 - OK = Monitoring is active in this monitoring channel, limit values are not violated  
 - L+ = Monitoring is active in this monitoring channel, upper limit exceeded  
 - L- = Monitoring is active in this monitoring channel, lower limit exceeded

**Reaction:** NC Start disable in this channel.  
 Alarm display.  
 A Stop F was triggered.  
 If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:** Check whether the safe inputs have switched to the same status in both monitoring channels within the permissible time tolerance.  
For further diagnostics, the drive parameters r9710[0], r9710[1] and the servo trace signals "Result list 1 NCK" and "Result list 1 drive" can be used.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

## 27102 Axis %1 difference in function safe velocity %2, NCK: %3 drive: %4

**Parameters:** %1 = Axis number  
%2 = SG level for which the difference was determined  
%3 = Monitoring status safe velocity  
%4 = Monitoring status safe velocity

**Definitions:** During cross-comparison of result list 1 a difference was detected between the NCK and drive monitoring channels in the status of safe velocity monitoring.  
- Safe velocity 1: Bit 6, 7 in result list 1  
- Safe velocity 2: Bit 8, 9 in result list 1  
- Safe velocity 3: Bit 10, 11 in result list 1  
- Safe velocity 4: Bit 12, 13 in result list 1  
Monitoring status (%3, %4):  
- OFF = Monitoring is inactive in this monitoring channel  
- OK = Monitoring is active in this monitoring channel, limit values are not violated  
- L+ = Monitoring is active in this monitoring channel, upper limit exceeded  
- L- = Monitoring is active in this monitoring channel, lower limit exceeded

**Reaction:** NC Start disable in this channel.  
Alarm display.  
A Stop F was triggered.  
If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:** Check whether the safe inputs have switched to the same status in both monitoring channels within the permissible time tolerance.  
For further diagnostics, the drive parameters r9710[0], r9710[1] and the servo trace signals "Result list 1 NCK" and "Result list 1 drive" can be used.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

## 27103 Axis %1 difference in function safe limit position %2, NCK: %3 drive: %4

**Parameters:** %1 = Axis number  
%2 = Number of safe limit position  
%3 = Monitoring status safe limit position  
%4 = Monitoring status safe limit position

**Definitions:** During cross-comparison of result list 1 a difference was detected between the NCK and drive monitoring channels in the status of safe limit position monitoring.  
- Safe limit position 1: Bit 2, 3 in result list 1  
- Safe limit position 2: Bit 4, 5 in result list 1  
Monitoring status (%3, %4):  
- OFF = Monitoring is inactive in this monitoring channel  
- OK = Monitoring is active in this monitoring channel, limit values are not violated  
- L+ = Monitoring is active in this monitoring channel, upper limit exceeded  
- L- = Monitoring is active in this monitoring channel, lower limit exceeded

**Reaction:** NC Start disable in this channel.  
Alarm display.  
A Stop F was triggered.  
If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:** Check whether the safe inputs have switched to the same status in both monitoring channels within the permissible time tolerance.  
 For further diagnostics, the drive parameters r9710[0], r9710[1] and the servo trace signals "Result list 1 NCK" and "Result list 1 drive" can be used.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**27104 Axis %1 difference in function safe cam plus %2, NCK: %3 drive: %4**

**Parameters:** %1 = Axis number  
 %2 = Cam number  
 %3 = Monitoring status safe cam plus  
 %4 = Monitoring status safe cam plus

**Definitions:** During cross-comparison of result list 2 ("Safe cams" function) and result list 3/4/5/6/7 ("Safe cam track" function), the status of safe cam plus monitoring was found to be different in the NCK and drive monitoring channels.

The following applies to the "Safe cams" function:

- Safe cam 1+: bit 0, 1 in result list 2
- Safe cam 2+: bit 4, 5 in result list 2
- Safe cam 3+: bit 8, 9 in result list 2
- Safe cam 4+: bit 12,13 in result list 2

The following applies to the "Safe cam track" function: (each of result lists 3-7 contains 6 cam results)

- Safe cam 1+: bit 0, 1 in result list 3
- Safe cam 2+: bit 4, 5 in result list 3
- Safe cam 3+: bit 8, 9 in result list 3
- Safe cam 4+: bit 12,13 in result list 3
- Safe cam 5+: bit 16,17 in result list 3
- Safe cam 6+: bit 20,21 in result list 3
- Safe cam 7+: bit 0, 1 in result list 4
- Safe cam 8+: bit 4, 5 in result list 4
- Safe cam 9+: bit 8, 9 in result list 4
- Safe cam 10+: bit 12,13 in result list 4
- Safe cam 11+: bit 16,17 in result list 4
- Safe cam 12+: bit 20,21 in result list 4
- Safe cam 13+: bit 0, 1 in result list 5
- Safe cam 14+: bit 4, 5 in result list 5
- Safe cam 15+: bit 8, 9 in result list 5
- Safe cam 16+: bit 12,13 in result list 5
- Safe cam 17+: bit 16,17 in result list 5
- Safe cam 18+: bit 20,21 in result list 5
- Safe cam 19+: bit 0, 1 in result list 6
- Safe cam 20+: bit 4, 5 in result list 6
- Safe cam 21+: bit 8, 9 in result list 6
- Safe cam 22+: bit 12,13 in result list 6
- Safe cam 23+: bit 16,17 in result list 6
- Safe cam 24+: bit 20,21 in result list 6
- Safe cam 25+: bit 0, 1 in result list 7
- Safe cam 26+: bit 4, 5 in result list 7
- Safe cam 27+: bit 8, 9 in result list 7
- Safe cam 28+: bit 12,13 in result list 7
- Safe cam 29+: bit 16,17 in result list 7
- Safe cam 30+: bit 20,21 in result list 7

Monitoring status (%3, %4):

- OFF = Monitoring is inactive in this monitoring channel
- OK = Monitoring is active in this monitoring channel, limit values are not violated
- L+ = Monitoring is active in this monitoring channel, upper limit exceeded
- L- = Monitoring is active in this monitoring channel, lower limit exceeded

<b>Reaction:</b>	NC Start disable in this channel. Alarm display. A Stop F was triggered. If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.
<b>Remedy:</b>	Check whether the safe actual values are the same in both monitoring channels. The drive parameters r9711[0,1] (diagnostics result list 2 [NCK, drive]) and r9735[0,1] / r9736[0,1] / r9737[0,1] / r9738[0,1] / r9739[0,1] (diagnostics result list 3/4/5/6/7 [NCK, drive]) can be used for further diagnostics. A diagnosis is also possible using the servo trace signals "Result list 2/3/4/5/6/7 NCK" and "Result list 2/3/4/5/6/7 drive".
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

## 27105      **Axis %1 difference in function safe cam minus %2, NCK: %3 drive: %4**

<b>Parameters:</b>	%1 = Axis number %2 = Cam number %3 = Monitoring status safe cam minus %4 = Monitoring status safe cam minus
<b>Definitions:</b>	<p>During cross-comparison of result list 2 ("Safe cams" function) and result list 3/4/5/6/7 ("Safe cam track" function), the status of safe cam minus monitoring was found to be different in the NCK and drive monitoring channels. The following applies to the "Safe cams" function:</p> <ul style="list-style-type: none"> <li>- Safe cam 1-: bit 2, 3 in result list 2</li> <li>- Safe cam 2-: bit 6, 7 in result list 2</li> <li>- Safe cam 3-: bit 10, 11 in result list 2</li> <li>- Safe cam 4-: bit 14, 15 in result list 2</li> </ul> <p>The following applies to the "Safe cam track" function: (each of result lists 3-7 contains 6 cam results)</p> <ul style="list-style-type: none"> <li>- Safe cam 1-: bit 2, 3 in result list 3</li> <li>- Safe cam 2-: bit 6, 7 in result list 3</li> <li>- Safe cam 3-: bit 10, 11 in result list 3</li> <li>- Safe cam 4-: bit 14, 15 in result list 3</li> <li>- Safe cam 5-: bit 18, 19 in result list 3</li> <li>- Safe cam 6-: bit 22, 23 in result list 3</li> <li>- Safe cam 7-: bit 2, 3 in result list 4</li> <li>- Safe cam 8-: bit 6, 7 in result list 4</li> <li>- Safe cam 9-: bit 10, 11 in result list 4</li> <li>- Safe cam 10-: bit 14, 15 in result list 4</li> <li>- Safe cam 11-: bit 18, 19 in result list 4</li> <li>- Safe cam 12-: bit 22, 23 in result list 4</li> <li>- Safe cam 13-: bit 2, 3 in result list 5</li> <li>- Safe cam 14-: bit 6, 7 in result list 5</li> <li>- Safe cam 15-: bit 10, 11 in result list 5</li> <li>- Safe cam 16-: bit 14, 15 in result list 5</li> <li>- Safe cam 17-: bit 18, 19 in result list 5</li> <li>- Safe cam 18-: bit 22, 23 in result list 5</li> <li>- Safe cam 19-: bit 2, 3 in result list 6</li> <li>- Safe cam 20-: bit 6, 7 in result list 6</li> <li>- Safe cam 21-: bit 10, 11 in result list 6</li> <li>- Safe cam 22-: bit 14, 15 in result list 6</li> <li>- Safe cam 23-: bit 18, 19 in result list 6</li> <li>- Safe cam 24-: bit 22, 23 in result list 6</li> <li>- Safe cam 25-: bit 2, 3 in result list 7</li> <li>- Safe cam 26-: bit 6, 7 in result list 7</li> <li>- Safe cam 27-: bit 10, 11 in result list 7</li> <li>- Safe cam 28-: bit 14, 15 in result list 7</li> <li>- Safe cam 29-: bit 18, 19 in result list 7</li> <li>- Safe cam 30-: bit 22, 23 in result list 7</li> </ul>

Monitoring status (%3, %4):

- OFF = Monitoring is inactive in this monitoring channel
- OK = Monitoring is active in this monitoring channel, limit values are not violated
- L+ = Monitoring is active in this monitoring channel, upper limit exceeded
- L- = Monitoring is active in this monitoring channel, lower limit exceeded

**Reaction:** NC Start disable in this channel.  
Alarm display.  
A Stop F was triggered.  
If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:** Check whether the safe actual values are the same in both monitoring channels.  
The drive parameters r9711[0,1] (Diagnostics result list 2 [NCK, drive]) and r9735[0,1] / r9736[0,1] / r9737[0,1] / r9738[0,1] / r9739[0,1] (Diagnostics result list 3/4/5/6/7 [NCK, drive]) can be used for further diagnostics.  
A diagnosis is also possible using the servo trace signals "Result list 2/3/4/5/6/7 NCK" and "Result list 2/3/4/5/6/7 drive".

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27106 Axis %1 difference in function safe velocity nx, NCK: %2 drive: %3**

**Parameters:** %1 = Axis number  
%2 = Monitoring status safe velocity nx  
%3 = Monitoring status safe velocity nx

**Definitions:** During cross-comparison of result list 2 a difference was detected between the NCK and drive monitoring channels in the status of safe velocity monitoring.

- Safe velocity nx+: Bit 16, 17 in result list 2
- Safe velocity nx-: Bit 18, 19 in result list 2

Monitoring status (%2, %3):

- OFF = Monitoring is inactive in this monitoring channel
- OK = Monitoring is active in this monitoring channel, limit values are not violated
- L+ = Monitoring is active in this monitoring channel, upper limit exceeded
- L- = Monitoring is active in this monitoring channel, lower limit exceeded

**Reaction:** NC Start disable in this channel.  
Alarm display.  
A Stop F was triggered.  
If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.

**Remedy:** Check whether the safe actual values in both monitoring channels are the same.  
For further diagnostics the drive parameters r9711[0,1] and the servo trace signals "Result list 2 NCK" and "Result list 2 drive" can be used.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27107 Axis %1 difference in function cam modulo monitoring, NCK: %2 drive: %3**

**Parameters:** %1 = Axis number  
%2 = Monitoring status safe cam modulo range  
%3 = Monitoring status safe cam modulo range

---

<b>Definitions:</b>	<p>During cross-comparison of result list 2 a difference was detected between the NCK and drive monitoring channels in the status of cam modulo monitoring.          Safe cam modulo range: Bit 20, 21 in result list 2          Monitoring status (%2, %3):</p> <ul style="list-style-type: none"> <li>- OFF = Monitoring is inactive in this monitoring channel</li> <li>- OK = Monitoring is active in this monitoring channel, limit values are not violated</li> <li>- L+ = Monitoring is active in this monitoring channel, upper limit exceeded</li> <li>- L- = Monitoring is active in this monitoring channel, lower limit exceeded</li> </ul>
<b>Reaction:</b>	<p>NC Start disable in this channel.          Alarm display.          A Stop F was triggered.          If safe monitoring was active, STOP B was also triggered automatically. In this case, a power OFF/ON of the control will be required.</p>
<b>Remedy:</b>	<p>Check whether the safe actual values in both monitoring channels are the same.          For further diagnostics the drive parameters r9711[0,1] and the servo trace signals "Result list 2 NCK" and "Result list 2 drive" can be used.</p>
<b>Program Continuation:</b>	<p>Clear alarm with the RESET key. Restart part program</p>

---

### **27110            Axis %1 fault during data transmission index%2.**

<b>Parameters:</b>	<p>%1 = Axis number          %2 = Index in data cross-check.</p>
<b>Definitions:</b>	<p>Faulty communication between NCK and drive caused that data cross-check of data and indicated index could not be executed three times in a row.</p>
<b>Reaction:</b>	<p>Alarm display.          In addition, a Stop F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024.          Alarm 27001 with error code 0 can be avoided by alarm reduction (\$MA_SAFE_ALARM_SUPPRESS_LEVEL higher or equal to 1).</p>
<b>Remedy:</b>	<p>Verification of compliance with the EMC regulations.          Replace the hardware.</p>
<b>Program Continuation:</b>	<p>Clear alarm with the RESET key. Restart part program</p>

---

### **27111            Axis %1 fault during encoder evaluation of the safe actual value.**

<b>Parameters:</b>	<p>%1 = Axis number</p>
<b>Definitions:</b>	<p>The redundantly determined safe actual value does not match the fine resolution actual value of the same encoder.</p>
<b>Reaction:</b>	<p>Alarm display.          In addition, a Stop F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024.          Alarm 27001 with error code 0 can be avoided by alarm reduction (\$MA_SAFE_ALARM_SUPPRESS_LEVEL higher or equal to 1).</p>
<b>Remedy:</b>	<p>Verification of compliance with the EMC regulations.          Replace the hardware.</p>
<b>Program Continuation:</b>	<p>Clear alarm with the RESET key. Restart part program</p>

---

### **27112            Axis %1 CRC error of the safe actual value.**

<b>Parameters:</b>	<p>%1 = Axis number</p>
--------------------	-------------------------

**Definitions:** An error has been detected on verifying data consistency of the safe actual value (CRC).

**Reaction:** Alarm display.  
In addition, a Stop F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024.  
Alarm 27001 with error code 0 can be avoided by alarm reduction (\$MA\_SAFE\_ALARM\_SUPPRESS\_LEVEL higher or equal to 1).

**Remedy:** Possible causes of the continual presence of this alarm:  
- The NCK monitoring channel for safe motion monitoring is not communicating with the monitoring channel of the assigned drive but with that of another axis. Check the correctness of the assignment of the drive in the hardware configuration, \$MA\_SAFE\_CTRLOUT\_MODULE\_NR, \$MN\_SAFE\_DRIVE\_LOGIC\_ADDRESS, and p0978.  
- Interference in the communication between NCK and drive. Check compliance with the EMC guidelines. Exchange hardware.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27113 Axis %1 hardware encoder error of the safe actual value.**

**Parameters:** %1 = Axis number

**Definitions:** Encoder evaluation outputs a hardware error. The reasons may be pollution in the visual encoder evaluation or problems during signal transmission.

**Reaction:** Alarm display.  
In addition, a Stop F is triggered that may cause follow-up alarm 27001 with error code 0 as well as alarms 27023 and 27024.  
Alarm 27001 with error code 0 can be avoided by alarm reduction (\$MA\_SAFE\_ALARM\_SUPPRESS\_LEVEL higher or equal to 1).

**Remedy:** Verification of compliance with the EMC regulations.  
Replace the encoder hardware.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**27124 Stop A triggered at least in 1 axis**

**Definitions:** This is only an informational alarm indicating that Stop A has been triggered in at least 1 axis and Power On is required for alarm acknowledgment.  
This alarm occurs if the alarm priority function was activated in MD \$MN\_SAFE\_ALARM\_SUPPRESS\_LEVEL.

**Reaction:** Interface signals are set.  
Alarm display.  
Trigger a "Pulse suppression" for the affected axis.

**Remedy:** Find the error cause by means of further alarm messages.

**Program Continuation:** Switch control OFF - ON.

---

**27132 Axis %1 checksum group error safe monitors. Confirmation and acceptance test required!**

**Parameters:** %1 = Axis number

**Definitions:** The relevant MDs for parameterizing axial safety functionality are protected by a checksum. The alarm indicates that at least one axial checksum no longer matches the stored checksum, which means that an item of data has either been changed without authorization or is defective.  
This alarm is displayed during the setup phase (SPL setup mode active) as an axial group alarm for checksum alarms 27032, 27035, and 27060.



---

<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check MDs. Have checksums recalculated. Check hardware components and drive assignments, repeat acceptance of safety functions (motion monitors).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27135 **Checksum group error safe monitors on at least one axis. Confirmation and acceptance test required!**

<b>Definitions:</b>	The relevant MDs for parameterizing axial safety functionality are protected by a checksum. The alarm indicates that on at least one axis at least one axial checksum no longer matches the stored checksum, which means that an item of data has either been changed without authorization or is defective. This alarm is displayed during the setup phase (SPL setup mode active) as a global group alarm for all axial checksum alarms 27032, 27035, and 27060, if this has been parameterized in MD \$MN_SAFE_ALARM_SUPPRESS_LEVEL (100s digit set).
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check MDs. Have checksums recalculated and confirm. Check hardware components and drive assignments, repeat acceptance of safety functions (motion monitors).
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27140 **Waiting for motor module of at least one axis.**

<b>Definitions:</b>	Alarm during ramp-up as long as the motor module of at least one axis is not yet ready for SI. Communication to the motor module during ramp-up has not yet been activated; the safety functions of at least one axis are not yet available. Via MD \$MN_SAFE_ALARM_SUPPRESS_LEVEL (MD<3) the alarm display can be set to display for each axis individually whether communication has been activated.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	The alarm will remain present during ramp-up if at least one drive does not communicate. Otherwise, the alarm will only briefly be displayed, and then be deleted automatically. Possible causes of the continued presence of the alarm: - Safe motion monitoring has only been activated in \$MA_SAFE_FUNCTION_ENABLE, but not in the corresponding parameter of the assigned drive (p9501). - The axis -> drive assignment is incorrect in MD \$MA_SAFE_CTRLOUT_MODULE_NR, MD \$MN_SAFE_DRIVE_LOGIC_ADDRESS or p0978. - PROFIBUS plug has fallen out. Check the correctness of parameter p9501 or the assignment of the drives in MD \$MA_SAFE_CTRLOUT_MODULE_NR, \$MN_SAFE_DRIVE_LOGIC_ADDRESS, p0978.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**27200 PROFIsafe: cycle time %1 [ms] too long**

**Parameters:** %1 = Parameterized cycle time  
**Definitions:** The PROFIsafe communication cycle time resulting from MD \$MN\_PROFISAFE\_IPO\_TIME\_RATIO and MD \$MN\_IPO\_CYCLE\_TIME exceeds the permissible limit value (25 ms).  
**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Adapt cycle time via MD \$MN\_PROFISAFE\_IPO\_TIME\_RATIO or correct the reduction of the IPO cycle.  
**Program**  
**Continuation:** Switch control OFF - ON.

---

**27201 PROFIsafe: MD %1[%2]: bus segment %3 error**

**Parameters:** %1 = MD name  
%2 = MD array index  
%3 = Parameterized bus segment  
**Definitions:** An incorrect bus segment was entered in the specified machine data. The value must be 5.  
**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Correct the MD.  
**Program**  
**Continuation:** Switch control OFF - ON.

---

**27202 PROFIsafe: MD %1[%2]: address %3 error**

**Parameters:** %1 = MD name  
%2 = MD array index  
%3 = Parameterized PROFIsafe address  
**Definitions:** An incorrect PROFIsafe address was entered in the specified machine data. The value must be greater than 0.  
**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Correct the MD.  
**Program**  
**Continuation:** Switch control OFF - ON.

---

**27203 PROFIsafe: MD %1[%2]: SPL assignment error**

**Parameters:** %1 = MD name  
%2 = MD array index

---

<b>Definitions:</b>	The parameterization of the specified machine data for the link between the SPL interface and a PROFIsafe module is incorrect because of the following reasons: - Bit values greater than definition of SPL interface (bit value > 64) - Number of bits too high for this PROFIsafe module (upper bit value - lower bit value + 1 > 8) - No SPL assignment parameterized (both bit values equal to zero) - Incorrect SPL assignment (bit value equals zero)
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct the MD.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

### 27204 PROFIsafe: double assignment MD %1[%2] - MD %3[%4]

<b>Parameters:</b>	%1 = MD name 1 %2 = MD array index for MD name 1 %3 = MD name 2 %4 = MD array index for MD name 2
<b>Definitions:</b>	A duplicate assignment has been parameterized illegally in the specified machine data: \$A_INSE parameterized on DMP as well as PROFIsafe modules. MDs affected: - MD \$MN_SAFE_IN_HW_ASSIGN - MD \$MN_PROFISAFE_IN_ASSIGN Multiple inputs of PROFIsafe modules parameterized on the same \$A_INSE. MDs affected: - MD \$MN_PROFISAFE_IN_ASSIGN Multiple \$A_OUTSE parameterized on the same output of a PROFIsafe module. MDs affected: - MD \$MN_PROFISAFE_OUT_FILTER Multiple substitute values of passive SPL connections parameterized on the same \$A_INSE. MDs affected: - MD \$MN_PROFISAFE_IN_ASSIGN
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct the MD.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

### 27205 PROFIsafe: number of signals in MD %1 [%2] <> MD %3[%4]

<b>Parameters:</b>	%1 = MD name 1 %2 = MD array index for MD name 1 %3 = MD name 2 %4 = MD array index for MD name 2
<b>Definitions:</b>	The parameterized number or the signals used must be the same in both machine data.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct the MD.

**Program Continuation:** Switch control OFF - ON.

---

**27206 PROFIsafe: MD %1[%2] maximum number of F user data (%3 bits) exceeded.**

**Parameters:** %1 = MD name  
%2 = MD array index for MD name  
%3 = Maximum F user data bits.

**Definitions:** The parameterized data indicated in the machine data are outside the F user data range of the F module.  
**Note**  
When machine data PROFISAFE\_IN/OUT\_ADDRESS is displayed, the sub slot address parameterized in it will exceed the F user data range of the F module.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the MD.

**Program Continuation:** Switch control OFF - ON.

---

**27207 PROFIsafe: MD %1[%2] max. sub slot number: %3 exceeded**

**Parameters:** %1 = MD name  
%2 = MD array index for MD name  
%3 = Max. number of sub slots

**Definitions:** The sub slot parameterized in the indicated machine data exceeds the max. permissible number of sub slots per PROFIsafe module.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Reduce the number of sub slots by changing the splitting of F user data of the PROFIsafe module.

**Program Continuation:** Switch control OFF - ON.

---

**27208 PROFIsafe: MD %1[%2]: max. sub-slot address %3 exceeded.**

**Parameters:** %1 = MD name  
%2 = MD array index  
%3 = Maximum sub-slot address.

**Definitions:** A sub-slot address was entered in the MD that is too high. The entered value must not exceed the displayed maximum sub-slot address.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the MD.

**Program Continuation:** Switch control OFF - ON.

### 27220 PROFIsafe: Number of NCK F modules (%1) <> Number of S7 F modules (%2)

**Parameters:** %1 = Number of parameterized NCK F modules  
%2 = Number of parameterized S7 F modules

**Definitions:** The number of F modules parameterized via the NCK machine data \$MN\_PROFISAFE\_IN/OUT\_ADDRESS is:  
- Greater than the number of PROFIBUS slaves in the S7 PROFIBUS configuration.  
- Smaller than the number of F modules in the S7 PROFIBUS configuration,  
- greater than the number of F modules known in the S7 PROFIBUS configuration.  
If alarm parameter %2 = 0, then none of the configured F modules were found in the S7 PROFIBUS configuration.  
In most cases, the reason for the alarm is an error in the parameterization of the PROFIsafe master address.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the F parameterization in MD \$MN\_PROFISAFE\_IN/OUT\_ADDRESS.  
Check the F configuration in the S7 PROFIBUS configuration.  
Check the parameterized PROFIsafe master address in MD \$MN\_PROFISAFE\_MASTER\_ADDRESS and in the S7 PROFIBUS configuration.

**Program Continuation:** Switch control OFF - ON.

### 27221 PROFIsafe: NCK F module MD %1[%2] unknown

**Parameters:** %1 = MD name  
%2 = MD array index

**Definitions:** The F module parameterized in the specified machine data is unknown under this PROFIsafe address in the S7 PROFIBUS configuration.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the PROFIsafe addresses in the NCK MD and S7 PROFIBUS configuration.

**Program Continuation:** Switch control OFF - ON.

### 27222 PROFIsafe: S7 F module PROFIsafe address %1 unknown

**Parameters:** %1 = PROFIsafe address

**Definitions:** The F module with the specified PROFIsafe address has not been parameterized as an F module in the NCK MD.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the S7 PROFIBUS configuration. Enter the module in the NCK MD.

**Program** Switch control OFF - ON.  
**Continuation:**

---

**27223 PROFIsafe: NCK F module MD %1[%2] is not a %3 module**

**Parameters:** %1 = MD name  
%2 = MD array index  
%3 = Module type

**Definitions:** The F module parameterized in the specified NCK MD has not been entered as input/output module in the S7 PROFIBUS configuration.  
- %3 = INPUT: NCK F parameterization expects INPUT module  
- %3 = OUTPUT: NCK F parameterization expects OUTPUT module  
- %3 = IN/OUT: NCK F parameterization expects INPUT or OUTPUT module

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check the module in the S7 PROFIBUS configuration.

**Program** Switch control OFF - ON.  
**Continuation:**

---

**27224 PROFIsafe: F module MD %1[%2] - MD %3[%4]: double assignment of PROFIsafe address**

**Parameters:** %1 = MD name 1  
%2 = MD array index 1  
%3 = MD name 2  
%4 = MD array index 2

**Definitions:** In the NCK MD or in the S7 F parameters, the same PROFIsafe address has been parameterized for the F modules parameterized in the specified machine data. Therefore, no clear communication link is possible between F master and F slave.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check and correct the S7 F parameterization and NCK MD.

**Program** Switch control OFF - ON.  
**Continuation:**

---

**27225 PROFIsafe: slave %1, configuration error %2**

**Parameters:** %1 = PROFIBUS slave address  
%2 = Configuration error

---

<b>Definitions:</b>	An error occurred during the evaluation of the S7 PROFIBUS configuration for the specified slave. This is further specified in alarm parameter %2. %2 = PRM header: the PRM telegram for this slave could not clearly be interpreted.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check and correct the S7 PROFIBUS configuration.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27240 PROFIsafe: PLC not running up, info: %1

<b>Parameters:</b>	%1 = Current information from the PROFIsafe ramp-up NCK-PLC
<b>Definitions:</b>	There is no PROFIsafe configuration available to the NCK after the time specified via the MD \$MN_PLC_RUNNINGUP_TIMEOUT. Alarm parameter %1: 0 = Configuration not available, PSI is not supported by FB15.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	- Increase MD \$MN_PLC_RUNNINGUP_TIMEOUT - Check the PLC operating status. - Check the PLC operating system software version. - Delete the F parameterization in the NCK MD.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 27241 PROFIsafe: different version, NCK: %1, PLC: %2, (%3)

<b>Parameters:</b>	%1 = Interface version of the NCK %2 = Interface version of the PLC %3 = Internal identifier of interface (DP, PSI)
<b>Definitions:</b>	The NCK and PLC components have different implementations of a required interface. The F communication cannot be initialized. %1 = version of the NCK-side interface %2 = version of the PLC-side interface %3 = internal identifier of the interface (DP, PSI)
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	- Check the PLC operating system and NCK software versions. - Upgrade the PLC operating system. - Delete the NCK F parameterization.
<b>Program Continuation:</b>	Switch control OFF - ON.

**27242 PROFIsafe: F module %1, %2 faulty**

**Parameters:** %1 = PROFIsafe address  
 %2 = Incorrect F parameter

**Definitions:** An error was detected during the evaluation of the F parameters.  
 %2 = CRC1: CRC specified by F parameters faulty.  
 %2 = F\_WD\_Timeout: The monitoring time parameterized in Step 7 is too small for the PROFIsafe cycle time defined by the MD \$MN\_PROFISAFE\_IPO\_TIME\_RATIO.  
 %2 = CRC2\_Len: CRC message length faulty.  
 %2 = F\_Data\_Len: the telegram length defined for the specified module is incorrect.

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** %2 = CRC1: PLC overall reset, reload the S7 F configuration.  
 %2 = F\_WD\_Timeout: reparameterize the PROFIsafe cycle time or F monitoring time.  
 %2 = CRC2\_Len: PLC overall reset, reload the S7 F configuration.  
 %2 = F\_Data\_Len: PLC overall reset, reload the S7 F configuration.

**Program Continuation:** Switch control OFF - ON.

**27250 PROFIsafe: configuration in DP M changed; error code %1 - %2**

**Parameters:** %1 = NCK project number  
 %2 = Current PLC project number

**Definitions:** The DP master shows a modified S7 PROFIBUS configuration. Error-free operation can no longer be guaranteed.

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Communication with F slaves is finished.  
 A STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) is triggered on all axes with safety functionality.

**Remedy:** Restart the PLC/NCK.

**Program Continuation:** Switch control OFF - ON.

**27251 PROFIsafe: F module %1, %2 reports error %3**

**Parameters:** %1 = PROFIsafe address or name  
 %2 = Reporting component (master/slave)  
 %3 = Error code



---

<b>Definitions:</b>	An error occurred in the PROFIsafe communication between the F master and the specified F module which was detected by the component (master/slave) shown in parameter %2. The error code specifies the error type: - %3 = TO: The parameterized communication timeout was exceeded - %3 = CRC: A CRC error was detected - %3 = CN: An error in the time sequence of the F messages was detected - %3 = SF: F master error, NCK/PLC are no longer synchronous - %3 = EA: Communication error, slave sends empty messages
<b>Reaction:</b>	Mode group not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Trigger a STOP D/E (settable via MD \$MN_SPL_STOP_MODE) on all axes with safety functionality.
<b>Remedy:</b>	Check the DP wiring. Restart F slave modules. Restart the NCK/PLC.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 27252 PROFIsafe: slave/device %1, bus %2, sign-of-life error

<b>Parameters:</b>	%1 = Slave/device identifier %2 = Bus number
<b>Definitions:</b>	The specified DP slave or the PN device no longer communicates with the master/controller.
<b>Reaction:</b>	Mode group not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Trigger a STOP D/E (settable via MD \$MN_SPL_STOP_MODE) on all axes with safety functionality.
<b>Remedy:</b>	Check the DP/PN wiring. Restart F modules. Restart the NCK/PLC.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 27253 PROFIsafe: communication fault F master component %1, error %2

<b>Parameters:</b>	%1 = Error component (NCK/PLC) %2 = Error code
<b>Definitions:</b>	The F master signals that the communication between the NCK and PLC is no longer working. The error code %1 specifies the cause: - %1 = PLC: The PLC does no longer execute the OB40 request. - %1 = PLC-DPM: DP master is no longer in OPERATE status. Parameter %2 provides further information about the error's cause: - %2 = 1,2,4: PLC processing of the OB40 not finished.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Trigger a STOP D/E (settable via MD \$MN_SPL_STOP_MODE) on all axes with safety functionality.
<b>Remedy:</b>	Extend the PROFIsafe cycle time via MD \$MN_PROFISAFE_IPO_TIME_RATIO.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

**27254**                    **PROFIsafe: F module %1, error on channel %2; %3<ALSI>**

**Parameters:**            %1 = PROFIsafe address or name  
                               %2 = Channel type, channel number  
                               %3 = System variable array index extension

**Definitions:**            The F module signals that an error occurred in the interface of the specified channel.  
                               This alarm is only triggered for ET200S F modules.  
                               The type of channel (input or output channel) is indicated by the abbreviations IN and OUT in %2.  
                               A specific alarm message can be programmed for each of the system variables on the HMI via parameter %3:  
                               - %3 = 1...64: Error in system variables \$A\_INSE[1...64]  
                               - %3 = 65...128: Error in system variables \$A\_OUTSE[1...64]  
                               - %3 = -1: Error in an input or output channel for which there is no SPL assignment

**Reaction:**                Mode group not ready.  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.  
                               Trigger a STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) on all axes with safety functionality.

**Remedy:**                 Check wiring. Wiring OK: replace F module.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**27255**                    **PROFIsafe: F module %1, general error**

**Parameters:**            %1 = PROFIsafe address or name

**Definitions:**            The specified PROFIsafe module signals an error. A more exact specification of the error's cause cannot be made without further assistance.  
                               This alarm is triggered for all types of PROFIsafe slaves.

**Reaction:**                Mode group not ready.  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.  
                               Trigger a STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) on all axes with safety functionality.

**Remedy:**                 Check wiring.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**27256**                    **PROFIsafe: Current cycle time %1 [ms]> parameterized cycle time**

**Parameters:**            %1 = Current PROFIsafe communication cycle time

**Definitions:**            The current PROFIsafe communication cycle time is greater than the value set via MD \$MN\_PROFISAFE\_IPO\_TIME\_RATIO. The parameterized PROFIsafe communication cycle time is continually exceeded on the PLC side.

**Reaction:**                Mode group not ready.  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.  
                               NC Stop on alarm.  
                               Trigger a STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) on all axes with safety functionality.

**Remedy:**                 Adapt cycle time via MD \$MN\_PROFISAFE\_IPO\_TIME\_RATIO.  
                               The value displayed in parameter %1 has to be set at least.  
                               The set cycle time affects the runtime load of the PLC module. This also has to be taken into consideration when making the setting.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### 27257 PROFIsafe: %1 %2 reports system error %3 (%4)

**Parameters:** %1 = Type of communication  
 %2 = PROFIsafe address or name  
 %3 = Error code  
 %4 = Component

**Definitions:** A system error has been detected in the PROFIsafe communication. Depending on the error, the relevant PROFIsafe driver or the entire PROFIsafe communication will be stopped.  
 In %1 the communication type is displayed  
 %1 = F module  
 %1 = SPL  
 %2 = PROFIsafe address or name of the affected F module (with %1 = F module)  
 %2 = - (with %1 = SPL)  
 In %3 the detected error cause is displayed:  
 %3 = SF: Asynchronous error state (StateFault)  
 %3 = SP: No update of the SPL input/output data (SPL I/O communications)  
 In %4 the affected component is displayed:  
 %4 = NCK  
 %4 = PLC

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) triggered on all axes with safety functionality.  
 Stop of the affected PROFIsafe drivers. Stopped PROFIsafe drivers of F modules of type F-DI or F-DIO output failsafe values (0) as F user data to the SPL.

**Remedy:** Power OFF/ON of the control. If the error occurs again, inform the service department.

**Program** Switch control OFF - ON.  
**Continuation:**

### 27299 PROFIsafe: Diagnostics %1 %2 %3 %4

**Parameters:** %1 = Error code 1  
 %2 = Error code 2  
 %3 = Error code 3  
 %4 = Error code 4

**Definitions:** Error in PROFIsafe configuration.  
 Alarm parameter %1 contains a reference to the component (PLC or NCK) which has detected the error.

**Reaction:** Alarm display.

**Remedy:** Place a support request with the error text under: <http://www.siemens.com/automation/support-request>

**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

### 27300 F\_DP: Cycle time %1 [ms] is too long

**Parameters:** %1 = Parameterized cycle time

**Definitions:** The F\_DP communication cycle time resulting from MD \$MN\_SAFE\_SRDP\_IPO\_TIME\_RATIO and \$MN\_IPO\_CYCLE\_TIME exceeds the permissible limit value of 250ms.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct cycle time via MD \$MN\_SAFE\_SRDP\_IPO\_TIME\_RATIO and/or \$MN\_IPO\_CYCLE\_TIME

**Program** Switch control OFF - ON.

**Continuation:**

**27301 F\_DP: MD %1[%2]: SPL interface faulty**

**Parameters:** %1 = MD name  
%2 = MD array index

**Definitions:** The SPL interface in the displayed MD is incorrect: Possible causes:  
- Bit values greater than definition of SPL interface (bit value > 64)  
- Number of bits too high (upper bit value - lower bit value > 16)  
- No SPL assignment parameterized (both bit values equal to zero)  
- Incorrect SPL assignment (bit value equals zero)

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the MD.

**Program** Switch control OFF - ON.

**Continuation:**

**27302 F\_DP: Double assignment MD %1[%2] - MD %3[%4]**

**Parameters:** %1 = MD name 1  
%2 = MD array index for MD name 1  
%3 = MD name 2  
%4 = MD array index for MD name 2

**Definitions:** An illegal double assignment has been parameterized in the stated MD:  
- %1 and %3 = \$MN\_SAFE\_RDP\_ASSIGN:  
SPL inputs (\$A\_INSE) are multiply occupied by F\_DP communication.  
- %1 and %3 = \$MN\_SAFE\_SDP\_FILTER:  
F user data of an F\_SENDDP are multiply occupied by sub-slots  
- %1 and %3 = \$MN\_SAFE\_SDP\_LADDR, \$MN\_SAFE\_RDP\_LADDR:  
Logical basic addresses are multiply occupied by SPL connections  
- %1 and %3 = \$MN\_SAFE\_SDP\_FILTER:  
System variable assignments are multiply occupied by SPL connections  
- %1 and %3 = \$MN\_SAFE\_SDP\_ID, \$MN\_SAFE\_RDP\_ID:  
Parameter DP\_DP\_ID is multiply occupied by different SPL connections  
%2 and %4: MD index of SPL connection

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the MD.

**Program** Switch control OFF - ON.  
**Continuation:**

### 27303 **F\_DP: Number of signals in MD %1 [%2] <> MD %3[%4]**

**Parameters:** %1 = MD name 1  
 %2 = MD array index for MD name 1  
 %3 = MD name 2  
 %4 = MD array index for MD name 2

**Definitions:** Different numbers of F user data signals have been parameterized in machine data \$MN\_SAFE\_SDP/RDP\_ASSIGN, \$MN\_SAFE\_SDP/RDP\_FILTER.

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Correct the stated MD.

**Program** Switch control OFF - ON.  
**Continuation:**

### 27305 **F\_DP: Parameter MD %1 [%2] <> MD %3[%4]**

**Parameters:** %1 = MD name 1  
 %2 = MD array index for MD name 1  
 %3 = MD name 2  
 %4 = MD array index for MD name 2

**Definitions:** An SPL connection has been parameterized with multiple SPL interfaces (sub-slots), in which different values have been entered in the F\_DP communication parameters or the SPL connection number (%1 and %3).  
 Note: SPL interfaces (sub-slots) of an SPL connection are characterized by equal values for:  
 - F\_DP communication parameter  
 - SPL connection number  
 Values for %1 and %3:  
 \$MN\_SAFE\_SDP/RDP\_LADDR or  
 \$MN\_SAFE\_SDP/RDP\_TIMEOUT or  
 \$MN\_SAFE\_SDP/RDP\_CONNECTION\_NR  
 \$MN\_SAFE\_SDP/RDP\_ERR\_REAC  
 \$MN\_SAFE\_RDP\_SUBS

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Correct the MD.

**Program** Switch control OFF - ON.  
**Continuation:**

### 27306 **F\_DP: Maximum number of active SPL connections (%1) exceeded for %2.**

**Parameters:** %1 = Maximum possible number of SPL connections  
 %2 = F\_SENDP/F\_RECVDP

**Definitions:** More than the permissible number of SPL connections %1, marked by different identifiers (\$MN\_SAFE\_SDP/RDP\_ID), have been parameterized for %2 in the active parameter data records.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Correct the identifiers of the active SPL connections or deactivate SPL connections (\$MN\_SAFE\_SDP/RDP\_ENABLE\_MASK).

**Program Continuation:** Switch control OFF - ON.

**27350 F\_DP: %1 communication, connection %2 reports error %3**

**Parameters:** %1 = Type of communication  
%2 = Name or DP\_DP\_ID of the communication relationship  
%3 = Error code

**Definitions:** The F\_DP communication with the external communication partner is disturbed, and the programmed error reaction is \$A\_FSDP\_/FRDP\_ERR\_REAC = 0 or 1.  
The communication type is displayed in %1:  
%1 = F\_SENDDP  
%1 = F\_RECVDVP  
The name or the DP\_DP\_ID (identifier) of the SPL connection is displayed in %2.  
The detected cause of the error is displayed in %3.  
%3 = SN: An error has been detected in the message sequence.  
%3 = CRC: A CRC error has been detected.  
%3 = TO: The parameterized communication timeout was exceeded.  
All values stated for %3 can also be displayed in combination according to the fault profile.

**Reaction:** Mode group not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
1. F\_SENDDP/F\_RECVDVP: system variable \$A\_FSDP/FRDP\_ERROR = TRUE  
2. F\_SENDDP/F\_RECVDVP: system variable \$A\_FSDP/FRDP\_DIAG <> 0  
3. F\_RECVDVP: system variable \$A\_FRDP\_ACK\_REQ = TRUE  
4. F\_RECVDVP: Output of the substitute values defined in system variable \$A\_FRDP\_SUBS  
5. An alarm and Stop D/E are also triggered with the programmed error reaction \$A\_FSDP\_/FRDP\_ERR\_REAC = 0

**Remedy:** Check the PROFIBUS communication and the communication partner.  
Note: A user acknowledgment via DB18.FRDP\_ACK\_REI only acknowledges the F\_DP communication. The alarm is still displayed and must be acknowledged separately via NC RESET.  
Note to %3 = LS: Internal system error, can only be eliminated by PowerOn.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**27351 F\_DP: %1 communication, connection %2 reports error %3**

**Parameters:** %1 = Type of communication  
%2 = Name or DP\_DP\_ID of the SPL connection  
%3 = Error code

**Definitions:** The F\_DP communication with the external communication partner is disturbed, and the programmed error reaction is \$A\_FSDP\_/FRDP\_ERR\_REAC = 2 (alarm, display only).  
The communication type is displayed in %1:  
%1 = F\_SENDDP  
%1 = F\_RECVDVP

The name or the DP\_DP\_ID (identifier) of the F\_DP communication relationship is displayed in %2.  
 The detected cause of the error is displayed in %3.  
 %3 = SN: An error has been detected in the message sequence.  
 %3 = CRC: A CRC error has been detected.  
 %3 = TO: The parameterized communication timeout was exceeded.  
 All values stated for %3 can also be displayed in combination according to the fault profile.

**Reaction:** Alarm display.  
 1. F\_SENDDP/F\_RECVDP: system variable \$A\_FSDP/FRDP\_ERROR = TRUE  
 2. F\_SENDDP/F\_RECVDP: system variable \$A\_FSDP/FRDP\_DIAG <> 0  
 3. F\_RECVDP: system variable \$A\_FRDP\_ACK\_REQ = TRUE  
 4. F\_RECVDP: Output of the substitute values defined in system variable \$A\_FRDP\_SUBS

**Remedy:** Check the PROFIBUS communication and the communication partner  
 User acknowledgment via DB18.FRDP\_ACK\_REI or NC-RESET  
 Note to %3 = LS: Internal system error, can only be eliminated by PowerOn.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

### 27352 F\_DP: Communication error %1, error %2

**Parameters:** %1 = Error component (NCK/PLC)  
 %2 = Error code

**Definitions:** The communication between the NCK and PLC is no longer working.  
 Error code %1 specifies the cause:  
 %1 = PLC: The PLC is no longer executing the OB40 request.  
 Parameter %2 provides further information about the cause of the error:  
 %2 <> 0: PLC processing of the OB40 not finished.

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Trigger a STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) on all axes with safety functionality.

**Remedy:** Check whether the set F\_DP cycle is too short.

**Program Continuation:** Switch control OFF - ON.

### 27353 F\_DP: Current cycle time %1 [ms] > parameterized cycle time

**Parameters:** %1 = Current F\_DP communication cycle time

**Definitions:** The current F\_DP communication cycle time is greater than the value set via MD \$MN\_SAFE\_SRDP\_IPO\_TIME\_RATIO. The parameterized communication cycle time is continually exceeded on the PLC side.

**Reaction:** Mode group not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Trigger a STOP D/E (settable via MD \$MN\_SPL\_STOP\_MODE) on all axes with safety functionality.

**Remedy:** Adapt cycle time via MD \$MN\_SAFE\_SRDP\_IPO\_TIME\_RATIO.  
 At least the value displayed in parameter %1 has to be set.  
 The set cycle time affects the runtime load of the PLC module. This also has to be taken into consideration when making the setting.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**27354 F\_DP: %1 communication, connection %2 reports SFC%3 error %4**

**Parameters:** %1 = Type of communication  
 %2 = Name or DP\_DP\_ID of the communication relationship  
 %3 = SFC block number  
 %4 = Error code

**Definitions:** The F\_DP communication with the external communication partner is disturbed. The PLC reports an error when trying to access via the parameterized interface.  
 The communication type is displayed in %1:  
 %1 = F\_SENDDP  
 %1 = F\_RECVDP  
 The name or the DP\_DP\_ID (identifier) of the SPL connection is displayed in %2.  
 The PLC block that detected an error is displayed in %3.  
 The detected cause of the error is displayed in %4.  
 This alarm can be masked with MD \$MN\_SAFE\_DIAGNOSIS\_MASK, bit 2 = 1.

**Reaction:** Alarm display.

**Remedy:** Check the PROFIBUS communication and the communication partner  
 Check the parameterized, logical basic address in \$MN\_SAFE\_SDP/RDP\_LADDR.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**27355 F\_DP: %1 communication, connection %2 reports system error %3 (%4)**

**Parameters:** %1 = Type of communication  
 %2 = Name or DP\_DP\_ID of the SPL connection  
 %3 = Error code  
 %4 = Component

**Definitions:** A system error has been detected during F\_DP communication. Depending on the error, the relevant PROFIsafe driver or the entire F\_DP communication will be stopped.  
 The communication type is displayed in %1  
 %1 = F\_SENDDP  
 %1 = F\_RECVDP  
 %1 = SPL  
 %2 = Name or DP\_DP\_ID (identifier) of the SPL connection ( with %1 = F\_SENDDP or F\_RECVDP)  
 %2 = - (with %1 = SPL)  
 The detected error cause is displayed in %3:  
 %3 = SF: asynchronous error state (StateFault)  
 %3 = LS: sign-of-life monitoring (LifeSign)  
 %3 = TD: discrepancies in the F telegram data (TelegramDiscrepancy)  
 %3 = OD: discrepancies in the output data (OutputdateDiscrepancy)  
     - with %1 = F\_SENDDP: \$A\_FSDP\_ERR\_REAC - DB18.DBW190,200,210)  
     - with %1 = F\_RECVDP: \$A\_FRDP\_SUBS - DB18.DBW220,232,244)  
                           \$A\_FRDP\_ERR\_REAC - DB18.DBW222,234,246)  
 %3 = SP: no update of the SPL input/output data (SPL I/O-communication)  
 The mentioned values for %3 can be displayed also combined depending on the fault profile.  
 The affected component is displayed in %4:  
 %4 = NCK  
 %4 = PLC  
 %4 = system variable (with %3 = OD)

**Reaction:** Mode group not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
 Stopped SPL connections of type F\_RECVDP output failsafe values (0) as F user data.

**Remedy:** Power OFF/ON of the control. If the error occurs again, inform the service department.



**Program** Switch control OFF - ON.  
**Continuation:**

**27900 PROFIBUS DP: SI fault on axis %1, code %2, value %3, time %4.**

**Parameters:** %1 = Axis number  
 %2 = Fault code of the drive (r9747).  
 %3 = Fault value of the drive (r9749)  
 %4 = Fault time of drive (r9748).  
**Definitions:** Error in a SINAMICS drive.  
**Reaction:** Alarm display.  
**Remedy:** See drive documentation for fault codes/fault values.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

**27901 PROFIBUS DP: SI fault on axis %1, code %2, value %3, time %4.**

**Parameters:** %1 = Axis number  
 %2 = Fault code of the drive (r9747).  
 %3 = Fault value of the drive (r9749)  
 %4 = Fault time of drive (r9748).  
**Definitions:** Error in a SINAMICS drive.  
**Reaction:** Alarm display.  
**Remedy:** See drive documentation for fault codes/fault values.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**28000 NCU link connection to all other NCUs of the link network has been aborted**

**Definitions:** All NCUs in the NCU link network exchange data cyclically (sign-of-life). If this alarm occurs, sign-of-life signals have not been received from any other NCUs on the NCU network. This fault in the link can have various causes:  
 - Defective hardware.  
 - The machine data which configure the NCU link are not the same on all NCUs.  
 - An identical interpolator cycle time has not been selected on all NCUs.  
**Reaction:** NC not ready.  
 Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.  
 NC Stop on alarm.  
**Remedy:** Check the IPO cycle on all the NCUs.  
 If necessary, check NCU link-specific alarms first.  
**Program** Switch control OFF - ON.  
**Continuation:**

**28001 NCU link connection to the NCU %1 of the link network has been aborted**

**Parameters:** %1 = NCU number

**Definitions:** All NCUs in the NCU link network exchange data cyclically (sign-of-life). If this alarm occurs, sign-of-life signals have not been received from one other NCU on the NCU network. (see alarm parameters) This fault in the link can have various causes:  
- Defective hardware.  
- The machine data which configure the NCU link are not identical on all NCUs.  
- An identical interpolator cycle time has not been selected on all NCUs.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** - Check the IPO cycle on all the NCUs.  
- If necessary, check NCU link-specific alarms first.

**Program Continuation:** Switch control OFF - ON.

---

**28002 Error on activation of machine data, NCU network-wide machine data were modified by NCU %1**

**Parameters:** %1 = NCU number

**Definitions:** During the activation of machine data with NEWCONFIG or during an operator panel RESET, NCU network-wide machine data were modified on another NCU. This alarm can only occur when a link connection is active.

**Reaction:** NC not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Repeat the operator action or, if NEWCONFIG is activated by an NC program, terminate the program with Reset.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**28003 Synchronization of the life cycle in the NCU link failed after %1 attempts.**

**Parameters:** %1 = Loop counter

**Definitions:** At a specific point in time during NCK ramp-up, the NCK switches to the cyclic plane; in other words, the IPO and servo tasks start to work. If these points in time deviate too significantly in the NCU link grouping, this alarm 280003 will appear. This delay time can be increased in IPO cycle steps by increasing the machine data LINK\_LIFECYCLE\_MAX\_LOOP.

**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Place a support request with the error text under: <http://www.siemens.com/automation/support-request>

**Program Continuation:** Switch control OFF - ON.

---

**28004 NCU link: NCU %1 of the link network is not on the bus**

**Parameters:** %1 = NCU number

---

<b>Definitions:</b>	Error message of the NCU link module. When the NCU link was powered up, the local NCU (indicated by the alarm) detected that the NCU with the number in the alarm parameter was not on the bus although it should be connected according to the MD settings. This fault in the link can have various causes: - Defective hardware. - The machine data which configure the NCU link are not identical on all NCUs. - An identical interpolator cycle time has not been selected on all NCUs.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check the machine data configuration and link hardware.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

### **28005 NCU link: NCU %1 of the link network not running synchronously**

<b>Parameters:</b>	%1 = NCU number
<b>Definitions:</b>	Error message of the NCU link module. When the NCU link was powered up, the local NCU (indicated by the alarm) detected that the NCU with the number in the alarm parameter was not running synchronously. This fault in the link can have various causes: - The machine data which configure the NCU link are not identical on all NCUs. - An identical interpolator cycle time has not been selected on all NCUs.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check machine data configuration.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

### **28007 NCU link: conflict in configuration data of NCU %1**

<b>Parameters:</b>	%1 = NCU number
<b>Definitions:</b>	Error message of the NCU link module. When the NCU link was powered up, the local NCU (indicated by the alarm) detected a conflict between its configuration and the configuration of the NCU in the alarm parameter. Example: MD18782 \$MN_MM_LINK_NUM_OF_MODULES defines the number of nodes on the NCU link network. The alarm occurs if this MD has a different setting on different NCUs.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check machine data configuration.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

**28008 NCU link: conflict in timer setting of NCU %1**

**Parameters:** %1 = NCU number  
**Definitions:** Error message of the NCU link module. When the NCU link was powered up, the local NCU (indicated by the alarm) detected a conflict between its timer configuration and the configuration of the NCU in the alarm parameter.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Check machine data configuration.  
**Program Continuation:** Switch control OFF - ON.

---

**28009 NCU link: conflict in bus parameters of NCU %1**

**Parameters:** %1 = NCU number  
**Definitions:** Error message of the NCU link module. When the NCU link was powered up, the local NCU (indicated by the alarm) detected a conflict between its timer bus configuration and the configuration of the NCU in the alarm parameter.  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Check machine data configuration.  
**Program Continuation:** Switch control OFF - ON.

---

**28010 NCU link: the NCU %1 has not received a message %2, %3**

**Parameters:** %1 = NCU number  
%2 = Reason  
%3 = Block  
**Definitions:** Error message of the NCU link module. During operation of the NCU link, a message from the local NCU to the NCU specified in the alarm parameter has failed. A hardware error may have occurred (e.g. sporadic disturbances on the communication line).  
**Reaction:** NC not ready.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** The message does not fail until several attempts have been made to repeat the communication. The number of repetitions can be increased with MD12550 \$MN\_LINK\_RETRY\_CTR.  
**Program Continuation:** Switch control OFF - ON.

---

**28011 IPO time insufficient for NCU link. Link cycle time: %1**

**Parameters:** %1 = Microseconds

---

<b>Definitions:</b>	Error message of the NCU link module. All messages must be transmitted within one interpolator cycle. This applies particularly to message retries. The time was not sufficient! The parameter indicates how many microseconds the NCU link module needs in order to send the message.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Increase the interpolator cycle time, i.e. modify one of the following MDs on all NCUs. IPO_SYSCLOCK_TIME_RATIO SYSCLOCK_CYCLE_TIME
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 28012 NCU link: synchronization cycle signal failure %1 times

<b>Parameters:</b>	%1 = Number of cycles
<b>Definitions:</b>	Error message of the NCU link module that does not occur at NCU 1. The NCU's are synchronized via their own NCU-link clock line. A large number of cycle signals are missing. The parameter indicates how many cycles have failed.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check the hardware.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

### 28020 NCU link: too many links configured %1

<b>Parameters:</b>	%1 = Number of link connections
<b>Definitions:</b>	Unfortunately, the communication capacity of the NCU link is insufficient for this link configuration. The link configuration is determined by the following MDs: - MD18781 \$MN_NCU_LINK_CONNECTIONS - MD10002 \$MN_AXCONF_LOGIC_MACHAX_TAB - MD12701 \$MN_AXCT_AXCONF_ASSIGN_TAB1 ... and all further container def.
<b>Reaction:</b>	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Apply fewer link connections. axes that need connecting through links or combine the axes in fewer containers. Machine data to be changed: - MD18781 \$MN_NCU_LINK_CONNECTIONS - MD10002 \$MN_AXCONF_LOGIC_MACHAX_TAB - MD12701 \$MN_AXCT_AXCONF_ASSIGN_TAB1 ... and all further container def.
<b>Program Continuation:</b>	Switch control OFF - ON.

---

**28030 Serious alarm on NCU %1, axes in follow-up mode**

**Parameters:** %1 = NCU number  
**Definitions:** All axes are trailing because of a serious alarm on another NCU.  
**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Acknowledge the alarm on the NCU.  
**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**28031 Serious alarm on NCU %1 not yet acknowledged, axes still in follow-up mode**

**Parameters:** %1 = NCU number  
**Definitions:** A serious alarm was not yet acknowledged on another NCU. Consequently, all the axes continue to trail.  
**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Acknowledge the alarm on the NCU.  
**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**28032 Emergency stop activated on NCU %1, axes in follow-up mode**

**Parameters:** %1 = NCU number  
**Definitions:** The emergency stop request is active at the PLC-NCK interface on one NCU in the NCU group. Consequently, all axes are following.  
**Reaction:** NC not ready.  
Mode group not ready, also effective for single axes.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Remedy the cause of the emergency stop on the NCU, and acknowledge the emergency stop via the PLC-NCK interface.  
**Program Continuation:** Teileprogramm neu starten. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

---

**28033 Emergency stop on NCU %1, axes still in follow-up mode**

**Parameters:** %1 = NCU number

---

<b>Definitions:</b>	The emergency stop request is active at the PLC-NCK interface on one NCU in the NCU group. Consequently, all axes are following.
<b>Reaction:</b>	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Remedy the cause of the emergency stop on the NCU, and acknowledge the emergency stop via the PLC-NCK interface.
<b>Program Continuation:</b>	Alarm display showing cause of alarm disappears. No further operator action necessary.

---

<b>29033</b>	<b>[Channel %1: ] Axis exchange of axis %2 not possible, PLC axis movement not yet completed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Axis
<b>Definitions:</b>	A PLC axis has not yet reached its end position and cannot be returned to a channel or neutralized. This alarm should not occur when PLC data block FC18 is used.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Wait until the axis has reached the end position or terminate the movement with delete distance to go.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program





## Cycle alarms

---

### 61000            %[[Channel %1: ] Block %2: %]No tool offset active

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             D-correction must be programmed before the cycle call.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

### 61001            [Channel %1: ] Block %2: Thread pitch incorrectly defined

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Check parameter for the thread size or setting for the pitch (contradict each other).

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

### 61002            %[[Channel %1: ] Block %2: %]Type of machining incorrectly defined

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Remedy:**             Modify VARI parameter.

**Program Continuation:**    Clear alarm with the RESET key. Restart part program

---

### 61003            %[[Channel %1: ] Block %2: %]No feed programmed in cycle

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Modify feed parameter.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61004 [Channel %1: ] Block %2: Incorrect configuration of geometry axes**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61005 [Channel %1: ] Block %2: 3rd geometry axis not available**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** With an application on the lathe with no Y-axis in the G18 plane.

**Remedy:** Check parameter on cycle call.

---

**61006 %[Channel %1: ] Block %2: %]Tool radius too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool radius is too large for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select a smaller tool.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61007 [Channel %1: ] Block %2: Tool radius too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool radius is too small for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select a larger tool.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61008 [Channel %1: ] Block %2: No tool active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Alarm triggered by following cycles:

**Remedy:** Select a tool.

---

**61009 [Channel %1: ] Block %2: Active tool number = 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No tool (T) has been programmed before the cycle call.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program tool (T).

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61010 [Channel %1: ] Block %2: Finishing allowance too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The finishing allowance for the base is greater than the total depth.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Reduce finishing allowance.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61011 [Channel %1: ] Block %2: Scaling not permissible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** A scale factor is active which is illegal for this cycle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify scale factor.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61012 %[Channel %1: ] Block %2: %]Different scaling in planes**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61013 [Channel %1: ] Block %2: Basic settings were changed, program cannot be executed**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The basic settings are not compatible with the generated program.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check and, if necessary, change the basic settings.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61014 [Channel %1: ] Block %2: Return plane exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check parameter RTP.

---

**61015 [Channel %1: ] Block %2: Contour is not defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61016 [Channel %1: ] Block %2: System frame for cycles missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Set MD 28082: MM\_SYSTEM\_FRAME\_MASK, Bit 5=1.

---

---

**61017**            **%[[Channel %1: ] Block %2: %]function %4 not present in NCK**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label channel number

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61018**            **[Channel %1: ] Block %2: function %4 not executable with NCK**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label channel number

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61019**            **%[[Channel %1: ] Block %2: %]Parameter %4 incorrectly defined**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label channel number

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              Check the value of the parameter.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61020**            **[Channel %1: ] Block %2: Machining not possible with active TRANSMIT/TRACYL**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label channel number

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61021 [Channel %1: ] Block %2: Parameter %4 value too high**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61022 [Channel %1: ] Block %2: Parameter %4 value too low**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61023 [Channel %1: ] Block %2: Parameter %4 value must be unequal to zero**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61024 [Channel %1: ] Block %2: Parameter %4 check value**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61025 [Channel %1: ] Block %2: Check tool carrier position**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61026 [Channel %1: ] Block %2: Cycle cannot be executed with NC function %4.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61027 %[[Channel %1: ] Block %2: %]Subroutine %4 does not exist**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check CYCLE62 call  
- Check whether the subroutines specified on CYCLE62 call exist in the program storage

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61028 [Channel %1: ] Block %2: Contour name %4 too long**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - use shorter contour name

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61029                    %[[Channel %1: ] Block %2: %]Program name %4 too long**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**                 - use shorter program name

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61030                    [Channel %1: ] Block %2: Path not permitted: %4**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61031                    [Channel %1: ] Block %2: Path not found: %4**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61032                    [Channel %1: ] Block %2: File not found: %4**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label



**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61033 [Channel %1: ] Block %2: Incorrect file type: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61034 [Channel %1: ] Block %2: File is full: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61035 [Channel %1: ] Block %2: File in use: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61036 [Channel %1: ] Block %2: NC storage limit reached: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61037 [Channel %1: ] Block %2: No access rights to file: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61038 [Channel %1: ] Block %2: Other file error: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61039 [Channel %1: ] Block %2: Line not available: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61040 [Channel %1: ] Block %2: Line longer than result variable: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61041 [Channel %1: ] Block %2: Line range too large: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61042 [Channel %1: ] Block %2: Program name %4 illegal**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** In the case of multi-channel systems, the main program name must not end with \_Cxx (xx stands for figures).  
Rename main program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61043 [Channel %1: ] Block %2: Error affecting coordinate conversion (%4)**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

- 1: Type not specified
- 2: Error during tool identification
- 3: Meas. point 1 not available
- 4: Meas. point 2 not available
- 5: Meas. point 3 not available
- 4: Meas. point 4 not available
- 7: No reference point available
- 8: No direction of approach
- 9: Meas. points are identical
- 10: Alpha is incorrect
- 11: Phi is incorrect
- 12: Incorrect direction of approach
- 13: Lines do not intersect
- 14: Planes not available
- 15: No frame or incorrect frame selected
- 16: Not enough memory available
- 17: Internal error

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61044            %[[Channel %1: ] Block %2: %]]Illegal character(s) in file name: %4**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Remove illegal character from file name  
                          Permitted characters are: letters, figures, underscore, slash with path name

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61045            [Channel %1: ] Block %2: Job list not found: %4**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             The specified job list could not be found.  
                          Check name and contents of job list.  
                          The job list must be in the same workpiece as the part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61046            [Channel %1: ] Block %2: Part program not found in job list: %4**

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Part program (main program) not found in specified job list in respective channel.  
Check name and contents of job list.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61047 [Channel %1: ] Block %2: Label name %4 too long**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - select shorter label name

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61048 [Channel %1: ] Block %2: Multi-channel data not found in job list: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Multi-channel data not found in job list.  
Correct job list.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61049 [Channel %1: ] Block %2: 1st spindle not programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program 1st spindle in the mask.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61050 [Channel %1: ] Block %2: Spindle programmed twice**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The same spindle was programmed twice.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Leave 2nd spindle empty or program other spindle.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61051 %[Channel %1: ] Block %2: %]Program name assigned twice**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The same program name was assigned twice.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** When using CYCLE952, the name of the main program must not be the same as the name of the cutting file (PRG) or the name of the updated blank contour (CONR).  
When using CYCLE63 and/or CYCLE64, the name of the main program must not be the same as the name of the program to be generated (PRG).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61052 [Channel %1: ] Block %2: Maximum spindle speed for main spindle not entered**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Max. speed for main spindle was not entered.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter speed limit in program header or under settings.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61053 [Channel %1: ] Block %2: Maximum spindle speed not entered for counterspindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Maximum speed of counterspindle was not entered.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter speed limit in program header or under settings.

---

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61054 [Channel %1: ] Block %2: Programs started from various job lists: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Programs from various job lists were started simultaneously.  
This is illegal. All programs must be assigned to the same job list.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select desired job list again, and start programs afresh.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61055 [channel %1: ] block %2: magazine location number too low: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The magazine location number entered was too low.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61056 [channel %1: ] block %2: magazine location number too high: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The magazine location number entered was too high.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61057 [channel %1: ] block %2: magazine location number is no integer: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The magazine location number must be an integer.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:**  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61058**            **%[[channel %1: ] block %2: %]function %4 not released**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label  
**Definitions:**  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** - CYCLE952: balance cutting function must be released via MD52218 \$MCS\_FUNCTION\_MASK\_TURN, bit6.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61059**            **%[[Channel %1: ] Block %2: %]Tool preselection failed**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label  
**Definitions:** --  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** --  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61060**            **%[[Channel %1: ] Block %2: %]Function requires tool management**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label  
**Definitions:** --  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** --  
**Program Continuation:** Clear alarm with the RESET key. Restart part program



---

**61099 [Channel %1: ] Block %2: Internal cycle error (%4)**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61101 %[[Channel %1: ] Block %2: %]Reference point defined incorrectly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** With an incremental specification of the depth, either different values have to be selected for the reference point (reference plane) and the retraction plane, or an absolute value must be specified for the depth.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61102 %[[Channel %1: ] Block %2: %]No spindle direction programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Parameter SDIR (or SDR in CYCLE840) must be programmed.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61103 [Channel %1: ] Block %2: Number of holes is zero**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check parameter NUM.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61104 [Channel %1: ] Block %2: Contour violation of slots**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Incorrect parameterization of the milling pattern in the parameters which define the position of the slots/elongated holes on the circle and their form.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61105 [Channel %1: ] Block %2: Milling cutter radius too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The diameter of the cutter used is too large for the form to be machined.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Either a tool with a smaller radius has to be used or the contour must be modified.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61106 [Channel %1: ] Block %2: Number of or distance between circular elements**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Incorrect parameterization of NUM or INDA. The layout of the circle elements within a full circle is not possible.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct parameterization.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61107 [Channel %1: ] Block %2: First drilling depth incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify drilling depth.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

<b>61108</b>	<b>[Channel %1: ] Block %2: Illegal values for radius and insertion depth parameters</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The radius (_RAD1) and insertion depth (_DP1) parameters for defining the helix path for the depth infeed have been incorrectly specified.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify parameter.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61109</b>	<b>%[[Channel %1: ] Block %2: %]Milling direction parameter incorrectly defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The value of the parameter for the cutting direction _CDIR has been incorrectly defined.
<b>Remedy:</b>	- Change milling direction. - During pocket machining (CYCLE63), the selected milling direction must match the milling direction of centering/rough drilling.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61110</b>	<b>[Channel %1: ] Block %2: Finishing allowance at bottom &gt; depth infeed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The finishing allowance at the base has been specified greater than the maximum depth infeed.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Either reduce finishing allowance or increase depth infeed.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61111</b>	<b>[Channel %1: ] Block %2: Infeed width &gt; Tool diameter</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The programmed infeed width is greater than the diameter of the active tool.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Infeed width must be reduced.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

**61112 [Channel %1: ] Block %2: Tool radius negative**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The radius of the active tool is negative. This is illegal.

**Remedy:** Change the tool radius.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61113 [Channel %1: ] Block %2: Parameter for corner radius too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The parameter for the corner radius \_CRAD has been specified too large.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Reduce corner radius

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61114 [Channel %1: ] Block %2: Machining direction G41/G42 incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The machining direction of the cutter radius compensation G41/G42 has been incorrectly selected.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Change machining direction.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61115 [Channel %1: ] Block %2: Approach or retract mode(straight / circle / plane / space) incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The approach or retract mode to/from the contour has been incorrectly defined.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameter \_AS1 or \_AS2.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61116 [Channel %1: ] Block %2: Approach or retract path = 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The approach or retract path has been specified with zero.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameter \_LP1 or \_LP2.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61117 %[Channel %1: ] Block %2: %]Active tool radius <= 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The radius of the active tool is negative or zero.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Modify radius.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61118 [Channel %1: ] Block %2: Length or width = 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The length or width of the milling area is illegal.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameters \_LENG and \_WID.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61119 [Channel %1: ] Block %2: Nominal or core diameter programmed incorrectly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The nominal or core diameter was incorrectly programmed.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check thread geometry.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61120 [Channel %1: ] Block %2: Thread type inside / outside not defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The thread type (internal/external) was not defined.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The internal/external thread type must be entered.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61121 [Channel %1: ] Block %2: Number of teeth per cutting edge is missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No value was entered for the number of teeth per cutting edge.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter the number of teeth/cutting edges for the active tool into the tool list.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61122 [Channel %1: ] Block %2: Safety distance incorrectly defined in plane**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The safety clearance is negative or zero. This is not allowed.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Define the safety clearance.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61123 [Channel %1: ] Block %2: CYCLE72 cannot be simulated**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

---

<b>61124</b>	<b>[Channel %1: ] Block %2: Infeed width is not programmed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	With active simulation without tool, a value for the infeed width _MIDA must always be programmed.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61125</b>	<b>[Channel %1: ] Block %2: Technology selection parameter incorrectly defined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check technology selection parameter (_TECHNO).
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61126</b>	<b>[Channel %1: ] Block %2: Thread length too short</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Program lower spindle speed or raise reference point (reference plane).
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61127</b>	<b>[Channel %1: ] Block %2: Wrong definition of tapping axis transformation ratio (machine data)</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check machine data 31050 and 31060 in the appropriate gear stage of the drilling axis.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61128 [Channel %1: ] Block %2: Insertion angle = 0 for insertion with oscillation or helix**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameter \_STA2.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61129 [Channel %1: ] Block %2: perpendic. approach and retraction during contour milling only allowed with G40**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61130 [Channel %1: ] Block %2: positions of parallel axes cannot be compensated. No workpiece reference agreed.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61131 [Channel %1: ] Block %2: parameter \_GEO incorrect, \_GEO=%4**

**Parameters:** %1 = Channel number  
%2 = Block number, label



**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61132 [Channel %1: ] Block %2: Parallel axis parameters incorrect, check values for parallel axis parameters ABS/INK**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61133 [Channel %1: ] Block %2: 3rd parallel axis parameter incorrect, check axis name or GUD\_SCW\_N[]**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61134 [Channel %1: ] Block %2: Rotary axis parameters incorrect, check values for rotary axis parameters ABS/INK**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61135 [Channel %1: ] Block %2: incorrect parameter sequence for approaching target position: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61136 [Channel %1: ] Block %2: no 3rd geometry axis agreed in GUD \_SCW\_N[]**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61137 [Channel %1: ] Block %2: swiveling and parallel axes cycle are mutually exclusive because of workpiece reference \$P\_WPFRAME**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61138 [Channel %1: ] Block %2: parameter %4 incorrectly defined for tool monitoring in cycles**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61139 [Channel %1: ] Block %2: error in function Tool monitoring in cycles**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61150 [Channel %1: ] Block %2: Tool cannot be aligned --> error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Causes of error:  
1st error code = A -> only new swivel plane permitted, see parameter \_ST

---

**61151 [Channel %1: ] Block %2: Orientation of tool not possible --> error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Causes of error:  
1st error code = A -> only additive swivel plane permitted, see parameter \_ST

---

**61152 [Channel %1: ] Block %2: B axis kinematics (turning technology) either not or incorrectly set up in Start-up of swivel cycle --> error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Causes of error:  
1st error code = A123 -> B axis not an automatic rotary axis under ShopTurn (123 corresponds to parameter \_TCBA)  
2nd error code = B123 -> B axis not activated in swiveling start-up (kinematics)  
(123 corresponds to \$TC\_CARR37[n], n ... number of the swivel data record)

---

**61153**            **[Channel %1: ] Block %2: No 'Rotary axes direct' swivel mode possible --> error code: %4**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Remedy:**            Causes of error:  
                         1st error code = A -> No tool or cutting edge (D1..) active

---

**61154**            **%[[Channel %1: ] Block %2: %]Final depth wrongly programmed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label channel number

**Definitions:**

**Remedy:**            Input of end depth possible only absolutely or incrementally

---

**61155**            **[Channel %1: ] Block %2: Unit for plane infeed wrongly programmed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label channel number

**Definitions:**

**Remedy:**            Unit for plane infeed possible only in mm or % of tool diameter

---

**61156**            **[Channel %1: ] Block %2: Depth calculation wrongly programmed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label channel number

**Definitions:**

**Remedy:**            Depth calculation possible only with or without SDIS

---

**61157**            **%[[Channel %1: ] Block %2: %]Reference point wrongly programmed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label channel number

**Definitions:**

**Remedy:**            Check reference point in screen form, input only -X, centred or +X

---

**61158**            **%[[Channel %1: ] Block %2: %]Machining plane wrongly programmed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label channel number

**Definitions:**

**Remedy:**            Check machining plane (G17, G18 or G19)

---

---

<b>61159</b>	<b>[Channel %1: ] Block %2: Machining plane on cycle call differs from the one in the position pattern</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	Adjust the machining plane on cycle call to the machining plane in the position pattern.

---

<b>61160</b>	<b>[Channel %1: ] Block %2: Residual material remains stationary, reduce plane infeed</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	Reduce plane infeed or slot width, or use milling cutter with larger diameter

---

<b>61161</b>	<b>[Channel %1: ] Block %2: Centering diameter or tool parameter (diameter, tip angle) are incorrect</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	- Diameter of centering with tip angle of active tool not possible - Entered workpiece diameter, tool diameter or tip angle of tool incorrect - Diameter of tool only has to be entered if centering is to be on workpiece diameter.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61162</b>	<b>[Channel %1: ] Block %2: Tool parameter diameter or tip angle incorrect</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	- The tool parameter diameter or tip angle must be greater than zero - Tip angle must be less than 180°
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61163</b>	<b>[Channel %1: ] Block %2: Infeed width in the plane too large</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Remedy:</b>	--

---

**61164 [Channel %1: ] Block %2: Transformation has incorrect type %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** The transformation has the incorrect type. Correct the transformation set up.

---

**61165 [Channel %1: ] Block %2: Transformation set up incorrectly: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** The transformation has been set up incorrectly. Correct the transformation set up.

---

**61166 [Channel %1: ] Block %2: Check machine data: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** The machine data must be checked. Adapt the setting of the machine data.

---

**61167 [Channel %1: ] Block %2: Transformation not set up: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** The specified transformation is not set up. Set up the transformation.

---

**61168 [Channel %1: ] Block %2: Incorrect machining plane: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** The machining plane is incorrect. Program correct machining plane.

---

**61175 [Channel %1: ] Block %2: angle of aperture programmed too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The angle of aperture of the text (\_DF) in the engraving cycle is too small. This means that the text for engraving does not fit in the specified angle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter a larger angle of aperture.

---

---

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61176 [Channel %1: ] Block %2: text length programmed too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The text length (\_DF) in the engraving cycle is too short. This means that the text for engraving is longer than the specified text length.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter longer text length

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61177 [Channel %1: ] Block %2: polar text length > 360 degrees**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the engraving cycle, the polar text length must not exceed 360 degrees.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter shorter text length.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61178 [Channel %1: ] Block %2: code page not present**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The specified code page is not supported by the cycle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use code page 1252.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61179 [Channel %1: ] Block %2: character does not exist, no.: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = Character number

**Definitions:** The character entered in the text for engraving cannot be milled.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Enter another character.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61180 [Channel %1: ] Block %2: No name assigned to swivel data record**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Although there are several swivel data blocks, no unique names have been assigned.  
**Remedy:** Assign unique name to swivel data block (\$TC\_CARR34[n]), if machine data 18088 \$MN\_MM\_NUM\_TOOL\_CARRIER is >1.

---

**61181 [Channel %1: ] Block %2: NCK software version is insufficient for the Swivel function**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Swivelling is not possible with the current NCK software version.  
**Remedy:** Upgrade NCK software to NCK 75.00 or higher.

---

**61182 [Channel %1: ] Block %2: Name of swivel data record unknown: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The specified name of the swivel data block is unknown.  
**Remedy:** Check name of swivel data record \$TC\_CARR34[n].

---

**61183 [Channel %1: ] Block %2: Swivel CYCLE800: Retraction mode parameter lies outside value range: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The value of the retraction mode parameter (\_FR) lies outside the valid range.  
**Remedy:** Swivel CYCLE800: Check transfer parameter \_FR. Value range 0 to 8

---

**61184 [Channel %1: ] Block %2: No solution possible with current input angle values**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The surface defined via the input angle cannot be processed with the machine.  
**Remedy:** -Check the angles entered for swiveling the machining plane: %4  
-Parameter \_MODE coding incorrect, e.g. rotation axis-wise YXY

---



---

<b>61185</b>	<b>[Channel %1: ] Block %2: Invalid angular ranges of rotary axes in swivel data record: %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The angular range of the rotary axes is invalid. Check setup of the swivel CYCLE800. Parameter \$TC_CARR30[n] to \$TC_CARR33[n] n number of swivel data record Example: Rotary axis 1 modulo 360 degrees: -> \$TC_CARR30[n]=0 \$TC_CARR32[n]=360
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check setup of swivel cycle CYCLE800.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61186</b>	<b>[Channel %1: ] Block %2: Invalid rotary axis vectors --&gt; Check setup of the swivel cycle CYCLE800.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	No or incorrect entry for rotary axis vector V1 or V2.
<b>Remedy:</b>	Check setup of swivel CYCLE800 Check rotary axis vector V1: \$TC_CARR7[n], \$TC_CARR8[n], \$TC_CARR9[n] Check rotary axis vector V2: \$TC_CARR10[n], \$TC_CARR11[n], \$TC_CARR12[n] n number of swivel data record

---

<b>61187</b>	<b>[Channel %1: ] Block %2: Check setup of the swivel cycle CYCLE800. --&gt; Error code: %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Error code: See current cycles software version notes in siemens.txt
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61188</b>	<b>[Channel %1: ] Block %2: No axis name agreed for rotary axis 1 -&gt; Check setup of the swivel cycle CYCLE800.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	No axis name was specified for the rotary axis 1.
<b>Remedy:</b>	Check setup of swivel CYCLE800. Axis name of rotary axis 1 see parameter \$TC_CARR35[n] n number of swivel data record

---

**61189 [Channel %1: ] Block %2: Swivel direct: Invalid rotary axis positions: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Swivel direct: Check input values of rotary axes.

**Remedy:** Swivel mode direct: Check input values of rotary axes or setup of swivel CYCLE800.  
Check angular range of rotary axes in swivel data record n:  
Rotary axis 1: \$TC\_CARR30[n], \$TC\_CARR32[n]  
Rotary axis 2: \$TC\_CARR31[n], \$TC\_CARR33[n]

---

**61190 [Channel %1: ] Block %2: Unable to retract prior to swiveling -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check setup of swiveling CYCLE800. Parameter \$TC\_CARR37[n] 7th and 8th decimal place  
n number of swivel data record  
Error code:  
A: Retraction Z not set up  
B: Retraction Z XY not set up  
C: Retraction in tool direction max. not set up  
D: Retraction in tool direction incremental not set up  
E: Retraction in tool direction: NC function CALCPOSI reports error  
F: Retraction in tool direction: no tool axis existing  
G: Retraction in tool direction max.: negative retraction path  
H: Retraction in tool direction incremental: negative retraction path  
I: Retraction not possible

---

**61191 [Channel %1: ] Block %2: Multi-axis transformation not set up. Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Error code:  
Number or parameter name of multi-axis transformation

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61192 [Channel %1: ] Block %2: Additional multi-axis transformations not set up. Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Error code:  
Number or parameter name of multi-axis transformation

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 61193 [Channel %1: ] Block %2: compressor option not set up

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 61194 [Channel %1: ] Block %2: spline interpolation option not set up

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 61196 [Channel %1: ] Block %2: No swiveling in JOG --> Multi-axis transformations and TCARR activated at the same time

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Multi-axis transformations (TRAORI) and Toolcarrier (TCARR) activated at the same time.

**Remedy:** Deselection of multi-axis transformation with TRAF00F  
or deselection of Toolcarrier (TCARR) with CYCLE800()

### 61197 [Channel %1: ] Block %2: Swiveling - plane not allowed -> Error code %4

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Error code:

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61198 [Channel %1: ] Block %2: Swiveling with kinematic chain -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61199 [Channel %1: ] Block %2: Swiveling - tool not allowed -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Error code:  
A: Orientation of tool and change of swivel data record not allowed

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61200 [Channel %1: ] Block %2: Too many elements in machining block**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The machining block contains too many elements.

**Remedy:** Check the machining block, delete some elements if required.

---

**61201 [Channel %1: ] Block %2: Wrong sequence in machining block**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The sequence of elements in the machining block is invalid.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Sort the sequence in the machining block.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61202 [Channel %1: ] Block %2: No technology cycle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No technology cycle was programmed in the machining block.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program a technology block.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61203 [Channel %1: ] Block %2: No position cycle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No positioning cycle was programmed in the machining block.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program positioning block.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61204 [Channel %1: ] Block %2: Technology cycle unknown**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The specified technology cycle in the machining block is unknown.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Delete and reprogram the technology block.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61205 [Channel %1: ] Block %2: Position cycle unknown**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The specified positioning cycle in the machining block is unknown.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Delete and reprogram the positioning block.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61206 [Channel %1: ] Block %2: Synchronizing possible only when using a job list**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Synchronizing with a counterspindle step in another channel is possible only if a job list is used.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Create job list and add programs for the individual channels.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61207 [Channel %1: ] Block %2: No counterspindle step found for synchronizing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No counterspindle step was found in any channel with which this channel could synchronize.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Control program.  
Delete step for synchronizing if it is not required.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61208 [Channel %1: ] Block %2: Assign parameters for main spindle chuck in the spindle chuck data**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The parameters for the main spindle chuck in the spindle chuck data are not assigned.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate parameters ZCn, ZSn and ZEn in the mask "Parameters" > "Setting data" > "Spindle chuck data".

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61209 [channel %1: ] block %2: counterspindle step programmed in several channels**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Counterspindle step may be programmed in one channel only.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The step "Counterspindle: synchronizing" must be used in the other channels.

---

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61210 [Channel %1: ] Block %2: Block search element not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The element specified for the block search does not exist.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Repeat block search.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61211 [Channel %1: ] Block %2: Absolute reference missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An incremental indication was made, but the absolute reference is unknown.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program an absolute position prior to using incremental indications.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61212 %[[Channel %1: ] Block %2: %]Wrong tool type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool type is not suitable for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select a new tool type.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61213 [Channel %1: ] Block %2: Circle radius too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed circle radius is too small.

**Remedy:** Correct the circle radius, center point or end point.

---

**61214 [Channel %1: ] Block %2: No pitch programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No thread/helical pitch has been entered.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program a pitch.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61215 [Channel %1: ] Block %2: Unfinished dimension incorrectly programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Check the blank spigot dimensions. The blank spigot must be larger than the production part spigot.

**Remedy:** Check parameters \_AP1 and \_AP2.

---

**61216 %[[Channel %1: ] Block %2: %]Feed/tooth only possible with cutting tools**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Feed per tooth is only possible with milling tools.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** As alternative, set a different feed type.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61217 [Channel %1: ] Block %2: Cutting speed programmed for tool radius 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** To be able to work with cutting speed, the tool radius has to be specified.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter a value for cutting speed.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61218 [Channel %1: ] Block %2: Feed/tooth programmed, but number of tools equals zero**

**Parameters:** %1 = Channel number  
%2 = Block number, label



---

**Definitions:** For feed per tooth, the number of teeth has to be specified.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Enter the number of teeth on the milling tool in the "Tool list" menu.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61219 [Channel %1: ] Block %2: Tool radius too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The tool radius is too large for machining.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Select a suitable tool.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61220 [Channel %1: ] Block %2: Tool radius too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The tool radius is too small for machining.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Select a suitable tool.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61221 [Channel %1: ] Block %2: No tool active**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** No tool active.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Select a suitable tool.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61222 [Channel %1: ] Block %2: Plane infeed greater than tool diameter**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The plane infeed must not be greater than the tool diameter.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Reduce plane infeed.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61223 [Channel %1: ] Block %2: Approach path too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The approach path must not be less than zero.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter a greater value for the approach path.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61224 [Channel %1: ] Block %2: Retract path too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The retract path must not be less than zero.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter a greater value for the retract path.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61225 [Channel %1: ] Block %2: Swivel data record unknown**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An attempt was made to access a swivel data block which has not been defined.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select another swivel data block or define a new swivel data block.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

<b>61226</b>	<b>[Channel %1: ] Block %2: Swivel head cannot be exchanged</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The parameter "Swivel data block" is set to "No". In spite of this, an attempt has been made to change the swivel head.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Set the parameter "Swivel data block" in the setup screen "Rotary axes" to "Automatic" or "Manual".
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61227</b>	<b>[Channel %1: ] Block %2: Target position cannot be reached: %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The target position of the approach motion is outside the software limit switch. This situation may arise from swiveling or coordinate rotations.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	If possible, lower retraction plane. Select alternative solution for swiveling (direction +/-) or clamp on workpiece differently.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61228</b>	<b>[Channel %1: ] Block %2: Retraction plane for swiveling with swivel head not reached due to software limit switches</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Retraction plane not reached!
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Correct retraction plane
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

<b>61229</b>	<b>[Channel %1: ] Block %2: The external retraction plane must be greater than the internal retraction plane</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The external retraction plane must be greater than the internal retraction plane.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

**Remedy:** Correct the retraction planes.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61230 [Channel %1: ] Block %2: Tool probe diameter too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The tool probe has not been calibrated correctly.  
**Remedy:** 840D sl - up to SW 1.x:  
Check the following variables in data block E\_MESS\_MT\_DR[n] or E\_MESS\_MT\_DL[n] for probe n+1  
840D sl/828D - as from SW 2.5:  
Check the following machine data: 51778 \$MNS\_J\_MEA\_T\_PROBE\_DIAM\_LENGTH[n] or 51780  
\$MNS\_J\_MEA\_T\_PROBE\_DIAM\_RAD[n] for probe n+1

---

**61231 [Channel %1: ] Block %2: ShopMill program %4 not executable, as not tested by ShopMill**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = Program name  
**Definitions:** Before a ShopMill program can be executed, it has to be tested by ShopMill.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** The program first has to be simulated in ShopMill or loaded into the operating mode "Machine auto" by ShopMill.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61232 [Channel %1: ] Block %2: Impossible to load magazine tool**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** Only manual tools may be loaded into a swivel head in which only manual tools can be loaded.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Load a manual tool into the swivel head or set the parameter "Tool change" on the setup screen form "Rotary axes" to "Automatic".  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61233 [Channel %1: ] Block %2: Thread angle wrongly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

---

**Definitions:** The thread angles were specified too large or too small.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Check thread geometry.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61234 [Channel %1: ] Block %2: ShopMill subroutine %4 cannot be executed, as not tested by ShopMill**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = Subroutine name

**Definitions:** Before a ShopMill subroutine can be used, it has to be tested by ShopMill.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The subroutine first has to be simulated in ShopMill or loaded into the ShopMill operating mode "Machine auto".  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61235 [Channel %1: ] Block %2: ShopTurn program %4 cannot be executed as not tested by ShopTurn.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = Program name

**Definitions:** Before a ShopTurn program can be executed, it has to be tested by ShopTurn.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Simulate the subroutine first in ShopTurn or load it into the ShopTurn operating mode "Machine auto".  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61236 [Channel %1: ] Block %2: ShopTurn subroutine %4 cannot be executed as not tested by ShopTurn.**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = Subroutine name

**Definitions:** Before a ShopTurn subroutine can be used, it has to be tested by ShopTurn.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Simulate the subroutine first in ShopTurn or load it into the ShopTurn operating mode "Machine auto".  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61237 [Channel %1: ] Block %2: Retraction direction unknown. Withdraw tool manually!**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool is in the retraction area and it is unknown in which direction it can be travelled out of it.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Manually retract the tool from the retraction area defined in the program header and restart the program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61238 [Channel %1: ] Block %2: Machining direction unknown!**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The direction of the next machining is unknown.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Please contact the responsible Siemens regional office.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61239 [Channel %1: ] Block %2: Tool change point lies within retraction area!**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool change point has to be far enough outside the retraction area so that when the revolver is swiveled, no tool extends into the retraction area.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Specify another tool change point.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61240 %[[Channel %1: ] Block %2: %]Wrong feed type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The feed type is not possible for this machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check feed type

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

<b>61241</b>	<b>[Channel %1: ] Block %2: Retraction plane not defined for this machining direction</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	No retraction plane has been defined for the selected machining direction.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Define the missing retraction plane.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61242</b>	<b>[Channel %1: ] Block %2: Wrong machine direction</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The machining direction has been specified incorrectly.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check the programmed machining direction.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61243</b>	<b>[Channel %1: ] Block %2: Correct tool change point, tool tip in retraction area!</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The tool change point must be situated so far outside the retraction area that no tool protrudes into the retraction area on turret swivelling.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Specify another tool change point.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61244</b>	<b>[Channel %1: ] Block %2: Pitch change leads to undefined thread</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The specified pitch change causes a reversal of the thread direction.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Check thread pitch change and thread geometry.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**61245 [Channel %1: ] Block %2: Machining plane does not match modal machining plane**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Machining plane does not match modal one.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check the machining plane.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61246 [Channel %1: ] Block %2: Safety distance too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The safety clearance is too small for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase safety clearance.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61247 [Channel %1: ] Block %2: Blank radius too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The blank radius is too small for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase blank radius.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61248 [Channel %1: ] Block %2: Infeed too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The infeed is too small for machining.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase infeed.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**



---

**61249 [Channel %1: ] Block %2: Number of edges too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The number of edges is too small.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase number of edges.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61250 [Channel %1: ] Block %2: Width across flats/edge length too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The width across flats/edge length is too small.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase key width/edge length.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61251 [Channel %1: ] Block %2: Width across flats/edge length too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The width across flats/edge length is too large.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Decrease key width/edge length.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61252 [Channel %1: ] Block %2: Chamfer/radius too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Chamfer/radius is too large.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Decrease chamfer/radius.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61253 [Channel %1: ] Block %2: No finishing allowance programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No finishing allowance has been entered.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Programm a finishing allowance.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61254 [Channel %1: ] Block %2: Error while traveling to fixed stop**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Error on travelling to fixed stop.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** specify another Z1 position for gripping the counterspindle.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61255 [Channel %1: ] Block %2: Error during cut-off: Tool broken?**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Cut-off could not be completed. A tool breakage might have occurred.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check the tool.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61256 [Channel %1: ] Block %2: Mirroring not allowed at program start. Deselect work offset!**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Mirroring impermissible at program start.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Deselect work offset.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61257 [Channel %1: ] Block %2: incomplete setup of counterspindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Setup of the counterspindle is incomplete.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The following machine and setting data must be set for the counterspindle:  
- MD52206 \$MCS\_AXIS\_USAGE  
- SD55232 \$SCS\_SUB\_SPINDLE\_REL\_POS  
- SD55550 \$SCS\_TURN\_FIXED\_STOP\_DIST  
- SD55551 \$SCS\_TURN\_FIXED\_STOP\_FEED  
- SD55552 \$SCS\_TURN\_FIXED\_STOP\_FORCE

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61258 [Channel %1: ] Block %2: Assign parameters for counterspindle chuck in the spindle chuck data**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The parameters for the counterspindle chuck in the spindle chuck data have not been assigned.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Indicate parameters ZCn, ZSn and ZEn in the mask "Parameters" > "Setting data" > "Spindle chuck data".

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61259 [Channel %1: ] Block %2: program contains new machining steps from ShopMill %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = ShopMill version

**Definitions:** The program has been created with a ShopMill version that is higher than the existing one.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Delete the machining step and reprogram machining if required.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61260 [Channel %1: ] Block %2: program contains new machining steps from ShopTurn %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
%4 = ShopTurn version

**Definitions:** The program has been created with a ShopMill version that is higher than the existing one.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Delete the machining step and reprogram machining if required.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61261 [Channel %1: ] Block %2: center offset too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The center offset on center drilling is larger than permissible.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Enter lower eccentricity (\$SCS\_DRILL\_MID\_MAX\_ECCENT).  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61262 [Channel %1: ] Block %2: pitch not possible with selected tool**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** The pitch of the tap does not match the programmed pitch.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Use a tap with the programmed pitch.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61263 [Channel %1: ] Block %2: Chained ShopMill program blocks not permissible in subprogram on pos. pattern**

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:** If a subroutine is called from a position pattern, the subroutine itself must not include a position pattern.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Reprogram machining.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61264 [Channel %1: ] Block %2: Chained ShopTurn program blocks not permissible in subprogram on pos. pattern**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** If a subroutine is called from a position pattern, the subroutine itself must not include a position pattern.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Reprogram machining.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61265 [Channel %1: ] Block %2: Too many restrictions, use rectangular pocket**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In face milling a maximum of only 3 sides can be delimited.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use pocket cycle.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61266 [Channel %1: ] Block %2: Illegal machining direction**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In face milling, the delimitations and the direction of machining do not match.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select another direction of machining.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61267 [Channel %1: ] Block %2: Plane infeed too large, residual corners remain**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In face milling, the plane infeed must not exceed 85%.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select a smaller plane infeed, as otherwise residual corners will be left over.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61268 [Channel %1: ] Block %2: Illegal machining direction, residual corners are left over.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In face milling, the machining direction does not match the selected delimitations.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The machining direction must be selected to match the delimitations.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61269 [Channel %1: ] Block %2: External tool diameter too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Incorrect tool definition.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check angle and diameter of the tool used.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61270 %[[Channel %1: ] Block %2: %]Chamfer width too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Chamfer width selected too small.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Increase the chamfer width.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61271 %[[Channel %1: ] Block %2: %]Chamfer width > tool radius**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Chamfer width larger than tool radius.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use a larger tool.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61272**            **%[[Channel %1: ] Block %2: %]Insertion depth too small**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**        Insertion depth on chamfering too small.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Increase the insertion depth.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61273**            **%[[Channel %1: ] Block %2: %]Insertion depth too large**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**        Insertion depth on chamfering too large.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Decrease the insertion depth.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61274**            **%[[Channel %1: ] Block %2: %]Invalid tool angle**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**        Invalid tool angle.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Check tool angle

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61275**            **[Channel %1: ] Block %2: Target point violates software limit switch!**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**        Due to a swivel action, the end point is outside the software limit switches.

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             Select another retraction plane or approach a suitable interpolation point.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61276 [Channel %1: ] Block %2: External tool diameter required for restrictions**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Outer tool diameter required in case of delimitations.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Specify the outer tool diameter.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61277 [Channel %1: ] Block %2: Tool diameter larger than restriction**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Tool diameter larger than delimitation.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use a smaller tool.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61278 [Channel %1: ] Block %2: If tool angle is larger than 90°, both tool diameters must be equal**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** For tool angles larger than 90°, the two tool diameters must be identical.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the tool angle or the tool diameters.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61279 [Channel %1: ] Block %2: If tool angle equals 90°, both tool diameters must be equal**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** For tool angles equal to 90°, the two tool diameters must be identical.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the tool angle or the tool diameters.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**



---

**61280 [Channel %1: ] Block %2: %4- Mirroring missing in work offset for counterspindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The work offset for counterspindle machining does not have Z mirroring.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Select Z mirroring for the work offset used.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61281 [Channel %1: ] Block %2: starting point of machining outside retraction planes**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The starting point of machining is outside the retraction planes.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Adjust the retraction planes.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61282 [Channel %1: ] Block %2: end point of machining outside retraction planes**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The end point of machining is outside the retraction planes.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Adjust the retraction planes.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61283 [Channel %1: ] Block %2: direct approach not possible, as tool change required**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** After block search a position is to be reached by direct approach, but a tool change is required before.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** First execute a manual tool change, then restart the block search.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61284 [Channel %1: ] Block %2: starting point cannot be approached without collision. Pre-position tool manually**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The starting point cannot be approached without collisions.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Preposition the tool manually.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61285 [Channel %1: ] Block %2: parking position is below return plane XRA.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The parking position is below retraction plane XRA.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Move the parking position above retraction plane XRA.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61286 [Channel %1: ] Block %2: machining not possible, check tool angle.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Machining not possible with the specified tool.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use a suitable tool.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61287 %[[Channel %1: ] Block %2: %]no master spindle active.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No master spindle active.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Activate the master spindle (machine data 20090).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61288 [Channel %1: ] Block %2: Main spindle not set up**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** -

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter channel axis number of main spindle in MD52206 \$MCS\_AXIS\_USAGE.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61289 [Channel %1: ] Block %2: Counterspindle not set up**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** -

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter channel axis number of counterspindle in MD52206 \$MCS\_AXIS\_USAGE.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61290 [Channel %1: ] Block %2: Tool spindle not set up**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** -

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter channel axis number of tool spindle in MD52206 \$MCS\_AXIS\_USAGE.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61291 [Channel %1: ] Block %2: Linear axis of counterspindle not set up**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** -

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter channel axis number of linear axis of counterspindle in MD52206 \$MCS\_AXIS\_USAGE.

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61292**                    **[Channel %1: ] Block %2: B axis not set up**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            -

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Enter channel axis number of B axis in MD52206 \$MCS\_AXIS\_USAGE.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61293**                    **[Channel %1: ] Block %2: Tool %4 has no spindle rotation direction**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            -

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Select spindle rotation direction in tool list.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61294**                    **[Channel %1: ] Block %2: Active radius/diameter setting does not match reset setting**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            -

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Before starting up the program, set G group 29 (DIAMON, DIAMOF etc.) to reflect the corresponding reset value.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61295**                    **[Channel %1: ] Block %2: The value of the "Axis sequence" parameter is illegal**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            -

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 Correct the "Axis sequence" parameter in the screen form

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61296 [Channel %1: ] Block %2: Blank programmed incorrectly**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The blank has been programmed incorrectly.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Correct the blank.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61297 [Channel %1: ] Block %2: Reference for incremental retraction plane missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The retraction plane can only be specified in increments if the blank is entered.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Program the retraction plane in absolute terms.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61298 [Channel %1: ] Block %2: No work offset entered for main spindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No work offset has been specified for the main spindle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Specify a work offset for the main spindle in the program header or under Settings.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61299 [Channel %1: ] Block %2: No work offset entered for counterspindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No work offset has been entered for the counterspindle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Specify a work offset for the counterspindle in the program header or under Settings.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61300 [Channel %1: ] Block %2: Probe defective**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61301 [Channel %1: ] Block %2: Probe not switching**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The measuring distance was completely traversed, but no switching signal was generated at the measuring input.

**Remedy:**  
-Check measuring input.  
-Check measuring distance.  
-Probe defective.

---

**61302 [Channel %1: ] Block %2: Probe - collision**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The measuring probe collided with an obstacle when being positioned.

**Remedy:**  
- Check spigot diameter (may be too small)  
- Check measuring distance (may be too long)

---

**61303 [Channel %1: ] Block %2: Safety margin exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The measuring result differs greatly from the specified value.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check setpoint value and parameter \_TSA  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check setpoint value and parameter TSA

---

**61304 [Channel %1: ] Block %2: Allowance**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

---

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61305 [Channel %1: ] Block %2: Dimension too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61306 [Channel %1: ] Block %2: Permissible measuring difference exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check setpoint value and parameter DIF  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check setpoint value and parameter DIF

---

---

**61307 [Channel %1: ] Block %2: Incorrect measuring variant**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- The value of parameter \_MVAR is impermissible.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- The value of parameter S\_MVAR is impermissible.

---

---

**61308 [Channel %1: ] Block %2: Check measuring path**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** A traversing path for measuring is generated with a size that can be specified. It describes the maximum distance before and after the expected switching position (workpiece edge) and must have a value greater than 0.  
For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter \_FA  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter DFA

---

**61309 [Channel %1: ] Block %2: Check probe type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Measurement of workpiece:  
Check tool type of measuring probe in TOOLMAN.  
When measuring workpiece milling, it is preferred to use tool type 710 and/or type 1xy.  
When measuring workpiece turning, it is preferred to use tool type 580 and/or type 5xy.  
Measurement of tool:  
- for 840D sl - up to SW 1.x:  
For measuring tool milling, no permissible tool probe type is entered in \_TP[x,8] or \_TPW[x,8] and/or check the permissible working plane G17...G19 for tool type "Disk".  
- for 840D sl/828D - as from SW 2.5:  
When measuring tool milling, no permissible tool probe type is entered in SD54633 \$SNS\_MEA\_TP\_TYPE[x] or SD54648 \$SNS\_MEA\_TPW\_TYPE[x] and/or check the permissible working plane G17...G19 for tool type "Disk".

---

**61310 [Channel %1: ] Block %2: Scale factor is active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Scale factor = scaling is active.

**Remedy:** Switch off the active scale factor in the program. Measuring is not possible with an active scale factor.

---

**61311 [Channel %1: ] Block %2: No D number active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No tool offset for the measuring probe (for workpiece measurement) or no tool offset for the active tool (for tool measurement) is selected.

**Remedy:** Select the tool's tool edge number D.

---

**61312 [Channel %1: ] Block %2: Check measuring cycle number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Measuring cycle called is impermissible...

---

**61313 [Channel %1: ] Block %2: Check probe number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**



**Remedy:** Check parameter \_PRNUM in connection with the following data fields and machine data:  
 For 840D sl - up to SW 1.x:  
 - Create data field \_WP[], \_TP[] and \_TPW[] for additional tool or workpiece probe and adjust \_CVAL[0]/\_CVAL[1] accordingly.  
 For 840D sl/828D - as from SW 2.5:  
 - Check the following machine data: 51600 \$MNS\_MEA\_CAL\_WP\_NUM, 51602 \$MNS\_MEA\_CAL\_TP\_NUM and 51603 \$MNS\_MEA\_CAL\_TPW\_NUM

### **61314 [Channel %1: ] Block %2: Check selected tool type**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:**

**Remedy:** Tool type impermissible for tool measurement/tool probe calibration.

### **61315 [Channel %1: ] Block %2: Check position of cutting edge**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:**

**Remedy:** Check tool edge position (probe) in TO memory.

### **61316 [Channel %1: ] Block %2: Center and radius cannot be determined**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** No circle can be calculated from the measured points, as all measured points lie on a straight line.

**Remedy:** Program change

### **61317 [Channel %1: ] Block %2: Check number of circle calculation points**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:** Parameterization faulty; requires 3 or 4 points to calculate the center point.

**Remedy:** Change parameterization of CYCLE116.

### **61318 [Channel %1: ] Block %2: Check weighting factor**

**Parameters:** %1 = Channel number  
 %2 = Block number, label

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
 - Check parameter (\_K)  
 For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
 - Check parameter (FW)

---

**61319 [Channel %1: ] Block %2: Check call parameter CYCLE114**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check call parameter CYCLE114.

---

**61320 [channel %1: ] block %2: check tool name / number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameters \_TNUM, \_TNAME.  
Bei 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter S\_TNAME .  
With active tool management, parameter S\_TNAME is empty or the specified tool name is unknown to the tool management.

---

**61321 [Channel %1: ] Block %2: Check WO memory number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter \_KNUM  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check the the number entered for the work offset compensation

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61322 [Channel %1: ] Block %2: Check 4th digit of \_KNUM**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The stated digit of \_KNUM includes invalid values. Also check \_MVAR.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
Check parameter for tool offset target (\_KNUM) and/or measurement variant (\_MVAR)

---

**61323 [Channel %1: ] Block %2: Check 5th digit of \_KNUM**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The stated digit of \_KNUM includes invalid values. Also check \_MVAR.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
Check parameter for tool offset target (\_KNUM) and/or measurement variant (\_MVAR)

---

---

**61324 [Channel %1: ] Block %2: Check 6th digit of \_KNUM**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The stated digit of \_KNUM includes invalid values. Also check \_MVAR.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
Check parameter for tool offset target (\_KNUM) and/or measurement variant (\_MVAR)

---

**61325 [Channel %1: ] Block %2: Check measuring axis/offset axis**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameters for measuring axis \_MA  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameters for measuring axis (X, Y, Z)

---

**61326 [Channel %1: ] Block %2: Check measuring direction**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Parameter for measuring direction \_MD has an incorrect value.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check the measuring direction (+ -) entered in the screenform.

---

**61327 [Channel %1: ] Block %2: Program reset required**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** NC reset required.

**Remedy:** Execute NC reset.

---

**61328 [Channel %1: ] Block %2: Check D number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** D number in parameter \_KNUM is 0.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter for tool offset target (\_KNUM)  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter for tool offset target (S\_KNUM1)

---

---

**61329 [Channel %1: ] Block %2: Check rotary axis**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** No name assigned to the axis number specified in the parameter of the rotary axis, or this axis is not configured as a rotary axis.  
For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check MD 20080 and/or MD 30300.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check MD 20080, MD 30300 and/or MCS 52207 - bit6.

---

**61330 [Channel %1: ] Block %2: Coordinate rotation active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No measuring possible in the rotated coordinate system.

**Remedy:** Check the conditions for measuring.

---

**61331 [Channel %1: ] Block %2: Angle too large, change measuring axis**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Parameter starting angle (`_STA`) is too large for the measuring axis specified.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Parameter starting angle (`alpha 0`) is too large for the measuring axis specified.  
Select another measuring axis.

---

**61332 [Channel %1: ] Block %2: Modify tool tip position**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The tool tip is below the measuring probe surface (e.g. for a ring gauge or cube).

**Remedy:** Place the tool above the measuring probe surface.

---

**61333 [Channel %1: ] Block %2: Check calibration block number**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Parameter `_CALNUM` is too large, reduce it to a permissible value  
For 840D sl - up to SW 1.x:  
- Increase the maximum value of `_CVAL[2]` in GUD6  
For 840D sl/828D - as from SW 2.5:  
- Check following machine data: 51601 `$MNS_MEA_CAL_EDGE_NUM`

---

**61334 [Channel %1: ] Block %2: Check safety area**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check the parameters for the protection zone  
For 840Dsl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- \_SZA or \_SZO  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- XS, YS or ZS

---

**61335 [Channel %1: ] Block %2: Reserved**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Alarm triggered: Reserved

**Remedy:** reserved

---

**61336 [Channel %1: ] Block %2: Geometry axes do not exist**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** No geometry axes configured.

**Remedy:** Machine data in MD 20060 must be changed.

---

**61337 [Channel %1: ] Block %2: Check measuring input**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61338 [Channel %1: ] Block %2: Positioning speed equal to zero**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** For some measuring versions, for example measuring spigots, in addition to the actual measuring paths, intermediate paths are generated that are traversed with a specified feed.  
The values for the feed are specified:  
- For 840D sl - up to SW 1.x: in parameters \_SPEED[1] and \_SPEED[2] in GUD6.  
- For 840D sl/828D - as from SW 2.5: in setting data 55631 \$SCS\_MEA\_FEED\_PLANE\_VALUE and 55632 \$SCS\_MEA\_FEED\_FEEDAX\_VALUE

---

**61339**                    **[Channel %1: ] Block %2: Correction factor for rapid traverse speed = 0**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 For 840D sl - up to SW 1.x: Check parameter \_SPEED[0] in GUD6  
                              For 840D sl/828D - as from SW 2.5: Check setting data 55630 \$SCS\_MEA\_FEED\_RAPID\_IN\_PERCENT

---

**61340**                    **[Channel %1: ] Block %2: Incorrect alarm number**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Internal error in measuring cycles.

---

**61341**                    **[Channel %1: ] Block %2: Probe not calibrated in active plane.**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Calibrate the probe prior to calling a cycle.

---

**61342**                    **[Channel %1: ] Block %2: Upgrade NCK software version**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Upgrade NCU software version.

---

**61343**                    **%[[channel %1: ] block %2:%] tool does not exist: %4**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Check tool name.

---

**61344**                    **[Channel %1: ] Block %2: Several tools are active**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Remove tool from another spindle.

---

---

**61345 [Channel %1: ] Block %2: D number of tool offset, too many digits**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
Reduce the D number in \_KNUM, check software or MD of flat D number.

---

**61346 [Channel %1: ] Block %2: Distance between starting point and measuring point <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
: - Parameter \_SETV[0] or \_SETV[1] is empty or less than 0.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
: - Parameter X1 or X2 is empty or less than 0.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61347 [Channel %1: ] Block %2: Angle 1st edge - 2nd edge equals 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Parameter following angle (\_INCA) is 0.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Parameter following angle (alpha 1) is 0.

---

**61348 [Channel %1: ] Block %2: Angle rel. to reference edge equals 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Clear alarm with the RESET key. Restart part program

**Program Continuation:**

---

**61349 [Channel %1: ] Block %2: Distance upper probe edge - measuring position = 0 for tool radius measurement**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The distance between the upper and lower edges of the tool probe equals 0; relevant for radius measurement.  
For 840D sl - up to SW 1.x: Check parameter `_TP[x,9]`  
For 840D sl/828D - as from SW 2.5: Check setting data 54634 `$SNS_MEA_TP_CAL_MEASURE_DEPTH`

---

**61350 [Channel %1: ] Block %2: Feed, speed not programmed for tool measurement with rotating spindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Measuring feed and/or spindle speed during tool measurement with turning spindle not entered in GUD variable `_MFS`.  
- Check parameter `_MFS[0]`  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameters F1 and S1

---

**61351 [Channel %1: ] Block %2: Tool length or radius is 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Cutter: - Check length and radius of the active tool in the compensation data memory  
Drill: - Check length of the active tool in the compensation data memory  
- Radius or tip angle of the active tool must be predefined in the compensation data memory

---

**61352 [Channel %1: ] Block %2: Path for logfile not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The specified path for the log file is incorrect.

**Remedy:** Check parameter `_PROTNAME[1]`

---

**61353 [Channel %1: ] Block %2: Path for logfile not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The specified directory does not exist or the specified path is incorrect.

**Remedy:** Check parameter `_PROTNAME[1]`

---



---

**61354 [Channel %1: ] Block %2: File for logfile not found**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** No name specified for the log file.

**Remedy:** Check parameter \_PROTNAME[1]

---

**61355 [Channel %1: ] Block %2: Incorrect file type for logfile**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The file extension for the log file is incorrect.

**Remedy:** Check parameter \_PROTNAME[1]

---

**61356 [Channel %1: ] Block %2: File for logfile is being used**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The log file is already used by an NC program.

**Remedy:** Check parameter \_PROTNAME[1]

---

**61357 %[[Channel %1: ] Block %2: %]No resources free**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Not enough NC memory space available or too many files / directories in the NC file system.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Delete or unload files  
MD18270: \$MN\_MM\_NUM\_SUBDIR\_PER\_DIR, MD18280: \$MN\_MM\_NUM\_FILES\_PER\_DIR or MD18320: Check \$MN\_MM\_NUM\_FILES\_IN\_FILESYSTEM and increase if necessary.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61358 [Channel %1: ] Block %2: Error during recording**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Internal error

**Remedy:** Call the hotline!

---

**61359 [Channel %1: ] Block %2: - continue with RESET**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Internal error

Remedy: Call the hotline!

---

**61360 [Channel %1: ] Block %2: Log job undefined - continue with RESET**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:** Cycle CYCLE106 was called by an incorrect parameter.  
**Remedy:** Check cycle call for CYCLE106, specifically the call parameter.

---

**61361 [Channel %1: ] Block %2: Variable cannot be recorded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:** The value specified in \_PROTVAL[] cannot be logged.  
**Remedy:** Check parameter \_PROTVAL[].

---

**61362 [Channel %1: ] Block %2: Cycle118: No. of values too large**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:** 4th parameter for CYCLE118 is larger than 10.  
**Remedy:** Reduce the 4th parameter (PAR4) of CYCLE118.

---

**61363 [Channel %1: ] Block %2: Max. no. of value lines for recording exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:** Maximum number of value lines exceeded.  
**Remedy:** Reduce the number of value lines.  
Check parameter \_PROTFORM[4].

---

**61364 [Channel %1: ] Block %2: Check distance between measuring points %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:**  
**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter incremental infeed depth (\_ID)  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter incremental infeed depth

---

**61365 [Channel %1: ] Block %2: Check circular feed**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number  
**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
:- Check parameter \_RF  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter SD55640 \$SCS\_MEA\_FEED\_CIRCLE

---

**61366 [Channel %1: ] Block %2: Direction of rotation for tool measurement with rotating spindle not specified.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 1.x:  
- Check parameter \_CM[5] in GUD6, permissible values are 3 (corresponds to M3) and/or 4 (corresponds to M4)  
For 840D sl/828D - as from SW 2.5:  
- Check setting data 54674 \$SNS\_MEA\_CM\_SPIND\_ROT\_DIR, permissible values are 3 (corresponds to M3) and/or 4 (corresponds to M4)

---

**61367 [channel %1: ] block %2: parameters %4 are identical**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Specify different positions for the relevant points of \_SETV[0...7]  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Specify different positions for the relevant points of X1 X2 Y1 Y2 X3 Y3 X4 Y4.

---

**61368 [channel %1: ] block %2: straights through parameter %4 do not intersect**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Specify different positions for the relevant points of \_SETV[0...7]  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Specify different positions for the relevant points of X1 X2 Y1 Y2 X3 Y3 X4 Y4.

---

**61369 [Channel %1: ] Block %2: Position of corner not clearly definable, check parameter %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Define P1 and P2 and/or P3 and P4 so that the intersection of the straights running through these points lies outside the sections formed by P1 and P2 and/or P3 and P4.  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Define X1 and X2 and/or Y1 and Y2 so that the intersection of the straights running through these points lies outside the sections formed by X1 and X2 and/or Y1 and Y2.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61370 [Channel %1: ] Block %2: \_PROTVAL[0] - \_PROTVAL[5] do not have any entries**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Enter values in \_PROTVAL[0...5].

---

**61371 [Channel %1: ] Block %2: Product of column width and number of columns exceeds 200 characters per line**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Reduce the column width (\_PROTFORM[4]) or number of columns (\_PROTVAL[2...5]).

---

**61372 [Channel %1: ] Block %2: selected meas.variant requires SPOS-capable spindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Change measuring variant or check machine equipment.

---

**61373 [Channel %1: ] Block %2: Mono-directional probe requires SPOS-capable spindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check machine equipment.

---

**61374 [Channel %1: ] Block %2: Probe not calibrated in axis direction %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Calibrate the probe in the specified axis direction.

---

**61375**                    **[Channel %1: ] Block %2: Trigger values of measuring sensor are incompatible**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Trigger values of the tool measuring sensor must be fully described either via the `_TP[] / _TPW[]` fields or via the setting data (SD: 54625-54632 or SD: 54640-54647). A mixture of the two variants is not permitted.

---

**61401**                    **[Channel %1: ] Block %2: Probe does not switch, traversing path limited by software limit position.**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 The position defined by a setpoint value cannot be reached as this would mean overrunning the software limit position.  
- Check specified setpoint value.

---

**61402**                    **[Channel %1: ] Block %2: Probe collision, traversing path limited by software limit position**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 For the measuring variants Measure web/shaft, the position path in the plane was limited by the software limit position. The probe switched in the following infeed along the infeed axis.  
Check programmed position of software limit position.

---

**61403**                    **[Channel %1: ] Block %2: Work offset correction not executed**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Call the SIEMENS hotline

---

**61404**                    **[Channel %1: ] Block %2: Tool correction not executed**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Check the dependent tool specifications.

---

**61405**                    **[Channel %1: ] Block %2: Tool environment does not exist**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

---

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Correct the name of the tool environment (\_TENV) or create this environment.

---

**61406 [Channel %1: ] Block %2: Check DL number**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter \_DLNUM  
For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:  
- Check parameter DL  
Check the number of the sum offset and that of the setup offset.

---

**61407 [Channel %1: ] Block %2: Check 7th digit and higher of \_KNUM**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:  
- Check parameter \_KNUM.  
- Check the the number of the sum offset and that of the setup offset.

---

**61408 [Channel %1: ] Block %2: total offsets not present**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Set MD 18080, Bit 8=1

---

**61409 [Channel %1: ] Block %2: set up offsets not present**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Set MD 18112, Bit 4=1

---

**61410 [Channel %1: ] Block %2 access to nonexistent tool element or property**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The variable to be corrected requires an option or an increase in MD values.

---

---

**61411 [Channel %1: ] Block %2: Check the distribution of measuring points on the plane.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check the setpoint and actual values

---

**61412 [Channel %1: ] Block %2: channel basic frame not present**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Set MD 28081>0, \$P\_CHBFRMASK>0

---

**61413 [Channel %1: ] Block %2: check setpoint of ball diameter, %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check setpoint value of spherical diameter.

---

**61414 [Channel %1: ] Block %2 : distortion of triangle over limit**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check the setpoint and actual values

---

**61415 [Channel %1: ] Block %2: Check probe / machining plane**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Enter permissible probe for machining plane:  
- For 840D sl - up to SW 1.x: Check the variables \_TP[x,8] and \_TPW[x,8] in GUD6  
- For 840D sl/828D - as from SW 2.5: Check the setting data 54633 \$SNS\_MEA\_TP\_TYPE and/or 54648 \$SNS\_MEA\_TPW\_TYPE  
or change the machining plane.

---

**61416 [Channel %1: ] Block %2: adapt array size %4!**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** For 840D sl - up to SW 1.x:  
Match \_CVAL entry to the number of existing probe and calibration block data fields, that means:  
- Adapt\_TP[ ]/\_CVAL[0] field size, or  
- Adapt\_WP[ ]/\_CVAL[1] field size, or  
- Adapt\_KP[ ]/\_CVAL[2] field size, or  
- Adapt\_TWP[ ]/\_CVAL[3].  
For 840D sl/828D - as from SW 2.5:  
Check machine data for the number of probe and calibration block data fields, that means:  
- Workpiece probe 51600\$MNS\_MEA\_CAL\_WP\_NUM or  
- Calibration block 51601\$MNS\_MEA\_CAL\_EDGE\_NUM or  
- Workpiece probe in Machine 51602\$MNS\_MEA\_CAL\_TP\_NUM or  
- Workpiece probe in Work 51603\$MNS\_MEA\_CAL\_TPW\_NUM

---

**61417 [Channel %1: ] Block %2: Probe will collide with the carrier of the reference groove.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Take up collision-free initial position of the axes involved in the measuring process.

---

**61418 [Channel %1: ] Block %2: Protocol file too small, check MD11420: LEN\_PROTOCOL\_FILE.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check MD11420: LEN\_PROTOCOL\_FILE.

---

**61419 [Channel %1: ] Block %2: Check probe calibration with reference to center of ball/ circumference of ball.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The workpiece probe must be calibrated according to its use in the measuring cycles.

---

**61420 [Channel %1: ] Block %2: Check calibration of multi/mono probes.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The workpiece probe must be calibrated according to its type and use.

---

**61421 [Channel %1: ] Block %2: Software release of measuring cycles or NCK inadequate or set up incorrectly --> error code %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number



**Definitions:****Remedy:**

Causes of error:

1. Error code = A -> `_OVR[]` - parameter field too small. Check GUD definition.  
DEF CHAN REAL `_OVR[72]` (up to MZ06.03.xx.xx =32)

**61422 [channel %1: ] block %2: parameter measuring variant incorrect --> error code: %4****Parameters:**

%1 = Channel number  
%2 = Block number, label channel number

**Definitions:****Remedy:**

Causes of error for 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:

1. Error code = A -> `_MVAR` = 9x identifier CYCLE996 measure kinematics
2. Error code = B -> Parameter for normalizing (`_MVAR`) incorrect
3. Error code = C -> Measurement variant "compute only" active, but rotary axis 1 or 2 not measured  
(see also parameter `_OVR[40]`)

**61423 [Channel %1: ] Block %2: Parameter %4 not agreed or not created****Parameters:**

%1 = Channel number  
%2 = Block number, label channel number

**Definitions:****Remedy:**

Causes of error:

For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:

1. Parameter CYCLE996 `_TNUM` incorrect or equals zero
2. No swivel data record created -> MD18088 = 0

For 840D sl - as from SW 2.7 and for 828D - as from SW 4.4:

1. Parameter CYCLE996 `S_TC` incorrect or equals zero
2. No swivel data record created -> MD18088 = 0

**61424 [Channel %1: ] Block %2: Parameter %4 for diameter of calibration ball incorrect****Parameters:**

%1 = Channel number  
%2 = Block number, label channel number

**Definitions:****Remedy:**

Bei 840D sl - bis SW 2.6 SP1 und bei 828D - bis SW 4.3 :

- Parameter `_SETVAL` prüfen!

Bei 840D sl - ab SW 2.7 und bei 828D - ab SW 4.4 :

- Parameter `S_SETV` prüfen!**61425 [Channel %1: ] Block %2: Parameter for measuring axis rotary axis 1 or 2 incorrect -> Error code: %4****Parameters:**

%1 = Channel number  
%2 = Block number, label channel number

**Definitions:****Remedy:**

Causes of error:

1. Error code = A -> Rotary axis number incorrect (1 or 2)
2. Error code = B -> No name agreed for rotary axis 1
3. Error code = C -> Rotary axis vector 1 equals zero
4. Error code = D -> No name agreed for rotary axis 2
5. Error code = E -> Rotary axis vector 2 equals zero

---

**61426 [Channel %1: ] Block %2: Sum of the active offsets does not equal zero -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Causes of error:  
Check the overview of active offsets (\$P\_ACTFRAME)  
1. Error code = A -> Sum of the translatory offsets of the geometry axes <> 0  
2. Error code = B -> Sum of the fine offsets of the geometry axes <> 0  
3. Error code = C -> Sum of the rotary components of the geometry axes <> 0  
4. Error code = D -> Sum of the translatory offsets of rotary axis 1 <> 0  
5. Error code = E -> Sum of the translatory offsets of rotary axis 2 <> 0

---

**61427 [Channel %1: ] Block %2: Tool data of the active workpiece probe incorrect or inactive --> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Causes of error:  
1. Error code = A -> Workpiece probe (or tool edge) inactive  
2. Error code = B -> Length L1 of the workpiece probe = 0

---

**61428 [Channel %1: ] Block %2: Error while creating log file -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Causes of error:  
1. Error code = A -> Number of log files in the current directory > 99  
2. Error code = B -> Log files too long. Rename or delete log files,  
check MD11420 \$MN\_LEN\_PROTOCOL\_FILE.

---

**61429 [Channel %1: ] Block %2: Measuring axis (rotary axis 1 or 2) not in basic or intended position -> Error code: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Causes of error:  
1. Error code = A -> Rotary axis 1 not in basic position on 1st measurement  
2. Error code = B -> Rotary axis 2 not in basic position on 1st measurement  
3. Error code = C -> Rotary axis 2 not in intended position on 2nd or 3rd measurement in comparison to 1st measurement, see parameters \_OVR[63 to 65]  
4. Error code = D -> Rotary axis 1 not in intended position on 2nd or 3rd measurement in comparison to 1st measurement, see parameters \_OVR[60 to 62]

---

<b>61430</b>	<b>[Channel %1: ] Block %2: Kinematic vectors not computed -&gt; Error code: %4</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	Causes of error: 1. Error code = A -> Plausibility of the input points PM1, PM2, PM3 not fulfilled, resulting side lengths must not be equal to zero (Notice: even in the case of side lengths not equal to zero, there is a risk of not being able to form a triangle, check => check PM1...3.) 2. Error code = B -> Enclosed angle at PM1 between the spread vectors PM1PM2 and PM1PM3 is equal to zero 0. Starting points do not form a triangle. 3. Error code = C -> Enclosed angle at PM2 between the spread vectors PM2PM1 and PM2PM3 is equal to 0. Starting points do not form a triangle. 4. Error code = D -> Enclosed angle at PM3 between the spread vectors PM3PM1 and PM3PM2 is equal to 0. Starting points do not form a triangle. 5. Error code = E -> Normalizing interpolation point: Invalid axis name defined for computation 6. Error code = F -> Normalizing interpolation point: Invalid plane defined for computation

---

<b>61440</b>	<b>[Channel %1: ] Block %2: Position of cutting edge cannot be determined</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	A turning tool with a cutting edge position between 1 and 8 must be used as the tool type. Check the entered cutting edge position with reference to the basic position of the tool carrier.

---

<b>61441</b>	<b>[Channel %1: ] Block %2: Position of cutting edge is not in the machining plane.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	The position of the cutting edge of the turning tool (cutting tip) is no longer in the machining plane (interpolation plane), this can be caused, for example, by a tool carrier with orientation capability. Correct the tool carrier position.

---

<b>61442</b>	<b>[Channel %1: ] Block %2: Tool carrier not parallel to the geometry axes</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	As a result of incorrect positioning of the orientable tool carrier, tool lengths L1,2,3 are not parallel to the geometry axes. Optimize the axes of the tool carrier.

---

<b>61443</b>	<b>[Channel %1: ] Block %2: Advance angle %4 or greater/less than +/-90° or +/-120°</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	

**Remedy:**

- For 840D sl - up to SW 2.6 SP1 and for 828D - up to SW 4.3:
  - Check the value in the parameter advance angle \_INCA!
  - If 3-point measurement is selected, \_INCA must not be greater/less than +/-120°, and with 4-point measurement \_INCA must not be greater/less than +/-90°.
  - The advance angle \_INCA must always be parameterized unequal to "zero".
- For 840D sl - aa from SW 2.7 and for 828D - as from SW 4.4:
  - Check the value in the parameter advance angle alpha 1!
  - If 3-point measurement is selected, alpha 1 must not be greater/less than +/-120° and with 4-point measurement, alpha 1 must not be greater/less than +/-90°!
  - The advance angle alpha 1 must always be parameterized unequal to "zero".

---

**61444 [Channel %1: ] Block %2: Current measuring speed is not identical to the calibration speed**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

1. Repeat the calibration on the basis of the desired measuring speed.
2. Match the current measuring speed to the calibration speed.

Note: In each case, the relevant calibration speed is stored in each calibration data record.

---

**61445 [Channel %1: ] Block %2: Check holder angle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check the entry for the holder angle in the tool offset.  
For cutting edge positions 1-4, the holder angle must be greater than or equal to 90° and less than 180°, for cutting edge positions 5-8, it must be greater than 0° and less than 90°.

---

**61446 [Channel %1: ] Block %2: Check insert angle and clearance angle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check the entry for the insert angle / clearance angle in the tool offset!

---

**61501 [Channel %1: ] Block %2: Simulation is active**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Reset simulation  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61502 [Channel %1: ] Block %2: No tool offset active**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** A tool number must be programmed

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61503 [Channel %1: ] Block %2: tool nose radius compensation left or right**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** A tool offset value has to be programmed

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61504 [Channel %1: ] Block %2: \_KNG incorrect for setup**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61505 [Channel %1: ] Block %2: retraction path < 1mm**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Increase retraction path

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61506 [Channel %1: ] Block %2: infeed path < 1mm**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Increase infeed path

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61507 [Channel %1: ] Block %2: safety clearance < 1mm**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61508 [Channel %1: ] Block %2: Incorrect default setting for shoulder position**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61509 [Channel %1: ] Block %2: Incorrect default setting for dresser position**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61510 [Channel %1: ] Block %2: Test run feed is active**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Switch off test run feed

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61511 [Channel %1: ] Block %2: Incorrect shoulder position or tool edge D1/D2**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61512 [Channel %1: ] Block %2: Incorrect longitudinal position**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61513 [Channel %1: ] Block %2: Dresser left and inclined grinding wheel**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61514 [Channel %1: ] Block %2: Grinding wheel type missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61515 [Channel %1: ] Block %2: Retraction path <= dressing amount**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Change retraction path

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61517 [Channel %1: ] Block %2: Angle of inclined grinding wheel missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Enter angle under \$TC\_TPG8

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61518 [Channel %1: ] Block %2: Shoulder height of grinding wheel must be > grinding wheel radius**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Change shoulder height or grinding wheel radius

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61519 %[[Channel %1: ] Block %2: %]Incorrect type of machining**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Assign a value between 1 and 3 to parameter B\_ART

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61520 [Channel %1: ] Block %2: Additional offsets not set**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Set MD18094 MM\_NUM\_CC\_TDA\_PARAM=10

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61521 [Channel %1: ] Block %2: Current grinding wheel too wide**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Reduce width of grinding wheel

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61522 [Channel %1: ] Block %2: Overlap >= current grinding wheel width**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Reduce overlap

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---



---

**61523 [Channel %1: ] Block %2: Zero signal of calipers missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check calipers signal

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61524 [Channel %1: ] Block %2: Incorrect oblique angle**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Oblique plunge angles must be  $>-90^\circ$  and  $<90^\circ$

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61525 [Channel %1: ] Block %2: Incorrect grinding wheel type**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Change grinding wheel type \$TC\_TPC1

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61526 [Channel %1: ] Block %2: Workpiece radius = 0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Enter workpiece radius  $> 0$

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61527 [Channel %1: ] Block %2: Grinding wheel radius  $\geq$  workpiece radius**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Change grinding wheel radius or workpiece radius

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61529**                    **[Channel %1: ] Block %2: Dimensional notation INCH programmed**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Basic system MD \$MN\_SCALING\_SYSTEM\_IS\_METRIC does not correspond to programmed G command (G group 13).

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61530**                    **[Channel %1: ] Block %2: Default longitudinal position incorrect**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Check longitudinal position parameter

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61531**                    **[Channel %1: ] Block %2: Longitudinal position not registered in Z**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Increase infeed path parameter

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61532**                    **[Channel %1: ] Block %2: Value for \_LAGE is incorrect**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Correct parameter content for \_LAGE

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61533**                    **[Channel %1: ] Block %2: No length L1 entered under D...**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label channel number

**Definitions:**

**Remedy:**                 Enter length L1 in the tool offset D of the grinding wheel

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61540 [Channel %1: ] Block %2: Incorrect D number / dresser D field active**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** A tool D number must be programmed that is < \_GC\_DNUM

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61541 [Channel %1: ] Block %2: Incorrect grinding wheel type entered**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Select a valid grinding wheel type in tool management

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61542 [Channel %1: ] Block %2: Incorrect grinding wheel reference point selected when selecting the dresser coordinate system**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** A tool D number must be programmed that is < \_GC\_DNUM

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61543 [Channel %1: ] Block %2: Incorrect dresser selected when selecting the dresser coordinate system**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** A dresser number >0 and <4 must be selected

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61544 [Channel %1: ] Block %2: Grinding wheel diameter worn down**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** New grinding wheel required, or check limit values in the grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61545 [Channel %1: ] Block %2: Width of grinding wheel worn down**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** New grinding wheel required, or check limit values in the grinding wheel data

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61546 [Channel %1: ] Block %2: Dresser %4, wear limit length 1 reached**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** New dresser required, or check limit values of dresser

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61547 [Channel %1: ] Block %2: Dresser %4, wear limit length 2 reached**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** New dresser required, or check limit values of dresser

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61548 [Channel %1: ] Block %2: Dresser %4, wear limit length 3 reached**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** New dresser required, or check limit values of dresser

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61549 [Channel %1: ] Block %2: Incorrect dresser type selected**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check dresser type on input

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61555 [Channel %1: ] Block %2: Diameter of grinding wheel ==0, GWPS cannot be calculated**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check diameter

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61556 [Channel %1: ] Block %2: Impossible chamfer and radius of left edge of wheel**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61557 [Channel %1: ] Block %2: Impossible chamfer and radius of right edge of wheel**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61558 [Channel %1: ] Block %2: Chamfer / radius + shoulder height are less than the retraction height of the left edge of the grinding wheel**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61559 [Channel %1: ] Block %2: Chamfer / radius + shoulder height are less than the retraction height of the right edge of the grinding wheel**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61560 [Channel %1: ] Block %2: Infeed in Z direction too big per stroke, or wheel too narrow**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Reduce infeed path parameter or use other tool

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61561 [Channel %1: ] Block %2: Feed left wheel edge <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61562 [Channel %1: ] Block %2: Feed right wheel edge <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61563 [Channel %1: ] Block %2: Feed on the diameter <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61564 %[[Channel %1: ] Block %2: %]Feed insertion <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61565 [Channel %1: ] Block %2: Feed dressing <=0**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check values in grinding wheel data

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61601 [Channel %1: ] Block %2: Finished part diameter too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check parameter SPD or DIATH.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61602 [Channel %1: ] Block %2: Tool width incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Plunge cutter is larger than the programmed groove width.

**Remedy:** Check tool or change program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61603 [Channel %1: ] Block %2: Recess type incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Radii/chamfers at the groove base do not match the groove width. Face groove on a contour element running parallel to the longitudinal axis is not possible.

**Remedy:** Check parameter VARI.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61604 [Channel %1: ] Block %2: Active tool violates programmed contour**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Contour violation in the relief cut elements due to the tool clearance angle of the tool used.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Use a different tool or check the contour subroutine.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61605 [Channel %1: ] Block %2: Contour incorrectly programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Illegal relief cut element detected.

**Remedy:** Check contour program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61606 [Channel %1: ] Block %2: Error during contour preparation**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** An error has been found on conditioning the contour. This alarm is always related to one of NCK alarms 10930...10934, 15800 or 15810.

**Remedy:** Check contour subroutine.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61607 [Channel %1: ] Block %2: Starting point incorrectly programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The starting point reached before the cycle call does not lie outside the rectangle described by the contour subroutine.

**Remedy:** Check starting point prior to cycle call.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61608 [Channel %1: ] Block %2: Incorrect tool point direction programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** A cutting edge position 1...4, matching the undercut form, must be programmed.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61609 [Channel %1: ] Block %2: Shape incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check parameter for the undercut form or groove form or pocket.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**



---

**61610 [Channel %1: ] Block %2: No infeed depth programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check parameter MID.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61611 [Channel %1: ] Block %2: No point of intersection found**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No intersection could be calculated with the contour.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check contour programming or modify infeed depth.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61612 [Channel %1: ] Block %2: Thread finishing not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check the conditions for thread finishing.

---

**61613 [Channel %1: ] Block %2: Undercut position incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check value in parameter \_VARI.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61614 [Channel %1: ] Block %2: %4 Z mirroring in WO for main spindle not permitted**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** WO for main spindle machining must not have Z mirroring.  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Deselect Z mirroring in the WO used.  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61700**      %[[Channel %1: ] Block %2: %]Name of program to be generated is missing

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:**  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** - Check parameter PRG  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61701**      %[[Channel %1: ] Block %2: %]Contour %4 does not exist

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:**  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** - Check parameter CON  
- Check contour call  
- Check whether the contours exist in the program storage (workpieces, subroutines or part programs)  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61702**      %[[Channel %1: ] Block %2: %]Label %4 not existing in machined part contour

**Parameters:** %1 = Channel number  
%2 = Block number, label  
**Definitions:**  
**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** - Check whether the labels exist in the machined part contour  
**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61703**            %[[Channel %1: ] Block %2: %]Label %4 not existing in the blank contour

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check whether the labels exist in the blank contour  
**Program**             Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61704**            %[[Channel %1: ] Block %2: %]Machined part contour missing

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check contour call  
**Program**             Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61705**            %[[Channel %1: ] Block %2: %]Blank contour missing

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check contour call  
**Program**             Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61706**            %[[Channel %1: ] Block %2: %]Error in machined part contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check programming of machined part contour  
**Program**             Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

---

**61707                    %[[Channel %1: ] Block %2: %]Error in the blank contour %4**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check programming of the blank contour

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61708                    %[[Channel %1: ] Block %2: %]Too many contours specified**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check number of contours  
                              - Max. two contours (machined part and blank contours)  
                              - Min. one contour (machined part contour)

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61709                    %[[Channel %1: ] Block %2: %]Cutting edge radius too small**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check cutting edge radius of the tool in tool management

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61710                    %[[Channel %1: ] Block %2: %]Calculation has been cancelled**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Calculation has been cancelled by PI service; please try again

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**61711**                    %[[Channel %1: ] Block %2: %]Infeed D is larger than the tip width of the tool

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Check infeed D in connection with the tip width of the tool in tool management.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**61712**                    %[[Channel %1: ] Block %2: %]Infeed DX or DZ is larger than tip length of tool

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Check infeed DX or DZ in connection with tip length of the tool in tool management.

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**61713**                    %[[Channel %1: ] Block %2: %]Tool radius larger than half the tip width

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Check tool radius and tip width of tool (plunge cutter, cutting tool)

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**61714**                    %[[Channel %1: ] Block %2: %]System error contour turning %4

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:** Call the SIEMENS hotline  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61730**            **%[[Channel %1: ] Block %2: %]Machining range outside delimitation**

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:**        Interpreter stop  
                  NC Start disable in this channel.  
                  Interface signals are set.  
                  Alarm display.

**Remedy:**            - Check machining range and delimitation

**Program**            Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61731**            **%[[Channel %1: ] Block %2: %]Unable to determine contour direction**

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:**        Interpreter stop  
                  NC Start disable in this channel.  
                  Interface signals are set.  
                  Alarm display.

**Remedy:**            - Check contours  
                  - Check whether the contour starting point exists

**Program**            Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61732**            **%[[Channel %1: ] Block %2: %]No material available for machining**

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:**        Interpreter stop  
                  NC Start disable in this channel.  
                  Interface signals are set.  
                  Alarm display.

**Remedy:**            - Check programming of the blank and machined part contour, particularly their position towards each other

**Program**            Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61733**            **%[[channel %1: ] block %2: %]cutting edge not compatible with machining direction**

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check programmed machining direction in connection with cutting edge position of the tool

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

**61734**                    %[[Channel %1: ] Block %2: %]Machined part contour is outside the blank contour

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check programming of the machined part and blank contour, particularly their position towards each other

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

**61735**                    %[[Channel %1: ] Block %2: %]Infeed D larger than the tip length of the tool

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** - Check infeed D in relation to the tip length of the tool in tool management

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

**61736**                    %[[Channel %1: ] Block %2: %]Cutting depth greater than maximum depth of cut of the tool

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61737            %[[Channel %1: ] Block %2: %]Cutting depth smaller than minimum depth of cut of the tool**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              --

**Program**                Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61738            %[[Channel %1: ] Block %2: %]Incorrect cutting edge position**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Check cutting edge position in tool management

**Program**                Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61739            %[[Channel %1: ] Block %2: %]Blank must be closed contour**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Check whether the blank contour is closed

**Program**                Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61740            %[[Channel %1: ] Block %2: %]Collision through approach**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Select the starting position to enable collision-free approach of the contour



**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61741**                    %[[Channel %1: ] Block %2: %]Axis in negative range

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Check the position of the axis in the ordinate

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61742**                    %[[Channel %1: ] Block %2: %]Retraction plane %4 is within the machining range

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - On internal machining check machining range in relation to the entered retraction distance (\$SCS\_TURN\_ROUGH\_I\_RELEASE\_DIST)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61743**                    %[[channel %1: ] block %2: %]guide channel for two-channel cutting missing

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                               NC Start disable in this channel.  
                               Interface signals are set.  
                               Alarm display.

**Remedy:**                 - Check if a guide channel has been defined

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61744**                    %[[channel %1: ] block %2: %]guide channel für two-channel cutting missing

**Parameters:**            %1 = Channel number  
                               %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check if a following channel has been defined

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61745**            **%[[channel %1: ] block %2: %]two-channel cutting in two guide channels (%4) active**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check if two guide channels are active  
- Check if two-channel cutting is active simultaneously in more than two channels  
- Two channels only may be active: a guide and a following channel

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61746**            **%[[channel %1: ] block %2: %]two-channel cutting active already in the channels (%4)**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check if two-channel cutting is active simultaneously in more than two channels.  
- Two channels only may be active simultaneously: a guide and a following channel.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61747**            **%[[channel %1: ] block %2: %]incorrect guide channel for two-channel cutting (%4)**

**Parameters:** %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check if the program of the guide channel runs in the channel selected via the program of the following channel in parameter partner channel.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61748**      **%[[channel %1: ] block %2: %]machining plane different in guide and following channel**

**Parameters:**      %1 = Channel number  
                     %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                     NC Start disable in this channel.  
                     Interface signals are set.  
                     Alarm display.

**Remedy:**             - Machining plane must be the same in guide and following channel.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61749**      **%[[channel %1: ] block %2: %]technology different in guide and following channel**

**Parameters:**      %1 = Channel number  
                     %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                     NC Start disable in this channel.  
                     Interface signals are set.  
                     Alarm display.

**Remedy:**             - Technology (cutting / residual, plunge-cutting / residual, plunge-turning / residual) must be the same in guide and following channel.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61750**      **%[[channel %1: ] block %2: %]machining different in guide and following channel**

**Parameters:**      %1 = Channel number  
                     %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                     NC Start disable in this channel.  
                     Interface signals are set.  
                     Alarm display.

**Remedy:**             - Machining (rough cutting / finish cutting) must be different in guide and following channel.

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61751**      **%[[channel %1: ] block %2: %]measuring system must be different in guide and following channel**

**Parameters:**      %1 = Channel number  
                     %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                     NC Start disable in this channel.  
                     Interface signals are set.  
                     Alarm display.

**Remedy:** - Measuring system (G group: 13 (G70, G71, G700, G710)) must be the same in guide and following channel.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61752**      **%[[Channel %1: ] Block %2: %]Cutting edge positions or cutting directions of the tools are different**

**Parameters:**      %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**            - Cutting edge position and cutting direction of the tools must be the same in guide and following channel.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61753**      **%[[channel %1: ] block %2: %]difference in tool radii too large**

**Parameters:**      %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**            - Tool radii may not be greater than the finishing allowance at maximum for rough cutting.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61754**      **%[[channel %1: ] block %2: %]tool radii must have same size for rough cutting**

**Parameters:**      %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**            - Check if tool radii have the same size in guide and following channel.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**61755**      **%[[channel %1: ] block %2: %]plate widths are different**

**Parameters:**      %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check if plate widths of recessing tools are the same size in guide and following channel.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61800 [Channel %1: ] Block %2: Ext. CNC system missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Machine data for external language MD18800: \$MN\_MM\_EXTERN\_LANGUAGE or option bit 19800 \$ON\_EXTERN\_LANGUAGE is not set.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61801 [Channel %1: ] Block %2: Wrong G code selected**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the program call CYCLE300<value> an impermissible numerical value was programmed for the entered CNC System, or in the Cycles Setting Datum an incorrect value for the G Code System was set.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61802 [Channel %1: ] Block %2: Wrong axis type**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed axis is assigned to a spindle

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61803 [Channel %1: ] Block %2: Programmed axis not available**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed axis is not in the system.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameter \_AXN.  
Check MD20050-20080.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61804 [Channel %1: ] Block %2: Progr. position exceeds reference point**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed intermediate position or actual position is behind the reference point.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61805 [Channel %1: ] Block %2: Value programmed absolute and incremental**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed intermediate position is both absolutely as well as incrementally programmed.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61806 [Channel %1: ] Block %2: Wrong axis assignment**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The axis-assignment sequence is wrong.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

**61807 [Channel %1: ] Block %2: Wrong spindle direction programmed (active)**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The programmed spindle direction contradicts the spindle direction planned for the cycle.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check parameters SDR and SDAC.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61808 [Channel %1: ] Block %2: Final drilling depth or single drilling depth missing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The total depth Z or individual drilling depth Q is missing from the G8xblock (initial cycle call).

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61809 [Channel %1: ] Block %2: Drill position not permissible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** --

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61810 [Channel %1: ] Block %2: ISO G code not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** In the call block an impermissible ISO axis name was programmed.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61811**                    **[Channel %1: ] Block %2: ISO axis name illegal**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            In the call block an impermissible numerical value was programmed.

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                    --

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61812**                    **[Channel %1: ] Block %2: Value(s) in external cycle call wrongly defined**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            In the call block an impermissible numerical value was programmed.

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                    --

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61813**                    **[Channel %1: ] Block %2: GUD value wrongly defined**

**Definitions:**            An impermissible numerical value was entered in the cycles-setting data.

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                    --

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61814**                    **[Channel %1: ] Block %2: Polar coordinates not possible with cycle**

**Parameters:**            %1 = Channel number  
                              %2 = Block number, label

**Definitions:**            --

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                    --

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**



---

**61815 [Channel %1: ] Block %2: G40 not active**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** G40 was inactive before the cycle call.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61816 [Channel %1: ] Block %2: Axes not on reference point**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** --

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61817 [Channel %1: ] Block %2: Axis coordinates within protection zone**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** --

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61818 [Channel %1: ] Block %2: Axis range limits are equal**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** --

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** --

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61850 [channel %1: ] block %2: cylinder surface transformation not released**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Cylinder surface transformation not released for ShopMill.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61851 [channel %1: ] block %2: no suitable transformation set up: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The required transformation is not set up on this machine.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61852 [channel %1: ] block %2: transformation not set up for this plane: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Transformation not set up for the plane used. Change plane.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61853 [channel %1: ] block %2: incorrect plane for machining with rotary axis: %4**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Machining cannot be executed on the rotary axis of the current plane. Change plane.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

---

<b>61854</b>	<b>[Channel %1: ] Block %2: Subprogram level too low for block search</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	The subprogram level is too low for block search.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Execute block search with another block.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61900</b>	<b>%[[Channel %1: ] Block %2: %]Name of program to be generated is missing</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Check parameter PRG
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61901</b>	<b>%[[Channel %1: ] Block %2: %]Contour %4 does not exist</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Check contour call - Check whether the contours exist in the program storage (workpieces, subroutines or part programs)
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>61902</b>	<b>%[[Channel %1: ] Block %2: %]Label %4 not existing in the pocket contour</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	- Check whether the labels exist in the pocket contour
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

**61903                    %[[Channel %1: ] Block %2: %]Label %4 not existing in the blank contour**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check whether the labels exist in the blank contour

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61904                    %[[Channel %1: ] Block %2: %]Label %4 not existing in the island contour**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check whether the labels exist in the island contour

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61905                    %[[Channel %1: ] Block %2: %]Label %4 not existing in the spigot contour**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check whether the labels exist in the spigot contour

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61906                    %[[Channel %1: ] Block %2: %]Label %4 not existing in the contour**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                              NC Start disable in this channel.  
                              Interface signals are set.  
                              Alarm display.

**Remedy:**                 - Check whether the labels exist in the contour

**Program**                 Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61907**            %[[Channel %1: ] Block %2: %]Pocket contour missing

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check contour call

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61908**            %[[Channel %1: ] Block %2: %]Blank contour missing

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check contour call

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61909**            %[[Channel %1: ] Block %2: %]Error in pocket contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check programming of the pocket contour

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61910**            %[[Channel %1: ] Block %2: %]Error in the blank contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check programming of the blank contour

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61911**            %[[Channel %1: ] Block %2: %]Error in island contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Check programming of the island contour

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61912**            %[[Channel %1: ] Block %2: %]Error in spigot contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Check programming of the spigot contour

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61913**            %[[Channel %1: ] Block %2: %]Error in contour %4

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Check programming of the contour

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61914**            %[[Channel %1: ] Block %2: %]Too many contours specified

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Check the number of contours

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61915**            **%[[Channel %1: ] Block %2: %]Cutter radius too small**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             - Check the radius of the milling cutter in tool management

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61916**            **%[[Channel %1: ] Block %2: %]Calculation has been cancelled**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             - Calculation has been cancelled by PI service; please try again

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61917**            **%[[Channel %1: ] Block %2: %]Combination of centering/predrilling and spigot not allowed**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             - Machining of spigot in conjunction with predrilling/centering not allowed!

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61918**            **%[[Channel %1: ] Block %2: %]Cut. radius for residual mach. must be smaller than cut. radius for ref. tool**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**             - Check cutter radius for residual machining which must be smaller than cutter radius for reference tool !

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61919**                    **%[[Channel %1: ] block %2: %]Radius of the reference tool is too small**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**                 - Check the radius of the reference tool.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61920**                    **%[[Channel %1: ] block %2: %]System error contour milling %4**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**                 Call the SIEMENS hotline

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61930**                    **%[[Channel %1: ] Block %2: %]No contour available**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**                Interpreter stop  
                         NC Start disable in this channel.  
                         Interface signals are set.  
                         Alarm display.

**Remedy:**                 - Check contour call  
                         - Check whether the contours exist in the program storage (workpieces, subroutines or part programs)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**61931**                    **%[[Channel %1: ] Block %2: %]Contour not closed**

**Parameters:**            %1 = Channel number  
                         %2 = Block number, label



**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check whether the contours are closed

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61932 %[[Channel %1: ] Block %2: %]Selfcutting contour**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Modify contour programming

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61933 %[[Channel %1: ] Block %2: %]Too many contour elements**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Modify contour programming and thereby try to reduce the number of contour elements

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61934 %[[Channel %1: ] Block %2: %]Programming of the machining plane not allowed here**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Modify contour programming

**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**61935            %[[Channel %1: ] Block %2: %]Programming of inch/metric measuring system not allowed here**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Modify contour programming

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61936            %[[Channel %1: ] Block %2: %]G0 is not allowed in contour programming**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Modify contour programming, replace G0 by G1

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61937            %[[Channel %1: ] Block %2: %]Pocket depth programmed incorrectly**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Check parameter Z1

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61938            %[[Channel %1: ] Block %2: %]No starting point specified**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:** - Check parameter for specified starting point,  
 - for G17: XS, YS  
 - for G18: ZS, XS  
 - for G19: YS, ZS

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61939**            %[[Channel %1: ] Block %2: %]No center point specified for circle

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Check contour programming, particularly circular-path programming

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61940**            %[[Channel %1: ] Block %2: %]Specified starting point programmed incorrectly

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Correct specified starting point

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61941**            %[[Channel %1: ] Block %2: %]Helix radius too small

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**              - Increase helix radius

**Program Continuation:** Clear alarm with the RESET key. Restart part program

**61942**            %[[Channel %1: ] Block %2: %]Helix violates contour

**Parameters:**        %1 = Channel number  
                          %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check helix radius and reduce in size, if possible

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61943**            %[[Channel %1: ] Block %2: %]Approach/retract motion violates contour

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Reduce safety clearance SC, if possible

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61944**            %[[Channel %1: ] Block %2: %]Ramp path too short

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check insertion angle, possibly use different insertion mode  
- Use tool with smaller radius

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61945**            %[[Channel %1: ] Block %2: %]Plane infeed too large, residual corners remaining

**Parameters:**    %1 = Channel number  
                  %2 = Block number, label

**Definitions:**

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check parameter for plane infeed  
          - for G17: DXY  
          - for G18: DZX  
          - for G19: DYZ

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**61946**            %[[Channel %1: ] Block %2: %]Island contour existing twice

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Delete double island contour

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61947**            %[[Channel %1: ] Block %2: %]Spigot contour existing twice

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Delete double spigot contour

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61948**            %[[Channel %1: ] Block %2: %]No material available for machining

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check programming of the contours

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61949**            %[[Channel %1: ] Block %2: %]Island is outside the pocket

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                      NC Start disable in this channel.  
                      Interface signals are set.  
                      Alarm display.

**Remedy:**             - Check programming of the island/pocket contour

**Program**             Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61950            %[[Channel %1: ] Block %2: %]No residual material available**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             --

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61951            %[[Channel %1: ] Block %2: %]Cutter radius for residual material too large**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Use cutter with smaller radius

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**61952            %[[Channel %1: ] Block %2: %]Radius of res. material cutter too small in relation to ref. cutter**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**

**Reaction:**            Interpreter stop  
                          NC Start disable in this channel.  
                          Interface signals are set.  
                          Alarm display.

**Remedy:**             - Use a cutter with a larger radius for residual machining

**Program**              Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**62000            [Channel %1: ] Block %2: Insert new tool**

**Parameters:**        %1 = Channel number  
                      %2 = Block number, label

**Definitions:**        Please load new tool.

**Remedy:**             --

**Program**              Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62100 [Channel %1: ] Block %2: No drilling cycle active**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No modal drilling cycle has been called before the drilling pattern cycle call.

**Remedy:** Check whether a drilling cycle was called prior to calling the drilling pattern cycle.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62101 [Channel %1: ] Block %2: Milling direction incorrect - G3 is generated**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Synchronous or reverse rotation programmed. But the spindle does not rotate at a cycle call.

**Remedy:** Check value in paramter CDIR.

---

**62102 [Channel %1: ] Block %2: pocket not completely solidly machined during finishing**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62103 [Channel %1: ] Block %2: No finishing allowance programmed**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** No finishing allowance is programmed, although it is necessary for this machining.

**Reaction:** Alarm display.

**Remedy:** Programm a finishing allowance.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62104 [Channel %1: ] Block %2: Drilling cycle incorrectly defined**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62105 [Channel %1: ] Block %2: Number of columns or lines equals zero**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Remedy:** Check parameters \_NUM1 and \_NUM2.

---

**62106 [Channel %1: ] Block %2: incorrect value for monitoring status in tool monitoring**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62107 [Channel %1: ] Block %2: parameter %4 incorrectly defined for tool monitoring in cycles**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62108 [Channel %1: ] Block %2: error in function Tool monitoring in cycles**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:**

**Reaction:** Alarm display.

**Remedy:**

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62180 [Channel %1: ] Block %2: Set rotary axes %4 [deg]**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Sample display of the swivel angle to be set for a manual rotary axis in CYCLE800:  
62180 "Set rotary axis B: 32.5 [grd]"

**Remedy:** Settable angles for manual rotary axes.



---

**62181**                    **[Channel %1: ] Block %2: Set rotary axis %4 [deg]**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**        Sample display of the swivel angle to be set for a manual rotary axis in CYCLE800:  
                         62181 "Set rotary axis B: 32.5 [grd]"

**Remedy:**                Settable angle for manual rotary axis.

---

**62182**                    **[Channel %1: ] Block %2 : load swivel head: %4**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**             Alarm display.

**Remedy:**               Request to load a swivel head.

**Program**                Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62183**                    **[Channel %1: ] Block %2 : unload swivel head: %4**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**             Alarm display.

**Remedy:**               --

**Program**                Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62184**                    **[Channel %1: ] Block %2 : replace swivel head: %4**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**

**Reaction:**             Alarm display.

**Remedy:**               --

**Program**                Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62185**                    **[Channel %1: ] Block %2 : angle adapted to angle grid: %4**

**Parameters:**        %1 = Channel number  
                         %2 = Block number, label

**Definitions:**        %4 difference angle with Hirth tooth system

**Remedy:**                Check setup of swivel CYCLE800.

---

---

**62186 [Channel %1: ] Block %2: No swiveling in JOG -> WO G%4 active and total basic WO (G500) contain rotations**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** On swiveling in JOG no rotation can be written to the work offset WO, if rotations are already contained in the total basic WO or in the basic reference  
Error 62186 message can be masked -> see setting data 55410 \$SCS\_MILL\_SWIVEL\_ALARM\_MASK

**Remedy:** %4 number of the active work offset WO.

---

**62187 [Channel %1: ] Block %2: Swiveling in JOG --> G500 active and total basic WO or basic reference contain rotations**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** During swiveling in JOG, it is not possible to write a rotation into the work offset WO, if, with active G500, rotations are already contained in the total basic WO or in the basic reference  
Error message 62187 can be masked -> see setting data 55410 \$SCS\_MILL\_SWIVEL\_ALARM\_MASK

**Remedy:** See notes for 62186 and 62187.

---

**62200 [Channel %1: ] Block %2: Start spindle**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** Stop prior to thread machining, as the spindle is in stop position.

**Remedy:** Start the tool spindle before machining the thread.

---

**62201 [Channel %1: ] Block %2: Z offset does not influence the retraction planes.**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** The retraction planes refer to the workpiece. Therefore, programmable offsets do not influence the retraction planes.

**Remedy:** Check that offset does not cause collision.  
Then press NC Start.

---

**62202 [Channel %1: ] Block %2: NOTICE: tool travels directly to machining!**

**Parameters:** %1 = Channel number  
%2 = Block number, label

**Definitions:** After block search a position is to be reached by direct approach.

**Remedy:** Check whether the desired position can be reached without collision.  
Then execute an NC start.

---

**62300 [Channel %1: ] Block %2: Check number of empirical value memory**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

---

**Definitions:** --  
**Reaction:** Alarm display.  
**Remedy:** Check setpoint value  
**Program** Clear alarm with the Delete key or NC START.  
**Continuation:**

---

---

**62301 [Channel %1: ] Block %2: Notice! Search run, test run or simulation active**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** - Deactivate program test or test run

---

---

**62303 [Channel %1: ] Block %2: Safety margin exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** - Check setpoint value and parameter \_TSA

---

---

**62304 [Channel %1: ] Block %2: Allowance**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Reaction:** Alarm display.

**Remedy:** The difference between actual and setpoint value is larger than upper tolerance limit (parameter \_TUL).

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

---

**62305 [Channel %1: ] Block %2: Dimension too small**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The difference between actual and setpoint value is smaller than lower tolerance limit (parameter \_TLL).

---

---

**62306 [Channel %1: ] Block %2: Permissible measuring difference exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** The difference between actual and setpoint value is larger than tolerance parameter \_TDIF, tool data are not corrected.

---

---

**62307 [Channel %1: ] Block %2: Maximum number of characters per line exceeded.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Insufficient number of characters per line.

**Remedy:** Increase the value in \_PROTFORM[1]

---

**62308 [Channel %1: ] Block %2: Variable column width not possible**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Unable to generate variable column widths, as no header available.  
A fixed column width of 12 characters is used.

**Reaction:** Alarm display.

**Remedy:** Complete the header in \_PROTVAL[0].

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62309 [Channel %1: ] Block %2: Insufficient column width**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The value to be logged is larger than the column width.

**Reaction:** Alarm display.

**Remedy:** Adjust \_PROTFORM[5] or change the header at variable column width.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**62310 [Channel %1: ] Block %2: The max. number of characters per line is limited to 200 characters per line**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** The maximum number of characters per line has been limited to 200 characters per line.

**Remedy:** --

---

**62311 [Channel %1: ] Block %2: The maximum number of characters per line \_PROTFORM[1] is adjusted.**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:** Max. number of characters per line \_PROTFORM[1] has been adjusted.

**Reaction:** Alarm display.

**Remedy:** --

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

<b>62312</b>	<b>[Channel %1: ] Block %2: probe is not perpendicular to plane!</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	--
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

<b>62313</b>	<b>[Channel %1: ] Block %2: The number of lines per page _PROTFORM[0] is incorrect and is automatically adjusted.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	Check _PROTFORM[0] in the program.

---

<b>62314</b>	<b>[Channel %1: ] Block %2: Traverse path limitation via software end position, collision detection activated, continue with NC START / cancel with RESET.</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	Position the workpiece to be measured further away from the software end positions.

---

<b>62315</b>	<b>[Channel %1: ] Block %2: Overwrite swivel data record TCARR = %4, yes -&gt; NC start, no -&gt; reset</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	

---

<b>62316</b>	<b>[Channel %1: ] Block %2: Overwrite TRAORIdata, yes -&gt; NC start, no -&gt; reset</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	
<b>Remedy:</b>	

---

<b>62317</b>	<b>[Channel %1: ] Block %2: Tolerance of the linear vector %4 exceeded</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label channel number
<b>Definitions:</b>	

Remedy:

---

**62318 [Channel %1: ] Block %2: Tolerance of the rotary axis vector %4 exceeded**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:**

---

**62319 [Channel %1: ] Block %2: No internal correction of the calibration data**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check probe alignment/spindle position!  
The alignment (programmed position) of the tool probe in the workspindle must be identical during calibration and measuring!  
If these positions vary, the calibration data cannot be corrected cycle-internally with regards to a coordinate rotation of the workplane around the infeed axis!

---

**62500 [Channel %1: ] Block %2: GWPS has been limited**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check limit value for GWPS and program a lower value in the NC program if necessary

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62501 [Channel %1: ] Block %2: Speed has been limited**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check limit value for speed and program a lower value in the NC program if necessary

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62502 [Channel %1: ] Block %2: Dresser %4, GWPS has been limited**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check limit value for GWPS and program a lower value in the NC program if necessary

**Program** Clear alarm with the Delete key or NC START.

**Continuation:**

---

**62503 [Channel %1: ] Block %2: Dresser %4, speed has been limited**

**Parameters:** %1 = Channel number  
%2 = Block number, label channel number

**Definitions:**

**Remedy:** Check limit value for speed and program a lower value in the NC program if necessary

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**75000 [Channel %1: ] CLC: incorrect MD configuration, error code: %2**

**Definitions:** On ramp-up the following error was found in the clearance control machine data:  
 Error code = -1: The intermediate points of one of the two sensor characteristics are not rising or falling strictly monotonously.  
 Error code = -2: One of the two sensor characteristics has less than 2 valid intermediate points.  
 Error code = -3: One of the two sensor characteristics has more than 5 intermediate points with negative velocity or more than 5 intermediate points with positive velocity.  
 Error code = -4: The digital input for sensor collision monitoring as set in MD \$MC\_CLC\_SENSOR\_TOUCHED\_INPUT has not been activated on the control ( 10350 \$MN\_FASTIO\_DIG\_NUM\_INPUTS )  
 Error code = -5: No rapid input was assigned to the special function "Fast retraction in the position controller" via MD \$MC\_CLC\_SENSOR\_TOUCHED\_INPUT.  
 Error code = -6: The axis selected for the clearance control in MD \$MC\_CLC\_AXNO is not active in the channel.  
 Error code = -7: The 5-axis transformation ( 24100 \$MC\_TRAFO\_TYPE\_x ) selected for the clearance control in MD \$MC\_CLC\_AXNO is not configured in the channel.  
 Error code = -8: More than one of the axes involved in the clearance control is the master axis of a gantry grouping 37100 \$MA\_GANTRY\_AXIS\_TYPE  
 Error code = -9: One of the axes involved in the clearance control is the slave axis of a gantry grouping 37100 \$MA\_GANTRY\_AXIS\_TYPE  
 Error code = -10: Export versions will only enable activation of an axial clearance control, if less than four simultaneously interpolating axes have been configured.  
 Error code = -11: In MD \$MC\_CLC\_PROG\_ORI\_AX\_MASK, no or three axes exactly may be configured for CLC(3). When three axes are configured, these must be assigned to the channel with \$MC\_AXCONF\_MACHAX\_USED.

**Reaction:** Mode group not ready.  
Channel not ready.  
NC Start disable in this channel.  
Alarm display.

**Remedy:** Modify relevant machine data

**Program Continuation:** Switch control OFF - ON.

---

**75005 [Channel %1: ] CLC: block %2 General programming error**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** The activation / deactivation command for the clearance control "CLC(..)" accepts only the values 3, 2, 1, 0 and -1 as call parameters. This alarm signals that parameters are incorrect or missing. The activation command CLC(2) with monitoring of the sensor collision signal is accepted only if a valid digital input is configured for the monitoring signal in MD \$MC\_CLC\_SENSOR\_TOUCHED\_INPUT.

**Reaction:** Interpreter stop  
Alarm display.

**Remedy:** Modify part program. Configure the digital input for the collision evaluation in MD if necessary.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75010 [Channel %1: ] CLC: block %2 CLC\_LIM value exceeds MD limit**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** One of the limits for the position offset of the clearance control programmed with CLC\_LIM( ..... ) is greater than the permissible limitation set in the associated MD. \$MC\_CLC\_SENSOR\_LOWER\_LIMIT[ 1 ] or \$MC\_CLC\_SENSOR\_UPPER\_LIMIT[ 1 ].

**Reaction:** Interpreter stop  
Alarm display.

**Remedy:** Modify parts program. Extend limitation in appropriate machine data.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75015 [Channel %1: ] CLC: block %2 CLC(0) with active TOC**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** The 3D clearance control has been switched off with CLC(0) while tool radius compensation is still active (G41/G42). Since CLC(0) empties the internal block buffer and accepts the current traversed position offset of the clearance control as a "contour jump" in the interpreter, TRC must be deactivated when this command is issued.

**Reaction:** Interpreter stop  
Alarm display.

**Remedy:** Modify part program: Switch off active G41/G42 before CLC(0) or do not switch of clearance control, but just "freeze" temporarily (CLC\_GAIN=0.0) or cancel the position offset mechanically with CLC(-1).

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75016 [Channel %1: ] CLC: block %2 orientation changed for TRAF00F**

**Parameters:** %1 = Channel number  
%2 = Block number

**Definitions:** 1. The 2D/3D clearance control has been switched off before the transformation. The tool direction according to G17/G18/G19 has been applied as the control direction. Switching on the transformation with rotary axis settings that define a different tool orientation requires an orientation step change and is therefore rejected.  
2. The transformation has been switched off temporarily (TRAF00F) while clearance control is still active. When the transformation is switched on again, the tool orientation must be the same as when it was switched off, i.e. the rotary axes must not be moved while the transformation is deactivated.

**Reaction:** NC Start disable in this channel.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Modify part program: Do not switch on the clearance control until the transformation is already active or make sure that the required conditions relating to orientation are observed.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75018 [Channel %1: ] CLC: block %2 in programmable direction, error ID: %3**

**Parameters:** %1 = Channel number  
%2 = Block number  
%3 = Error ID



---

<b>Definitions:</b>	The subfunction of the 3D clearance control programmed with CLC(3) "Closed-loop control in programmable direction" reports an error: Error ID: 0:CLC(3) was programmed without having set the corresponding option bit or without having entered an axis screen with three validly configured, simulated axes in MD \$MC_CLC_PROG_ORI_AX_MASK. 1:The plane in which the closed-loop control direction is to be re-oriented, has not been defined. Probably, two directions programmed one after the other, are anti-parallel.
<b>Reaction:</b>	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify MD or the part program.
<b>Program</b>	Clear alarm with the RESET key in all channels. Restart part program.
<b>Continuation:</b>	

---

### 75019 [Channel %1: ] CLC: error ID: %2, angle %3

<b>Parameters:</b>	%1 = Channel number %2 = Error ID %3 = Angle
<b>Definitions:</b>	The subfunction of the 3D clearance control programmed with CLC(3) "Closed-loop control in programmable direction" reports an error: Error ID: 1:The clearance control direction has not been defined. Probably, [ 0,0,0 ] has been programmed for the three simulated axes specifying the direction components. In the "angle" parameter, zero is output. 2:The max. permissible angle between the orientation of the blast tool and the programmed control direction was exceeded. The permissible angle is set in machine data \$MC_CLC_PROG_ORI_MAX_ANGLE. The angle triggering the alarm is output in the 3rd alarm parameter.
<b>Reaction:</b>	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Enlarge the monitoring angle or modify the programming in the part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

### 75020 [Channel %1: ] CLC: position offset at lower limit %2

<b>Parameters:</b>	%1 = Channel number %2 = Limit value
<b>Definitions:</b>	The position offset generated by the overlaid motion has reached the limit set in MD \$MC_CLC_SENSOR_LOWER_LIMIT or programmed with CLC_LIM(.....). Depending on the setting in bit 0 of MD \$MC_CLC_SPECIAL_FEATURE_MASK the following cancel criterion applies: Bit 0 = 0: Cancel key Bit 0 = 1: Reset key
<b>Reaction:</b>	NC Start disable in this channel. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Check position and form of the workpiece. If necessary, program further limits.
<b>Program</b>	Clear alarm with the Delete key or NC START.
<b>Continuation:</b>	

**75021**                    **[Channel %1: ] CLC: position offset at upper limit %2**

**Parameters:**            %1 = Channel number  
                               %2 = Limit value

**Definitions:**            The position offset generated by the overlaid motion has reached the limit set in MD \$MC\_CLC\_SENSOR\_UPPER\_LIMIT or programmed with CLC\_LIM(.....). Depending on the setting in bit 1 of MD \$MC\_CLC\_SPECIAL\_FEATURE\_MASK the following cancel criterion is active:  
                               Bit 1 = 0: Cancel key  
                               Bit 1 = 1: Reset

**Reaction:**                NC Start disable in this channel.  
                               Alarm display.  
                               NC Stop on alarm.

**Remedy:**                 Check position and form of the workpiece. If necessary, program further limits.

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

**75025**                    **[Channel %1: ] CLC: stopped because sensor head has been touched**

**Parameters:**            %1 = Channel number

**Definitions:**            The collision monitor of the sensor tip has signaled "Sensor touched". A retraction motion to the upper limit of the position offset (\$MC\_CLC\_SENSOR\_UPPER\_LIMIT ) is started using the max available velocity and acceleration reserves. The feedrate override setting has no effect on this retraction motion. The path motion is stopped at the same time.

**Reaction:**                Alarm display.  
                               NC Stop on alarm.

**Remedy:**                 The part program can be continued with NC start. The overlaid motion then returns to the control distance.

**Program**                    Clear alarm with the Delete key or NC START.

**Continuation:**

---

**75050**                    **[Channel %1: ] MCSC: wrong MD configuration, error code %2**

**Parameters:**            %1 = Channel number  
                               %2 = Error code

**Definitions:**            Incorrect configuration in MD \$MA\_CC\_MASTER\_AXIS  
                               Error code = 2: This axis indicated in the alarm message or the CC\_Master axis is a spindle.  
                               Error code = 4: Coupling between rotary and linear axes impermissible.  
                               Error code = 8: Coupled axes must not be exchanged between channels.

**Reaction:**                Interpreter stop  
                               Alarm display.

**Remedy:**                 Check machine data.

**Program**                    Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**75051**                    **[Channel %1: ] MCSC: CC\_COPON CC\_COPOFF error code %2**

**Parameters:**            %1 = Channel number  
                               %2 = Error code

---

**Definitions:** Error code = 1: Wrong argument programmed  
Error code = 10: An axis for which no coupling has been defined, was programmed in CC\_COPON (axis identifier).  
Error code = 20: Too many arguments programmed.  
Error code = 100: Internal error  
Error code = 200: Internal error

**Reaction:** Interpreter stop  
Alarm display.

**Remedy:** Modify part program.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

### **75060 [Channel %1: ] MCSC: tolerance window exceeded axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The actual position value difference between the CC\_Slave axis indicated in the alarm message and its CC\_Master axis is outside the configured tolerance window.

**Reaction:** NC Start disable in this channel.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Check configured tolerance window.  
Compare dynamic settings of involved axes.  
Check mechanical components of axes.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

### **75061 [Channel %1: ] MCSC: MD modification on active coupling axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** Machine data MD 63000 CC\_MASTER\_AXIS has been changed when the coupling was active.

**Reaction:** Alarm display.  
NC Stop on alarm.

**Remedy:** Reset machine data to its old value, switch off the coupling and then enter the new value.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

### **75062 [Channel %1: ] MCSC: axes to be coupled are not in standstill axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The CC\_Master and/or CC\_Slave axes were not at standstill when the coupling was switched on.

**Reaction:** Alarm display.  
NC Stop on alarm.

**Remedy:** Input G601 for path axes or program a stop preprocessor (STOPRE) before coupling with CC\_COPON.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

---

**75070 [Channel %1: ] MCSC: wrong machine data for collision protection axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** Incorrect machine data for collision protection.

**Reaction:** Interpreter stop  
Alarm display.

**Remedy:** Correct machine data. The axes must be either both rotary axes or both linear axes!

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**75071 [Channel %1: ] MCSC: collision monitoring axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis name

**Definitions:** The collision monitor has responded because the deceleration precomputation has detected that the distance between the axes has fallen below the configured distance.

**Reaction:** Alarm display.  
NC Stop on alarm.

**Remedy:** Traverse the axis out of the danger area in manual mode.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**75090 Axis %1 stopped by external process monitoring system**

**Parameters:** %1 = Axis number

**Definitions:** An external process monitoring system has stopped the axis, as tool breakage is to be expected or has already occurred.

**Reaction:** The NC switches to follow-up mode.  
Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** Change current tool, if required.

**Program** Clear alarm with the RESET key. Restart part program

**Continuation:**

---

**75200 [Channel %1: ] RCTR: incorrect MD configuration, error in MD: %2**

**Parameters:** %1 = Channel number  
%2 = MD name

**Definitions:** The following error was detected in the handling transformation machine data:  
TRAFO6\_IRORO: The orientation entered in MD TRAFO6\_TIRORO\_RPY is impermissible.  
TRAFO6\_TFLWP: The orientation entered in MD TRAFO6\_TFLWP\_RPY is impermissible.  
TRAFO6\_TX3P3: The orientation entered in MD TRAFO6\_TX3P3\_RPY is impermissible.  
TRAFO6\_MAIN\_LENGTH\_AB: The value entered in MD TRAFO6\_MAIN\_LENGTH\_AB is incorrect.

**Reaction:** Channel not ready.  
Alarm display.

**Remedy:** Correct machine data

**Program** Switch control OFF - ON.

**Continuation:**

---

---

**75210 [Channel %1: ] RCTR: number of axes/axis assignment inconsistent**

**Parameters:** %1 = Channel number  
**Definitions:** On transformation selection an incorrect axis assignment is detected:  
The axes entered in MD TRAFO\_AXES\_IN\_1 do not match MD TRAFO6\_NUM\_AXES.  
**Reaction:** Interpreter stop  
Alarm display.  
**Remedy:** Correct machine data.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75212 [Channel %1: ] RCTR: incorrect TRAFO\_TYPE\_ : use 4100**

**Parameters:** %1 = Channel number  
**Definitions:** The transformer type entered in MD TRAFO\_TYPE\_x is incorrect  
**Reaction:** Interpreter stop  
Alarm display.  
**Remedy:** TRAFO\_TYPE 4100 is to be used  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75214 [Channel %1: ] RCTR: MD cannot be changed while transformation active.**

**Parameters:** %1 = Channel number  
**Definitions:** An attempt has been made to modify machine data of an active transformation via NEWCONF.  
This is not permissible, because a change to the machine data directly affects the current axis position, which is transformed from the basic coordinate system into the machine coordinate system in real time. Changing the transformation data during an active transformation would cause the axis positions to jump.  
**Reaction:** Interpreter stop  
Alarm display.  
**Remedy:** Switch off transformation with TRAFOOF before the machine data is taken over by means of NEWCONF.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:** The changed machine data become effective after RESET.

---

**75250 [Channel %1: ] RCTR: tool parameters incorrect interpreter**

**Parameters:** %1 = Channel number  
**Definitions:** On block interpretation incorrect tool parameters are detected:  
**Reaction:** Interpreter stop  
Alarm display.  
**Remedy:** Correct tool parameters.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75255 [Channel %1: ] RCTR: unreachable position interpreter**

**Parameters:** %1 = Channel number

**Definitions:** On block interpretation a non-approachable position is detected:  
**Reaction:** Interpreter stop  
Alarm display.  
**Remedy:** Modify part program.  
**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**75260 [Channel %1: ] RCTR: block: %2, tool parameters incorrect on block editing**

**Parameters:** %1 = Channel number  
%2 = Block number  
**Definitions:** On block editing incorrect tool parameters are detected:  
**Reaction:** Interpreter stop  
Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Correct tool parameters.  
**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**75263 [channel %1: ] RCTR: block: %2, software limit switch axis %3 %4 violated when preparing block**

**Parameters:** %1 = Channel number  
%2 = Block number  
%3 = Axis name  
%4 = Direction  
**Definitions:** When preparing the block it is recognized that the software limit switch of an axis is exceeded.  
**Reaction:** NC Stop on alarm at block end.  
Correction block is reorganized.  
Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Correct the target position.  
**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**75265 [Channel %1: ] RCTR: block: %2, unreachable position on block editing**

**Parameters:** %1 = Channel number  
%2 = Block number  
**Definitions:** On block editing a non-approachable position is detected:  
**Reaction:** Interpreter stop  
Local alarm reaction.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
**Remedy:** Modify part program.  
**Program**  
**Continuation:** Clear alarm with the RESET key. Restart part program

---

**75270 [Channel %1: ] RCTR: tool parameters incorrect on interpolation**

**Parameters:** %1 = Channel number  
**Definitions:** On interpolation incorrect tool parameters are detected:  
**Reaction:** NC Start disable in this channel.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Correct tool parameters.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75273 [Channel %1: ] RCTR: Transformation violates software limit switch of axis %2 %3**

**Parameters:** %1 = Channel number  
%2 = Axis name  
%3 = Direction  
**Definitions:** A violation of the software limit switch of an axis has been detected while traversing with transformation active in JOG mode.  
**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** JOG traverse in opposite direction.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75274 [Channel %1: ] RCTR: Excessive velocity near pole, error code %2 old value %3 new value %4**

**Parameters:** %1 = Channel number  
%2 = Error code  
%3 = Old value  
%4 = New value  
**Definitions:** Excessive velocity of the machine axes involved can occur when traversing near the pole with active transformation, especially in JOG mode. The alarm is triggered if excessive velocity or acceleration occurs for an output axis of the transformation (Machine).  
Error code:  
0: Position jump  
1: Excessive velocity  
2: Excessive acceleration  
Depending on whether a position jump, excessive velocity or excessive acceleration occurs, the old and the new value for position, velocity or acceleration are output as third and fourth parameter.  
**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Reduce velocity. Avoid JOG traverse near pole.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

**75275 [Channel %1: ] RCTR: block: %2, unreachable position on interpolation**

**Parameters:** %1 = Channel number  
 %2 = Block number

**Definitions:** On block interpolation a non-approachable position is detected:

**Reaction:** NC Start disable in this channel.  
 Alarm display.  
 NC Stop on alarm.

**Remedy:** Modify part program.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75500 [Channel %1: ] HSLC: Configuration error ID=%2**

**Parameters:** %1 = Channel number

**Definitions:** The function CC\_FASTON or CC\_FASTON\_CONT cannot be executed because the following MD configuration is incorrect:  
 ID=2: The NCK system function "Timer-controlled cam signal output" (see Description of Functions "Software cams, Position switching signals (N3)" ) is configured with machine data MD 10480 \$MN\_SW\_CAM\_TIMER\_FASTOUT\_MASK > 0 at the same time as the function HSLC. As there is only one hardware timer on the NCU, only one of the two functions can be used.  
 ID=4: Programming CC\_FASTON and CC\_FASTON\_CONT requires internal block memory:  
 In order to activate the compile cycle CCHSLC, the entries have to be increased in the following machine data:  
 MD 28090 \$MC\_MM\_NUM\_CC\_BLOCK\_ELEMENTS by 1 element  
 MD 28100 \$MC\_MM\_NUM\_CC\_BLOCK\_USER\_MEM by 2 [KB]

**Reaction:** Alarm display.

**Remedy:** Modify the stated MD settings

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75501 [Channel %1: ] HSLC: CC\_FASTON\_CONT velocity too high**

**Parameters:** %1 = Channel number

**Definitions:** The path-related switching signal output switched on by the part rogramm command CC\_FASTON\_CONT( PATH\_DISTANCE\_ON, PATH\_DISTANCE\_OFF ) cannot output all switching signals correctly at the current velocity.  
 Reason:  
 A maximum of one switching edge can be output per IPO cycle (see \$MN\_IPO\_CYCLE\_TIME ). The current path velocity is so high that there is more than one switching edge to be output within one path distance PATH\_DISTANCE\_ON or PATH\_DISTANCE\_OFF.  
 Example:  
 IPO cycle = 2ms ( position-control cycle = 1ms )  
 PATH\_DISTANCE\_ON = 0.667  
 PATH\_DISTANCE\_OFF = 0.667  
 Maximum path velocity in which no switching edges are lost: 20000 mm/min  
 When alarm 75501 occurs, the function skips the output of two successive switching edges. This does not affect the position of subsequent switching edges.  
 Note: Whether the omission of a signal from the previous switching signal leaves a high or low level present, is purely coincidental.

**Reaction:** Alarm display.

**Remedy:** - Lengthen the operating travels programmed in the command CC\_FASTON\_CONT  
 - Program the path velocity or reduce it with the override switch  
 - Set a shorter IPO cycle (machine manufacturer only)

**Program Continuation:** Clear alarm with the Delete key or NC START.



---

<b>75600</b>	<b>[Channel %1: ] RESU: wrong MD configuration. Error code %2</b>
<b>Parameters:</b>	%1 = Channel number %2 = Error code
<b>Definitions:</b>	The following errors were detected in the machine data of the retrace support function when ramping up: Error code = 4 : Machine data \$MC_MM_NUM_CC_BLOCK_ELEMENTS or \$MC_MM_NUM_CC_BLOCK_USER_MEM must be increased. Error code = 5 : Insufficient heap memory for compile cycles available. Adjust machine data \$MC_RESU_RING_BUFFER_SIZE, \$MC_RESU_SHARE_OF_CC_HEAP_MEM and \$MC_MM_NUM_CC_HEAP_MEM. Error code = 6 : The machine data \$MN_ASUP_START_MASK and \$MN_ASUP_START_PRIO_LEVEL are not set correctly. Error code = 11: Machine data \$MC_AXCONF_GEOAX_NAME_TAB[n], \$MN_INTERMEDIATE_POINT_NAME_TAB[n] and \$MN_IPO_PARAM_NAME_TAB[n] are not set correctly for RESU: Error code = 13: With bit 2 = 0 of MD \$MC_RESU_SPECIAL_FEATURE_MASK it was specified that the retraction program cc_resu.mpf is to be stored in the DRAM parts program memory. However, no DRAM parts program memory was requested via MD \$MN_MM_DRAM_FILE_MEM_SIZE. Remedy: Either set MD \$MN_MM_DRAM_FILE_MEM_SIZE to a value inequal to zero or set bit 2 of MD \$MC_RESU_SPECIAL_FEATURE_MASK equal to one.
<b>Reaction:</b>	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
<b>Remedy:</b>	Correct machine data.
<b>Program</b>	Switch control OFF - ON.
<b>Continuation:</b>	

---

<b>75601</b>	<b>[Channel %1: ] RESU: block %2 invalid parameter in CC_PREPRE()</b>
<b>Parameters:</b>	%1 = Channel number %2 = Block number, label
<b>Definitions:</b>	Only the values <arg> = -1 0 or 1 are valid parameters for programming CC_STOPRE( <arg>).
<b>Reaction:</b>	Interpreter stop Interface signals are set. Alarm display.
<b>Remedy:</b>	Modify part program.
<b>Program</b>	Clear alarm with the RESET key. Restart part program
<b>Continuation:</b>	

---

<b>75604</b>	<b>[Channel %1: ] RESU: Return traveling not possible, error code %2</b>
<b>Parameters:</b>	%1 = Channel number %2 = Error code
<b>Definitions:</b>	Return traveling is not possible, as the following error was detected: Error code = 1 : The current reverse block for return traveling is likely to be a block of cc_resu_ini.spf or cc_resu_end.spf programmed with a block number. It is impermissible to program block numbers in the subroutines cc_resu_ini.spf and cc_resu_end.spf, as they have an internal meaning. Error code = 2 : Unable to create cc_resu.mpf, as DRAM is insufficient. Error code = 4 : The selected continuation block is likely to be a block of cc_resu_ini.spf or cc_resu_end.spf programmed with block number. It is impermissible to program block numbers in the subroutines cc_resu_ini.spf and cc_resu_end.spf, as they have an internal meaning.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Error code = 1 or 4 : Remove all block numbers from cc\_resu\_ini.spf and cc\_resu\_end.spf and their subroutines.  
Error code = 2 : Assign a higher value to machine data \$MN\_MM\_DRAM\_FILE\_MEM\_SIZE.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75605 [Channel %1: ] RESU: internal error, error code %2**

**Parameters:** %1 = Channel number  
%2 = Error code

**Definitions:** With this alarm, RESU-internal error states are displayed which, together with the transferred error number, provide information on the error cause and error location.

**Reaction:** NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** If this error occurs, please contact us on the SINUMERIK Hotline of the SIEMENS AG, specifying the error number.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**75606 [Channel %1: ] RESU: retraceable contour was shortened**

**Parameters:** %1 = Channel number

**Definitions:** The block search buffer is full. Therefore the retraceable contour had to be shortened.

**Reaction:** Alarm display.

**Remedy:** This alarm has no effect on the current machining. If the alarm continues to occur frequently, the reason should be eliminated: adjust machine data \$MC\_RESU\_RING\_BUFFER\_SIZE, \$MC\_RESU\_SHARE\_OF\_CC\_HEAP\_MEM and \$MC\_MM\_NUM\_CC\_HEAP\_MEM.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**75607 [Channel %1: ] RESU: resynchronisation not possible**

**Parameters:** %1 = Channel number

**Definitions:** The block search triggered by the compile cycle has been terminated with an error. It can have the following cause:  
The control is not in the correct operating mode, e.g. in JOG\_AUTO instead of in AUTO.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Switch the control to the AUTO operating mode and restart resynchronisation.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**75608 [Channel %1: ] RESU: NC memory limit reached, RAM type %2**

**Definitions:** A memory limit was reached on writing to file cc\_resu.mpf. The possible area for return traveling is shortened.  
RAM type = 1: File cc\_resu.mpf is created in the buffer memory (SRAM). The buffer memory is therefore full. If the buffer memory is used and if alarm 75608 with RAM type 1 is output, system alarm 6500 will be output simultaneously.  
RAM type = 2: The memory limit was reached on creating file cc\_resu.mpf in the dynamic memory (DRAM part program memory).

**Reaction:** Alarm display.

**Remedy:** RAM type = 1: Increase size of buffer memory (\$MN\_MM\_USER\_MEM\_BUFFERED) or the available space in the buffer memory, e.g. by unloading unused parts programs. Alternatively the ring buffer can be decreased via MD \$MC\_RESU\_RING\_BUFFER\_SIZE.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### 75609 [Channel %1: ] RESU: POS axis not permitted, axis type %2, block no. %3

**Parameters:** %1 = Channel number  
%2 = Axis type  
%3 = Block number

**Definitions:** A geometry axis is traversed as a positioning axis with CC\_PREPRE active. This programming is not permissible.

**Reaction:** Interpreter stop  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.  
NC Stop on alarm.

**Remedy:** In order to traverse a geometry axis as positioning axis, RESU must be switched off temporarily (with CC\_PREPRE(0) ) or completely. In order to make the internal axis state change from the geometry axis as positioning axis after traversing, a block without traveling motion must be programmed, if required: e.g. X=IC(0)

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 75610 [Channel %1: ] RESU: NC start currently not possible

**Definitions:** While RESU is active, no NC START must be performed in certain situations. If NC START is confirmed nevertheless, execution will be blocked and alarm 75610 will be displayed. This applies in the following situations:  
- On requesting return traveling: NC START is blocked when return traveling program cc\_resu.mpf has been created and selected.  
- After having triggered continuation under NC STOP condition: as long as the internally started block search or the finally started Asup cc\_resu\_bs\_asup.spf is running.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Wait for completion of the current internal procedure. Then delete the alarm with NC START and continue

**Program Continuation:** Clear alarm with NC START or RESET key and continue the program.

### 75651 [Channel %1: ] PROT: Incorrect configuration no. %2

**Parameters:** %1 = Channel number  
%2 = Error code

**Definitions:** Invalid configuration of the axis collision protection PROT  
Significance of the displayed error numbers:  
1:The axes of one pair are not of the same axis type (linear / rotary axis)  
2:A selected axis pair includes an axis not activated in any channel  
8:In the assignment \$MN\_CC\_PROTECT\_PAIRS[ n ] only one axis was entered  
16:MD \$MN\_CC\_PROTECT\_SAFE\_DIR[ n ] or \$MN\_CC\_PROTECT\_OFFSET[ n ] were changed in active collision monitoring  
32:The current position difference between the axes to be monitored is smaller than the monitoring window \$MN\_CC\_PROTECT\_WINDOW[ n ]

**Reaction:** Mode group not ready.  
Interface signals are set.  
Alarm display.

**Remedy:** Still missing

**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75652 [channel %1: ] PROT: Trace file access error No. %2**

**Parameters:** %1 = Channel number  
%2 = Error code  
**Definitions:** Trace file access error  
**Reaction:** Alarm display.  
**Remedy:** Close trace file or release memory space  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

---

**75653 [Channel %1: ] PROT: Collision protection stops axis %2**

**Parameters:** %1 = Channel number  
%2 = Axis number  
**Definitions:** The axis collision protection function PROT has detected a risk of collision, and stopped the critical axes.  
**Reaction:** Interface signals are set.  
Alarm display.  
NC Stop on alarm.  
**Remedy:** Retract axis in JOG. Modify part program if necessary.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

# HMI alarms

---

## 120000 **Area %1 cannot be loaded! Acknowledge alarm, press area switchover key!**

**Parameters:** %1 = Operating area name  
**Definitions:** One of the applications listed in the REGIE.INI could not be started.  
**Reaction:** Alarm display.  
**Remedy:** Check whether the entry in REGIE.INI is correct.  
**Program** Internal  
**Continuation:**

---

## 120001 **Area %1 cannot be selected. Please deactivate area %2**

**Parameters:** %1 = Operating area name  
 %2 = Operating area name  
**Definitions:** Within the scope of an area switchover, a different area is to be terminated (unloaded).  
 However, the area refuses this.  
 The area switchover does not take place.  
**Reaction:** Alarm display.  
**Remedy:** Try again and, if possible, first close the area that could not be deactivated.  
**Program** Internal  
**Continuation:**

---

## 120002 **Area %1 is still active. Please deactivate area %1**

**Parameters:** %1 = Operating area name  
**Definitions:** When the MMC system is closed (closing the master control), an area is to be terminated.  
 However, the area refuses this.  
 The system was NOT closed.  
**Reaction:** Alarm display.  
**Remedy:** Try again and, if possible, first close the area that could not be deactivated.  
**Program** Internal  
**Continuation:**

---

## 120003 **Area %1 cannot be deactivated. Please try again**

**Parameters:** %1 = Operating area name  
**Definitions:** Within the scope of an area switchover, an area is to be deselected.  
 However, the area refuses this.  
 The area switchover does not take place.  
**Reaction:** Alarm display.  
**Remedy:** Try again and, if possible, first close the area that could not be deactivated.  
**Program** Internal  
**Continuation:**

---

## 120005 **Please acknowledge the dialog box in area %1**

**Parameters:** %1 = Operating area name  
**Definitions:** The area %1 could not be deselected, as in this area a dialog box is still open.  
**Reaction:** Alarm display.  
**Remedy:** Close the dialog box in area %1!  
**Program** Internal  
**Continuation:**

**120006            The channel switchover is currently disabled by area %1.**  
**Parameters:**        %1 = Operating area name  
**Definitions:**        The area %1 has disabled the channel switchover at the moment, as it is performing a critical operation (e.g. execution from external sources, etc.), during which no channel switchover may occur.  
**Reaction:**            Alarm display.  
**Remedy:**              Wait until the critical operation is finished or end the critical operation manually.  
**Program**                Internal  
**Continuation:**

---

**120007            The channel switchover is currently disabled.**  
**Definitions:**        The channel switchover is currently disabled, as a critical operation, during which no channel switchover may occur, is being carried out.  
**Reaction:**            Alarm display.  
**Remedy:**              Wait until the critical operation is finished or end the critical operation manually.  
  
**Program**                Internal  
**Continuation:**

---

**120008            Control unit switchover, PLC timeout: %1**  
**Parameters:**        %1 = --  
**Definitions:**        001: MMC would like to go offline from this NCU. MMC has made the offline request in the online PLC and is waiting for the positive / negative acknowledgement from the PLC.  
                           002: MMC would like to go online to this NCU. MMC has called the target PLC and is waiting for the release to go online.  
                           003: MMC has requested the active operating mode and is waiting for acknowledgement from the PLC.  
**Remedy:**              Check whether the switchover blocks are loaded and started in the online PLC.

---

**120010            PCU temperature alarm**  
**Definitions:**        The temperature sensor on the PCU module has reached the response threshold.  
                           Interface bit DB10.DB103.6 will be set.  
**Remedy:**              Switch off the PCU and let it cool off.  
                           Improve the ventilation of the PCU module.  
                           Check the function of the fan of the PCU module (fan defect).  
                           If the error is displayed again, please inform the authorized service personnel.

---

**120011            Request for authority to operate from another station.%nTo retain authority to operate=>Recall key,%nto transfer authority to operate=>wait (no entry)**  
**Definitions:**        The operator of another station requests authority to operate. This can be refused to him through Recall. After approx. 5 seconds, the authority to operate will automatically be transferred to the other station.  
**Reaction:**            Alarm display.  
**Remedy:**              The alarm automatically disappears after approx. five seconds or if the Recall key is pressed within this time limit.  
**Program**                Internal  
**Continuation:**

---

**120020            PCU fan monitoring CPU fan**  
**Definitions:**        Low fan speed of CPU fan.  
                           Interface bit DB10.DB103.4 is being set.  
**Remedy:**              Switch off the PCU, let it cool off and have the function of the CPU fan of PCU module checked by qualified service personnel (fan problem).  
                           Spare part description: Manual Operator Components SINUMERIK  
                           840D/840Di/810D section PCU 50 V3 spare parts, replacement of device fan.

---

<b>120021</b>	<b>PCU fan monitoring housing fan 1</b>
<b>Definitions:</b>	Low fan speed of PCU casing fan 1. Interface bit DB10.DB103.4 is being set.
<b>Remedy:</b>	Switch off the PCU, let it cool off and have the function of casing fan 1 of PCU module checked by qualified service personnel (fan problem). Spare part description: Manual Operator Components SINUMERIK 840D/840Di/810D section PCU 50 V3 spare parts, replacement of device fan.

---

<b>120022</b>	<b>PCU fan monitoring housing fan 2</b>
<b>Definitions:</b>	Low fan speed of PCU casing fan 2. Interface bit DB10.DB103.4 is being set.
<b>Remedy:</b>	Switch off the PCU, let it cool off and have the function of casing fan 2 of PCU module checked by qualified service personnel (fan problem). Spare part description: Manual Operator Components SINUMERIK 840D/840Di/810D section PCU 50 V3 spare parts, replacement of device fan.

---

<b>120029</b>	<b>PCU: fatal hard disk error</b>
<b>Definitions:</b>	A high number of write/read errors was found on the hard disk. This indicates a hardware failure to come soon (S.M.A.R.T error). Interface bit DB10.DB103.3 is being set.
<b>Remedy:</b>	Back up the PCU data and have the hard disk replaced by qualified service personnel. Spare part description: Manual Operator Components SINUMERIK 840D/840Di/810D section PCU 50 V3 spare parts. Hard disk replacement: Installation & Start-Up Guide HMI SINUMERIK 840D/840Di/810D section Installation variants/data backup.

---

<b>120120</b>	<b>%1 see explanation</b>
<b>Parameters:</b>	%1 = Alarm texts are displayed below in respect of individual causes of the alarm
<b>Definitions:</b>	Alarm text: Alarm list is full. Pending alarms/messages could not be entered into the alarm list due to lack of space. The alarm cannot be deleted, as this event has made the alarm list permanently inconsistent. Alarm text: Number of alarm texts too high. The number of alarm texts is currently limited to 5000. This limit has been exceeded by the alarm text configuration. Alarm text: File %1 not found. Alarm text: Input/output error in file %1. Alarm text: Input/output error. Alarm text: Error on reading from the index file. Alarm text: Error on writing into the index file. Alarm text: Syntax error in alarm text file %1. Alarm texts are stored in files. One of these files could not be accessed properly.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	Expand the alarm list (Enter maximum number in the file mbdde.ini in the section [Alarms]). Then perform a cold restart for the operator panel. Reduce the number of alarm texts. Then perform a cold restart for the operator panel. Make sure that the MMC memory on the hard disk is available after booting, or re-install the MMC software. When entering your own alarm texts, check whether the path and file name are entered correctly in mbdde.ini.
<b>Program Continuation:</b>	Internal

---

<b>120200</b>	<b>Image preparation suppressed</b>
<b>Definitions:</b>	The control is so heavily loaded by the processing of a subroutine, that it cannot keep all the display values up-to-date.
<b>Reaction:</b>	Alarm display.
<b>Remedy:</b>	The alarm disappears automatically as soon as the overload situation has been eliminated. If this alarm occurs often, the start-up engineer will have to take appropriate measures (e.g. reduce IPO clock pulse rate).

Program Internal  
Continuation:

---

**120201      Communication failure**

**Definitions:**      The operator panel is connected with the NC and PLC via a serial bus.  
This alarm occurs when the communication to these components is interrupted.  
In connection with this alarm, all display values connected with the NC/PLC become invalid.  
Such faults are normal while the controls are ramping up (e.g. after resetting).

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the fault situation has ended.  
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

Program Internal  
Continuation:

---

**120202      Waiting for a connection to the NC/PLC**

**Definitions:**      The operator panel is connected to the NC and PLC via a serial bus.  
This alarm occurs if the MMC is started for the first time and the NC/PLC ramp-up is not yet finished or the communication to these components is faulty.  
In connection with this alarm, all display values connected with the NC/PLC become invalid.  
Such faults are normal while the controls are ramping up (e.g. after resetting).

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the fault situation has ended.  
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

Program Internal  
Continuation:

---

**120203      Communication failure**

**Definitions:**      The operator panel is connected to the NC and PLC via a serial bus.  
This alarm occurs if the MMC is started for the first time and the NC/PLC ramp-up is not yet finished or the communication to these components is faulty.  
In connection with this alarm, all display values connected with the NC/PLC become invalid.  
Such faults are normal while the controls are ramping up (e.g. after resetting).

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the fault situation has ended.  
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

Program Internal  
Continuation:

---

**120301      Faulty entry for hardkey 'Program' in Keys.ini.**

**Definitions:**      The configuration in Keys.ini is wrong.

**Reaction:**      Alarm display.

**Remedy:**      In Keys.ini, the parameter ChildTask:=26 has to be set in the line KEY2.0=  
The alarm can also be acknowledged manually via diagnostics.

Program Internal  
Continuation:

---

**120302      The selection is not possible. A program has to have been edited first via the area 'Program'.**

**Definitions:**      A program can only be selected via the hardkey program if a program has already been edited in the program area.

**Reaction:**      Alarm display.



**Remedy:** The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

**120303 The selection is not possible. The edited file %1 no longer exists.**

**Parameters:** %1 = Program name with path

**Definitions:** The file edited last in the program area has in the meantime been deleted.

**Reaction:** Alarm display.

**Remedy:** The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

**120304 The selection is not possible. The file %1 has insufficient read rights.**

**Parameters:** %1 = Program name with path

**Definitions:** The file has insufficient read rights for the current access level.

**Reaction:** Alarm display.

**Remedy:** Set the required read rights by means of keyswitch or password entry.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

**120305 Selection is not possible. The file %1 is currently being edited.**

**Parameters:** %1 = Program name with path

**Definitions:** The file is currently open in another application (e.g. services) with an editor.

**Reaction:** Alarm display.

**Remedy:** Change the program in the already open editor.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

**120306 The selection is not possible. The file %1 is selected and active in channel %2.**

**Parameters:** %1 = Program name with path  
%2 = Channel number

**Definitions:** --

**Reaction:** Alarm display.

**Remedy:** Stop the program with the NCU's channel reset and make the selection again.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

**120307 File %1 cannot be opened for the editor because it is selected in channel %2 for execution by external sources.**

**Parameters:** %1 = Program name with path  
%2 = Channel number

**Definitions:** --

**Reaction:** Alarm display.

**Remedy:** A different program on the NCU or for execution from external sources has to be selected.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

---

**120308 In the event of an emergency stop, the program %1 can only be changed in the machine/program correction area.**

**Parameters:** %1 = Program name with path  
**Definitions:** --  
**Reaction:** Alarm display.  
**Remedy:** Switch to the machine area and change the program with the program correction function.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

---

**120309 The selection is not possible. Please close the simulation and repeat the selection.**

**Definitions:** The simulation is currently active in the program area.  
A simultaneous editing is not possible.  
**Reaction:** Alarm display.  
**Remedy:** Close the simulation and make the selection again.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

---

**120310 The selection is not possible. Please wait for the pending action or terminate it, then repeat the selection.**

**Definitions:** In the program area, programs are currently being copied, loaded or unloaded.  
A simultaneous editing is not possible.  
**Reaction:** Alarm display.  
**Remedy:** Wait until the action is completed or terminate the action via the softkey "Cancel", and then repeat the selection.  
The alarm disappears automatically as soon as a program is edited or simulated in the program area.  
The alarm can also be acknowledged manually via diagnostics.

**Program Continuation:** Internal

---

**120400 The settings for the acyclic links with the drive devices are not yet effective.%nSwitch off/on HMI !**

**Definitions:** A file transfer from/to a drive device has failed as the settings for acyclic links with the drive devices become effective only after an HMI reboot.  
**Reaction:** Alarm display.  
**Remedy:** Switch off/on HMI and then repeat the process leading to the alarm.

**Program Continuation:** Internal

---

**120401 SINAMICS: Write job for parameter %1, value %2, area %3: %4s timeout!**

**Parameters:** %1 = Number of parameter the value of which is to be written.  
%2 = Value to be written  
%3 = Area (drive object class to which the write job was addressed)  
%4 = Time passed without the write job being acknowledged by the drive device.

**Definitions:** The write job of a SINAMICS parameter was not acknowledged within 10 seconds by the drive device. If the write job is not acknowledged within the next 10 seconds, the alarm will again be triggered. The waiting period for the acknowledgement of a write job is a maximum of 130 seconds, i.e. if the timeout specified in the alarm is 130 seconds, it is assumed that the write job has failed. Otherwise it can be assumed that the write job was successful despite the timeout.

**Reaction:** Alarm display.

**Remedy:** As long as the timeout specified in the alarm is less than 130 seconds, acknowledge alarm, otherwise switch off/on control, drive system and HMI, and then repeat the process leading to the alarm.

**Program Continuation:** Internal

### 120402 **Bus%1.Slave%2: %3: First commissioning of SINAMICS required!**

**Parameters:** %1 = Bus number  
%2 = Slave address  
%3 = Name of the affected drive device

**Definitions:** The drive device with the bus number and slave address specified in the alarm is in 'First commissioning' state.

**Reaction:** Alarm display.

**Remedy:** Execute first commissioning for the affected drive device. To do so, switch in the HMI to the dialog 'First commissioning > Drive system > Drive devices, select the affected drive device, and follow the instructions of the HMI.

**Program Continuation:** Internal

### 120403 **Bus%1.Slave%2: %3: Check/acknowledge topology!**

**Parameters:** %1 = Bus number  
%2 = Slave address  
%3 = Name of the affected drive device

**Definitions:** The drive device with the bus number and slave address specified in the alarm has detected an illegal difference between reference topology and actual topology during the ramp-up when checking the DRIVE-CLiQ topology. For this reason, the drive device has stopped the ramp-up in the 'Topology error' state.

**Reaction:** Alarm display.

**Remedy:** - Check actual topology and possibly replug in line with the actual topology.  
- Check DRIVE-CLiQ cables for breakage and problems with contacts.  
- Test DRIVE-CLiQ components for operational functioning.  
Note:  
Under 'Setup > Drive system > Drive devices > Topology', HMI offers a suitable diagnostics (e.g. reference/actual value comparison).

**Program Continuation:** Internal

### 120404 **Setting up acyclic link %1 failed.%nSwitch off/on control, drives and HMI.**

**Parameters:** %1 = Name of connection

**Definitions:** Setting up an acyclic link with a drive device for file transfer from/to this drive device has failed. The file could not be transferred from/to this drive device. The affected drive device has the bus number and slave address specified in the link name: /DRIVE\_<Bus number>\_<Slave address>.

**Reaction:** Alarm display.

**Remedy:** Execute the following measures in the sequence specified until the process leading to the alarm can be repeated successfully:

1. Switch off/on control, drives and HMI, and then repeat the process leading to the alarm.
2. Load PROFIBUS configuration (HW Config) with same PLC and CP-Subnet-ID in PLC and CP, switch off/on control and HMI, and then repeat the process leading to the alarm.
3. Return to factory settings of the affected drive device, switch off/on control, drives and HMI, and then repeat the process leading to the alarm.
4. Contact Siemens AG, Industry Sector, I DT MC, Hotline (Phone/Fax: see Alarm 1000) regarding the error text.

**Program Continuation:** Internal

**120405 SINAMICS: Firmware update for DRIVE-CLiQ components is running.%nPlease wait for the firmware update to be completed!**

**Definitions:** The firmware update is being executed for at least one DRIVE-CLiQ component.  
**Reaction:** Alarm display.  
**Remedy:** None required.  
 Please wait for the firmware update to be completed.  
 Completion of the firmware update is signaled by alarm 120406.  
**Program Continuation:** Internal

---

**120406 SINAMICS: Firmware update of DRIVE-CLiQ components completed.%nSwitch off/on drive system!**

**Definitions:** Firmware update of all DRIVE-CLiQ components completed.  
**Reaction:** Alarm display.  
**Remedy:** Switch off/on drive system including all DRIVE-CLiQ components.  
**Program Continuation:** Internal

---

**120407 SINAMICS: Read job for parameter %1, area %2: %3 s timeout!**

**Parameters:** %1 = Number of the parameter whose value was read.  
 %2 = Area (drive object class to which the write job was addressed)  
 %3 = Time required to read the parameter.  
**Definitions:** It is taking too long to read a SINAMICS parameter. This can slow down the operation of a connected HMI significantly.  
**Reaction:** Alarm display.  
**Remedy:** 1. Acknowledge alarm.  
 2. Check drive load: The CPU time load values in parameter r9976 for the corresponding Control Unit should be less than 80%.  
 3. Make a note of the error text and contact Siemens AG, Industry Sector, I DT MC, hotline (phone/fax: see alarm 1000).  
**Program Continuation:** Internal

---

**129900 Data of passive drives are not backed up!**

**Definitions:** This indicates that passive drives are not backed up as well when an upgrade is made.  
**Reaction:** Alarm display.  
**Remedy:** If the drive shall be backed up as well, it must be enabled. If the note shall not be displayed again, set the drive to "0" in machine data 30240 ENC\_TYPE and 30130 CTRLOUT\_TYPE.  
**Program Continuation:** Internal

---

**129901 Time determination is being initialized. Please wait...**

**Definitions:** This indicates that the time determination is being initialized and that the operator shall not yet press NC Start or execute other operator actions.  
**Reaction:** Alarm display.  
**Remedy:** Not necessary. After completion of the initialization, the dialog box will be faded out again automatically.  
**Program Continuation:** Internal

---

**129902 Recorded data are being processed. Please wait...**

**Definitions:** This indicates that data recorded by time determination are currently processed and that the operator shall not yet press NC Start or execute other operating actions.  
**Reaction:** Alarm display.

**Remedy:** Not necessary. After completion of the initialization, the dialog box will be faded out again automatically.  
**Program:** Internal  
**Continuation:**

---

**129903 Time determination is active.**

**Definitions:** This indicates that time determination is enabled and that the user can press NC Start.  
**Reaction:** Alarm display.  
**Remedy:** Not necessary. As soon as all channels viewed for time determination are in Reset again, this message will be cancelled automatically.  
**Program:** Internal  
**Continuation:**

---

**129904 %1: Current NCK Version %2 is too low for time measurement. Version 500000 or higher will be required.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
 %2 = Current NCU version  
**Definitions:** The version of the specified NCU is too old (< 500000).  
**Remedy:** Upgrade or replace the relevant NCU for the required software version in order to use the time determination.

---

**129905 %1: Unable to determine the NCK version for time measurement.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:** The version of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129906 %1: Unable to determine the number of channels.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:** The number of channels of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129907 %1: The max. number of channels could not be determined.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:** The maximum number of channels of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129908 %1: Unable to determine active channels.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:** The active channels of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129909 %1: Unable to determine the name of channel %2.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
 %2 = Channel number  
**Definitions:** The channel name of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129910 %1: Unable to determine general machine data.**

**Parameters:** %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:** The general machine data of the specified NCU could not be determined.  
**Remedy:** Connect to the NCU and restart the PCU if required.

---

**129911            %1: Unable to determine machine data \$MN\_MM\_PROTOD\_NUM\_FILES[1,10].**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:**        Machine data MN\_MM\_PROTOD\_NUM\_FILES[1,10] of the specified NCU could not be determined.  
**Remedy:**                Connect to the NCU and restart the PCU if required.

---

**129912            %1: Unable to determine machine data \$MN\_MM\_PROTOD\_NUM\_ETPD\_STD\_LIST[1,10].**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:**        Machine data LINKITEM\_MN\_MM\_PROTOD\_NUM\_ETPD\_STD\_LIST[1,10] of the specified NCU could not be determined.  
**Remedy:**                Connect to the NCU and restart the PCU if required.

---

**129913            %1: Unable to determine machine data \$MN\_MM\_PROTOD\_NUM\_ETPD\_OEM\_LIST[1,10].**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:**        Machine data LINKITEM\_MN\_MM\_PROTOD\_NUM\_ETPD\_OEM\_LIST[1,10] of the specified NCU could not be determined.  
**Remedy:**                Connect to the NCU and restart the PCU if required.

---

**129914            %1: Unable to determine channel-specific machine data.**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
**Definitions:**        The channel-specific machine data of the specified NCU could not be determined.  
**Remedy:**                Connect to the NCU and restart the PCU if required.

---

**129915            %1: Unable to determine active user for channel %2.**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
                           %2 = Channel number  
**Definitions:**        The "active user" of the specified channel of the specified NCU could not be determined.  
**Remedy:**                Connect to the NCU and restart the PCU if required.

---

**129930            %1: Min. %2 log files are required for the requested time determination (\$MN\_MM\_PROTOD\_NUM\_FILES[%3])**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
                           %2 = Number of log files required  
                           %3 = User index  
**Definitions:**        Time measuring of the configured workpiece requires at least the specified number of log files.  
**Remedy:**                Set general machine data \$MN\_MM\_PROTOD\_NUM\_FILES[%3] of NCU %1 to value %2.

---

**129931            %1: Min. %2 ETPD lists are required for the requested time determination (\$MN\_MM\_PROTOD\_NUM\_ETPD\_STD\_LIST[%3])**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
                           %2 = Number of ETPD lists required  
                           %3 = User index  
**Definitions:**        Time measuring of the configured workpiece requires at least the specified number of ETPD lists.  
**Remedy:**                Set general machine data \$MN\_MM\_PROTOD\_NUM\_ETPD\_STD\_LIST[%3] of NCU %1 to value %2.

---

**129932            DAT: The configured NCU (%1) for part program %2 in channel %3 is invalid.**

**Parameters:**        %1 = Name of the NCU according to NETNAMES.INI  
                           %2 = Name of the part program  
                           %3 = Channel number

**Definitions:** The specified combination of NCU, part program and channel is invalid for time measuring of the configured workpiece.

**Remedy:** Part program %2 can only be assigned to a channel in an NCU configured in NETNAMES.INI.

**129933 DAT: The configured channel (%1) for part program %2 in NCU %3 is invalid.**

**Parameters:** %1 = Channel number  
%2 = Name of the part program  
%3 = Name of the NCU according to NETNAMES.INI

**Definitions:** The specified combination of NCU, part program and channel is invalid for time measuring of the configured workpiece.

**Remedy:** Correct the corresponding entry in the DAT file belonging to the workpiece.

**129934 DAT: Part program %1 has been configured more than once.**

**Parameters:** %1 = Name of the part program

**Definitions:** For time measuring of the configured workpiece, the specified part program is configured for several channels.

**Remedy:** Correct the corresponding entry in the DAT file belonging to the workpiece.

**129935 NC configuration not yet determined.**

**Definitions:** Unable to determine the configuration of the NCs.

**Remedy:** Ensure that communication to the NC has been activated and all machine data required for time measuring have been set correctly.

**129936 Initialization not yet executed.**

**Definitions:** An order has been sent to the ITS server although the server has not been initialized yet.

**Remedy:** Execute your operation again later.

**129937 Workpiece selection missing.**

**Definitions:** The ITS server has not yet received any DAT file for time measuring, or the contents of the DAT file is faulty.

**Remedy:** Select a workpiece for execution prior to executing a time measurement.

**129938 Status of workpiece (%1) could not be determined.**

**Parameters:** %1 = Workpiece name

**Definitions:** The state ?editable? of the DAT file or the workpiece could not be determined.

**Remedy:** Restart communication to the NC, if required.

**129939 Workpiece (%1) is currently being machined.**

**Parameters:** %1 = Workpiece name

**Definitions:** The DAT file or workpiece is currently disabled.

**Remedy:** Close the open DAT file or the corresponding workpiece in MCSE, if required.

**129940 Error in workpiece (%1).**

**Parameters:** %1 = Workpiece name

**Definitions:** The ITS server has not yet been initialized, it cannot, therefore, execute the order.

**Remedy:** Execute your operation again later.

**129941 Not all involved channels are in RESET.**

**Definitions:** At least one of the channels configured in the workpiece for time measuring is not in the "Reset" state.

**Remedy:** Ensure that all channels configured in the workpiece for time measurement are in the "Reset" state.

**129942**            **Not all involved channels are in AUTO.**  
**Definitions:**        At least one channel/mode group configured in the workpiece for time measurement is not in the "AUTO" mode.  
**Remedy:**             Ensure that all channels/mode groups configured in the workpiece for time measurement are in the "AUTO" state.

---

**129943**            **%1: Invalid configuration of \$AN\_TIMER.**  
**Parameters:**        %1 = NCU name  
**Definitions:**        Setting AN\_TIMER\_Nr of section [DAT] in ITS.INI is incompatible with the setting in machine data 18710 \$MN\_MM\_NUM\_AN\_TIMER.  
**Remedy:**             The value in general machine data 18710 \$MN\_MM\_NUM\_AN\_TIMER must be at least "1".  
                           The value set for AN\_TIMER\_Nr of section [DAT] in ITS.INI must be higher than "0" and smaller than or equal to the value of general machine data 18710 \$MN\_MM\_NUM\_AN\_TIMER.  
                           The following rule applies:  
                           0 < AN\_TIMER\_Nr <= \$MN\_MM\_NUM\_AN\_TIMER

---

**129944**            **%1: \$AN\_TIMER[%2] not running.**  
**Parameters:**        %1 = NCU name  
                           %2 = Index of system variable \$AN\_TIMER used.  
**Definitions:**        The \$AN\_TIMER[AN\_TIMER\_No] configured with setting AN\_TIMER\_Nr of section [DAT] in ITS.INI has not been started.  
**Remedy:**             Ensure that system variable \$AN\_TIMER[AN\_TIMER\_No] with value "0" is initialized and started on NCU ramp-up; for example, with AN\_TIMER\_No = 1 the system variable must be initialized with NC instruction \$AN\_TIMER[1] = 0.

---

**129945**            **%1: The current NCK version (%2) is too old for this type of time measuring.**  
**Parameters:**        %1 = NCU name  
                           %2 = NCK software version of NCU %1.  
**Definitions:**        Measuring method "1" configured with setting MeasureMode of section [DAT] in ITS.INI cannot be used, as the current NCK version is too old.  
**Remedy:**             Either upgrade NCK software to at least 511300 or select measuring method "0".

---

**129946**            **General error. See entry in log file ITSx.LOG.**  
**Definitions:**        A general error has occurred that is specified in detail in log file "ITSx.LOG".  
                           The files are stored in sub-directory "SEditor" of the "TMP" directory in HMI Advanced.  
**Remedy:**             Follow the instructions in log file "ITSx.LOG" or contact the Siemens hotline.

---

**142000**            **Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142001**            **Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**



---

**142002**            **Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142003**            **Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142004**            **Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142005**            **Machine ready for remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Are triggered in "PLC Controlled" mode  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142006**            **Machine ready for remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Are triggered in "PLC Controlled" mode  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142007**            **Machine ready for remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem  
**Definitions:**        Are triggered in "PLC Controlled" mode  
**Reaction:**            Alarm display.  
**Remedy:**             Acknowledge alarm  
**Program**              Internal  
**Continuation:**

---

**142008**            **Machine ready for remote diagnostics! %1 %2 %3 %4**  
**Parameters:**        %1 = IP address for existing Internet connection via modem

**Definitions:** Are triggered in "PLC Controlled" mode  
**Reaction:** Alarm display.  
**Remedy:** Acknowledge alarm  
**Program** Internal  
**Continuation:**

---

**142009 Machine ready for remote diagnostics! %1 %2 %3 %4**

**Parameters:** %1 = IP address for existing Internet connection via modem  
**Definitions:** Are triggered in "PLC Controlled" mode  
**Reaction:** Alarm display.  
**Remedy:** Acknowledge alarm  
**Program** Internal  
**Continuation:**

---

**142010 Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**

**Parameters:** %1 = IP address for existing Internet connection via modem  
**Definitions:** Will be triggered in "User Controlled" mode, if user explicitly selects and starts a host object.  
**Reaction:** Alarm display.  
**Remedy:** Acknowledge alarm  
**Program** Internal  
**Continuation:**

---

**142011 Operator at the machine is waiting for support via remote diagnostics! %1 %2 %3 %4**

**Parameters:** %1 = IP address for existing Internet connection via modem  
**Definitions:** Will be triggered in "User Controlled" mode, if user uses "Request Support" function.  
**Reaction:** Alarm display.  
**Remedy:** Acknowledge alarm  
**Program** Internal  
**Continuation:**

---

**149000 Job execution failed**

**Definitions:** -  
**Remedy:** -  
**Program** Internal  
**Continuation:**

---

**149001 No boot script available**

**Definitions:** -  
**Remedy:** -  
**Program** Internal  
**Continuation:**

---

**149002 Error during execution of script**

**Definitions:** -  
**Remedy:** -  
**Program** Internal  
**Continuation:**

---

**149005 A job could not be fetched from the server.**

**Definitions:** -  
**Remedy:** -

---

Program Internal  
Continuation:

---

**149006 The job fetched from the server does not contain any data.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149007 The server certificate has expired, or the date and time settings on the computer are incorrect.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149008 Access to the ePS configuration failed for unknown reasons.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149009 The ePS configuration could not be initialized.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149010 The ePS machine identity could not be initialized.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149200 The boot script has not received a valid service script ID from the ePS server.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149201 The boot script has not received a service script from the ePS server.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149202 The boot script could not start the service script.**

Definitions: -

Remedy: -

Program Internal

Continuation:

---

**149203            The service script could not start the data transfer service script.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149305            PLC monitoring canceled during access to the controller.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149306            PLC monitoring failed while generating the data access object, or there is a hotlink error.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149307            PLC monitoring canceled during timeout during initial RESET.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149308            PLC monitoring canceled due to faulty trigger.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149310            NC monitoring canceled on account of access error to the controller.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149311            NC monitoring failed while generating the data access object.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

**149315            PLC DataUpload failed while generating the DataAccess object.**

Definitions:            -  
Remedy:                -  
Program                Internal  
Continuation:

---

---

<b>149316</b>	<b>PLC DataUpload canceled on account of missing parameters.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>149317</b>	<b>PLC DataUpload canceled because the timer could not be started.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>149320</b>	<b>NC monitoring canceled because the generation of the data access object failed.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>149321</b>	<b>NC monitoring canceled on account of missing parameters.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>149322</b>	<b>NC monitoring canceled because the timers could not be started.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>149500</b>	<b>An HMI restart is required to complete the installation of the application.</b>
Definitions:	-
Remedy:	-
Program	Internal
Continuation:	

---

<b>150000</b>	<b>Auto Servo Tuning has been shut down unexpectedly during a previous operation. It may be necessary to restore the output data of the last tuning.</b>
Definitions:	The alarm signals that a recovery point exists. A recovery point may come to a standstill on a platform if AST is unexpectedly shut down (e.g. in the case of power failure, failure in communications etc.) Recovery of the recovery point sets the machine data back to the values before the tuning. This ensures that the machine is in a consistent state.
Reaction:	Alarm display.
Remedy:	Data recovery may be executed from the Auto Servo Tuning application in HMI-Setup.
Program	Internal
Continuation:	

---

**150100      Adaptation of the softkey access levels active**

**Definitions:**      The alarm signalizes that the commissioning mode for softkeys has been activated.  
In this mode, the access level of a softkey can be reassigned by a right click on the softkey.

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the commissioning mode for softkeys is terminated.

**Program**      Internal

**Continuation:**

---

**150201      Communication to %1 failed**

**Parameters:**      %1 = Source URL of the component involved

**Definitions:**      The operator panel is connected to the NC and PLC by a communications bus.  
This alarm occurs when the communication to these components is interrupted.  
In connection with this alarm, all display values connected with the NC/PLC become invalid.  
Such faults are normal while the controls are ramping up (e.g. after resetting).

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the fault situation has ended.  
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

**Program**      Internal

**Continuation:**

---

**150202      Waiting for a connection to %1**

**Parameters:**      %1 = Source URL of the component involved

**Definitions:**      The operator panel is connected to the NC and PLC by a communications bus.  
This alarm occurs if the MMC is started for the first time and the NC/PLC ramp-up has not yet finished or the communication to these components is faulty.  
In conjunction with this alarm, all display values connected with the NC/PLC become invalid.  
Such faults are normal while the controls are starting up (e.g. after resetting).

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the fault situation has ended.  
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

**Program**      Internal

**Continuation:**

---

**150204      ----- Start alarm acquisition -----**

**Definitions:**      The alarm indicates the start or restart of alarm acquisition in the alarm log.  
If the alarm log has been configured so that it is persistently written into the file system, a further alarm is written into the log at each new start. The alarm thus separates the individual time intervals during which alarm acquisition is active.  
The coming and going time stamps are identical, and correspond to the time of the start/restart of the alarm acquisition.  
The alarm is only visible in the alarm log.

**Reaction:**      Alarm display.

**Remedy:**      The alarm can but need not be deleted as it is only visible in the alarm log.

**Program**      Internal

**Continuation:**

---

**150300      %1 is active**

**Definitions:**      The alarm signalizes that a defined energy state has been reached.  
Energy states can be configured via an HMI screen form in commissioning.  
The HMI screen forms can be accessed with the shortcut "Ctrl-E".

**Reaction:**      Alarm display.

**Remedy:**      The alarm disappears automatically as soon as the energy state reached has been terminated.

---

**Program** Internal  
**Continuation:**

---

**150400 The system CF card is nearly full.**

**Definitions:** The alarm signalizes that the system CF card is nearly full.  
Please delete the programs no longer required on the local drive and/or the data on the system CF card.

**Reaction:** Alarm display.

**Remedy:** The alarm disappears automatically as soon as sufficient memory space is available again.

**Program** Internal

**Continuation:**





# SINAMICS alarms

Product: ALL\_840, Version: 4402100, Language: eng,  
 Objects: A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP,  
 CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO,  
 TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, TOCtrlUnitNX828, VECTOR

---

## 201000 <location>Internal software error

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** An internal software error has occurred.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.  
**Remedy:**

- evaluate fault buffer (r0945).
- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.
- replace the Control Unit.

---

## 201001 <location>FloatingPoint exception

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** An exception occurred during an operation with the FloatingPoint data type.  
 The error may be caused by the base system or an OA application (e.g., FBLOCKS, DCC).  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.  
 Note:  
 Refer to r9999 for further information about this fault.  
 r9999[0]: Fault number.  
 r9999[1]: Program counter at the time when the exception occurred.  
 r9999[2]: Cause of the FloatingPoint exception.  
 Bit 0 = 1: Operation invalid  
 Bit 1 = 1: Division by zero  
 Bit 2 = 1: Overflow  
 Bit 3 = 1: Underflow  
 Bit 4 = 1: Imprecise result  
**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- check configuration and signals of the blocks in FBLOCKS.
- check configuration and signals of DCC charts.
- upgrade firmware to later version.
- contact the Hotline.

**201002**            **<location>Internal software error**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         OFF2

**Acknowledge:**    IMMEDIATELY

**Cause:**            An internal software error has occurred.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**           - carry out a POWER ON (power off/on) for all components.  
 - upgrade firmware to later version.  
 - contact the Hotline.

---

**201003**            **<location>Acknowledgement delay when accessing the memory**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         OFF2

**Acknowledge:**    IMMEDIATELY

**Cause:**            A memory area was accessed that does not return a "READY".  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**           - carry out a POWER ON (power off/on) for all components.  
 - contact the Hotline.

---

**201004**            **<location>Internal software error**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            An internal software error has occurred.  
 Fault value (r0949, hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**           - read out diagnostics parameter (r9999).  
 - contact the Hotline.  
 See also: r9999 (Software error internal supplementary diagnostics)

---

**201005**            **<location>Firmware download for DRIVE-CLiQ component unsuccessful**

**Message value:**    Component number: %1, fault cause: %2

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    IMMEDIATELY

**Cause:**            It was not possible to download the firmware to a DRIVE-CLiQ component.  
 Fault value (r0949, interpret hexadecimal):  
 yyxxxx hex: yy = component number, xxxx = fault cause  
 xxxx = 000B hex = 11 dec:  
 DRIVE-CLiQ component has detected a checksum error.

---

xxxx = 000F hex = 15 dec:  
 The selected DRIVE-CLiQ component did not accept the contents of the firmware file.

xxxx = 0012 hex = 18 dec:  
 Firmware version is too old and is not accepted by the component.

xxxx = 0013 hex = 19 dec:  
 Firmware version is not suitable for the hardware release of the component.

xxxx = 0065 hex = 101 dec:  
 After several communication attempts, no response from the DRIVE-CLiQ component.

xxxx = 008B hex = 139 dec:  
 Initially, a new boot loader is loaded (must be repeated after POWER ON).

xxxx = 008C hex = 140 dec:  
 Firmware file for the DRIVE-CLiQ component not available on the memory card.

xxxx = 008D hex = 141 dec:  
 An inconsistent length of the firmware file was signaled. The firmware download may have been caused by a loss of connection to the firmware file. This can occur during a project download/reset in the case of a SINAMICS Integrated Control Unit, for example.

xxxx = 008F hex = 143 dec:  
 Component has not changed to the mode for firmware download. It was not possible to delete the existing firmware.

xxxx = 0090 hex = 144 dec:  
 When checking the firmware that was downloaded (checksum), the component detected a fault. It is possible that the file on the memory card is defective.

xxxx = 0091 hex = 145 dec:  
 Checking the loaded firmware (checksum) was not completed by the component in the appropriate time.

xxxx = 009C hex = 156 dec:  
 Component with the specified component number is not available (p7828).

xxxx = Additional values:  
 Only for internal Siemens troubleshooting.

**Remedy:**

- check the selected component number (p7828).
  - check the DRIVE-CLiQ connection.
  - save suitable firmware file for download in the directory "/siemens/sinamics/code/sac/".
  - use a component with a suitable hardware version
  - after POWER ON has been carried out again for the DRIVE-CLiQ component, download the firmware again.
- Depending on p7826, the firmware will be automatically downloaded.

**201006 <location>Firmware update for DRIVE-CLiQ component required**

**Message value:** Component number: %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The firmware of a DRIVE-CLiQ component must be updated as there is no suitable firmware or firmware version in the component for operation with the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Component number of the DRIVE-CLiQ component.

**Remedy:** Firmware update using the commissioning software:  
 The firmware version of all of the components on the "Version overview" page can be read in the Project Navigator under "Configuration" of the associated drive unit and an appropriate firmware update can be carried out.  
 Firmware update via parameter:  
 - take the component number from the alarm value and enter into p7828.  
 - start the firmware download with p7829 = 1.

**201007 <location>POWER ON for DRIVE-CLiQ component required**

**Message value:** Component number: %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A DRIVE-CLiQ component must be powered up again (POWER ON) (e.g. due to a firmware update).  
 Alarm value (r2124, interpret decimal):  
 Component number of the DRIVE-CLiQ component.  
**Note:**  
 For a component number = 1, a POWER ON of the Control Unit is required.

**Remedy:** Switch off the power supply of the specified DRIVE-CLiQ component and switch it on again.

---

**201009 <location>CU: Control module overtemperature**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature (r0037[0]) of the control module (Control Unit) has exceeded the specified limit value.  
**Remedy:** - check the air intake for the Control Unit.  
 - check the Control Unit fan.  
**Note:**  
 The alarm automatically disappears after the limit value has been undershot.

---

**201010 <location>Drive type unknown**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** An unknown drive type was found.  
 Fault value (r0949, decimal interpretation):  
 Drive object number (refer to p0101, p0107).  
**Remedy:** - replace Power Module.  
 - carry out a POWER ON (power off/on) for all components.  
 - upgrade firmware to later version.  
 - contact the Hotline.

---

**201011 <location>Download interrupted**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The project download was interrupted.  
 Fault value (r0949, decimal interpretation):  
 1: The user prematurely interrupted the project download.  
 2: The communication cable was interrupted (e.g. cable breakage, cable withdrawn).  
 3: The project download was prematurely ended by the commissioning software (e.g. STARTER, SCOUT).  
 100: Different versions between the firmware version and project files "Download from card".  
**Note:**  
 The response to an interrupted download is the state "first commissioning".  
**Remedy:** - check the communication cable.  
 - download the project again.  
 - boot from previously saved files (power-down/power-up or p0976).  
 - when downloading from the card, use the matching version.

---

<b>201012</b>	<b>&lt;location&gt;Project conversion error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	When converting the project of an older firmware version, an error occurred. Fault value (r0949, decimal interpretation): Parameter number of the parameter causing the error. For fault value = 600, the following applies: The temperature evaluation is no longer assigned to the power unit but to the encoder evaluation. Notice: Monitoring of the motor temperature is no longer ensured.
<b>Remedy:</b>	Check the parameter indicated in the fault value and correctly adjust it accordingly. For fault value = 600: Parameter p0600 must be set to the values 1, 2 or 3 in accordance with the assignment of the internal encoder evaluation to the encoder interface. Value 1 means: The internal encoder evaluation is assigned to the encoder interface 1 via p0187. Value 2 means: The internal encoder evaluation is assigned to the encoder interface 2 via p0188. Value 3 means: The internal encoder evaluation is assigned to the encoder interface 3 via p0189. - If necessary, the internal encoder evaluation must be assigned to an encoder interface via parameters p0187, p0188 or p0189 accordingly. - If necessary, upgrade the firmware to a later version.

---

<b>201013</b>	<b>&lt;location&gt;CU: Fan operating time reached or exceeded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The maximum operating time of the fan in the Control Unit has either been reached or exceeded. Alarm value (r2124, interpret decimal): 0: The maximum fan operating time is 500 hours. 1: The maximum fan operating time has been exceeded (50,000 hours).
<b>Remedy:</b>	Replace the fan in the Control Unit and reset the operating hours counter to 0 (p3961 = 0).

---

<b>201015</b>	<b>&lt;location&gt;Internal software error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	An internal software error has occurred. Fault value (r0949, decimal interpretation): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	- carry out a POWER ON (power off/on) for all components. - upgrade firmware to later version. - contact the Hotline.

**201016 <location>Firmware changed**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** At least one firmware file in the directory /SIEMENS/SINAMICS/ has been changed without authorization with respect to the version shipped from the factory. No changes are permitted in this directory.  
 Alarm value (r2124, interpret decimal):  
 0: Checksum of one file is incorrect.  
 1: File missing.  
 2: Too many files.  
 3: Incorrect firmware version.  
 4: Incorrect checksum of the back-up file.  
 See also: r9925 (Firmware file incorrect)  
**Remedy:** For the non-volatile memory for the firmware (memory card/device memory), restore the delivery condition.  
 Note:  
 The file involved can be read out using parameter r9925.  
 See also: r9926 (Firmware check status)

---

**201017 <location>Component lists changed**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** On the memory card, one file in the directory /SIEMENS/SINAMICS/DATA or /ADDON/SINAMICS/DATA has been illegally changed with respect to that supplied from the factory. No changes are permitted in this directory.  
 Alarm value (r2124, interpret decimal):  
 zyx dec: x = Problem, y = Directory, z = File name  
 x = 1: File does not exist.  
 x = 2: Firmware version of the file does not match the software version.  
 x = 3: File checksum is incorrect.  
 y = 0: Directory /SIEMENS/SINAMICS/DATA/  
 y = 1: Directory /ADDON/SINAMICS/DATA/  
 z = 0: File MOTARM.ACX  
 z = 1: File MOTSRM.ACX  
 z = 2: File MOTSLM.ACX  
 z = 3: File ENCDATA.ACX  
 z = 4: File FILTDATA.ACX  
 z = 5: File BRKDATA.ACX  
 z = 6: File DAT\_BEAR.ACX  
 z = 7: File CFG\_BEAR.ACX  
 z = 8: File ENC\_GEAR.ACX  
**Remedy:** For the file on the memory card involved, restore the status originally supplied from the factory.

---

**201020 <location>Write to RAM disk unsuccessful**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The write access to the internal RAM disk was unsuccessful.  
**Remedy:** Adapt the size of the system logbook (p9930) to the internal RAM disk.

---

**201023 <location>Software timeout (internal)**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** An internal software timeout has occurred.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - carry out a POWER ON (power off/on) for all components.  
 - upgrade firmware to later version.  
 - contact the Hotline.

---

**201030 <location>Sign-of-life failure for master control**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF3 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
 Vector: OFF3 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For active PC master control, no sign-of-life was received within the monitoring time.  
 The master control was returned to the active BICO interconnection.  
**Remedy:** Set the monitoring time higher at the PC or, if required, completely disable the monitoring function.  
 For the commissioning software, the monitoring time is set as follows:  
 <Drive> -> Commissioning -> Control panel -> Button "Fetch master control" -> A window is displayed to set the monitoring time in milliseconds.  
 Notice:  
 The monitoring time should be set as short as possible. A long monitoring time means a late response when the communication fails!

---

**201031 <location>Sign-of-life failure for OFF in REMOTE**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF3 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
 Vector: OFF3 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** With the "OFF in REMOTE" mode active, no sign-of-life was received within 3 seconds.  
**Remedy:** - Check the data cable connection at the serial interface for the Control Unit (CU) and operator panel.  
 - Check the data cable between the Control Unit and operator panel.

---

**201033 <location>Units changeover: Reference parameter value invalid**

**Message value:** Parameter: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** When changing over the units to the referred representation type, it is not permissible for any of the required reference parameters to be equal to 0.0  
 Fault value (r0949, parameter):  
 Reference parameter whose value is 0.0.  
 See also: p0349 (System of units, motor equivalent circuit diagram data), p0505 (Selecting the system of units), p0595 (Selecting technological units)

**Remedy:** Set the value of the reference parameter to a number different than 0.0.  
 See also: p0304, p0305, p0310, p0596, p2000, p2001, p2002, p2003, r2004

**201034 <location>Units changeover: Calculation parameter values after reference value change unsuccessful**

**Message value:** Parameter: %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The change of a reference parameter meant that for an involved parameter the selected value was not able to be re-calculated in the per unit representation. The change was rejected and the original parameter value restored.  
 Fault value (r0949, parameter):  
 Parameter whose value was not able to be re-calculated.  
 See also: p0304, p0305, p0310, p0596, p2000, p2001, p2002, p2003, r2004

**Remedy:** Select the value of the reference parameter such that the parameter involved can be calculated in the per unit representation.  
 See also: p0304, p0305, p0310, p0596, p2000, p2001, p2002, p2003, r2004

**201035 <location>ACX: Boot from the back-up parameter back-up files**

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** When the Control Unit is booted, no complete data set was found from the parameter back-up files. The last time that the parameterization was saved, it was not completely carried out. Instead, a back-up data set or a back-up parameter back-up file is downloaded.  
 Alarm value (r2124, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:** If you have saved the project using the commissioning software, carry out a new download for your project. Save using the function "Copy RAM to ROM" or with p0977 = 1 so that all of the parameter files are again completely written to the non-volatile memory.

**201036 <location>ACX: Parameter back-up file missing**

**Message value:** %1

**Drive object:** All objects

**Reaction:** Infeed: NONE (OFF2)  
 Servo: NONE (OFF1, OFF2, OFF3)  
 Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY



<b>Cause:</b>	<p>When downloading the device parameterization, a parameter back-up file associated with a drive object cannot be found. Neither a PSxxxxyy.ACX, a PSxxxxyy.NEW nor a PSxxxxyy.BAK parameter back-up file exists in the non-volatile memory for this drive object.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>Byte 1: yyy in the file name PSxxxxyy.ACX</p> <p>yyy = 000 --&gt; consistency back-up file</p> <p>yyy = 001 ... 062 --&gt; drive object number</p> <p>yyy = 099 --&gt; PROFIBUS parameter back-up file</p> <p>Byte 2, 3, 4:</p> <p>Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<p>If you have saved the project data using the commissioning software, carry out a new download for your project. Save using the function "Copy RAM to ROM" or with p0977 = 1 so that all of the parameter files are again completely written to the non-volatile memory.</p> <p>If you have not saved the project data, then first commissioning of the system has to be carried out again.</p>

---

### 201037 <location>ACX: Re-naming the parameter back-up file unsuccessful

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	<p>Infeed: NONE (OFF2)</p> <p>Servo: NONE (OFF1, OFF2, OFF3)</p> <p>Vector: NONE (OFF1, OFF2, OFF3)</p>
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>Re-naming after saving a parameter back-up file in the non-volatile memory was unsuccessful.</p> <p>One of the parameter back-up files to be re-named had the "read only" attribute. The parameter back-up files are saved in the directory \USER\SINAMICS\DATA.</p> <p>It is possible that the non-volatile memory is defective.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>Byte 1: yyy in the file names PSxxxxyy.* or CAxxxxyy.* or CCxxxxyy.*</p> <p>yyy = 000 --&gt; consistency back-up file</p> <p>yyy = 099 --&gt; PROFIBUS parameter back-up file PSxxx099.*</p> <p>Byte 2: xxx in the file name PSxxxxyy.*</p> <p>xxx = 000 --&gt; data save started with p0977 = 1</p> <p>xxx = 010 --&gt; data save started with p0977 = 10</p> <p>xxx = 011 --&gt; data save started with p0977 = 11</p> <p>xxx = 012 --&gt; data save started with p0977 = 12</p> <p>Byte 4, 3:</p> <p>Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<p>- check whether one of the files to be overwritten has the attribute "read only" and change this file attribute to "writable".</p> <p>Check all of the files (PSxxxxyy.*, CCxxxxyy.*, CAxxxxyy.*) that belong to drive yyy designated in the fault value.</p> <p>- replace the memory card or Control Unit.</p>

---

### 201038 <location>ACX: Loading the parameter back-up file unsuccessful

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	<p>Infeed: NONE (OFF2)</p> <p>Servo: NONE (OFF1, OFF2, OFF3)</p> <p>Vector: NONE (OFF1, OFF2, OFF3)</p>
<b>Acknowledge:</b>	IMMEDIATELY

**Cause:** An error has occurred when downloading PSxxxxxy.ACX or PTxxxxxy.ACX files from the non-volatile memory.  
 Fault value (r0949, interpret hexadecimal):  
 Byte 1: yyy in the file name PSxxxxxy.ACX  
 yyy = 000 --> consistency back-up file  
 yyy = 001 ... 062 --> drive object number  
 yyy = 099 --> PROFIBUS parameter back-up file  
 Byte 2:  
 255 = incorrect drive object type  
 254 = topology comparison unsuccessful -> drive object type was not able to be identified  
 Reasons could be:  
 - incorrect component type in the actual topology  
 - component does not exist in the actual topology  
 - component not active  
 Otherwise for internal Siemens troubleshooting.  
 Byte 4, 3:  
 Only for internal Siemens troubleshooting.

**Remedy:**  
 - If you have saved the project data using the commissioning software, carry out a new download for your project. Save using the function "Copy RAM to ROM" or with p0977 = 1 so that all of the parameter files are again completely written to the non-volatile memory.  
 - replace the memory card or Control Unit.  
 - for byte 1 = 255:  
 Correct the drive object type (see p0107).

---

**201039 <location>ACX: Writing to the parameter back-up file was unsuccessful**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** Infeed: NONE (OFF2)  
 Servo: NONE (OFF1, OFF2, OFF3)  
 Vector: NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Writing to at least one parameter back-up file PSxxxxxy.\*\*\* in the non-volatile memory was unsuccessful.  
 - In the directory /USER/SINAMICS/DATA/ at least one parameter back-up file PSxxxxxy.\*\*\* has the "read only" file attribute and cannot be overwritten.  
 - There is not sufficient free memory space available.  
 - The non-volatile memory is defective and cannot be written to.  
 Fault value (r0949, interpret hexadecimal):  
 dcba hex  
 a = yyy in the file names PSxxxxxy.\*\*\*  
 a = 000 --> consistency back-up file  
 a = 001 ... 062 --> drive object number  
 a = 070 --> FEPROM.BIN  
 a = 080 --> DEL4BOOT.TXT  
 a = 099 --> PROFIBUS parameter back-up file  
 b = xxx in the file names PSxxxxxy.\*\*\*  
 b = 000 --> data save started with p0977 = 1  
 b = 010 --> data save started with p0977 = 10  
 b = 011 --> data save started with p0977 = 11  
 b = 012 --> data save started with p0977 = 12  
 d, c:  
 Only for internal Siemens troubleshooting.

**Remedy:**  
 - check the file attribute of the files (PSxxxxxy.\*\*\*, CAxxxxxy.\*\*\*, CCxxxxxy.\*\*\*) and, if required, change from "read only" to "writeable".  
 - check the free memory space in the non-volatile memory. Approx. 80 kbyte of free memory space is required for every drive object in the system.  
 - replace the memory card or Control Unit.

---

<b>201040</b>	<b>&lt;location&gt;Save parameter settings and carry out a POWER ON</b>
<b>Message value:</b>	-
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	A parameter was changed in the drive system which means that it is necessary to save the parameters and re-boot (e.g. p0110).
<b>Remedy:</b>	- save the parameters (p0971/p0977). - carry out a POWER ON (power off/on) for all components.

---

<b>201041</b>	<b>&lt;location&gt;Parameter save necessary</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Defective or missing files were detected on the memory card when booting. Fault value (r0949, decimal interpretation): 1: Source file cannot be opened. 2: Source file cannot be read. 3: Target directory cannot be set up. 4: Target file cannot be set up/opened. 5: Target file cannot be written to. Additional values: Only for internal Siemens troubleshooting.
<b>Remedy:</b>	- save the parameters. - download the project again to the drive unit. - update the firmware - if required, replace the Control Unit and/or memory card card.

---

<b>201042</b>	<b>&lt;location&gt;Parameter error during project download</b>
<b>Message value:</b>	Parameter: %1, Index: %2, fault cause: %3
<b>Drive object:</b>	All objects
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Vector: OFF2 (NONE, OFF1, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	An error was detected when downloading a project using the commissioning software (e.g. incorrect parameter value). For the specified parameter, it was detected that dynamic limits were exceeded that may possibly depend on other parameters. Fault value (r0949, interpret hexadecimal): ccbbaaaa hex aaaa = Parameter bb = Index cc = fault cause 0: Parameter number illegal. 1: Parameter value cannot be changed. 2: Lower or upper value limit exceeded. 3: Sub-index incorrect. 4: No array, no sub-index. 5: Data type incorrect. 6: Setting not permitted (only resetting).

- 7: Descriptive element cannot be changed.
- 9: Descriptive data not available.
- 11: No master control.
- 15: No text array available.
- 17: Task cannot be executed due to operating state.
- 20: Illegal value.
- 21: Response too long.
- 22: Parameter address illegal.
- 23: Format illegal.
- 24: Number of values not consistent.
- 25: Drive object does not exist.
- 101: Presently de-activated.
- 104: Illegal value.
- 107: Write access not permitted when controller enabled.
- 108: Unit unknown.
- 109: Write access only in the commissioning state, encoder (p0010 = 4).
- 110: Write access only in the commissioning state, motor (p0010 = 3).
- 111: Write access only in the commissioning state, power unit (p0010 = 2).
- 112: Write access only in the quick commissioning mode (p0010 = 1).
- 113: Write access only in the ready mode (p0010 = 0).
- 114: Write access only in the commissioning state, parameter reset (p0010 = 30).
- 115: Write access only in the Safety Integrated commissioning state (p0010 = 95).
- 116: Write access only in the commissioning state, technological application/units (p0010 = 5).
- 117: Write access only in the commissioning state (p0010 not equal to 0).
- 118: Write access only in the commissioning state, download (p0010 = 29).
- 119: Parameter may not be written in download.
- 120: Write access only in the commissioning state, drive basis configuration (device: p0009 = 3).
- 121: Write access only in the commissioning state, define drive type (device: p0009 = 2).
- 122: Write access only in the commissioning state, data set basis configuration (device: p0009 = 4).
- 123: Write access only in the commissioning state, device configuration (device: p0009 = 1).
- 124: Write access only in the commissioning state, device download (device: p0009 = 29).
- 125: Write access only in the commissioning state, device parameter reset (device: p0009 = 30).
- 126: Write access only in the commissioning state, device ready (device: p0009 = 0).
- 127: Write access only in the commissioning state, device (device: p0009 not equal to 0).
- 129: Parameter may not be written in download.
- 130: Transfer of the master control is inhibited via binector input p0806.
- 131: Required BICO interconnection not possible because BICO output does not supply floating value
- 132: Free BICO interconnection inhibited via p0922.
- 133: Access method not defined.
- 200: Below the valid values.
- 201: Above the valid values.
- 202: Cannot be accessed from the Basic Operator Panel (BOP).
- 203: Cannot be read from the Basic Operator Panel (BOP).
- 204: Write access not permitted.

**Remedy:**

- enter the correct value in the specified parameter.
- identify the parameter that restricts the limits of the specified parameter.

---

**201043 <location>Fatal error at project download**

**Message value:** Fault cause: %1  
**Drive object:** All objects  
**Reaction:** Infeed: OFF2 (OFF1)  
 Servo: OFF2 (OFF1, OFF3)  
 Vector: OFF2 (OFF1, OFF3)  
**Acknowledge:** IMMEDIATELY

<b>Cause:</b>	<p>A fatal error was detected when downloading a project using the commissioning software.</p> <p>Fault value (r0949, decimal interpretation):</p> <ol style="list-style-type: none"> <li>1: Device status cannot be changed to Device Download (drive object ON?).</li> <li>2: Incorrect drive object number.</li> <li>3: A drive object that has already been deleted is deleted again.</li> <li>4: Deleting of a drive object that has already been registered for generation.</li> <li>5: Deleting a drive object that does not exist.</li> <li>6: Generating an undeleted drive object that already existed.</li> <li>7: Regenerating a drive object already registered for generation.</li> <li>8: Maximum number of drive objects that can be generated exceeded.</li> <li>9: Error while generating a device drive object.</li> <li>10: Error while generating target topology parameters (p9902 and p9903).</li> <li>11: Error while generating a drive object (global component).</li> <li>12: Error while generating a drive object (drive component).</li> <li>13: Unknown drive object type.</li> <li>14: Drive status cannot be changed to "ready for operation" (p0947 and p0949).</li> <li>15: Drive status cannot be changed to drive download.</li> <li>16: Device status cannot be changed to "ready for operation".</li> <li>17: It is not possible to download the topology. The component wiring should be checked, taking into account the various messages/signals.</li> <li>18: A new download is only possible if the factory settings are restored for the drive unit.</li> <li>19: The slot for the option module has been configured several times (e.g. CAN and COMM BOARD)</li> <li>20: The configuration is inconsistent (e.g. CAN for Control Unit, however no CAN configured for drive objects A_INF, SERVO or VECTOR ).</li> </ol> <p>Additional values: only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- use the current version of the commissioning software.</li> <li>- modify the offline project and carry out a new download (e.g. compare the number of drive objects, motor, encoder, power unit in the offline project and at the drive).</li> <li>- change the drive state (is a drive rotating or is there a message/signal?).</li> <li>- carefully note any other messages/signals and remove their cause.</li> </ul>

## 201044 <location>CU: Descriptive data error

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	An error was detected when loading the descriptive data saved in the non-volatile memory.
<b>Remedy:</b>	Replace the memory card or Control Unit.

## 201045 <location>CU: Configuring data invalid

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>An error was detected when evaluating the parameter files PSxxxxyy.ACX, PTxxxxyy.ACX, CAxxxxyy.ACX, or CCxxxxyy.ACX saved in the non-volatile memory.</p> <p>Alarm value (r2124, interpret hexadecimal):</p> <p>Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<p>Restore the factory setting using (p0976 = 1) and re-load the project to the drive unit. Operation without any restrictions is then possible.</p> <p>After downloading the project, save the parameters in STARTER using "Copy RAM to ROM" or with p0977 = 1. This overwrites the incorrect parameter files in the non-volatile memory.</p>

---

**201049 <location>CU: It is not possible to write to file**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** It is not possible to write into a write-protected file (PSxxxxxx.acx). The write request was interrupted.  
 Alarm value (r2124, interpret decimal):  
 Drive object number.  
**Remedy:** Check whether the "write protected" attribute has been set for the files in the non-volatile memory under .../USER/SINAMICS/DATA/...  
 When required, remove write protection and save again (e.g. set p0977 to 1).

---

**201050 <location>Memory card and device incompatible**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (NONE, OFF1, OFF3)  
 Vector: OFF2 (NONE, OFF1, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The memory card and the device type do not match (e.g. a memory card for SINAMICS S is inserted in SINAMICS G).  
**Remedy:** - insert the matching memory card.  
 - use the matching Control Unit or power unit.

---

**201054 <location>CU: System limit exceeded**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** At least one system overload has been identified.  
 Fault value (r0949, decimal interpretation):  
 1: Computing time load too high (r9976[1]).  
 5: Peak load too high (r9976[5]).  
 See also: r9976 (System utilization)  
**Remedy:** Re fault value = 1, 5:  
 - reduce the computing time load of the drive unit (r9976[1] and r9976[5]) to under 100 %.  
 - check the sampling times and adjust if necessary (p0115, p0799, p4099).  
 - de-activate function modules.  
 - de-activate drive objects.  
 - remove drive objects from the target topology.  
 - note the DRIVE-CLiQ topology rules and if required, change the DRIVE-CLiQ topology.  
 When using the Drive Control Chart (DCC) or free function blocks (FBLOCKS), the following applies  
 - the computing time load of the individual run-time groups on a drive object can be read out in r21005 (DCC) or 20005 (FBLOCKS).  
 - if necessary, the assignment of the run-time group (p21000, p20000) can be changed in order to increase the sampling time (r21001, r20001).  
 - if necessary, reduce the number of cyclically calculated blocks (DCC) and/or function blocks (FBLOCKS).

---

**201064** <location>CU: Internal error (CRC)

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** CRC error in the Control Unit program memory  
**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

---

**201068** <location>CU: Data memory, memory overflow

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A data memory area has been overloaded.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: High-speed data memory 1 overloaded  
 Bit 1 = 1: High-speed data memory 2 overloaded  
 Bit 2 = 1: High-speed data memory 3 overloaded  
 Bit 3 = 1: High-speed data memory 4 overloaded  
**Remedy:**

- de-activate the function module.
- de-activate the drive object.
- remove the drive object from the target topology.

---

**201069** <location>Parameter backup and device incompatible

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The parameter backup on the memory card and the device type do not match (e.g. a memory card with the parameter backup of a SINAMICS S120 is inserted in SINAMICS G150).  
 The module boots with the factory settings.  
**Remedy:**

- insert a memory card with compatible parameter backup and carry out a POWER ON.
- insert a memory card without parameter backup and carry out a POWER ON.
- save the parameters (p0977 = 1).

---

**201099** <location>Tolerance window of time synchronization exited

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The time master exited the selected tolerance window for time synchronization.  
 See also: p3109 (RTC real time synchronization, tolerance window)  
**Remedy:** Select the re-synchronization interval so that the synchronization deviation between the time master and drive system lies within the tolerance window.  
 See also: r3108 (RTC last synchronization deviation)

---

**201100 <location>CU: Memory card withdrawn**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The memory card (non-volatile memory) was withdrawn during operation.  
 Notice:  
 It is not permissible for the memory card to be withdrawn or inserted under voltage.  
**Remedy:** - power down the drive system.  
 - re-insert the memory card that was withdrawn - this card must match the drive system.  
 - power up the drive system again.

---

**201105 <location>CU: Insufficient memory**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF1  
**Acknowledge:** POWER ON  
**Cause:** Too many functions have been configured on this Control Unit (e.g. too many drives, function modules, data sets, OA applications, blocks, etc).  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - change the configuration on this Control Unit (e.g. fewer drives, function modules, data sets, OA applications, blocks, etc).  
 - use an additional Control Unit.

---

**201107 <location>CU: Data save in the non-volatile memory unsuccessful**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A data save in the non-volatile memory was not able to be successfully carried out.  
 - non-volatile memory is defective.  
 - insufficient space in the non-volatile memory.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - try to save again.  
 - replace the memory card or Control Unit.

---

**201110 <location>CU: More than one SINAMICS G on one Control Unit**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** More than one SINAMICS G type power unit is being operated from the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Number of the second drive with a SINAMICS G type power unit.



**Remedy:** Only one SINAMICS G drive type is permitted.

---

**201111 <location>CU: Mixed operation of drive units illegal**

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** Illegal operation of various drive units on one Control Unit:  
- SINAMICS S together with SINAMICS G  
- SINAMICS S together with SINAMICS S Value or Combi  
Fault value (r0949, decimal interpretation):  
Number of the first drive object with a different power unit type.

**Remedy:** Only power units of one particular drive type may be operated with one Control Unit.

---

**201112 <location>CU: Power unit not permissible**

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The connected power unit cannot be used together with this Control Unit.  
Fault value (r0949, decimal interpretation):  
1: Power unit is not supported (e.g. PM240).  
2: DC/AC power unit connected to CU310 not permissible.

**Remedy:** Replace the power unit that is not permissible by a component that is permissible.

---

**201120 <location>Terminal initialization has failed**

**Message value:** %1

**Drive object:** All objects

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** An internal software error occurred while the terminal functions were being initialized.  
Fault value (r0949, interpret hexadecimal):  
Only for internal Siemens troubleshooting.

**Remedy:**  
- carry out a POWER ON (power off/on) for all components.  
- upgrade firmware to later version.  
- contact the Hotline.  
- replace the Control Unit.

---

**201122 <location>Frequency at the measuring probe input too high**

**Message value:** %1

**Drive object:** All objects

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** The frequency of the pulses at the measuring probe input is too high.  
Fault value (r0949, decimal interpretation):  
1: DI/DO 9 (X122.8)  
2: DI/DO 10 (X122.10)  
4: DI/DO 11 (X122.11)  
8: DI/DO 13 (X132.8)  
16: DI/DO 14 (X132.10)  
32: DI/DO 15 (X132.11)  
64: DI/DO 8 (X122.7)  
128: DI/DO 12 (X132.7)

**Remedy:** Reduce the frequency of the pulses at the measuring probe input.

---

**201150 <location>CU: Number of instances of a drive object type exceeded**

**Message value:** Drive object type: %1, number permitted: %2, actual number: %3  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The maximum permissible number of instances of a drive object type was exceeded.  
Fault value (r0949, interpret hexadecimal):  
ddccbbaa hex:  
aa: Drive object type (p0107), for which the maximum permissible number of instances was exceeded.  
bb: Max. permissible number of instances for this drive object type.  
cc: Actual number of instances for this drive object type.  
dd: No significance.

**Remedy:**

- power down the unit.
- suitably restrict the number of instances of a drive object type by reducing the number of inserted components.
- re-commission the unit.

---

**201151 <location>CU: Number of drive objects of a category exceeded**

**Message value:** Drive object category: %1, number permitted: %2, actual number: %3  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The maximum permissible number of drive objects of a category was exceeded.  
Fault value (r0949, interpret hexadecimal):  
ddccbbaa hex:  
aa: drive object category.  
bb: Max. permissible number for this drive object category.  
cc: Actual number for this drive object category.  
dd: No significance.

**Remedy:**

- power down the unit.
- suitably restrict the number of drive objects of the specified category by reducing the number of inserted components.
- re-commission the unit.

---

**201200 <location>CU: Time slice management internal software error**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** A time slice management error has occurred.  
 It is possible that the sampling times have been inadmissibly set.  
 Fault value (r0949, interpret hexadecimal):  
 998:  
 Too many time slices occupied by OA (e.g. DCC).  
 999:  
 Too many time slices occupied by the basic system. Too many different sampling times may have been set.  
 Additional values:  
 Only for internal Siemens troubleshooting.

**Remedy:** - check the sampling time setting (p0112, p0115, p4099).  
 - contact the Hotline.

### 201205 <location>CU: Time slice overflow

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** Insufficient processing time is available for the existing topology.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:** - reduce the number of drives.  
 - increase the sampling times.

### 201221 <location>CU: Bas clk cyc too low

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The closed-loop control / monitoring cannot maintain the envisaged clock cycle.  
 The runtime of the closed-loop control/monitoring is too long for the particular clock cycle or the computing time remaining in the system is not sufficient for the closed-loop control/monitoring.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:** Increase the basic clock cycle of DRIVE-CLiQ communication.  
 See also: p0112 (Sampling times pre-setting p0115)

### 201223 <location>CU: Sampling time inconsistent

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When changing a sampling time (p0115[0], p0799 or p4099), inconsistency between the clock cycles has been identified.  
 Alarm value (r2124, interpret decimal):  
 1: Value, low minimum value.  
 2: Value, high maximum value.  
 3: Value not a multiple of 1.25 µs.  
 4: Value does not match clock-cycle synchronous PROFIBUS operation.  
 5: Value not a multiple of 125 µs.

- 6: Value not a multiple of 250  $\mu$ s.
  - 7: Value not a multiple of 375  $\mu$ s.
  - 8: Value not a multiple of 400  $\mu$ s.
  - 10: Special restriction of the drive object violated.
  - 20: On a SERVO with a sampling time of 62.5  $\mu$ s, more than two drive objects or one drive object of a type other than SERVO have been detected on the same DRIVE-CLiQ line (a maximum of two SERVO type drive objects are permitted).
  - 21: Value can be a multiple of the current controller sampling time of a servo or vector drive in the system (e.g. for TB30, the values of all of the indices should be taken into account).
  - 30: Value less than 31.25  $\mu$ s.
  - 31: Value less than 62.5  $\mu$ s.
  - 32: Value less than 125  $\mu$ s.
  - 40: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 125  $\mu$ s. Further, none of the nodes has a sampling time of less than 125  $\mu$ s.
  - 41: A chassis unit was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than 250  $\mu$ s.
  - 42: An Active Line Module was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than 125  $\mu$ s.
  - 43: A Voltage Sensing Module (VSM) was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is not equal to the current controller sampling time of the drive object of the VSM.
  - 44: The highest common denominator of the sampling times of all of the components connected to the DRIVE-CLiQ line is not the same for all components of this drive object (e.g. there are components on different DRIVE-CLiQ lines on which different highest common denominators are generated).
  - 45: A chassis parallel unit was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than: 162.5  $\mu$ s or 187.5  $\mu$ s (for 2 or 3x parallel connection).
  - 46: A node has been identified on the DRIVE-CLiQ line whose sampling time is not a multiple of the lowest sampling time on this line.
  - 52: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 31.25  $\mu$ s.
  - 54: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 62.5  $\mu$ s.
  - 56: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 125  $\mu$ s.
  - 58: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 250  $\mu$ s.
  - 99: Inconsistency of cross drive objects detected.
  - 116: Recommended clock cycle in r0116[0...1].
- General note:  
 The topology rules should be noted when connecting up DRIVE-CLiQ (refer to the appropriate product documentation).  
 The parameters of the sampling times can also be changed with automatic calculations.  
 Example for highest common denominator: 125  $\mu$ s, 125  $\mu$ s, 62.5  $\mu$ s --> 62.5  $\mu$ s

**Remedy:**

- check the DRIVE-CLiQ cables.
  - set a valid sampling time.
- See also: p0115, p0799, p4099

**201224 <location>CU: Pulse frequency inconsistent**

- Message value:** %1
- Drive object:** All objects
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** When changing the minimum pulse frequency (p0113) inconsistency between the pulse frequencies was identified.  
 Alarm value (r2124, interpret decimal):  
 1: Value, low minimum value.  
 2: Value, high maximum value.  
 3: Resulting sampling time is not a multiple of 1.25  $\mu$ s.

4: Value does not match clock-cycle synchronous PROFIBUS operation.  
 10: Special restriction of the drive object violated.  
 99: Inconsistency of cross drive objects detected.  
 116: Recommended clock cycle in r0116[0...1].

**Remedy:** Set a valid pulse frequency.  
 See also: p0113 (Minimum pulse frequency, selection)

### **201250 <location>CU: CU-EEPROM incorrect read-only data**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE (OFF2)  
**Acknowledge:** POWER ON  
**Cause:** Error when reading the read-only data of the EEPROM in the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - carry out a POWER ON.  
 - replace the Control Unit.

### **201251 <location>CU: CU-EEPROM incorrect read-write data**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when reading the read-write data of the EEPROM in the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Only for internal Siemens troubleshooting.  
**Remedy:** For alarm value r2124 < 256, the following applies:  
 - carry out a POWER ON.  
 - replace the Control Unit.  
 For alarm value r2124 >= 256, the following applies:  
 - for the drive object with this alarm, clear the fault memory (p0952 = 0).  
 - as an alternative, clear the fault memory of all drive objects (p2147 = 1).  
 - replace the Control Unit.

### **201255 <location>CU: Option Board EEPROM read-only data error**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE (OFF2)  
**Acknowledge:** POWER ON  
**Cause:** Error when reading the read-only data of the EEPROM in the Option Board.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - carry out a POWER ON.  
 - replace the Control Unit.

---

**201256 <location>CU: Option Board EEPROM read-write data error**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when reading the read-write data of the EEPROM in the Option Board.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - carry out a POWER ON.  
 - replace the Control Unit.

---

**201303 <location>DRIVE-CLiQ component does not support the required function**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A function requested by the Control Unit is not supported by a DRIVE-CLiQ component.  
 Fault value (r0949, decimal interpretation):  
 1: The component does not support the de-activation.  
 101: The Motor Module does not support an internal armature short-circuit.  
 102: The Motor Module does not support the de-activation.  
 201: The Sensor Module does not support actual value inversion (p0410.0 = 1) when using a Hall sensor (p0404.6 = 1) for the commutation.  
 202: The Sensor Module does not support parking/unparking.  
 203: The Sensor Module does not support the de-activation.  
 204: The firmware of this Terminal Module 15 (TM15) does not support the application TM15DI/DO.  
 205: The Sensor Module does not support the selected temperature evaluation (r0458).  
 206: The firmware of this Terminal Modules TM41/TM31/TM15 refers to an old firmware version. It is urgently necessary to upgrade the firmware to ensure disturbance-free operation.  
 207: The power unit with this hardware version does not support operation with device supply voltages of less than 380 V.  
 208: The Sensor Module does not support de-selection of commutation with zero mark (via p0430.23).  
 211: The Sensor Module does not support single-track encoders (r0459.10).  
 212: The Sensor Module does not support LVDT sensors (p4677.0).  
 213: The Sensor Module does not support the characteristic type (p4662).  
**Remedy:** Upgrade the firmware of the DRIVE-CLiQ component involved.  
 For fault value = 205:  
 Check parameter p0600 and p0601 and if required, adapt interpretation.  
 For fault value = 207:  
 Replace the power unit or if required set the device supply voltage higher (p0210).  
 For fault value = 208:  
 Check parameter p0430.23 and reset if necessary.

---

**201304 <location>Firmware version of DRIVE-CLiQ component is not up-to-date**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The non-volatile memory has a more recent firmware version than the one in the connected DRIVE-CLiQ component.  
 Alarm value (r2124, interpret decimal):  
 Component number of the DRIVE-CLiQ component involved.  
**Remedy:** Update the firmware (p7828, p7829 and commissioning software).

---

<b>201305</b>	<b>&lt;location&gt;Topology: Component number missing</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The component number from the topology was not parameterized (p0121 (for power unit, refer to p0107), p0131 (for servo/vector drives, refer to p0107), p0141, p0151, p0161). Fault value (r0949, decimal interpretation): Data set number. Note: The fault also occurs if speed encoders have been configured (p0187 to p0189) but no component numbers exist for them. In this case, the fault value includes the drive data set number plus 100 * encoder number (e.g. 3xx, if a component number was not entered in p0141 for the third encoder (p0189)). See also: p0121, p0131, p0141, p0142, p0151, p0161, p0186, p0187, p0188, p0189
<b>Remedy:</b>	Enter the missing component number or remove the component and restart commissioning. See also: p0121, p0131, p0141, p0142, p0151, p0161, p0186, p0187, p0188, p0189

---

<b>201306</b>	<b>&lt;location&gt;Firmware of the DRIVE-CLiQ component being updated</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	Firmware update is active for at least one DRIVE-CLiQ component. Alarm value (r2124, interpret decimal): Component number of the DRIVE-CLiQ component.
<b>Remedy:</b>	Not necessary. This alarm automatically disappears after the firmware has been updated.

---

<b>201314</b>	<b>&lt;location&gt;Topology: Component must not be present</b>
<b>Message value:</b>	Component number: %1, Component class: %2, Connection number: %3
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	For a component, "de-activate and not present" is set but this component is still in the topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: aa = component number bb = component class of the component cc = connection number Note: Component class and connection number are described in F01375.
<b>Remedy:</b>	- remove the corresponding component. - change the setting "de-activate and not present". Note: Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison). See also: p0105, p0125, p0145, p0155, p0165

---

**201315**            **<location>Drive object not ready for operation**

**Message value:**        -  
**Drive object:**        All objects  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              For the active drive object involved, at least one activated component is missing.  
                            Note:  
                            All other active and operational drive objects can be in the "RUN" state.  
**Remedy:**              The alarm automatically disappears again with the following actions:  
                            - de-activate the drive object involved (p0105 = 0).  
                            - de-activate the components involved (p0125 = 0, p0145 = 0, p0155 = 0, p0165 = 0).  
                            - re-insert the components involved.  
                            See also: p0105, p0125, p0145, p0155, p0165

---

**201316**            **<location>Drive object inactive and again ready for operation**

**Message value:**        -  
**Drive object:**        All objects  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              If, when inserting a component of the target topology, an inactive, non-operational drive object becomes operational again. The associated parameter of the component is, in this case, set to "activate" (p0125, p0145, p0155, p0165).  
                            Note:  
                            This is the only message that is displayed for a de-activated drive object.  
**Remedy:**              The alarm automatically disappears again with the following actions:  
                            - activate the drive object involved (p0105 = 1).  
                            - again withdraw the components involved.  
                            See also: p0105 (Activate/de-activate drive object)

---

**201317**            **<location>De-activated component again present**

**Message value:**        -  
**Drive object:**        All objects  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              If a component of the target topology for an active drive object is inserted and the associated parameter of the component is set to "de-activate" (p0125, p0145, p0155, p0165).  
                            Note:  
                            This is the only message that is displayed for a de-activated component.  
**Remedy:**              The alarm automatically disappears again with the following actions:  
                            - activate the components involved (p0125 = 1, p0145 = 1, p0155 = 1, p0165 = 1).  
                            - again withdraw the components involved.  
                            See also: p0125 (Activate/de-activate power unit components), p0145, p0155, p0165 (Activate/de-activate filter module)

---

**201318**            **<location>BICO: De-activated interconnections present**

**Message value:**        %1  
**Drive object:**        All objects  
**Reaction:**            NONE  
**Acknowledge:**        NONE



---

<b>Cause:</b>	This alarm is used in the following cases: - If an inactive/non-operational drive object is active again/ready for operation - If there are items in the list of BI/CI parameters (r9498[0...29], r9499[0...29]) - If the BICO interconnections saved in the list of BI/CI parameters (r9498[0...29], r9499[0...29]) have actually been changed
<b>Remedy:</b>	Reset alarm: - Set p9496 to 1 or 2 or - de-activate the drive object again.

---

### 201319 <location>Inserted component not initialized

<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	Initialization is required for at least one inserted component. This is only possible if the pulses are inhibited for all the drive objects.
<b>Remedy:</b>	Activate pulse inhibit for all drive objects.

---

### 201320 <location>Topology: Drive object number does not exist in configuration

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	A drive object number is missing in p0978 Alarm value (r2124, interpret decimal): Index of p0101 under which the missing drive object number can be determined.
<b>Remedy:</b>	Set p0009 to 1 and change p0978: Rules: - p0978 must include all of the drive object numbers (p0101). - it is not permissible for a drive object number to be repeated. - by entering a 0, the drive objects with PZD are separated from those without PZD. - only 2 partial lists are permitted. After the second 0, all values must be 0. - dummy drive object numbers (255) are only permitted in the first partial list.

---

### 201321 <location>Topology: Drive object number does not exist in configuration

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	p0978 contains a drive object number that does not exist. Alarm value (r2124, interpret decimal): Index of p0978 under which the drive object number can be determined.

**Remedy:** Set p0009 to 1 and change p0978:  
**Rules:**  
 - p0978 must include all of the drive object numbers (p0101).  
 - it is not permissible for a drive object number to be repeated.  
 - by entering a 0, the drive objects with PZD are separated from those without PZD.  
 - only 2 partial lists are permitted. After the second 0, all values must be 0.  
 - dummy drive object numbers (255) are only permitted in the first partial list.

**201322 <location>Topology: Drive object number present twice in configuration**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A drive object number is present more than once in p0978.  
 Alarm value (r2124, interpret decimal):  
 Index of p0978 under which the involved drive object number is located.

**Remedy:** Set parameter p0009 = 1 and change p0978:  
**Rules:**  
 - p0978 must include all of the drive object numbers (p0101).  
 - it is not permissible for a drive object number to be repeated.  
 - by entering a 0, the drive objects with PZD are separated from those without PZD.  
 - only 2 partial lists are permitted. After the second 0, all values must be 0.  
 - dummy drive object numbers (255) are only permitted in the first partial list.

**201323 <location>Topology: More than two partial lists created**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Partial lists are available more than twice in p0978. After the second 0, all must be 0.  
 Alarm value (r2124, interpret decimal):  
 Index of p0978 under which the illegal value is located.

**Remedy:** Set p0009 to 1 and change p0978:  
**Rules:**  
 - p0978 must include all of the drive object numbers (p0101).  
 - it is not permissible for a drive object number to be repeated.  
 - by entering a 0, the drive objects with PZD are separated from those without PZD.  
 - only 2 partial lists are permitted. After the second 0, all values must be 0.  
 - dummy drive object numbers (255) are only permitted in the first partial list.

**201324 <location>Topology: Dummy drive object number incorrectly created**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In p0978, dummy drive object numbers (255) are only permitted in the first partial list.  
 Alarm value (r2124, interpret decimal):  
 Index of p0978 under which the illegal value is located.

**Remedy:** Set p0009 to 1 and change p0978:  
 Rules:  
 - p0978 must include all of the drive object numbers (p0101).  
 - it is not permissible for a drive object number to be repeated.  
 - by entering a 0, the drive objects with PZD are separated from those without PZD.  
 - only 2 partial lists are permitted. After the second 0, all values must be 0.  
 - dummy drive object numbers (255) are only permitted in the first partial list.

### 201325 <location>Topology: Component Number not present in target topology

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The component configured in a parameter (e.g. p0121, p0131, etc.) is not present in the target topology.  
 Alarm value (r2124, interpret decimal):  
 Configured Component Number that is not present in target topology.  
**Remedy:** Establish topology and DO configuration consistency.

### 201330 <location>Topology: Quick commissioning not possible

**Message value:** Fault cause: %1, supplementary information: %2, preliminary component number: %3  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Unable to carry out a quick commissioning. The existing actual topology does not fulfill the requirements.  
 Alarm value (r2124, interpret hexadecimal):  
 ccccbbaa hex: cccc = preliminary component number, bb = supplementary information, aa = fault cause  
 aa = 01 hex = 1 dec:  
 On one component illegal connections were detected.  
 - bb = 01 hex = 1 dec: For a Motor Module, more than one motor with DRIVE-CLiQ was detected.  
 - bb = 02 hex = 2 dec: For a motor with DRIVE-CLiQ, the DRIVE-CLiQ cable is not connected to a Motor Module.  
 aa = 02 hex = 2 dec:  
 The topology contains too many components of a particular type.  
 - bb = 01 hex = 1 dec: There is more than one master Control Unit.  
 - bb = 02 hex = 2 dec: There is more than 1 infeed (8 for a parallel circuit configuration).  
 - bb = 03 hex = 3 dec: There are more than 10 Motor Modules (8 for a parallel circuit configuration).  
 - bb = 04 hex = 4 dec: There are more than 9 encoders.  
 - bb = 05 hex = 5 dec: There are more than 8 Terminal Modules.  
 - bb = 07 hex = 7 dec: Unknown component type  
 - bb = 08 hex = 8 dec: There are more than 6 drive slaves.  
 - bb = 09 hex = 9 dec: Connection of a drive slave not permitted.  
 - bb = 0a hex = 10 dec: There is no drive master.  
 - bb = 0b hex = 11 dec: There is more than one motor with DRIVE-CLiQ for a parallel circuit.  
 - bb = 0c hex = 12 dec: Different power units are being used in a parallel connection.  
 - cccc: Not used.  
 aa = 03 hex = 3 dec:  
 More than 16 components are connected at a DRIVE-CLiQ socket of the Control Unit.  
 - bb = 0, 1, 2, 3 means e.g. detected at the DRIVE-CLiQ socket X100, X101, X102, X103.  
 - cccc: Not used.  
 aa = 04 hex = 4 dec:  
 The number of components connected one after the other is greater than 125.  
 - bb: Not used.  
 - cccc = preliminary component number of the first component and component that resulted in the fault.

aa = 05 hex = 5 dec:  
 The component is not permissible for SERVO.  
 - bb = 01 hex = 1 dec: SINAMICS G available.  
 - bb = 02 hex = 2 dec: Chassis available.  
 - cccc = preliminary component number of the first component and component that resulted in the fault.  
 aa = 06 hex = 6 dec:  
 On one component illegal EEPROM data was detected. These must be corrected before the system continues to boot.  
 - bb = 01 hex = 1 dec: The Order No. [MLFB] of the power unit that was replaced includes a space retainer. The space retainer (\*) must be replaced by a correct character.  
 - cccc = preliminary component number of the component with illegal EEPROM data.  
 aa = 07 hex = 7 dec:  
 The actual topology contains an illegal combination of components.  
 - bb = 01 hex = 1 dec: Active Line Module (ALM) and Basic Line Module (BLM).  
 - bb = 02 hex = 2 dec: Active Line Module (ALM) and Smart Line Module (SLM).  
 - bb = 03 hex = 3 dec: SIMOTION control (e.g. SIMOTION D445) and SINUMERIK component (e.g. NX15).  
 - bb = 04 hex = 4 dec: SINUMERIK control (e.g. SINUMERIK 730.net) and SIMOTION component (e.g. CX32).  
 - cccc: Not used.  
 Note:  
 Connection type and connection number are described in F01375.  
 See also: p0097 (Select drive object type), r0098 (Actual device topology), p0099 (Device target topology)

**Remedy:**

- adapt the output topology to the permissible requirements.
- carry out commissioning using the commissioning software.
- for motors with DRIVE-CLiQ, connect the power and DRIVE-CLiQ cable to the same Motor Module (Single Motor Module: DRIVE-CLiQ at X202, Double Motor Module: DRIVE-CLiQ from motor 1 (X1) to X202, from motor 2 (X2) to X203).

Re aa = 06 hex = 6 dec and bb = 01 hex = 1 dec:  
 Correct the order number when commissioning using the commissioning software.  
 See also: p0097 (Select drive object type), r0098 (Actual device topology), p0099 (Device target topology)

---

**201331**                      **<location>Topology: At least one component not assigned to a drive object**

**Message value:**            Component number: %1  
**Drive object:**             All objects  
**Reaction:**                 NONE  
**Acknowledge:**            NONE  
**Cause:**                    At least one component is not assigned to a drive object.  
                                  - when commissioning, a component was not able to be automatically assigned to a drive object.  
                                  - the parameters for the data sets are not correctly set.  
**Alarm value (r2124, interpret decimal):**  
 Component number of the unassigned component.

**Remedy:**                    This component is assigned to a drive object.  
 Check the parameters for the data sets.  
**Examples:**  
 - power unit (p0121).  
 - motor (p0131, p0186).  
 - encoder interface (p0140, p0141, p0187 ... p0189).  
 - encoder (p0140, p0142, p0187 ... p0189).  
 - Terminal Module (p0151).  
 - option board (p0161).

---

**201340**                      **<location>Topology: Too many components on one line**

**Message value:**            Component number or connection number: %1, fault cause: %2  
**Drive object:**             All objects  
**Reaction:**                 NONE  
**Acknowledge:**            IMMEDIATELY

<b>Cause:</b>	<p>For the selected communications clock cycle, too many DRIVE-CLiQ components are connected to one line of the Control Unit.</p> <p>Fault value (r0949, interpret hexadecimal):  xyy hex: x = fault cause, yy = component number or connection number.</p> <p>1yy:  The communications clock cycle of the DRIVE-CLiQ connection on the CU is not sufficient for all read transfers.</p> <p>2yy:  The communications clock cycle of the DRIVE-CLiQ connection on the CU is not sufficient for all write transfers.</p> <p>3yy:  Cyclic communication is fully utilized.</p> <p>4yy:  The DRIVE-CLiQ cycle starts before the earliest end of the application. An additional dead time must be added to the control. Sign-of-life errors can be expected.</p> <p>5yy:  Internal buffer overflow for net data of a DRIVE-CLiQ connection.</p> <p>6yy:  Internal buffer overflow for receive data of a DRIVE-CLiQ connection.</p> <p>7yy:  Internal buffer overflow for send data of a DRIVE-CLiQ connection.</p> <p>8yy:  The component clock cycles cannot be combined with one another</p> <p>900:  The lowest common multiple of the clock cycles in the system is too high to be determined.</p> <p>901:  The lowest common multiple of the clock cycles in the system cannot be generated with the hardware.</p>
<b>Remedy:</b>	<p>Check the DRIVE-CLiQ connection.</p> <p>Reduce the number of components on the DRIVE-CLiQ line involved and distribute these to other DRIVE-CLiQ sockets of the Control Unit. This means that communication is uniformly distributed over several lines.</p> <p>When using DCC, the scope of the DCC logic can also become a problem.</p> <p>Re fault value = 1yy - 4yy in addition:  - increase the sampling times (p0112, p0115, p4099).  - reduce the DCC logic</p> <p>Re fault value = 8yy in addition:  - check the clock cycles settings (p0112, p0115, p4099). Clock cycles on a DRIVE-CLiQ line must be perfect integer multiples of one another. As clock cycle on a line, all clock cycles of all drive objects in the previously mentioned parameters apply, which have components on the line involved.</p> <p>Re fault value = 9yy in addition:  - check the clock cycles settings (p0112, p0115, p4099). The lower the numerical value difference between two clock cycles, the higher the lowest common multiple. This behavior has a significantly stronger influence, the higher the numerical values of the clock cycles.</p>

**201354****<location>Topology: Actual topology indicates an illegal component**

<b>Message value:</b>	Fault cause: %1, component number: %2
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The actual topology indicates at least one illegal component.</p> <p>Fault value (r0949, interpret hexadecimal):  yyxx hex: yy = component number, xx = cause.</p> <p>xx = 1: Component at this Control Unit not permissible.  xx = 2: Component in combination with another component not permissible.</p> <p>Note:  Pulse enable is prevented.</p>
<b>Remedy:</b>	Remove the illegal components and restart the system.

<b>201355</b>	<b>&lt;location&gt;Topology: Actual topology changed</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The device target topology (p0099) does not correspond to the device actual topology (r0098).                      The fault only occurs if the topology was commissioned using the automatic internal device mechanism and not using the commissioning software.                      Fault value (r0949, decimal interpretation):                      Only for internal Siemens troubleshooting.                      See also: r0098 (Actual device topology), p0099 (Device target topology)</p>
<b>Remedy:</b>	<p>One of the following counter-measures can be selected if no faults have occurred in the topology detection itself:                      If commissioning is still not completed:</p> <ul style="list-style-type: none"> <li>- carry out a self-commissioning routine (starting from p0009 = 1).</li> </ul> <p>In general:                      Set p0099 = r0098, set p0009 = 0; for existing Motor Modules, this results in servo drives being automatically generated (p0107).                      Generating servo drives: Set p0097 to 1, set p0009 to 0.                      Generating vector drives: Set p0097 to 2, set p0009 to 0.                      Generating vector drives with parallel circuit: Set p0097 to 12, set p0009 to 0.                      In order to set configurations in p0108, before setting p0009 to 0, it is possible to first set p0009 to 2 and modify p0108. The index corresponds to the drive object (p0107).                      If commissioning has already been completed:</p> <ul style="list-style-type: none"> <li>- re-establish the original connections and re-connect power to the Control Unit.</li> <li>- restore the factory setting for the complete equipment (all of the drives) and allow automatic self-commissioning again.</li> <li>- change the device parameterization to match the connections (this is only possible using the commissioning software).</li> </ul> <p>Notice:                      Topology changes that result in this fault being generated cannot be accepted by the automatic function in the device, but must be transferred using the commissioning software and parameter download. The automatic function in the device only allows constant topology to be used. Otherwise, when the topology is changed, all of the previous parameter settings are lost and replaced by the factory setting.                      See also: r0098 (Actual device topology)</p>

---

<b>201356</b>	<b>&lt;location&gt;Topology: Defective components in actual topology</b>
<b>Message value:</b>	Fault cause: %1, Component number: %2, Connection number: %3
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The actual topology indicates at least one defective DRIVE-CLiQ component.                      Fault value (r0949, interpret hexadecimal):                      zzyyxx hex:                      zz = connection number of component before the defective component                      yy = component number of component before the defective component                      xx = fault cause                      xx = 1: Component at this Control Unit not permissible.                      Note:                      Pulse enable is withdrawn and prevented.</p>
<b>Remedy:</b>	Remove the defective components and restart the system.

---

<b>201360</b>	<b>&lt;location&gt;Topology: Actual topology not permissible</b>
<b>Message value:</b>	Fault cause: %1, preliminary component number: %2
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The detected actual topology is not permissible.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>ccccbaa hex: cccc = preliminary component number, aa = fault cause</p> <p>aa = 01 hex = 1 dec: Too many components were detected at the Control Unit. A maximum of 199 components is permissible.</p> <p>aa = 02 hex = 2 dec: The component type of a component is not known.</p> <p>aa = 03 hex = 3 dec: It is illegal to combine ALM and BLM.</p> <p>aa = 04 hex = 4 dec: It is illegal to combine ALM and SLM.</p> <p>aa = 05 hex = 5 dec: It is illegal to combine BLM and SLM.</p> <p>aa = 06 hex = 6 dec: A CX32 was not directly connected to a permitted Control Unit.</p> <p>aa = 07 hex = 7 dec: An NX10 or NX15 was not directly connected to a permitted Control Unit.</p> <p>aa = 08 hex = 8 dec: A component was connected to a Control Unit that is not permitted for this purpose.</p> <p>aa = 09 hex = 9 dec: A component was connected to a Control Unit with out-of-date firmware.</p> <p>aa = 0A hex = 10 dec: Too many components of a particular type detected.</p> <p>aa = 0B hex = 11 dec: Too many components of a particular type detected on a single line.</p> <p>Note: The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.</p>
<b>Remedy:</b>	<p>Re fault cause = 1: Change the configuration. Connect less than 199 components to the Control Unit.</p> <p>Re fault cause = 2: Remove the component with unknown component type.</p> <p>Re fault cause = 3, 4, 5: Establish a valid combination.</p> <p>Re fault cause = 6, 7: Connect the expansion module directly to a permitted Control Unit.</p> <p>Re fault cause = 8: Remove component or use a permissible component.</p> <p>Re fault cause = 9: Upgrade the firmware of the Control Unit to a later version.</p> <p>Re fault cause = 10, 11: Reduce the number of components.</p>

---

<b>201361</b>	<b>&lt;location&gt;Topology: Actual topology contains SINUMERIK and SIMOTION components</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE

**Cause:** The detected actual topology contains SINUMERIK and SIMOTION components.  
 The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.  
 Alarm value (r2124, interpret hexadecimal):  
 ddcbbbaa hex: cc = fault cause, bb = component class of the actual topology, aa = component number of the component  
 cc = 01 hex = 1 dec:  
 An NX10 or NX15 was connected to a SIMOTION control.  
 cc = 02 hex = 2 dec:  
 A CX32 was connected to a SINUMERIK control.

**Remedy:** Re alarm value = 1:  
 Replace all NX10 or NX15 by a CX32.  
 Re alarm value = 2:  
 Replace all CX32 by an NX10 or NX15.

**201362** <location>Topology: Topology rule(s) broken

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** At least one topology rule for the SINAMICS S120 Combi has been broken.  
 In the event of a fault, the ramping up of the drive system is aborted and closed-loop drive control is not enabled.  
 Alarm value (r2124, interpret decimal):  
 The alarm value indicates which rule has been violated.  
 1: The S120 Combi may only be wired via DRIVE-CLiQ socket X200 to X100 on the NCU.  
 2: Only one Single Motor Module (SMM) or one Double Motor Module (DMM) may be connected via X200 to the DRIVE-CLiQ socket X101 on the NCU.  
 3: Only one Terminal Module 54F (TM54F) or one DRIVE-CLiQ Hub Module (hub) may be connected via X500 to the DRIVE-CLiQ socket X102 on the NCU.  
 4: Only Sensor Modules may be connected to DRIVE-CLiQ sockets X201 up to X203 (3-axis) or X204 (4-axis) on the S120 Combi.  
 5: Only one Sensor Module, type SMC20 or SME20 may be connected to DRIVE-CLiQ socket X205 (X204 is not available for 3-axis).  
 6: If a Single Motor Module is being used as the first expansion axis, only one more Single Motor Module may be connected (via X200 to X201 on the first Single Motor Module).  
 7: Only Sensor Modules may be connected to the corresponding DRIVE-CLiQ socket X202 on any Single Motor Modules which may be present.  
 8: For a second Single Motor Module or for a Double Motor Module, it is not permissible to connect anything at X201.  
 9: If a Double Motor Module is used as an expansion axis, only Sensor Modules may be connected to X202 and X203.  
 10: If a Terminal Module 54F (TM54F) is configured, only one DRIVE-CLiQ Hub Module (DMC20, DME20) may be connected to X501 of the TM54F module via DRIVE-CLiQ socket X500.  
 11: On the DRIVE-CLiQ Hub Module, only Sensor Modules Cabinet (SMC) and Sensor Modules External (SME) may be connected to X501 through X505.  
 12: Only certain Motor Modules may be used for expansion axes.  
 13: For an S120 Combi with 3 axes, nothing must be connected at the DRIVE-CLiQ Hub Module at X503.

**Remedy:** Evaluate the fault value and ensure compliance with the corresponding topology rule(s).

**201375** <location>Topology: Actual topology, duplicate connection between two components

**Message value:** Preliminary component number: %1, component class: %2, connection number: %3  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY



<b>Cause:</b>	<p>When detecting the actual topology, a ring-type connection was detected.          Fault value (r0949, interpret hexadecimal):          ccbbaaaa hex:          cc = connection number          bb = component class          aaaa = preliminary component number of a component included in the ring          Component class:          1: Control Unit.          2: Motor Module.          3: Line Module.          4: Sensor Module (SM).          5: Voltage Sensing Module (VSM).          6: Terminal Module (TM).          7: DRIVE-CLiQ Hub Module.          8: Controller Extension 32 (CX32, NX10, NX15).          9: Filter Module          49: DRIVE-CLiQ components (non-listed components).          50: Option Slot (e.g. Terminal Board 30).          60: Encoder (e.g. EnDat).          70: Motor with DRIVE-CLiQ.          Component type:          Precise designation within a component class (e.g. "SMC20").          Connection number:          Consecutive numbers, starting from zero, of the appropriate connection or slot (e.g. DRIVE-CLiQ connection X100 on the Control Unit has the connection number 0).</p>
<b>Remedy:</b>	<p>Output the fault value and remove the specified connection.          Note:          Under "Topology --&gt; Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).</p>

---

### 201380 <location>Topology: Actual topology, defective EEPROM

<b>Message value:</b>	Preliminary component number: %1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	<p>When detecting the actual topology, a component with a defective EEPROM was detected.          Fault value (r0949, interpret hexadecimal):          bbbbaaaa hex:          aaaa = preliminary component number of the defective components</p>
<b>Remedy:</b>	Output the fault value and remove the defected component.

---

### 201381 <location>Topology: Comparison power unit shifted

<b>Message value:</b>	Component number: %1, Component class: %2, Component (target): %3, Connection number: %4
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>The topology comparison has detected a power unit in the actual topology that has been shifted with respect to the target topology.          Alarm value (r2124, interpret hexadecimal):          ddccbbaa hex:          dd = connection number          cc = component number          bb = component class          aa = component number of the component shifted in the target topology</p>

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.

- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.

- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201382**

**<location>Topology: Comparison Sensor Module shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a Sensor Module in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb.

Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.

- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.

- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201383**

**<location>Topology: Comparison Terminal Module shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a Terminal Module in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.
- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.
- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201384**

**<location>Topology: Comparison DRIVE-CLiQ Hub Module shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a DRIVE-CLiQ Hub Module in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.
- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.
- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201385**

**<location>Topology: Comparison CX32 shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a controller extension 32 (CX32) in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.

- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.

- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201386**

**<location>Topology: Comparison DRIVE-CLiQ component shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a DRIVE-CLiQ component in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.

- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.

- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201387**

**<location>Topology: Comparison option slot component shifted**

**Message value:**

Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected a option slot component in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

**Note:**

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.
- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.
- automatically remove the topology error (p9904).

**Note:**

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201388****<location>Topology: Comparison EnDat encoder shifted**

**Message value:** Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The topology comparison has detected an EnDat encoder in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

**Note:**

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb.

Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.
- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.
- automatically remove the topology error (p9904).

**Note:**

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201389****<location>Topology: Comparison motor with DRIVE-CLiQ shifted**

**Message value:** Component number: %1, Component class: %2, Component (target): %3, Connection number: %4

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The topology comparison has detected a motor with DRIVE-CLiQ in the actual topology that has been shifted with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number

cc = component number

bb = component class

aa = component number of the component shifted in the target topology

Note:

The connection in the actual topology where the shifted component was detected is described in dd, cc and bb. Component class and connection number are described in F01375.

The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:

- undo the change to the actual topology by changing over the DRIVE-CLiQ cables.

- commissioning software: Go online, upload the drive unit, adapt the topology offline and download the modified project.

- automatically remove the topology error (p9904).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201416**

**<location>Topology: Comparison additional component in actual topology**

**Message value:**

Component number: %1, Component class: %2, Connection number: %3

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has found a component in the actual topology which is not specified in the target topology. The alarm value includes the component number and connection number of the component with which the additional component is connected.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

cc = connection number

bb = component class of the additional component

aa = component number

Note:

- component class and connection number are described in F01375.

- components that are connected to this additional component are not operational.

**Remedy:**

Adapting the topologies:

- remove the additional component in the actual topology.

- download the target topology that matches the actual topology (commissioning software).

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201420**

**<location>Topology: Comparison a component is different**

**Message value:**

Component number: %1, component class target: %2, component class actual: %3, fault cause: %4

**Drive object:**

All objects

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The topology comparison has detected differences in the actual and target topologies in relation to one component. There are differences in the electronic rating plate.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex: aa = component number of the component, bb = component class of the target topology, cc = component class of the actual topology, dd = fault cause

dd = 01 hex = 1 dec:

Different component type.

dd = 02 hex = 2 dec:

Different Order No.

dd = 03 hex = 3 dec:

Different manufacturer.

dd = 04 hex = 4 dec:

Connection changed over for a multi-component slave (e.g. Double Motor Module), defective EEPROM data in the electronic rating plate, or only part of a multi-component slave set to "de-activate and not present".

dd = 05 hex = 5 dec:  
 A CX32 was replaced by an NX10 or NX15.  
 dd = 06 hex = 6 dec:  
 An NX10 or NX15 was replaced by a CX32.  
 Note:  
 Component class and component type are described in F01375.  
 The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:** Adapting the topologies:  
 - check the component soft-wired connections against the hardware configuration of the drive unit in the commissioning software and correct differences.  
 - parameterize the topology comparison of all components (p9906).  
 - parameterize the topology comparison of one components (p9907, p9908).  
 Note:  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

## 201425 <location>Topology: Comparison serial number of a component is different

**Message value:** Component number: %1, Component class: %2, Differences: %3  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected differences in the actual and target topologies in relation to one component. The serial number is different.  
 Alarm value (r2124, interpret hexadecimal):  
 ddccbbaa hex:  
 cc = number of differences  
 bb = component class  
 aa = component number of the component  
 Note:  
 The component class is described in F01375.  
 The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:** Adapting the topologies:  
 - change over the actual topology to match the target topology.  
 - download the target topology that matches the actual topology (commissioning software).  
 Re byte cc:  
 cc = 1 --> can be acknowledged using p9904 or p9905.  
 cc > 1 --> can be acknowledged using p9905 and can be de-activated using p9906 or p9907/p9908.  
 Note:  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).  
 See also: p9904 (Topology comparison, acknowledge differences), p9905 (Device specialization), p9906 (Topology comparison, comparison stage of all components), p9907 (Topology comparison, comparison stage of the component number), p9908 (Topology comparison, comparison stage of a component)

## 201428 <location>Topo: Comparison connection of a component is different

**Message value:** Component number: %1, Component class: %2, Connection number1: %3, Connection number2: %4  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected differences in the actual and target topologies in relation to one component. A component was connected to another connection.  
 The different connections of a component are described in the alarm value:  
 Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:  
 dd = connection number of the target topology  
 cc = connection number of the actual topology  
 bb = component class  
 aa = component number  
 Note:  
 Component class and connection number are described in F01375.  
 The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:  
 - change over the actual topology to match the target topology.  
 - download the target topology that matches the actual topology (commissioning software).  
 - automatically remove the topology error (p9904).  
 Note:  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).  
 See also: p9904 (Topology comparison, acknowledge differences)

**201429 <location>Topology: Comparison connection is different for more than one component**

**Message value:** Component number: %1, Component class: %2, Connection number1: %3, Connection number2: %4  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A topology comparison has found differences between the actual and target topology for several components. A component was connected to another connection.  
 The different connections of a component are described in the alarm value:  
 Alarm value (r2124, interpret hexadecimal):  
 ddccbbaa hex:  
 dd = connection number of the target topology  
 cc = connection number of the actual topology  
 bb = component class  
 aa = component number  
 Note:  
 Component class and connection number are described in F01375.  
 The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

**Remedy:**

Adapting the topologies:  
 - change over the actual topology to match the target topology.  
 - download the target topology that matches the actual topology (commissioning software).  
 Note:  
 In the software, a Double Motor Module behaves just like two separate DRIVE-CLiQ nodes. If a Double Motor Module is re-inserted, this can result in several differences in the actual topology.  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201451 <location>Topology: Target topology is invalid**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** An error was detected in the target topology.  
 The target topology is invalid.  
 Fault value (r0949, interpret hexadecimal):  
 ccccbbaa hex: cccc = index error, bb = component number, aa = fault cause  
 aa = 1B hex = 27 dec: Error not specified.



aa = 1C hex = 28 dec: Value illegal.  
 aa = 1D hex = 29 dec: Incorrect ID.  
 aa = 1E hex = 30 dec: Incorrect ID length.  
 aa = 1F hex = 31 dec: Too few indices left.  
 aa = 20 hex = 32 dec: component not connected to Control Unit.

**Remedy:** Reload the target topology using the commissioning software.

### 201470 <location>Topology:Target topology ring-type connection detected

**Message value:** Component number: %1, Component class: %2, Connection number: %3

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** A ring-type connection was detected when writing to the target topology.  
 Fault value (r0949, interpret hexadecimal):

ddccbbaa hex:

cc = connection number

bb = component class

aa = component number of a component included in the ring

Note:

Component class and connection number are described in F01375.

**Remedy:** Read out the fault value and remove one of the specified connections.

Then download the target topology again using the commissioning software.

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

### 201475 <location>Topology: Target topology duplicate connection between two components

**Message value:** Component number: %1, Component class: %2, Connection number1: %3, Connection number2: %4

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** When writing the target topology, a duplicate connection between two components was detected.

Fault value (r0949, interpret hexadecimal):

ddccbbaa hex:

dd = connection number 2 of the duplicate connection

cc = connection number 1 of the duplicate connection

bb = component class

aa = component number of one of the components connected twice

Note:

Component class and connection number are described in F01375.

**Remedy:** Read out the fault value and remove one of the two specified connections.

Then download the target topology again using the commissioning software.

Note:

Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

---

**201481**                    **<location>Topology: Comparison power unit missing in the actual topology**

**Message value:**        Component number: %1

**Drive object:**         All objects

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                The topology comparison has detected a power unit in the target topology that is not available in the actual topology.  
Alarm value (r2124, interpret decimal):  
Component number of the additional target components.

**Remedy:**                - delete the drive belonging to the power unit in the commissioning software project and download the new configuration to the drive unit.  
- check that the actual topology matches the target topology and if required, change over.  
- check DRIVE-CLiQ cables for interruption and contact problems.  
- check the 24 V supply voltage.  
- check that the power unit is working properly.

Note:  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

---

**201482**                    **<location>Topology: Comparison Sensor Module missing in the actual topology**

**Message value:**        Component number: %1

**Drive object:**         All objects

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                The topology comparison has detected a Sensor Module in the target topology that is not available in the actual topology.  
Alarm value (r2124, interpret decimal):  
Component number of the additional target components.

**Remedy:**                - re-configure the drive belonging to the Sensor Module in the commissioning software project (encoder configuration) and download the new configuration to the drive unit.  
- delete the drive belonging to the Sensor Module in the commissioning software project and download the new configuration to the drive unit.  
- check that the actual topology matches the target topology and if required, change over.  
- check DRIVE-CLiQ cables for interruption and contact problems.  
- check the 24 V supply voltage.  
- check that the Sensor Module is working properly.

Note:  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

---

**201483**                    **<location>Topology: Comparison Terminal Module missing in the actual topology**

**Message value:**        Component number: %1

**Drive object:**         All objects

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                The topology comparison has detected a Terminal Module in the target topology that is not available in the actual topology.  
Alarm value (r2124, interpret decimal):  
Component number of the additional target components.

**Remedy:**

- delete the Terminal Module in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check the 24 V supply voltage.
- check that the Terminal Module is working properly.

Note:  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

#### 201484 <location>Topology: Comparison DRIVE-CLiQ Hub Module missing in the actual topology

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected a DRIVE-CLiQ Hub Module in the target topology that does not exist in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Component number of the additional target components.

**Remedy:**

- delete the DRIVE-CLiQ Hub Module in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check the 24 V supply voltage.
- test the DRIVE-CLiQ Hub Module to ensure that it functions properly.

Note:  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

#### 201485 <location>Topology: Comparison CX32 missing in the actual topology

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected a controller extension 32 (CX32) in the target topology that is not available in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Component number of the additional target components.

**Remedy:**

- delete the CX32 / NX in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check the 24 V supply voltage.
- check that CX32/NX functions correctly.

Note:  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201486 <location>Topology: Comparison DRIVE-CLiQ components missing in the actual topology**

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected a DRIVE-CLiQ component in the target topology that is not available in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Component number of the additional target components.  
**Remedy:**

- delete the drive belonging to this component in the commissioning software project and download the new configuration to the drive unit.
- re-configure the drive belonging to this component in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check the 24 V supply voltage.
- check that the component is working properly.

**Note:**  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201487 <location>Topology: Comparison option slot components missing in the actual topology**

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected an option slot module in the target topology that is not available in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Component number of the additional target components.  
**Remedy:**

- delete the option board in the commissioning software project and download the new configuration to the drive unit.
- re-configure the drive unit in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check that the option board is functioning correctly

**Note:**  
 Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201488 <location>Topology: Comparison EnDat encoder missing in the actual topology**

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected an EnDat encoder in the target topology that is not available in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Component number of the additional target components.

**Remedy:**

- re-configure the drive belonging to the encoder in the commissioning software project (encoder configuration) and download the new configuration to the drive unit.
- delete the drive belonging to the encoder in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.

**Note:**  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201489 <location>Topology: Comparison motor with DRIVE-CLiQ missing in the actual topology**

**Message value:** Component number: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The topology comparison has detected a motor with DRIVE-CLiQ in the target topology that is not available in the actual topology.  
 Alarm value (r2124, interpret decimal):Component number of the additional target components.

**Remedy:**

- re-configure the drive belonging to this motor in the commissioning software project and download the new configuration to the drive unit.
- re-configure the drive belonging to this motor in the commissioning software project and download the new configuration to the drive unit.
- check that the actual topology matches the target topology and if required, change over.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check that the motor is working properly.

**Note:**  
Under "Topology --> Topology view" the commissioning software where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

**201505 <location>BICO: Interconnection cannot be established**

**Message value:** Parameter: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A PROFIdrive telegram has been set (p0922).  
 An interconnection contained in the telegram was not able to be established.  
 Fault value (r0949, decimal interpretation):  
 Parameter receiver that should be changed.

**Remedy:** Establish another interconnection.

**201506 <location>BICO: No standard telegram**

**Message value:** Parameter: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The standard telegram in p0922 is not maintained and therefore p0922 is set to 999.  
 Fault value (r0949, decimal interpretation):  
 BICO parameter for which the write attempt was unsuccessful.

**Remedy:** Again set the required standard telegram (p0922).

---

**201507 <location>BICO: Interconnections to inactive objects present**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** There are BICO interconnections as signal sink from a drive object that is either inactive/not operational.  
The BI/CI parameters involved are listed in r9498.  
The associated BO/CO parameters are listed in r9499.  
The list of the BICO interconnections to other drive objects is displayed in r9491 and r9492 of the de-activated drive object.  
Note:  
r9498 and r9499 are only written to, if p9495 is not set to 0.  
Alarm value (r2124, interpret decimal):  
Number of BICO interconnections found to inactive drive objects.  
**Remedy:** - set all open BICO interconnections centrally to the factory setting with p9495 = 2.  
- make the non-operational drive object active/operational again (re-insert or activate components).

---

**201508 <location>BICO: Interconnections to inactive objects exceeded**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The maximum number of BICO interconnections (signal sinks) when de-activating a drive object was exceeded.  
When de-activating a drive object, all BICO interconnections (signal sinks) are listed in the following parameters:  
- r9498[0...29]: List of the BI/CI parameters involved.  
- r9499[0...29]: List of the associated BO/CO parameters.  
**Remedy:** The alarm automatically disappears as soon as no BICO interconnection (value = 0) is entered in r9498[29] and r9499[29].  
Notice:  
When re-activating the drive object, all BICO interconnections should be checked and if required, re-established.

---

**201510 <location>BICO: Signal source is not float type**

**Message value:** Parameter: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The requested connector output does not have the correct data type. This interconnection is not established.  
Fault value (r0949, decimal interpretation):  
Parameter number to which an interconnection should be made (connector output).  
**Remedy:** Interconnect this connector input with a connector output having a float data type.

---

**201511 <location>BICO: Interconnection with different scalings**

**Message value:** Parameter: %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

---

<b>Cause:</b>	<p>The requested BICO interconnection was established. However, a conversion is made between the BICO output and BICO input using the reference values.</p> <ul style="list-style-type: none"> <li>- the BICO output has different normalized units than the BICO input.</li> <li>- message only for interconnections within a drive object.</li> </ul> <p>Example: The BICO output has, as normalized unit, voltage and the BICO input has current. This means that the factor p2002/p2001 is calculated between the BICO output and the BICO input. p2002: contains the reference value for current p2001: contains the reference value for voltage Fault value (r0949, decimal interpretation): Parameter number of the BICO input (signal sink).</p>
<b>Remedy:</b>	Not necessary.

---

### 201512 <location>BICO: No scaling available

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	<p>Infeed: OFF2 (OFF1) Servo: OFF2 Vector: OFF2</p>
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	<p>An attempt was made to determine a conversion factor for a scaling that does not exist. Fault value (r0949, decimal interpretation): Unit (e.g. corresponding to SPEED) for which an attempt was made to determine a factor.</p>
<b>Remedy:</b>	Apply scaling or check the transfer value.

---

### 201513 <location>BICO: Interconnection cross DO with different scalings

<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The requested BICO interconnection was established. However, a conversion is made between the BICO output and BICO input using the reference values. An interconnection is made between different drive objects and the BICO output has different normalized units than the BICO input or the normalized units are the same but the reference values are different.</p> <p>Example 1: BICO output with voltage normalized unit, BICO input with current normalized unit, BICO output and BICO input lie in different drive objects. This means that the factor p2002/p2001 is calculated between the BICO output and the BICO input. p2002: contains the reference value for current p2001: contains the reference value for voltage</p> <p>Example 2: BICO output with voltage normalized unit in drive object 1 (DO1), BICO input with voltage normalized unit in drive object 2 (DO2). The reference values for voltage (p2001) of the two drive objects have different values. This means that the factor p2001(DO1)/p2001(DO2) is calculated between the BICO output and the BICO input. p2001: contains the reference value for voltage, drive objects 1, 2 Fault value (r0949, decimal interpretation): Parameter number of the BICO input (signal sink).</p>
<b>Remedy:</b>	Not necessary.

**201514**                    **<location>BICO: Error when writing during a reconnect**

**Message value:**        Parameter: %1

**Drive object:**         All objects

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                During a reconnect operation (e.g. while booting or downloading - but can also occur in normal operation) a parameter was not able to be written to.  
 Example:  
 When writing to a double word BICO input in the second index, the memory areas overlap (e.g. p8861). The parameter is then reset to the factory setting.  
 Alarm value (r2124, interpret decimal):  
 Parameter number of the BICO input (signal sink).

**Remedy:**                Not necessary.

---

**201515**                    **<location>BICO: Writing to parameter not permitted as the master control is active**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**              NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                When changing the number of CDS or when copying from CDS, the master control is active.

**Remedy:**                If required, return the master control and repeat the operation.

---

**201590**                    **<location>Drive: Motor maintenance interval expired**

**Message value:**        Fault cause: %1 bin

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                The selected service/maintenance interval for this motor was reached.  
 Alarm value (r2124, interpret decimal):  
 Motor data set number.  
 See also: p0650 (Actual motor operating hours), p0651 (Motor operating hours maintenance interval)

**Remedy:**                carry out service/maintenance and reset the service/maintenance interval (p0651).

---

**201600**                    **<location>SI CU: STOP A initiated**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a fault and initiated a STOP A (pulse suppression via the safety shutdown path of the Control Unit).  
 - forced checking procedure of the safety shutdown path of the Control Unit unsuccessful.  
 - subsequent response to fault F01611 (defect in a monitoring channel).



Fault value (r0949, decimal interpretation):  
 0: Stop request from the Motor Module.  
 1005: Pulses suppressed although STO not selected and there is no internal STOP A present.  
 1010: Pulses enabled although STO is selected or an internal STOP A is present.  
 1015: Feedback of the safe pulse suppression for Motor Modules connected in parallel are different.  
 9999: Subsequent response to fault F01611.

**Remedy:**

- select Safe Torque Off and de-select again.
- replace the Motor Module involved.

For fault value = 9999:

- carry out diagnostics for fault F01611.

Note:

CU: Control Unit  
 MM: Motor Module  
 SI: Safety Integrated  
 STO: Safe Torque Off / SH: Safe standstill

---

## 201611 <location>SI CU: Defect in a monitoring channel

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a fault in the crosswise data comparison between the CU and Motor Module (MM) and initiated a STOP F.  
 As a result of this fault, after the parameterized transition has expired (p9658), fault F01600 (SI CU: STOP A initiated) is output.

Fault value (r0949, decimal interpretation):  
 0: Stop request from the Motor Module.  
 1 ... 999:  
 Number of the cross-checked data that resulted in this fault. This number is also displayed in r9795.

- 1: SI monitoring clock cycle (r9780, r9880).
- 2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.
- 3: SI SGE changeover tolerance time (p9650, p9850).
- 4: SI transition period STOP F to STOP A (p9658, p9858).
- 5: SI enable Safe Brake Control (p9602, p9802).
- 6: SI Motion enable, safety-relevant functions (p9501, internal value).
- 7: SI pulse suppression delay time for Safe Stop 1 (p9652, p9852).
- 8: SI PROFIsafe address (p9610, p9810).
- 9: SI debounce time for STO/SBC/SS1 (MM) (p9651, p9851).
- 10: SI delay time for pulse suppression for ESR (p9697, p9897).
- 11: SI Safe Brake Adapter mode, BICO interconnection (p9621, p9821).
- 12: SI Safe Brake Adapter relay ON time (p9622[0], p9822[0]).
- 13: SI Safe Brake Adapter relay OFF time (p9622[1], p9822[1]).
- 1000: Watchdog timer has expired. Within the time of approx. 5 x p9650 too many switching operations have occurred at terminal EP of the Motor Module, or STO (also as subsequent response) was initiated too frequently via PROFIsafe/TM54F.
- 1001, 1002: Initialization error, change timer / check timer.
- 1900: CRC error in the SAFETY sector.
- 1901: CRC error in the ITCM sector.
- 1902: Overloading in the ITCM sector has occurred in operation.
- 1950: Module temperature outside the permissible temperature range.
- 1951: Module temperature not plausible.

2000: Status of the STO selection on the Control Unit and Motor Module are different.  
 2001: Feedback signal for safe pulse suppression on the Control Unit and Motor Module are different.  
 2002: Status of the delay timer SS1 on the Control Unit and Motor Module are different.  
 2004: Status of the STO selection for modules connected in parallel are different.  
 2005: Feedback signal of the safe pulse suppression on the Control Unit and Motor Modules connected in parallel are different.

6000 ... 6999:

Error in the PROFIsafe control.

For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

**Remedy:**

Re fault value = 1 ... 5 and 7 ... 999:

- check the cross-checked data that resulted in a STOP F.
- carry out a POWER ON (power off/on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 6:

- carry out a POWER ON (power off/on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 1000:

- check the EP terminal at the Motor Module (contact problems).
- PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller.
- check the wiring of the failsafe inputs at the TM54F (contact problems).

Re fault value = 1001, 1002:

- carry out a POWER ON (power off/on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

Re fault value = 1900, 1901, 1902:

- carry out a POWER ON (power off/on) for all components.
- upgrade the Control Unit software.
- replace Control Unit.

Re fault value = 2000, 2001, 2002, 2004, 2005:

- check the tolerance time SGE changeover and if required, increase the value (p9650/p9850, p9652/p9852).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).
- check the causes of the STO selection in r9772. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions.
- replace the Motor Module involved.

Re fault value = 6000 ... 6999:

Refer to the description of the message values in safety message C01711.

Note:

CU: Control Unit

EP: Enable Pulses (pulse enable)

MM: Motor Module

SGE: Safety-relevant input

SI: Safety Integrated

SMM: Safe Motion Monitoring

SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)

STO: Safe Torque Off / SH: Safe standstill

ESR: Extended Stop and Retract

---

**201612**

**<location>SI CU: STO inputs for power units connected in parallel different**

**Message value:**

Fault cause: %1 bin

**Drive object:**

SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**

NONE (OFF1, OFF2, OFF3)

**Acknowledge:**

IMMEDIATELY (POWER ON)

**Cause:** The drive-integrated "Safety Integrated" function on the Control Unit (CU) has identified different states of the AND'ed STO inputs for power units connected in parallel and has initiated a STOP F.  
As a result of this fault, after the parameterized transition has expired (p9658), fault F01600 (SI CU: STOP A initiated) is output.  
Fault value (r0949, interpret binary):  
Binary image of the digital inputs of the Control Unit that are used as signal source for the function "Safe Torque Off".

**Remedy:** - check the tolerance time SGE changeover and if required, increase the value (p9650).  
- check the wiring of the safety-relevant inputs (SGE) (contact problems).  
Note:  
CU: Control Unit  
SGE: Safety-relevant input  
SI: Safety Integrated  
STO: Safe Torque Off / SH: Safe standstill

---

**201620**            **<location>SI CU: Safe Torque Off active**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The "Safe Torque Off" (STO) function has been selected on the Control Unit (CU) using the input terminal and is active.  
Note:  
This message does not result in a safety stop response.

**Remedy:** Not necessary.  
Note:  
CU: Control Unit  
SI: Safety Integrated  
STO: Safe Torque Off / SH: Safe standstill

---

**201621**            **<location>SI CU: Safe Stop 1 active**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The "Safe Stop 1" (SS1) function has been selected on the Control Unit (CU) and is active.  
Note:  
This message does not result in a safety stop response.

**Remedy:** Not necessary.  
Note:  
CU: Control Unit  
SI: Safety Integrated  
SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)

---

**201625**            **<location>SI CU: Sign-of-life error in safety data**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected an error in the sign-of-life of the safety data between the CU and Motor Module (MM) and initiated a STOP A.  
 - there is either a DRIVE-CLiQ communication error or communication has failed.  
 - a time slice overflow of the safety software has occurred.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- select Safe Torque Off and de-select again.
- carry out a POWER ON (power off/on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- de-select all drive functions that are not absolutely necessary.
- reduce the number of drives.
- check the electrical cabinet design and cable routing for EMC compliance

Note:  
 CU: Control Unit  
 MM: Motor Module  
 SI: Safety Integrated

---

**201630** <location>SI CU: Brake control error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a brake control fault and initiated a STOP A.  
 Fault value (r0949, decimal interpretation):  
 Re fault value = 10, 11:  
 Fault in "open holding brake" operation.  
 - Parameter p1278 incorrectly set.  
 - No brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).  
 - Ground fault in brake cable.  
 For fault value = 20:  
 Fault in "brake open" state.  
 - Short-circuit in brake winding.  
 Re fault value = 30, 31:  
 Fault in "close holding brake" operation.  
 - No brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).  
 - Short-circuit in brake winding.  
 For fault value = 40:  
 Fault in "brake closed" state.  
 For fault value = 50:  
 Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control).  
 For fault value = 80:  
 SafeBrakeAdapter: Fault in the brake control circuit of the Control Unit or communication fault between Control Unit and Motor Module (brake control diagnostics).  
 Note:  
 The following causes may apply to fault values:  
 - motor cable is not shielded correctly.  
 - defect in control circuit of the Motor Module.

- Remedy:**
- check parameter p1278 (for SBC, only p1278 = 0 is permissible).
  - select Safe Torque Off and de-select again.
  - check the motor holding brake connection.
  - check the function of the motor holding brake.
  - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
  - check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).
  - replace the Motor Module involved.
- Operation with Safe Brake Module or Safe Brake Adapter:
- check the Safe Brake Module or Safe Brake Adapter connection.
  - replace the Safe Brake Module or Safe Brake Adapter.
- Note:
- CU: Control Unit  
SBC: Safe Brake Control  
SI: Safety Integrated

---

### 201649 <location>SI CU: Internal software error

- Message value:** %1
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF2
- Acknowledge:** IMMEDIATELY (POWER ON)
- Cause:** An internal error in the Safety Integrated software on the Control Unit has occurred.
- Note:
- This fault results in a STOP A that cannot be acknowledged.  
Fault value (r0949, interpret hexadecimal):  
Only for internal Siemens troubleshooting.
- Remedy:**
- carry out a POWER ON (power off/on) for all components.
  - re-commission the "Safety Integrated" function and carry out a POWER ON.
  - Upgrade the firmware of the Control Unit to a later version.
  - contact the Hotline.
  - replace the Control Unit.
- Note:
- CU: Control Unit  
MM: Motor Module  
SI: Safety Integrated

---

### 201650 <location>SI CU: Acceptance test required

- Message value:** %1
- Drive object:** All objects
- Reaction:** OFF2
- Acknowledge:** IMMEDIATELY (POWER ON)
- Cause:** The drive-integrated "Safety Integrated" function on the Control Unit requires an acceptance test.
- Note:
- This fault results in a STOP A that can be acknowledged.  
Fault value (r0949, decimal interpretation):  
130: Safety parameters for the Motor Module not available.
- Note:
- This fault value is always output when Safety Integrated is commissioned for the first time.  
1000: Reference and actual checksum on the Control Unit are not identical (booting).  
- at least one checksum-checked piece of data is defective.  
2000: Reference and actual checksum on the Control Unit are not identical (commissioning mode).  
- reference checksum incorrectly entered into the Control Unit (p9799 not equal to r9798).  
- when de-activating the safety functions, p9501 or p9503 were not deleted.

2001: Reference and actual checksum on the Motor Module are not identical (commissioning mode).  
 - reference checksum incorrectly entered into the Motor Module (p9899 not equal to r9898).  
 - when de-activating the safety functions, p9501 or p9503 are not deleted.  
 2002: Enable of safety-related functions between the Control Unit and Motor Module differ (p9601 not equal to p9801).  
 2003: Acceptance test is required as a safety parameter has been changed.  
 2004: An acceptance test is required because a project with enabled safety-functions has been downloaded.  
 2005: The Safety logbook has identified that a functional safety checksum has changed. An acceptance test is required.  
 2010: Safe Brake Control is enabled differently between the Control Unit and Motor Module (p9602 not equal to p9802).  
 2020: Error when saving the safety parameters for the Motor Module.  
 3003: Acceptance test is required as a hardware-related safety parameter has been changed.  
 3005: The Safety logbook has identified that a hardware-related safety checksum has changed. An acceptance test is required.  
 9999: Subsequent response of another safety-related fault that occurred when booting that requires an acceptance test.

**Remedy:**

For fault value = 130:  
 - carry out safety commissioning routine.  
 For fault value = 1000:  
 - again carry out safety commissioning routine.  
 - replace the memory card or Control Unit.  
 For fault value = 2000:  
 - check the safety parameters in the Control Unit and adapt the reference checksum (p9799).  
 For fault value = 2001:  
 - check the safety parameters in the Motor Module and adapt the reference checksum (p9899).  
 For fault value = 2002:  
 - enable the safety-related functions in the Control Unit and check in the Motor Module (p9601 = p9801).  
 Re fault value = 2003, 2004, 2005:  
 - Carry out an acceptance test and generate an acceptance report.  
 The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:  
 SINAMICS S120 Function Manual Safety Integrated  
 The fault with fault value 2005 can only be acknowledged when the "STO" function is de-selected.  
 For fault value = 2010:  
 - check enable of the safety-related brake control in the Control Unit and Motor Module (p9602 = p9802).  
 For fault value = 2020:  
 - again carry out safety commissioning routine.  
 - replace the memory card or Control Unit.  
 For fault value = 3003:  
 - carry out the function checks for the modified hardware and generate an acceptance report.  
 The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:  
 SINAMICS S120 Function Manual Safety Integrated  
 For fault value = 3005:  
 - carry out the function checks for the modified hardware and generate an acceptance report.  
 The fault with fault value 3005 can only be acknowledged when the "STO" function is de-selected.  
 For fault value = 9999:  
 - carry out diagnostics for the other safety-related fault that is present.  
 Note:  
 CU: Control Unit  
 MM: Motor Module  
 SI: Safety Integrated  
 STO: Safe Torque Off  
 See also: p9799 (SI reference checksum SI parameters (Control Unit)), p9899 (SI reference checksum SI parameters (Motor Module))

---

<b>201651</b>	<b>&lt;location&gt;SI CU: Synchronization safety time slices unsuccessful</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The "Safety Integrated" function requires a synchronization of the safety time slices between the Control Unit (CU) and Motor Module (MM) and between the Control Unit and the higher-level control. This synchronization routine was unsuccessful. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, decimal interpretation): 121: - with SINUMERIK Safety Integrated enabled, a drive-side warm restart was performed on the CU/NX. - with SINUMERIK Safety Integrated enabled, the function "restore factory setting" was selected on a drive object of the CU and a drive-side warm restart was initiated. 150: - fault in the synchronization to the PROFIBUS master. All other values: - only for internal Siemens troubleshooting. See also: p9510 (SI Motion clock-cycle synchronous PROFIBUS master)
<b>Remedy:</b>	For fault value = 121: - carry out a common POWER ON/warm restart for the higher-level control and SINAMICS. For fault value = 150: - check the setting of p9510 (SI Motion clock-cycle synchronous PROFIBUS master) and if required, correct. General: - carry out a POWER ON (power off/on) for all components. - upgrade the Motor Module software. - upgrade the Control Unit software. - upgrade the software of the higher-level control. Note: CU: Control Unit MM: Motor Module SI: Safety Integrated

---

<b>201652</b>	<b>&lt;location&gt;SI CU: Illegal monitoring clock cycle</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	One of the Safety Integrated monitoring clock cycles is not permissible: - the monitoring clock cycle integrated in the drive cannot be maintained due to the communication conditions required in the system. - the monitoring clock cycle for safe motion monitoring functions with the higher-level control is not permissible (p9500). - The sampling time for the current controller (p0112, p0115) cannot be supported. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, decimal interpretation): - for enabled SI monitoring integrated in the drive (p9601/p9801 > 0): Minimum setting for the monitoring clock cycle (in $\mu$ s). - with the motion monitoring function enabled (p9501 > 0):

- 100: No matching monitoring clock cycle was able to be found.
- 101: The monitoring clock cycle is not an integer multiple of the actual value sensing clock cycle.
- 102: An error has occurred when transferring the DP clock cycle to the Motor Module (MM).
- 103: An error has occurred when transferring the DP clock cycle to the Sensor Module.
- 104,105:
  - four times the current controller sampling time is greater than 1 ms when operating with a non-isochronous PROFIBUS.
  - four times the current controller sampling time is greater than the DP clock cycle when operating with an isochronous PROFIBUS.
  - The DP clock cycle is not an integer multiple of the sampling time of the current controller.
- 106: The monitoring clock cycle does not match the monitoring clock cycle of the TM54F.
- 107: Four times the current controller sampling time is greater than the actual value sensing clock cycle (p9511) or the actual value sensing clock cycle is not an integer multiple of the current controller sampling time.
- 108: The parameterized actual value sensing clock cycle cannot be set on this component.
- 109: If the motion monitoring functions have been parameterized as encoderless (p9506), the actual value sensing clock cycle (p9511) and the current controller clock cycle must be identical.
- 110: The actual value sensing clock cycle (p9511) for safety with encoder (p9506 = 0) is less than 2 ms for this Control Unit (e.g. CU305).

**Remedy:**

- For enabled SI monitoring integrated in the drive (p9601/p9801 > 0):
  - upgrade the Control Unit software.
- For enabled motion monitoring function (p9501 > 0):
  - correct the monitoring clock cycle (p9500) and carry out POWER ON.
- For fault value = 101:
  - actual value sensing clock cycle corresponds to position control clock cycle/DP clock cycle (factory setting).
  - for motion monitoring functions integrated in the drive (p9601/p9801bit 2 = 1) the actual value sensing clock cycle can be directly parameterized in P9511/p9311.
- Re fault value = 104, 105:
  - set a separate actual value sensing clock cycle in p9511.
  - restrict operation to a maximum of two vector drives. For the standard setting in p0112, p0115, the current controller sampling time is automatically reduced to 250 µs. If the standard values were changed, then the current controller sampling time (p0112, p0115) should be appropriately set.
  - increase the DP clock cycle for operation with a clock-cycle synchronous PROFIBUS so that there is a multiple clock cycle ratio of at least 4:1 between the DP clock cycle and the current controller sampling time. A clock cycle ratio of at least 8:1 is recommended.
  - With firmware version 2.5, please ensure that parameter p9510 is set to 1 in the drive (clock cycle synchronous operation).
- For fault value = 106:
  - set the parameters for the monitoring clock cycles the same (p10000 and p9500 / p9300).
- For fault value = 107:
  - set an actual value sensing clock cycle in p9511 that matches the current controller clock cycle. A clock cycle ratio of at least 8:1 is recommended.
- For fault value = 108:
  - set a suitable actual value sensing clock cycle in p9511.
  - if the DP clock cycle is used as the actual value sensing clock cycle for operation with isochronous PROFIBUS (p9511 = 0), then a suitable DP clock cycle must be configured.

A suitable multiple of the DP clock cycle (e.g. 1, 2, 3, 4, 5, 6, 8, 10) must be parameterized on the D410. Otherwise, the clock cycle must be set to less than 8 ms.
- For fault value = 109:
  - set the actual value sensing clock cycle in p9511 to the same value as the current controller clock cycle (p115).
- For fault value = 110:
  - set the actual value sensing clock cycle in p9511 to 2 ms or higher.

Note:

- CU: Control Unit
- MM: Motor Module
- SI: Safety Integrated



---

<b>201653</b>	<b>&lt;location&gt;SI CU: PROFIBUS configuration error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE (OFF1, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>There is a PROFIBUS configuration error for using Safety Integrated monitoring functions with a higher-level control (SINUMERIK or F-PLC).</p> <p>Note:</p> <p>For safety functions that have been enabled, this fault results in a STOP A that cannot be acknowledged.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>200: A safety slot for receive data from the control has not been configured.</p> <p>210, 220: The configured safety slot for the receive data from the control has an unknown format.</p> <p>230: The configured safety slot for the receive data from the F-PLC has the incorrect length.</p> <p>231: The configured safety slot for the receive data from the F-PLC has the incorrect length.</p> <p>240: The configured safety slot for the receive data from the SINUMERIK has the incorrect length.</p> <p>250: A PROFIsafe slot is configured in the higher-level F control, however PROFIsafe is not enabled in the drive.</p> <p>300: A safety slot for the send data to the control has not been configured.</p> <p>310, 320: The configured safety slot for the send data to the control has an unknown format.</p> <p>330: The configured safety slot for the send data to the F-PLC has the incorrect length.</p> <p>331: The configured safety slot for the send data to the F-PLC has the incorrect length.</p> <p>340: The configured safety slot for the send data to the SINUMERIK has the incorrect length.</p>
<b>Remedy:</b>	<p>The following generally applies:</p> <ul style="list-style-type: none"> <li>- check and, if necessary, correct the PROFIBUS configuration of the safety slot on the master side.</li> <li>- upgrade the Control Unit software.</li> </ul> <p>For fault value = 250:</p> <ul style="list-style-type: none"> <li>- remove the PROFIsafe configuring in the higher-level F control or enable PROFIsafe in the drive.</li> </ul> <p>Re fault value = 231, 331:</p> <ul style="list-style-type: none"> <li>- configure the PROFIsafe telegram matching the parameterization in the F-PLC.</li> </ul> <p>The following applies for p9501.30 = 1 (F-DI via PROFIsafe is enabled): PROFIsafe telegram 900 must be configured.</p> <p>The following applies for p9501.30 = 0 (F-DI via PROFIsafe is not enabled): PROFIsafe telegram 30 must be configured.</p>

---

<b>201655</b>	<b>&lt;location&gt;SI CU: Align monitoring functions</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>An error has occurred when aligning the Safety Integrated monitoring functions on the Control Unit (CU) and Motor Module (MM). Control Unit and Motor Module were not able to determine a common set of supported SI monitoring functions.</p> <ul style="list-style-type: none"> <li>- there is either a DRIVE-CLiQ communication error or communication has failed.</li> <li>- Safety Integrated software releases on the Control Unit and Motor Module are not compatible with one another.</li> </ul> <p>Note:</p> <p>This fault results in a STOP A that cannot be acknowledged.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- upgrade the Motor Module software.</li> <li>- upgrade the Control Unit software.</li> <li>- check the electrical cabinet design and cable routing for EMC compliance</li> </ul> <p>Note:</p> <p>CU: Control Unit MM: Motor Module SI: Safety Integrated</p>

**201656**                    **<location>SI CU: Motor Module parameter error**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                When accessing the Safety Integrated parameters for the Motor Module (MM) in the non-volatile memory, an error has occurred.

Note:  
 This fault results in a STOP A that can be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 129:  
 - safety parameters for the Motor Module corrupted.  
 - drive with enabled safety functions was possibly copied offline using the commissioning software and the project downloaded.  
 131: Internal Motor Module software error.  
 132: Communication errors when uploading or downloading the safety parameters for the Motor Module.  
 255: Internal software error on the Control Unit.

**Remedy:**

- re-commission the safety functions.
- upgrade the Control Unit software.
- upgrade the Motor Module software.
- replace the memory card or Control Unit.

For fault value = 129:

- activate the safety commissioning mode (p0010 = 95).
- adapt the PROFIsafe address (p9610).
- start the copy function for SI parameters (p9700 = D0 hex).
- acknowledge data change (p9701 = DC hex).
- exit the safety commissioning mode (p0010 = 0).
- save all parameters (p0977 = 1 or "copy RAM to ROM").
- carry out a POWER ON (power off/on) for all components.

For fault value = 132:

- check the electrical cabinet design and cable routing for EMC compliance

Note:  
 CU: Control Unit  
 MM: Motor Module  
 SI: Safety Integrated

---

**201659**                    **<location>SI CU: Write request for parameter rejected**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                The write request for one or several Safety Integrated parameters on the Control Unit (CU) was rejected.

Note:  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 1: The Safety Integrated password is not set.  
 2: A reset of the drive parameters was selected. However, the Safety Integrated parameters were not reset, as Safety Integrated is presently enabled.  
 3: The interconnected STO input is in the simulation mode.  
 10: An attempt was made to enable the STO function although this cannot be supported.  
 11: An attempt was made to enable the SBC function although this cannot be supported.  
 12: An attempt was made to enable the SBC function although this cannot be supported for a parallel circuit configuration.

- 13: An attempt was made to enable the SS1 function although this cannot be supported.  
 14: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on the CU and MM is different.  
 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.  
 16: An attempt was made to enable the STO function although this cannot be supported when the internal voltage protection (p1231) is enabled.  
 17: An attempt was made to enable the PROFIsafe function although this cannot be supported for a parallel circuit configuration.  
 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.  
 19: An attempt was made to enable the SBA (Safe Brake Adapter), although this cannot be supported.  
 20: An attempt was made to enable the motion monitoring functions integrated in the drive and the STO function, both controlled via F-DI.  
 21: An attempt was made to enable the motion monitoring functions integrated in the drive for a parallel connection, although these cannot be supported.  
 22: An attempt was made to enable the Safety Integrated functions although these cannot be supported by the connected Power Module.  
 23: For ESR, an attempt was made to enable the delay for pulse suppression, although this cannot be supported.  
 See also: p0970, p3900, r9771, r9871

**Remedy:**

- For fault value = 1:  
 - set the Safety Integrated password (p9761).  
 For fault value = 2:  
 - Inhibit Safety Integrated (p9501, p9601) or reset safety parameters (p0970 = 5), then reset the drive parameters again.  
 For fault value = 3:  
 - end the simulation mode for the digital input (p0795).  
 Re fault value = 10, 11, 12, 13, 14, 15, 17, 18, 19, 21, 22, 23:  
 - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.  
 - use a Motor Module that supports the required function.  
 - upgrade the Motor Module software.  
 - upgrade the Control Unit software.  
 For fault value = 16:  
 - inhibit the internal voltage protection (p1231).  
 For fault value = 20:  
 - correct setting in p9601.  
 For fault value = 22:  
 - use a Power Module that supports the Safety Integrated functions.  
 Note:  
 CU: Control Unit  
 ESR: Extended Stop and Retract  
 MM: Motor Module  
 SBA: Safe Brake Adapter  
 SBC: Safe Brake Control  
 SI: Safety Integrated  
 SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)  
 STO: Safe Torque Off / SH: Safe standstill  
 See also: p9501, p9601, p9620, p9761, p9801

**201659****<location>SI CU: Write request for parameter rejected**

- Message value:** %1  
**Drive object:** TM54F\_MA, TM54F\_SL  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)

- Cause:** The write request for one or several Safety Integrated parameters on the Control Unit (CU) was rejected.
- Note:  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):
- 1: The Safety Integrated password is not set.
  - 2: A reset of the drive parameters was selected. However, the Safety Integrated parameters were not reset, as Safety Integrated is presently enabled.
  - 3: The interconnected STO input is in the simulation mode.
  - 10: An attempt was made to enable the STO function although this cannot be supported.
  - 11: An attempt was made to enable the SBC function although this cannot be supported.
  - 12: An attempt was made to enable the SBC function although this cannot be supported for a parallel circuit configuration.
  - 13: An attempt was made to enable the SS1 function although this cannot be supported.
  - 14: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on the CU and MM is different.
  - 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.
  - 16: An attempt was made to enable the STO function although this cannot be supported when the internal voltage protection (p1231) is enabled.
  - 17: An attempt was made to enable the PROFIsafe function although this cannot be supported for a parallel circuit configuration.
  - 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.
  - 19: An attempt was made to enable the SBA (Safe Brake Adapter), although this cannot be supported.
  - 20: An attempt was made to enable the motion monitoring functions integrated in the drive and the STO function, both controlled via F-DI.
  - 21: An attempt was made to enable the motion monitoring functions integrated in the drive for a parallel connection, although these cannot be supported.
  - 22: An attempt was made to enable the Safety Integrated functions although these cannot be supported by the connected Power Module.
  - 23: For ESR, an attempt was made to enable the delay for pulse suppression, although this cannot be supported.
- See also: p0970, p3900, r9771, r9871
- Remedy:**
- For fault value = 1:
    - set the Safety Integrated password (p10061).
  - For fault value = 2:
    - Inhibit Safety Integrated (p9501, p9601) or reset safety parameters (p0970 = 5), then reset the drive parameters again.
  - For fault value = 3:
    - end the simulation mode for the digital input (p0795).
  - Re fault value = 10, 11, 12, 13, 14, 15, 17, 18, 19, 21, 22, 23:
    - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.
    - use a Motor Module that supports the required function.
    - upgrade the Motor Module software.
    - upgrade the Control Unit software.
  - For fault value = 16:
    - inhibit the internal voltage protection (p1231).
  - For fault value = 20:
    - correct setting in p9601.
  - For fault value = 22:
    - use a Power Module that supports the Safety Integrated functions.
- Note:  
 CU: Control Unit  
 ESR: Extended Stop and Retract  
 MM: Motor Module  
 SBA: Safe Brake Adapter  
 SBC: Safe Brake Control  
 SI: Safety Integrated  
 SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)  
 STO: Safe Torque Off / SH: Safe standstill  
 See also: p9501, p9601, p9620, p9761, p9801

---

<b>201660</b>	<b>&lt;location&gt;SI CU: Safety-related functions not supported</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The Motor Module (MM) does not support the safety-related functions (e.g. the Motor Module version is not the correct one). Safety Integrated cannot be commissioned. Note: This fault does not result in a safety stop response.
<b>Remedy:</b>	- use a Motor Module that supports the safety-related functions. - upgrade the Motor Module software. Note: CU: Control Unit MM: Motor Module SI: Safety Integrated

---

<b>201663</b>	<b>&lt;location&gt;SI CU: Copying the SI parameters rejected</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	One of the following values is saved in p9700 or was entered offline: 87 or 208. This is the reason that when booting, an attempt is made to copy SI parameters from the Control Unit to the Motor Module. However, no safety-relevant function has been selected on the Control Unit (p9501 = 0, p9601 = 0). This is the reason that copying is not possible. Note: This fault does not result in a safety stop response. See also: p9700 (SI Motion copy function)
<b>Remedy:</b>	- Set p9700 to 0. - Check p9501 and p9601 and if required, correct. - Restart the copying function by entering the corresponding value into p9700.

---

<b>201664</b>	<b>&lt;location&gt;SI CU: No automatic firmware update</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	During booting, the system detected that the "Firmware update automatic" function (p7826 = 1) was not activated. This function must be activated for automatic firmware updates/downgrades to prevent impermissible version combinations when safety functions are enabled. Note: This fault does not result in a safety stop response. See also: p7826 (Firmware update automatic)
<b>Remedy:</b>	When safety functions are enabled (p9501 <> 0 and/or p9601 <> 0): 1. Activate the "Firmware update automatic" function (p7826 = 1). 2. Save the parameters (p0977 = 1) and carry out a POWER ON. When de-activating the safety functions (p9501 = 0, p9601 = 0), the fault can be acknowledged after exiting the safety commissioning mode.

**201665 <location>SI CU: System is defective**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A system defect was detected before the last boot or in the actual one. The system might have been rebooted (reset).  
 Fault value (r0949, interpret hexadecimal):  
 200000 hex, 400000 hex, 8000yy hex (yy any):  
 - Fault in the actual booting/operation.  
 800004 hex:  
 - Parameters p9500/p9300 are, under certain circumstances, not the same. In addition, Safety message C01711/C30711 is displayed.  
 Additional values:  
 - defect before the last time that the system booted.  
**Remedy:**  
 - carry out a POWER ON (power off/on).  
 - upgrade firmware to later version.  
 - contact the Hotline.  
 Re fault value = 200000 hex, 400000 hex, 8000yy hex (yy any):  
 - ensure that the Control Unit is connected to the Power Module.  
 Re fault value = 800004 hex:  
 - Check that parameters p9500/p9300 are the same.

**201666 <location>SI Motion CU: Steady-state (static) 1 signal at the F-DI for safety-relevant acknowledgement**

**Message value:** -  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A logical 1 signal is present at the F-DI configured in p10006 for more than 10 seconds.  
 If, at the F-DI no acknowledgment was performed for safe acknowledgment, then a steady-state logical and 0 signal must be present. This avoids unintentional safety-relevant acknowledgement (or the "Internal Event Acknowledge" signal) if a wire breaks or one of the two digital inputs bounces.  
**Remedy:** Set the fail-safe digital input (F-DI) to a logical 0 signal (10006).  
 Note:  
 F-DI: Failsafe Digital Input

**201669 <location>SI Motion: Unfavorable combination of motor and power unit**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The combination of motor and power unit used is not suitable for using safe motion monitoring functions without an encoder.  
 Alarm value (r2124, interpret decimal):  
 Number of the motor data set, which caused the fault.  
**Remedy:** Use a suitable power unit with a lower power rating or a motor with a higher power rating.

---

<b>201670</b>	<b>&lt;location&gt;SI Motion: Invalid parameterization Sensor Module</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The parameterization of a Sensor Module used for Safety Integrated is not permissible. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, decimal interpretation): 1: No encoder was parameterized for Safety Integrated. 2: An encoder was parameterized for Safety Integrated that does not have an A/B track (sine/cosine). 3: The encoder data set selected for Safety Integrated is still not valid. 4: A communication error with the encoder has occurred. 5: Number of relevant bits in the encoder coarse position invalid. 6: DRIVE-CLiQ encoder configuration invalid. 10: For an encoder used for Safety Integrated, not all of the Drive Data Sets (DDS) are assigned to the same Encoder Data Set (EDS) (p0187 ... p0189).
<b>Remedy:</b>	Re fault value = 1, 2: - use and parameterize an encoder that Safety Integrated supports (encoder with track A/B sine-wave, p0404.4 = 1). For fault value = 3: - check whether the drive or drive commissioning function is active and if required, exit this (p0009 = p00010 = 0), save the parameters (p0971 = 1) and carry out a POWER ON For fault value = 4: - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Sensor Module involved and if required, carry out a diagnostics routine for the faults identified. For fault value = 10: - align the EDS assignment of all of the encoders used for Safety Integrated (p0187 ... p0189). Note: SI: Safety Integrated

---

<b>201671</b>	<b>&lt;location&gt;SI Motion: Parameterization encoder error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The parameterization of the encoder used by Safety Integrated is different to the parameterization of the standard encoder. Note: This fault does not result in a safety stop response. Fault value (r0949, decimal interpretation): Parameter number of the non-corresponding safety parameter.
<b>Remedy:</b>	Align the encoder parameterization between the safety encoder and the standard encoder. Note: SI: Safety Integrated

---

<b>201672</b>	<b>&lt;location&gt;SI CU: Motor Module software/hardware incompatible</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)

**Cause:** The existing Motor Module software does not support safe motion monitoring or is not compatible to the software on the Control Unit or there is a communications error between the Control Unit and Motor Module.  
**Note:**  
 This fault results in a STOP A that cannot be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 1: The existing Motor Module software does not support the safe motion monitoring function.  
 2, 3, 6, 8: There is a communications error between the Control Unit and Motor Module.  
 4, 5, 7: The existing Motor Module software is not compatible to the software on the Control Unit.  
 9,10,11,12: The actual Motor Module software does not support safe encoderless motion monitoring.  
 13: At least one Motor Module in parallel operation does not support the safe motion monitoring function.

**Remedy:**  
 - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.  
 For fault value = 1:  
 - use a Motor Module that supports safe motion monitoring.  
 Re fault value = 2, 3, 6, 8:  
 - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.  
 Re fault value = 4, 5, 7, 9, 13:  
 - upgrade the Motor Module software.  
**Note:**  
 SI: Safety Integrated

**201673 <location>SI Motion: Sensor Module software/hardware incompatible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The existing Sensor Module software and/or hardware does not support the safe motion monitoring function with the higher-level control.  
**Note:**  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:**  
 - upgrade the Sensor Module software.  
 - use a Sensor Module that supports the safe motion monitoring function.  
**Note:**  
 SI: Safety Integrated

**201680 <location>SI Motion CU: Checksum error safety monitoring functions**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The actual checksum calculated by the drive and entered in r9728 via the safety-relevant parameters does not match the reference checksum saved in p9729 at the last machine acceptance.  
 Safety-relevant parameters have been changed or a fault is present.  
**Note:**  
 This fault results in a STOP A that can be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 0: Checksum error for SI parameters for motion monitoring.  
 1: Checksum error for SI parameters for actual values.  
 2: Checksum error for SI parameters for component assignment.



**Remedy:**

- check the safety-relevant parameters and if required, correct.
- perform a POWER ON if safety parameters requiring a POWER ON have been modified.
- carry out an acceptance test.

## 201681 <location>SI Motion CU: Incorrect parameter value

**Message value:** Parameter: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The parameter cannot be parameterized with this value.

**Note:**  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Parameter number with the incorrect value.  
 9522: The gear stage was set too high.  
 9500: p9500 not equal to p9300  
 9511: p9511 not equal to p9311

**Remedy:** Correct the parameter value.  
 For fault value = 9500:  
 Align parameters 9300 and 9500, backup parameters (p0971 = 1) and carry out a POWER ON.  
 With hysteresis/filtering enabled (p9501.16 = 1), the following applies:  
 - Set parameters p9546/p9346 and p9547/p9347 acc. to the following rule: p9546 >= 2 x p9547; p9346 >= 2 x p9347.  
 - The following rule must also be adhered to when actual value synchronization (p9501.3 = 1) is enabled: p9549 <= p9547; p9349 <= p9347.  
 For fault value = 9507:  
 - Set synchronous or induction motor according to p0300.  
 Re fault value = p9511:  
 Align parameters 9311 and 9511, backup parameters (p0971 = 1) and carry out a POWER ON.  
 For fault value = 9517:  
 - Also check p9516.0.  
 For fault value = 9522:  
 - Correct parameters.

## 201682 <location>SI Motion CU: Monitoring function not supported

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The monitoring function enabled in p9501, p9601 or p9801 is not supported in this firmware version.

**Note:**  
 This fault results in a STOP A that cannot be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 1: Monitoring function SLP not supported (p9501.1).  
 2: Monitoring function SCA not supported (p9501.7 and p9501.8 ... 15 and p9503).  
 3: Monitoring function SLS override not supported (p9501.5).  
 4: Monitoring function external ESR activation not supported (p9501.4).  
 5: Monitoring function F-DI in PROFIsafe not supported (p9501.30).  
 6: Enable actual value synchronization not supported (p9501.3).  
 9: Monitoring function not supported, enable bit reserved (p9501.2, p9501.17 ... 29, p9501.31, if required p9501.6).  
 10: Monitoring functions only supported for a SERVO drive object.  
 11: Only encoderless monitoring functions integrated in the drive are supported.  
 12: Monitoring functions for ncSI are not supported on a CU305.

- 20: Motion monitoring functions integrated in the drive are only supported in conjunction with PROFIsafe (p9501, p9601.1 ... 2 and p9801.1 ... 2).
- 21: PROFIsafe only supported in conjunction with motion monitoring functions integrated in the drive (p9501, p9601.1 ... 2 and p9801.1 ... 2).
- 22: Encoderless monitoring functions in chassis format not supported.
- 23: CU240 does not support monitoring functions requiring an encoder.
- 24: Monitoring function SDI not supported (p9501.17).
- 25: Drive-integrated motion monitoring functions not supported (p9501, p9601.2).
- 26: hysteresis and filtering for SSM monitoring function without an encoder not supported (p9501.16).

**Remedy:** De-select the monitoring function involved (p9501, p9503, p9506, p9601, p9801).  
 Note:  
 ESR: Extended Stop and Retract  
 SCA: Safe Cam / SN: Safe software cam  
 SDI: Safe Direction (safe motion direction)  
 SI: Safety Integrated  
 SLP: Safely-Limited Position / SE: Safe software limit switches  
 SLS: Safely-Limited Speed / SG: Safely reduced speed  
 SDI: Safe Direction (safe motion direction)  
 See also: p9501 (SI Motion enable safety functions (Control Unit)), p9503 (SI Motion SCA (SN) enable (Control Unit)), r9771 (SI common functions (Control Unit))

**201683 <location>SI Motion CU: SOS/SLS enable missing**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The safety-relevant basic function "SOS/SLS" is not enabled in p9501 although other safety-relevant monitoring functions are enabled.  
 Note:  
 This fault does not result in a safety stop response.  
**Remedy:** Enable the function "SOS/SLS" (p9501.0) and carry out a POWER ON.  
 Note:  
 SI: Safety Integrated  
 SLS: Safely-Limited Speed / SG: Safely reduced speed  
 SOS: Safe Operating Stop / SBH: Safe operating stop  
 See also: p9501 (SI Motion enable safety functions (Control Unit))

**201684 <location>SI Motion: Safely limited position limit values interchanged**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** For the function "Safely-Limited Position" (SE), a lower value is in p9534 than in p9535.  
 Note:  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 1: Limit values SLP1 interchanged.  
 2: Limit values SLP2 interchanged.  
**Remedy:** Correct the limit values in p9534 and p9535 and carry out a POWER ON.  
 Note:  
 SI: Safety Integrated  
 SLP: Safely-Limited Position / SE: Safe software limit switches

---

**201685**            **<location>SI Motion CU: Safely-limited speed limit value too high**

**Message value:**    %1

**Drive object:**     SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**         OFF2

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            The limit value for the function "Safely-Limited Speed" (SLS) is greater than the speed that corresponds to an encoder limit frequency of 500 kHz.  
Note:  
This fault does not result in a safety stop response.  
Fault value (r0949, decimal interpretation):  
Maximum permissible speed.

**Remedy:**           Correct the limit values for SLS and carry out a POWER ON.  
Note:  
SI: Safety Integrated  
SLS: Safely-Limited Speed / SG: Safely reduced speed  
See also: p9531 (SI Motion SLS (SG) limit values (Control Unit))

---

**201686**            **<location>SI Motion: Illegal parameterization cam position**

**Message value:**    %1

**Drive object:**     SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**         OFF2

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            At least one enabled "Safety Cam" (SCA) is parameterized in p9536 or p9537 too close to the tolerance range around the modulo position.  
The following conditions must be complied with to assign cams to a cam track:  
- the cam length of cam x = p9536[x]-p9537[x] must be greater or equal to the cam tolerance + the position tolerance (= p9540 + p9542). This also means that for cams on a cam track, the minus position value must be less than the plus position value.  
- the distance between 2 cams x and y (minus position value[y] - plus position value[x] = p9537[y] - p9536[x]) on a cam track must be greater than or equal to the cam tolerance + position tolerance (= p9540 + p9542).  
Note:  
This fault does not result in a safety stop response.  
Fault value (r0949, decimal interpretation):  
Number of the "Safe Cam" with an illegal position.  
See also: p9501 (SI Motion enable safety functions (Control Unit))

**Remedy:**           Correct the cam position and carry out a POWER ON.  
Note:  
SCA: Safe Cam / SN: Safe software cam  
SI: Safety Integrated  
See also: p9536, p9537

---

**201687**            **<location>SI Motion: Illegal parameterization modulo value SCA (SN)**

**Message value:**    -

**Drive object:**     SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**         OFF2

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            The parameterized modulo value for the "Safe Cam" (SCA) function is not a multiple of 360 000 mDegrees.  
Note:  
This fault does not result in a safety stop response.

**Remedy:** Correct the modulo value for SCA and carry out a POWER ON.  
 Note:  
 SCA: Safe Cam / SN: Safe software cam  
 SI: Safety Integrated  
 See also: p9505 (SI Motion SCA (SN) modulo value (Control Unit))

**201688 <location>SI Motion CU: Actual value synchronization not permissible**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** - It is not permissible to enable actual value synchronization for a 1-encoder system.  
 - It is not permissible to simultaneously enable actual value synchronization and a monitoring function with absolute reference (SCA/SLP).  
 Note:  
 This fault results in a STOP A that cannot be acknowledged.  
**Remedy:** - Either select the "actual value synchronization" function or parameterize a 2-encoder system.  
 - Either de-select the function "actual value synchronization" or the monitoring functions with absolute reference (SCA/SLP) and carry out a POWER ON.  
 Note:  
 SCA: Safe Cam / SN: Safe software cam  
 SI: Safety Integrated  
 SLP: Safely-Limited Position / SE: Safe software limit switches  
 See also: p9501 (SI Motion enable safety functions (Control Unit)), p9526 (SI Motion encoder assignment second channel)

**201689 <location>SI Motion: Axis re-configured**

**Message value:** Parameter: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** The axis configuration was changed (e.g. changeover between linear axis and rotary axis).  
 Parameter p0108.13 is internally set to the correct value.  
 Note:  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Parameter number of parameter that initiated the change.  
 See also: p9502 (SI Motion axis type (Control Unit))  
**Remedy:** The following should be carried out after the changeover:  
 - exit the safety commissioning mode (p0010).  
 - save all parameters (p0977 = 1 or "copy RAM to ROM").  
 - carry out a POWER ON.  
 Once the Control Unit has been switched on, safety message F01680 or F30680 indicates that the checksums in r9398[0] and r9728[0] have changed in the drive. The following must, therefore, be carried out:  
 - activate safety commissioning mode again.  
 - complete safety commissioning of the drive.  
 - exit the safety commissioning mode (p0010).  
 - save all parameters (p0977 = 1 or "copy RAM to ROM").  
 - carry out a POWER ON.  
 Note:  
 For the commissioning software, the units are only consistently displayed after a project upload.

---

<b>201690</b>	<b>&lt;location&gt;SI Motion: Data save problem for the NVRAM</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (OFF1, OFF2, OFF3) Vector: NONE (OFF1, OFF2, OFF3)
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	There is not sufficient memory space in the NVRAM on the drive to save parameters r9781 and r9782 (safety logbook). Note: This fault does not result in a safety stop response. Fault value (r0949, decimal interpretation): 0: There is no physical NVRAM available in the drive. 1: There is no longer any free memory space in the NVRAM.
<b>Remedy:</b>	For fault value = 0: - use a Control Unit NVRAM. For fault value = 1: - de-select functions that are not required and that take up memory space in the NVRAM. - contact the Hotline. Note: NVRAM: Non-Volatile Random Access Memory (non-volatile read and write memory)

---

<b>201691</b>	<b>&lt;location&gt;SI Motion: Ti and To unsuitable for DP cycle</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The configured times for PROFIBUS communication are not permitted and the DP cycle is used as the actual value acquisition cycle for the safe movement monitoring functions: Isochronous PROFIBUS: the total of Ti and To is too high for the set DP cycle. The DP cycle should be at least 1 current controller cycle greater than the sum of Ti and To. Non-isochronous PROFIBUS: the DP cycle must be at least 4 x current controller cycle.
<b>Remedy:</b>	Configure Ti and To low so that they are suitable for the DP cycle or increase the DP cycle time. Alternative when SI monitoring integrated in the drive is enabled (p9601/p9801 > 0): Use the actual value acquisition cycle p9511/p9311 and, in turn, set independently from DP cycle. The actual value sensing clock cycle must be at least four times the current controller clock cycle. A clock cycle ratio of at least 8:1 is recommended. See also: p9511 (SI Motion actual value sensing cycle clock (Control Unit))

---

<b>201692</b>	<b>&lt;location&gt;SI Motion CU: Parameter value not permitted for encoderless</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The parameter cannot be set to this value if encoderless motion monitoring functions have been selected in p9506. Note: This fault does not result in a safety stop response. Fault value (r0949, decimal interpretation): Parameter number with the incorrect value. See also: p9501 (SI Motion enable safety functions (Control Unit))
<b>Remedy:</b>	- Correct the parameter specified in the fault value. - If necessary, de-select encoderless motion monitoring functions (p9506). See also: p9501 (SI Motion enable safety functions (Control Unit))

**201693 <location>SI CU: Safety parameter settings changed, warm restart/POWER ON required**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Safety parameters have been changed; these will only take effect following a warm restart or POWER ON. Alarm value (r2124, interpret decimal): Parameter number of the safety parameter which has changed, necessitating a warm restart or POWER ON.  
**Remedy:** - carry out a warm restart (p0009 = 30, p0976 = 2, 3).  
 - carry out a POWER ON (power off/on) for all components.  
 Note:  
 Before performing an acceptance test, a POWER ON must be carried out for all components.

---

**201694 <location>SI Motion CU: Firmware version Motor Module older Control Unit**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The firmware version of the Motor Module is older than the version of the Control Unit. It is possible that safety functions are not available (r9771/r9871).  
 Note:  
 This message does not result in a safety stop response.  
 This message can also occur, if after an automatic firmware update, a POWER ON was not carried out (Alarm A01007).  
**Remedy:** Upgrade the firmware of the Motor Module to a later version.  
 See also: r9390 (SI Motion version safety motion monitoring (Motor Module)), r9590 (SI Motion version safety motion monitoring (Control Unit))

---

**201695 <location>SI Motion: Sensor Module was replaced**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A Sensor Module, which is used for safe motion monitoring functions, was replaced. The hardware replacement must be acknowledged. An acceptance test must be subsequently performed.  
 Note:  
 This message does not result in a safety stop response.  
**Remedy:** Carry out the following steps using the STARTER commissioning software:  
 - press the "Acknowledge hardware replacement" button in the safety screen form.  
 - execute the function "Copy RAM to ROM".  
 - carry out a POWER ON (power off/on) for all components.  
 As an alternative, carry out the following steps in the expert list of the commissioning software:  
 - start the copy function for the node identifier on the drive (p9700 = 1D hex).  
 - acknowledge the hardware CRC on the drive (p9701 = EC hex).  
 - save all parameters (p0977 = 1).  
 - carry out a POWER ON (power off/on) for all components.  
 Then carry out an acceptance test (refer to the Safety Integrated Function Manual).  
 See also: p9700 (SI Motion copy function), p9701 (Acknowledge SI motion data change)

---

<b>201696</b>	<b>&lt;location&gt;SI Motion: Testing of the motion monitoring functions selected when booting</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The test of the motion monitoring functions was already illegally active when booting. This is the reason that the test is only carried out again after selecting the forced checking procedure parameterized in p9705. Note: This message does not result in a safety stop response. See also: p9705 (SI Motion: Test stop signal source)
<b>Remedy:</b>	De-select the forced checking procedure of the safety motion monitoring functions and then select again. The signal source for initiation is parameterized in binector input p9705. Notice: It is not permissible to use TM54F inputs to start the test stop. Note: SI: Safety Integrated See also: p9705 (SI Motion: Test stop signal source)

---

<b>201697</b>	<b>&lt;location&gt;SI Motion: Motion monitoring functions must be tested</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The time set in p9559 for the forced checking procedure of the safety motion monitoring functions has been exceeded. A new test is required. After next selecting the forced checking procedure parameterized in p9705, the message is withdrawn and the monitoring time is reset. Note: This message does not result in a safety stop response. As the shutdown paths are not automatically checked during booting, an alarm is always issued once booting is complete. See also: p9559 (SI Motion forced checking procedure timer (Control Unit)), p9705 (SI Motion: Test stop signal source)
<b>Remedy:</b>	Carry out the forced checking procedure of the safety motion monitoring functions. The signal source for initiation is parameterized in binector input p9705. Notice: It is not permissible to use TM54F inputs to start the test stop. Note: SI: Safety Integrated See also: p9705 (SI Motion: Test stop signal source)

---

<b>201698</b>	<b>&lt;location&gt;SI CU: Commissioning mode active</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, TM54F_MA, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE

**Cause:** The commissioning of the "Safety Integrated" function is selected.  
 This message is withdrawn after the safety functions have been commissioned.  
**Note:**  
 This message does not result in a safety stop response.  
 See also: p0010

**Remedy:** Not necessary.  
**Note:**  
 CU: Control Unit  
 SI: Safety Integrated

**201699**                    **<location>SI CU: Shutdown path must be tested**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The time set in p9659 for the forced checking procedure of the safety shutdown paths has been exceeded. The safety shutdown paths must be re-tested.  
 After the next time the "STO" function is de-selected, the message is withdrawn and the monitoring time is reset.  
**Note:**  
 This message does not result in a safety stop response.  
 See also: p9659 (SI forced checking procedure timer)

**Remedy:** Select STO and then de-select again.  
**Note:**  
 CU: Control Unit  
 SI: Safety Integrated  
 STO: Safe Torque Off / SH: Safe standstill

**201700**                    **<location>SI Motion CU: STOP A initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP A (pulses are suppressed via the safety shutdown path of the Control Unit).  
 Possible causes:  
 - stop request from the 2nd monitoring channel.  
 - pulses not suppressed after a parameterized time (p9557) after test stop selection.  
 - subsequent response to the message C01706 "SI Motion CU: SAM/SBR limit exceeded".  
 - subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".  
 - subsequent response to the message C01701 "SI Motion CU: STOP B initiated".

**Remedy:**  
 - remove the cause of the fault on the 2nd monitoring channel.  
 - carry out a diagnostics routine for message C01706.  
 - carry out a diagnostics routine for message C01714.  
 - carry out a diagnostics routine for message C01701.  
 - check the value in p9557 (where available), increase the value if necessary, and carry out a POWER ON  
 - check the shutdown path of the Control Unit (check DRIVE-CLiQ communication if it has been implemented)  
 - replace the Motor Module/Power Module  
 - replace Control Unit.  
 This message can be acknowledged without a POWER ON as follows:  
 - motion monitoring functions integrated in the drive: via Terminal Module 54F (TM54F) or PROFIsafe  
 - motion monitoring functions with SINUMERIK: via the machine control panel in acceptance test mode only  
**Note:**  
 SAM: Safe Acceleration Monitor (safe acceleration monitoring)  
 SBR: Safe Brake Ramp (safe brake ramp monitoring)  
 SI: Safety Integrated



---

**201701 <location>SI Motion CU: STOP B initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF3

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP B (braking along the OFF3 deceleration ramp).  
As a result of this fault, after the time parameterized in p9556 has expired, or the speed threshold parameterized in p9560 has been undershot, message C01700 "STOP A initiated" is output.  
Possible causes:

- stop request from the second monitoring channel.
- subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".
- subsequent response to the message C01711 "SI Motion CU: Defect in a monitoring channel".
- subsequent response to the message C01707 "SI Motion CU: tolerance for safe operating stop exceeded".

**Remedy:**

- remove the cause of the fault on the second monitoring channel.
- carry out a diagnostics routine for message C01714.
- carry out a diagnostics routine for message C01711.
- carry out a diagnostics routine for message C01707.

This message can be acknowledged without a POWER ON as follows:

- motion monitoring functions integrated in the drive: via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: via the machine control panel in acceptance test mode only

**Note:**  
SI: Safety Integrated

---

**201706 <location>SI Motion CU: SAM/SBR limit exceeded**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** Motion monitoring functions with encoder (p9506 = 0) or encoderless with set acceleration monitoring (p9506 = 3):  
SAM - safe acceleration monitoring. After initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance.  
Motion monitoring functions encoderless with set brake ramp monitoring (p9506 = 1):  
SBR - Safe brake ramp monitoring. After initiating STOP B (SS1) or SLS changeover to the lower speed stage, the speed has exceeded the selected tolerance.  
The drive is shut down by the message C01700 "SI Motion: STOP A initiated".

**Remedy:** Check the braking behavior and, if necessary, adapt the tolerance for the "SAM" function or modify the parameter settings for the "SBR" function.

This message can be acknowledged without a POWER ON as follows:

- motion monitoring functions integrated in the drive: via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: via the machine control panel in acceptance test mode only

**Note:**  
SAM: Safe Acceleration Monitor (safe acceleration monitoring)  
SBR: Safe Brake Ramp (safe ramp monitoring)  
SI: Safety Integrated  
See also: p9548, p9581, p9582, p9583

---

**201707 <location>SI Motion CU: Tolerance for safe operating stop exceeded**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The actual position has distanced itself further from the target position than the standstill tolerance.  
The drive is shut down by the message C01701 "SI Motion: STOP B initiated".

**Remedy:**

- check whether safety faults are present and if required carry out the appropriate diagnostic routines for the particular faults.
- check whether the standstill tolerance matches the accuracy and control dynamic performance of the axis.
- carry out a POWER ON.

This message can be acknowledged without a POWER ON as follows:

- motion monitoring functions integrated in the drive: via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: via the machine control panel in acceptance test mode only

Note:

SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop  
 See also: p9530 (SI Motion standstill tolerance (Control Unit))

---

**201708**                    **<location>SI Motion CU: STOP C initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** STOP2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP C (braking along the OFF3 deceleration ramp).  
 "Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
 Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C01714 "SI Motion: Safely limited speed exceeded".
- subsequent response to the message C01715 "SI Motion: Safe end stop exceeded".

See also: p9552 (SI Motion transition time STOP C to SOS (SBH) (Control Unit))

**Remedy:**

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714.

This message can be acknowledged as follows:

- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: Via the machine control panel

Note:

SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop

---

**201709**                    **<location>SI Motion CU: STOP D initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP D (braking along the path).  
 "Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
 Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C01714 "SI Motion: Safely limited speed exceeded".
- subsequent response to the message C01715 "SI Motion: Safe end stop exceeded".

See also: p9553 (SI Motion transition time STOP D to SOS (SBH) (Control Unit))

**Remedy:**

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714.

This message can be acknowledged as follows:

- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: Via the machine control panel

Note:

SI: Safety Integrated  
SOS: Safe Operating Stop / SBH: Safe operating stop

## 201710 <location>SI Motion CU: STOP E initiated

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP E (retraction motion).  
"Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C01714 "SI Motion: Safely limited speed exceeded".
- subsequent response to the message C01715 "SI Motion: Safe end stop exceeded".

See also: p9554 (SI Motion transition time STOP E to SOS (SBH) (Control Unit))

**Remedy:**

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714.

This message can be acknowledged as follows:

- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: Via the machine control panel

Note:

SI: Safety Integrated  
SOS: Safe Operating Stop / SBH: Safe operating stop

## 201711 <location>SI Motion CU: Defect in a monitoring channel

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** When cross-checking and comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.  
If at least one monitoring function is active, then after the parameterized timer has expired, the message C01701 "SI Motion: STOP B initiated" is output.  
The message value that resulted in a STOP F is displayed in r9725. The described message values involve the crosswise data comparison between the Control Unit and Motor Module. If the drive is operated together with a SINUMERIK, the message values are described in message 27001 of SINUMERIK.  
The following message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:

- cycle times not set uniformly (p9500/p9300 and p9511/p9311)
- differently parameterized axis types (p9502/p9302).
- excessively fast cycle times (p9500/p9300, p9511/p9311).
- for message values 3, 44 ... 57, 232 and 1-encoder systems, differently parameterized encoder values (p9516/p9316, p9517/p9317, p9518/p9318, p9520/p9320, p9521/p9321, p9522/p9322, p9526/p9326).
- incorrect synchronization.

Message value (r9749, interpret decimal):

0 to 999: Number of the cross-checked data that resulted in this fault.

Message values that are not subsequently listed are only for internal Siemens troubleshooting.

0: Stop request from the other monitoring channel.

1: Status image of monitoring functions SOS, SLS or SLP (result list 1) (r9710[0], r9710[1]).

2: Status image of monitoring function SCA or n < nx (result list 2) (r9711[0], r9711[1]).

3: The position actual value differential (r9713) between the two monitoring channels is greater than the tolerance in p9542/p9342. When actual value synchronization is enabled (p9501.3/p9301.3), the velocity differential (based on the position actual value) is greater than the tolerance in p9549/p9349.

4: Error when synchronizing the crosswise data comparison between the two channels.

5: Function enable signals (p9501/p9301)

6: Limit value for SLS1 (p9531[0]/p9331[0])

7: Limit value for SLS2 (p9531[1]/p9331[1])

8: Limit value for SLS3 (p9531[2]/p9331[2])

9: Limit value for SLS4 (p9531[3]/p9331[3])

10: Standstill tol. (p9530/p9330)

31: Position tolerance (p9542/p9342) or (p9549/p9349) when actual value synchronization is enabled (p9501.3/p9301.3)

33: Time, velocity changeover (p9551/p9351)

35: Delay time, pulse canc. (p9556/p9356)

36: Checking time, pulse canc. (p9557/p9357)

37: Trans. time, STOP C to SOS (p9552/p9352)

38: Trans. time STOP D to SOS (p9553/p9353)

40: Stop response for SLS (p9561/p9361)

42: Shutdown speed, pulse canc. (p9560/p9360)

43: Memory test, stop response (STOP A).

44 ... 57: General

Possible cause 1 (during commissioning or parameter modification)

The tolerance value for the monitoring function is not the same on the two monitoring channels.

Possible cause 2 (during active operation)

The limit values are based on the current actual value (r9713). If the safe actual values on the two monitoring channels do not match, the limit values, which have been set at a defined interval, will also be different (i.e. corresponding to fault value 3). This can be ascertained by checking the safe actual positions.

44: Position actual value (r9713) + limit value for SLS1 (p9531[0]/p9331[0]) \* Safety monitoring clock cycle

45: Position actual value (r9713) - limit value for SLS1 (p9531[0]/p9331[0]) \* Safety monitoring clock cycle

46: Position actual value (r9713) + limit value for SLS2 (p9531[1]/p9331[1]) \* Safety monitoring clock cycle

47: Position actual value (r9713) - limit value for SLS2 (p9531[1]/p9331[1]) \* Safety monitoring clock cycle

48: Position actual value (r9713) + limit value for SLS3 (p9531[2]/p9331[2]) \* Safety monitoring clock cycle

49: Position actual value (r9713) - limit value for SLS3 (p9531[2]/p9331[2]) \* Safety monitoring clock cycle

50: Position actual value (r9713) + limit value for SLS4 (p9531[3]/p9331[3]) \* Safety monitoring clock cycle

51: Position actual value (r9713) - limit value for SLS4 (p9531[3]/p9331[3]) \* Safety monitoring clock cycle

52: Standstill position + tolerance (p9530/9330)

53: Standstill position - tolerance (p9530/9330)

54: Position actual value (r9713) + limit value nx (p9546/p9346) + tolerance (p9542/p9342)

55: Position actual value (r9713) + limit value nx (p9546/p9346)

56: Position actual value (r9713) - limit value nx (p9546/p9346)

57: Position actual value (r9713) - limit value nx (p9546/p9346) - tolerance (p9542/p9342)

58: Actual stop request.

75: Velocity limit nx (p9546, p9346).

76: Stop response for SLS1 (p9563[0]/p9363[0])

77: Stop response for SLS2 (p9563[1]/p9363[1])

78: Stop response for SLS3 (p9563[2]/p9363[2])

79: Stop response for SLS4 (p9563[3]/p9363[3])

81: Velocity tolerance for SAM (p9548/p9348)

82: SGEs for SLS correction factor.

83: Acceptance test timer (p9558/p9358)

84: Trans. time STOP F (p9555/p9355)

85: Trans. time bus failure (p9580/p9380)

86: ID 1-encoder system (p9526/p9326).

87: Encoder assignment, second channel (p9526/p9326)

89: Encoder limit freq.

230: Filter time constant for n < nx.

231: Hysteresis tolerance for n < nx.

- 232: Smoothed velocity actual value.  
 233: Limit value nx / safety monitoring clock cycle + hysteresis tolerance.  
 234: Limit value nx / Safety monitoring clock cycle.  
 235: -Limit value nx / Safety monitoring clock cycle.  
 236: -Limit value nx / safety monitoring clock cycle - hysteresis tolerance.  
 237: SGA n < nx.  
 238: Speed limit value for SAM (p9568/p9368).  
 239: Acceleration for SBR (p9581/p9381 and p9583/p9383).  
 240: Inverse value of acceleration for SBR (p9581/p9381 and p9583/p9383).  
 241: Deceleration time for SBR (p9582/p9382).  
 242: Encoderless safety (p9506/p9306).  
 243: Extended alarm acknowledgment (p9507/p9307).  
 244: Encoderless actual value sensing filter time (p9587/p9387).  
 245: Encoderless actual value sensing minimum current (p9588/p9388).  
 246: Voltage tolerance acceleration (p9589/p9389).  
 247: SDI tolerance (p9564/p9364).  
 248: SDI positive upper limit (0x7ffffff).  
 249: Position actual value (r9713) - SDI tolerance.  
 250: Position actual value (r9713) + SDI tolerance.  
 251: SDI negative lower limit (0x80000001).  
 252: SDI stop response (p9566/p9366).  
 253: SDI delay time (p9565/p9365).  
 254: Setting the evaluation delay for actual value sensing after pulse enable (p9586/p9386).  
 255: Setting, behavior during pulse suppression (p9509/p9309).  
 256: Status image of monitoring functions SOS, SLS, SLP, test stop, SBR, SDI (result list 1 ext) (r9710).  
 1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.  
 1001: Initialization error of watchdog timer.  
 1005: Pulses already suppressed for test stop selection.  
 1011: Acceptance test status between the monitoring channels differ.  
 1012: Plausibility violation of the actual value from the encoder.  
 1020: Cyc. communication failure between the monit. cycles.  
 1021: Cyc. communication failure between the monit. channel and Sensor Module.  
 1022: Sign-of-life error for DRIVE-CLiQ encoder CU  
 1023: Error in the effectiveness test in the DRIVE-CLiQ encoder  
 1032: Sign-of-life error for DRIVE-CLiQ encoder MM  
 1033: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder CU  
 1034: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder MM  
 1041: Current absolute value too low (encoderless)  
 1042: Current/voltage plausibility error  
 1043: Too many acceleration phases  
 1044: Actual current values plausibility error.  
 5000 ... 5140:  
 PROFIsafe message values.  
 For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.  
 5000, 5014, 5023, 5024, 5030 ... 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122  
 ... 5125, 5132 ... 5135, 5140: An internal software error has occurred (only for internal Siemens troubleshooting).  
 5012: Error when initializing the PROFIsafe driver.  
 5013: The result of the initialization is different for the two controllers.  
 5022: Error when evaluating the F parameters. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.  
 5025: The result of the F parameterization is different for the two controllers.  
 5026: CRC error for the F parameters. The transferred CRC value of the F parameters does not match the value calculated in the PST.  
 5065: A communications error was identified when receiving the PROFIsafe telegram.  
 5066: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.  
 6000 ... 6166:  
 PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).  
 For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.  
 6000: A fatal PROFIsafe communication error has occurred.  
 6064 ... 6071: Error when evaluating the F parameters. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.  
 6064: Destination address and PROFIsafe address are different (F\_Dest\_Add).  
 6065: Destination address not valid (F\_Dest\_Add).

6066: Source address not valid (F\_Source\_Add).  
 6067: Watchdog time not valid (F\_WD\_Time).  
 6068: Incorrect SIL level (F\_SIL).  
 6069: Incorrect F-CRC length (F\_CRC\_Length).  
 6070: Incorrect F parameter version (F\_Par\_Version).  
 6071: CRC error for the F parameters (CRC1). The transferred CRC value of the F parameters does not match the value calculated in the PROFIsafe driver.  
 6072: F parameterization is inconsistent.  
 6165: A communications error was identified when receiving the PROFIsafe telegram. The fault may also occur if an inconsistent or out-of-date PROFIsafe telegram has been received after switching the Control Unit off and on or after plugging in the PROFIBUS/PROFINET cable.  
 6166: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.  
 See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion, diagnostics STOP F)

**Remedy:**

The following generally applies:

The monitoring clock cycles in both channels and the axis types should be checked for equality and the same setting applied if necessary. If the error continues to be identified, increasing the monitoring clock cycles may resolve it.

Re message value = 0:

- no error was identified in this monitoring channel. Note the error message of the other monitoring channel (for MM: C30711).

Re message value = 3:

Commissioning phase:

Encoder evaluation for own or second channel has been set incorrectly --> Correct the encoder evaluation.

In operation:

Check the mechanical design and the encoder signals.

Re message value = 4:

The monitoring clock cycles in both channels should be checked for equality and if required, set the same. In combination with fault value 5 from the other monitoring channel (with MM: C30711), the monitoring clock cycle settings must be increased.

Re message value = 232:

-increase the hysteresis tolerance (p9547/p9347). Possibly set the filtering higher (p9545/p9345).

Re message value = 1 ... 999:

- if the message value is listed under cause: Check the crosswise-compared parameters to which the message value refers.

- copy the safety parameters.

- carry out a POWER ON (power off/on) for all components.

- upgrade the Motor Module software.

- upgrade the Control Unit software.

- correction of the encoder evaluation. The actual values differ as a result of mechanical faults (V belts, travel to a mechanical endstop, wear and window setting that is too narrow, encoder fault, ...).

Re message value = 1000:

- investigate the signal associated with the safety-relevant input (contact problems).

Re message value = 1001:

- carry out a POWER ON (power off/on) for all components.

- upgrade the Motor Module software.

- upgrade the Control Unit software.

Re message value = 1005:

- check the conditions for pulse enable.

Re message value = 1011:

- for diagnostics, refer to parameter (r9571).

Re message value = 1012:

- upgrade the Sensor Module software.

- for 1-encoder systems, check the encoder parameters for equality (p9515/p9315, p9519/p9319, p9523/p9323, p9524/p9324, p9525/p9325, p9529/p9329).

- For DQI encoders the following applies: If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.

Re message value = 1020, 1021:

- check the communication link.
- increase the monitoring cycle clock settings (p9500, p9511).
- carry out a POWER ON (power off/on) for all components.
- replace the hardware.

Re message value = 1033:

- If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.

Re message value = 1041:

- reduce the minimum current (p9588).
- for synchronous motors increase the absolute value of p9783.
- Check whether the function "Closed-loop controlled operation with HF signal injection" is activated (p1750.5 = 1) and if required, deactivate.

Re message value = 1042:

- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).
- reduce the dynamic response of the setpoint value.
- increase the minimum current (p9588).

Re message value = 1043:

- increase the voltage tolerance (p9589).
- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).
- reduce the dynamic response of the setpoint value.

Re message value = 5000, 5014, 5023, 5024, 5030, 5031, 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122 ... 5125, 5132 ... 5135, 5140:

- carry out a POWER ON (power off/on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- upgrade firmware to later version.
- contact the Hotline.
- replace the Control Unit.

Re message value = 5012:

- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810). It is not permissible for the PROFIsafe address to be 0 or FFFF!

Re message value = 5013, 5025:

- carry out a POWER ON (power off/on) for all components.
- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810).
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

Re message value = 5022:

- check the setting of the values of the F parameters at the PROFIsafe slave (F\_SIL, F\_CRC\_Length, F\_Par\_Version, F\_Source\_Add, F\_Dest\_add, F\_WD\_Time).

Re message value = 5026:

- check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and update.

Re message value = 5065:

- check the configuration and communication at the PROFIsafe slave (cons. No. / CRC).
- check the setting of the value for F parameter F\_WD\_Time on the PROFIsafe slave and increase if necessary.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

Re message value = 5066:

- check the setting of the value for F parameter F\_WD\_Time on the PROFIsafe slave and increase if necessary.
- evaluate diagnostic information in the F host.
- check PROFIsafe connection.

Re message value = 6000:

- carry out a POWER ON (power off/on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- increase the monitoring cycle clock settings (p9500, p9511).
- upgrade firmware to later version.
- contact the Hotline.

- replace the Control Unit.
- Re message value = 6064:
  - check the setting of the value in the F parameter F\_Dest\_Add at the PROFIsafe slave.
  - check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810).
- Re message value = 6065:
  - check the setting of the value in the F parameter F\_Dest\_Add at the PROFIsafe slave. It is not permissible for the destination address to be either 0 or FFFF!
- Re message value = 6066:
  - check the setting of the value in the F parameter F\_Source\_Add at the PROFIsafe slave. It is not permissible for the source address to be either 0 or FFFF!
- Re message value = 6067:
  - check the setting of the value in the F parameter F\_WD\_Time at the PROFIsafe slave. It is not permissible for the watch time to be 0!
- Re message value = 6068:
  - check the setting of the value in the F parameter F\_SIL at the PROFIsafe slave. The SIL level must correspond to SIL2!
- Re message value = 6069:
  - check the setting of the value in the F parameter F\_CRC\_Length at the PROFIsafe slave. The setting of the CRC2 length is 2-byte CRC in the V1 mode and 3-byte CRC in the V2 mode!
- Re message value = 6070:
  - check the setting of the value in the F parameter F\_Par\_Version at the PROFIsafe slave. The value for the F parameter version is 0 in the V1 mode and 1 in the V2 mode!
- Re message value = 6071:
  - check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and, if required, update.
- Re message value = 6072:
  - check the settings of the values for the F parameters and, if required, correct.

The following combinations are permissible for F parameters F\_CRC\_Length and F\_Par\_Version:

F\_CRC\_Length = 2-byte CRC and F\_Par\_Version = 0

F\_CRC\_Length = 3-byte CRC and F\_Par\_Version = 1
- Re message value = 6165:
  - if the fault occurs after powering up the Control Unit or after plugging in the PROFIBUS/PROFINET cable, acknowledge the fault.
  - check the configuration and communication at the PROFIsafe slave.
  - check the setting of the value for F parameter F\_WD\_Time on the PROFIsafe slave and increase if necessary.
  - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- Re message value = 6166:
  - check the configuration and communication at the PROFIsafe slave.
  - check the setting of the value for F parameter F\_WD\_Time on the PROFIsafe slave and increase if necessary.
  - evaluate diagnostic information in the F host.
  - check PROFIsafe connection.

This message can be acknowledged as follows:

  - motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
  - motion monitoring functions with SINUMERIK: Via the machine control panel

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

---

**201712**

**<location>SI Motion CU: Defect in F-IO processing**

- Message value:** %1
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** NONE
- Acknowledge:** IMMEDIATELY (POWER ON)
- Cause:** When cross checking and comparing the two monitoring channels, the drive detected a difference between parameters or results of the F-IO processing and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.  
The safety message C01711 with message value 0 is also displayed due to initiation of STOP F.



If at least one monitoring function is active, the safety message C01701 "SI Motion: STOP B initiated" is output after the parameterized timer has expired.

Message value (r9749, interpret decimal):

Number of the cross-checked data that resulted in this message.

- 1: SI discrepancy monitoring time inputs (p10002, p10102).
- 2: SI acknowledgement internal event input terminal (p10006, p10106).
- 3: SI STO input terminal (p10022, p10122).
- 4: SI SS1 input terminal (p10023, p10123).
- 5: SI SS2 input terminal (p10024, p10124).
- 6: SI SOS input terminal (p10025, p10125).
- 7: SI SLS input terminal (p10026, p10126).
- 8: SI SLS\_Limit(1) input terminal (p10027, p10127).
- 9: SI SLS\_Limit(2) input terminal (p10028, p10128).
- 10: SI Safe State signal selection (p10039, p10139).
- 11 SI F-DI input mode (p10040, p10140).
- 12: SI F-DO 0 signal sources (p10042, p10142).
- 13: Different states for static inactive signal sources (p10006, p10022 ... p10028).
- 14: SI discrepancy monitoring time outputs (p10002, p10102).
- 15: SI acknowledgment internal event (p10006, p10106).
- 16: SI test sensor feedback signal test mode selected for test stop (p10046, p10146, p10047, p10147).
- 17: SI delay time for test stop at DOs (p10001).
- 18 ... 25: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of internal readback signal, generated from the selected test stop mode.
- 26 ... 33: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of external readback signal, generated from the selected test stop mode.
- 34 ... 41: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of second internal readback signal, generated from the selected test stop mode.
- 42: Internal data for processing the second internal readback signal, generated from the selected test stop mode (p10047, p10147).
- 43: Internal data for processing the internal readback signal, generated from the selected test stop mode (p10047, p10147).
- 44: Internal data for processing the external readback signal, generated from the selected test stop mode (p10047, p10147).
- 45: Internal data for initialization state of test stop mode, dependent upon test stop parameters.
- 46: SI digital inputs debounce time (p10017, p10117)
- 47: Selection F-DI for PROFIsafe (p10050, p10150)
- 48: Selection F-DI for PROFIsafe (p10050, p10150)
- 49: SI SDI positive input terminal (p10030, p10130).
- 50: SI SDI negative input terminal (p10031, p10131).

**Remedy:**

- check parameterization in the parameters involved and correct if required.
- ensure equality by copying the SI data to the second channel and then carry out an acceptance test.
- check monitoring clock cycle in p9500 and p9300 for equality.

Note:

This message can be acknowledged via F-DI or PROFIsafe.

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

---

**201714 <location>SI Motion CU: Safely-Limited Speed exceeded**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive has moved faster than that specified by the velocity limit value (p9531). The drive is stopped as a result of the configured stop response (p9563).

Message value (r9749, interpret decimal):

100: SLS1 exceeded.

200: SLS2 exceeded.  
 300: SLS3 exceeded.  
 400: SLS4 exceeded.  
 1000: Encoder limit frequency exceeded.

**Remedy:**

- check the traversing/motion program in the control.
- check the limits for "Safely-Limited Speed (SLS) and if required, adapt (p9531).

This message can be acknowledged as follows:

- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: Via the machine control panel

Note:

SI: Safety Integrated  
 SLS: Safely-Limited Speed / SG: Safely reduced speed  
 See also: p9531 (SI Motion SLS (SG) limit values (Control Unit)), p9563 (SI Motion SLS (SG)-specific stop response (Control Unit))

**201716 <location>SI Motion CU: Tolerance for safe motion direction exceeded**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The tolerance for the "safe motion direction" function was exceeded. The drive is stopped as a result of the configured stop response (p9566).  
 Message value (r9749, interpret decimal):  
 0: Tolerance for the "safe motion direction positive" function exceeded.  
 1: Tolerance for the "safe motion direction positive negative" function exceeded.

**Remedy:**

- check the traversing/motion program in the control.
- check the tolerance for "SDI" function and if required, adapt (p9564).

This message can be acknowledged as follows:  
 Via F-DI or PROFIsafe

Note:

SDI: Safe Direction (safe motion direction)  
 SI: Safety Integrated  
 See also: p9564, p9565, p9566

**201745 <location>SI Motion CU: Checking braking torque for the brake test**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** POWER ON (IMMEDIATELY)  
**Cause:** The scaling of the brake torque for the brake test can be changed using parameter p2003.  
 An acceptance test must be carried out again for the braking test. This determines whether the braking test is still carried out with the correct braking torque.

**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- repeat the acceptance test for the safe brake test if the brake test is used.

See also: p2003

---

**201750 <location>SI Motion CU: Hardware fault safety-relevant encoder**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The encoder that is used for the safety-relevant motion monitoring functions signals a hardware fault.  
 Message value (r9749, interpret decimal):  
 Encoder status word 1, encoder status word 2 that resulted in the message.  
**Remedy:** - check the encoder connection.  
 - replace the encoder.  
 This message can be acknowledged as follows:  
 - motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe  
 - motion monitoring functions with SINUMERIK: Via the machine control panel.

---

**201751 <location>SI Motion CU: Effectivity test error safety-relevant encoder**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The DRIVE-CLiQ encoder for safe motion monitoring signals an error for the effectivity tests.  
 Message value (r9749, interpret decimal):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - check the encoder connection.  
 - replace the encoder.  
 This message can be acknowledged as follows:  
 - motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe  
 - motion monitoring functions with SINUMERIK: Via the machine control panel

---

**201770 <location>SI Motion CU: Discrepancy error of the failsafe inputs or outputs**

**Message value:** %1  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The fail-safe digital inputs/digital outputs (F-DI/F-DO) show a different state longer than that parameterized in p10002 / p10102.  
 Fault value (r0949, interpret bitwise binary):  
 yyyxxxx bin  
 xxxx: Discrepancy error for fail-safe digital inputs (F-DI).  
 Bit 0: Discrepancy error for F-DI 0  
 Bit 1: Discrepancy error for F-DI 1  
 ...  
 yyyy: Discrepancy error for fail-safe digital outputs (F-DO).  
 Bit 0: Discrepancy error for F-DO 0  
 ...  
**Note:**  
 If several discrepancy errors occur consecutively, then this fault is only signaled for the first error that occurs.  
**Remedy:** - check the wiring of the F-DI (contact problems).  
**Note:**  
 This message can be acknowledged via F-DI or PROFIsafe.  
 Discrepancy errors of an F-DI can only be completely acknowledged if safe acknowledgement was carried out once the cause of the error was resolved (p10006 or acknowledgment via PROFIsafe). As long as safety acknowledgement was not carried out, the corresponding F-DI stays in the safe state internally.

For cyclic switching operations at the F-DI, it may be necessary to adapt the discrepancy time to the switching frequency.

If the period of a cyclic switching pulse has the order of magnitude of double the value of p10002, then the following formulas must be checked.

$p10002 < (tp / 2) - td$  (discrepancy time must be less than half the period minus the actual discrepancy time)

$p10002 \geq p9500$  (discrepancy time must be no less than P9500)

$p10002 > td$  (discrepancy time must be greater than the switch discrepancy time which may actually apply)

td = possible actual discrepancy time (in ms) that can occur with a switching operation. This must correspond to at least 1 SI sampling cycle (see p9500).

tp = period for a switching operation in ms.

When debounce p10017 is active, the discrepancy time is directly specified by the debounce time.

If the period of a cyclic switching pulse has the order of magnitude of twice the debounce time, then the following formulas should be checked.

$p10002 < p10017 + 1 \text{ ms} - td$

$p10002 > td$

$p10002 \geq p9500$

Example:

For a 12 ms SI sampling cycle and a switching frequency of 110 ms (p10017 = 0), the maximum discrepancy time which can be set is as follows:

$p10002 \leq (110/2 \text{ ms}) - 12 \text{ ms} = 43 \text{ ms}$

Rounded-off, p10002  $\leq$  36 ms is obtained (since the discrepancy time can only be accepted as a whole SI sampling cycle, the value will need to be rounded up or down to a whole SI sampling time value if the result is not an exact multiple of an SI sampling cycle).

Note:

F-DI: Failsafe Digital Input  
 F-DO: Failsafe Digital Output

---

**201772**                      **<location>SI Motion CU: Test stop failsafe inputs/outputs active**

**Message value:**            -

**Drive object:**              SERVO

**Reaction:**                    NONE

**Acknowledge:**              NONE

**Cause:**                      The test stop for the fail-safe digital inputs (F-DI) and/or fail-safe digital outputs (F-DO) is presently being performed.

Note:

F-DI: Failsafe Digital Input  
 F-DO: Failsafe Digital Output

**Remedy:**                    The alarm disappears automatically after successfully ending or canceling (when a fault condition occurs) the test stop.

---

**201773**                      **<location>SI Motion CU: Test stop error**

**Message value:**            %1

**Drive object:**              SERVO

**Reaction:**                    NONE

**Acknowledge:**              IMMEDIATELY (POWER ON)

**Cause:**                      A fault has occurred on the CU side during the test stop for the fail-safe outputs.

Fault value (r0949, interpret hexadecimal):

RRRVWXYZ hex:

R: Reserved.

V: Actual state of the DO channel concerned (see X) on the CU (corresponds to the states read back from the hardware, bit 0 = DO 0, bit 1 = DO 1, etc.).

W: Required state of the DO channel concerned (see X, bit 0 = DO 0, bit 1 = DO 1, etc.).

X: DO channels involved, which indicate an error (bit 0 = DO 0, bit 1 = DO 1, etc.).

Y: Reason for the test stop fault.

Z: State of the test stop in which the fault has occurred.

Y: Reason for the test stop fault

Y = 1: MM side in incorrect test stop state (internal fault).

Y = 2: Expected states of the DOs were not fulfilled (CU305: readback via DI 22 / CU240 readback DI 2).

Y = 3: Incorrect timer state on CU side (internal fault)

Y = 4: Expected states of the diag DOs were not fulfilled (CU305: internal readback on MM channel).

Y = 5: Expected states of the second diag DOs were not fulfilled (CU305: internal readback on CU channel).

X and V indicate the DI or Diag-DO state dependent upon the reason for the fault (2, 4 or 5).

In the event of multiple test stop faults, the first one that occurred is shown.

Z: Test stop state and associated test actions

Z = 0 ... 3: Synchronization phase of test stop between CU and Motor Module no switching operations

Z = 4: DO + OFF and DO - OFF

Z = 5: Check to see if states are as expected

Z = 6: DO + ON and DO - ON

Z = 7: Check to see if states are as expected

Z = 8: DO + OFF and DO - ON

Z = 9: Check to see if states are as expected

Z = 10: DO + ON and DO - OFF

Z = 11: Check to see if states are as expected

Z = 12: DO + OFF and DO - OFF

Z = 13: Check to see if states are as expected

Z = 14: End of test stop

Diag expected states in table format:

Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4

5: 0/-/-1

7: 0/-/-0

9: 0/-/-0

11: 1/-/-1

13: 0/-/-1

Second diag expected states in table format:

Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4

5: -/-/-1

7: -/-/-0

9: -/-/-1

11: -/-/-0

13: -/-/-1

DI expected states in table format:

Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4

5: -/1/1/-

7: -/0/0/-

9: -/0/1/-

11: -/0/1/-

13: -/1/1/-

Example:

Fault F01773 (CU) is signaled with fault value = 0001\_0127 and fault F30773 (MM) is signaled with fault value 0000\_0127.

This means that in state 7 (Z = 7) the state of the external readback signal was not set correctly (Y = 2) after DO-0 (X = 1) was switched to ON/ON.

Fault value 0001\_0127 indicates that 0 was expected (W = 0) and 1 (V = 1) was read back from the hardware.

Fault value 0000\_0127 on the MM indicates that the states were as expected.

In the case of fault F30773, W and V are always identical; a value of 0 always means that 0 was expected at the readback input but was not present on the other channel (CU).

#### Remedy:

Check the wiring of the F-DOs and restart the test stop.

Note:

The fault is withdrawn if the test stop is successfully completed.

In the event of multiple test stop faults, the first one that occurred is shown.

Once the test stop has been restarted the next queued test stop fault will be signaled (if there is one).

---

**201774 <location>SI Motion CU: Test stop necessary**

**Message value:** -  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** - after powering up the drive, a test stop has still not been carried out.  
 - a new test stop is required after commissioning.  
 - the time to carry out the forced checking procedure (test stop) has expired (p10003).  
**Remedy:** Initiate test stop (BI: p10007).

---

**201796 <location>SI Motion CU: Wait for communication**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The drive waits for communication to be established with SINUMERIK or TM54F to execute the safety-relevant motion monitoring functions.  
**Note:**  
 In this state, the pulses are safely suppressed.  
**Remedy:** If, after a longer period of time, the message is not automatically withdrawn, the following checks have to be made as appropriate:  
 For communication with SINUMERIK, the following applies:  
 - check any other PROFIBUS messages/signals present and remove their cause.  
 - check that assignment of the axes on the higher-level control to the drives in the drive unit is correct.  
 - check enable signal of the safety-relevant motion monitoring functions for the corresponding axis on the higher-level control and if required, set it.  
 For communication with TM54F, the following applies:  
 - check any other messages/signals present for DRIVE-CLiQ communication with the TM54F and remove their cause.  
 - check the setting of p10010. All the drive objects controlled by the TM54F must be listed.  
 See also: p9601 (SI enable, functions integrated in the drive (Control Unit)), p9801 (SI enable, functions integrated in the drive (Motor Module)), p10010 (SI drive object assignment)

---

**201798 <location>SI Motion CU: Test stop running**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The test stop is active.  
**Remedy:** Not necessary.  
 The message is withdrawn when the test stop is finished.  
**Note:**  
 SI: Safety Integrated

---

**201799 <location>SI Motion CU: Acceptance test mode active**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)

<b>Cause:</b>	The acceptance test mode is active. The POWER ON signals of the safety-relevant motion monitoring functions can be acknowledged during the acceptance test using the RESET button of the higher-level control.
<b>Remedy:</b>	Not necessary. The message is withdrawn when exiting the acceptance test mode.
	<b>Note:</b> SI: Safety Integrated

## 201800 <location>DRIVE-CLiQ: Hardware/configuration error

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (ENCODER, IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2) Vector: NONE (ENCODER, IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	A DRIVE-CLiQ connection fault has occurred. Fault value (r0949, decimal interpretation): 100 ... 107: Communication via DRIVE-CLiQ socket X100 ... X107 has not been switched to cyclic operation. The cause may be an incorrect structure or a configuration that results in an impossible bus timing. 10: Loss of the DRIVE-CLiQ connection. The cause may be, for example, that the DRIVE-CLiQ cable was withdrawn from the Control Unit or as a result of a short-circuit for motors with DRIVE-CLiQ. This fault can only be acknowledged in cyclic communication. 11: Repeated faults when detecting the connection. This fault can only be acknowledged in cyclic communication. 12: A connection was detected but the node ID exchange mechanism does not function. The reason is probably that the component is defective. This fault can only be acknowledged in cyclic communication.
<b>Remedy:</b>	Re fault value = 100 ... 107: - ensure that the DRIVE-CLiQ components have the same firmware versions. - avoid longer topologies for short current controller clock cycles. For fault value = 10: - check the DRIVE-CLiQ cables at the Control Unit. - remove any short-circuit for motors with DRIVE-CLiQ. - carry out a POWER ON. For fault value = 11: - check the electrical cabinet design and cable routing for EMC compliance For fault value = 12: - replace the component involved.

## 201840 <location>SMI: Component found without motor data

<b>Message value:</b>	Component number: %1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	An SMI/DQI without motor data has been found (e.g. SMI installed as replacement part). Alarm value (r2124, interpret decimal): Component number from target topology.
<b>Remedy:</b>	1. Download the SMI/DQI data (motor/encoder data) from the data backup again (p4690, p4691). 2. Carry out a POWER ON (power off/on) for this component. <b>Note:</b> DQI: DRIVE-CLiQ Sensor Integrated SMI: SINAMICS Sensor Module Integrated See also: p4690 (SMI spare part component number), p4691 (SMI spare part save/download data)

---

<b>201900</b>	<b>&lt;location&gt;PB/PN: Configuration telegram error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	A controller attempts to establish a connection using an incorrect configuring telegram. Alarm value (r2124, interpret decimal): 1: Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978. 2: Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is specified by the number of indices in r2050/p2051. 3: Uneven number of bytes for input or output. 4: Setting data for synchronization not accepted. For more information, see A01902. 223: Illegal clock synchronization for the PZD interface set in p8815[0]. 253: PN Shared Device: illegal mixed configuration of PROFIsafe and PZD. 254: PN Shared Device: Illegal double assignment of a slot/subslot. 255: PN: Configured drive object and existing drive object do not match. 501: PROFIsafe parameter error (e.g. F_dest).
<b>Remedy:</b>	Check the bus configuration on the master and slave sides. Re alarm value = 1: Check the list of the drive objects with process data exchange (p0978). With p0978[x] = 0, all of the following drive objects in the list are excluded from the process data exchange. Re alarm value = 2: Check the number of data words for output and input to a drive object. Re alarm value = 255: Check the drive objects to be configured. Re alarm value = 501: Check the set PROFIsafe address (p9610).

---

<b>201902</b>	<b>&lt;location&gt;IF1: PB/PN clock cycle synchronous operation parameterization not permissible</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	Parameterization for isochronous operation is not permissible. Alarm value (r2124, interpret decimal): 0: Bus cycle time Tdp < 0.5 ms. 1: Bus cycle time Tdp > 32 ms. 2: Bus cycle time Tdp is not an integer multiple of the current controller clock cycle. 3: Instant of the actual value sensing Ti > Bus cycle time Tdp or Ti = 0. 4: Instant of the actual value sensing Ti is not an integer multiple of the current controller clock cycle. 5: Instant of the setpoint acceptance To >= Bus cycle time Tdp or To = 0. 6: Instant of the setpoint acceptance To is not an integer multiple of the current controller clock cycle. 7: Master application cycle time Tmapc is not an integer multiple of the speed controller clock cycle. 8: Bus reserve bus cycle time Tdp - data exchange time Tdx less than two current controller clock cycles. 10: Instant of the setpoint acceptance not To <= data exchange time Tdx + To_min. 11: Master application cycle time Tmapc > 14 x Tdp or Tmapc = 0. 12: PLL tolerance window Tpll_w > Tpll_w_max. 13: Bus cycle time Tdp is not a multiple of all basic clock cycles p0110[x].



- 14: For COMM BOARD with the setting  $To - 1 \times Tbase\_io = Tdp - Ti$ , the instant of the setpoint acceptance is not  $To \leq Data\ exchange\ time\ Tdx + 2 * To\_min$ .
- 15: This configuration is not permitted for  $Tdp < 1\ ms$ .
- 16: Instant of the actual value sensing  $Ti$  is less than the permitted value (COMM BOARD:  $Ti \geq 2 \times Tbase\_io$ ).
- 17: The setting ( $To + Ti = Tdp + 2 \times Tbase\_io$ ) is not permitted for COMM BOARD.

**Remedy:**

- adapt the parameterizing telegram.
- adapt the current and speed controller clock cycle.

Re alarm value = 15:

- check the number of specific drive object types in the configuration.

Note:

IF1: Interface 1  
 PB: PROFIBUS  
 PN: PROFINET  
 Tbase\_io: Time basis for  $Ti$ ,  $To$  (= 125us)

---

## 201903 <location>COMM INT: Receive configuration data invalid

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, TOCtrlUnitNX828, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The drive unit did not accept the receive configuration data.  
 Alarm value (r2124, interpret decimal):  
 Return value of the receive configuration data check.

- 1: Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978.
- 2: Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051.
- 3: Uneven number of bytes for input or output.
- 4: Setting data for synchronization not accepted. For more information, see A01902.
- 5: Cyclic operation not active.

501: PROFIsafe parameter error (e.g. F\_dest).

**Remedy:** Check the receive configuration data.  
 Re alarm value = 1:  
 Check the list of the drive objects with process data exchange (p0978). With  $p0978[x] = 0$ , all of the following drive objects in the list are excluded from the process data exchange.  
 Re alarm value = 2:  
 Check the number of data words for output and input to a drive object.  
 Re alarm value = 501:  
 Check the set PROFIsafe address (p9610).

---

## 201910 <location>Fieldbus: setpoint timeout

**Message value:** -

**Drive object:** All objects

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF3 (IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
 Vector: OFF3 (IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)

**Acknowledge:** IMMEDIATELY

**Cause:** The reception of setpoints from the fieldbus interface (onboard, PROFIBUS/PROFINET/USS) has been interrupted.

- bus connection interrupted.
- controller switched off.
- controller set into the STOP state.

See also: p2047 (PROFIBUS additional monitoring time)

**Remedy:** Restore the bus connection and set the controller to RUN.  
 PROFIBUS slave redundancy:  
 For operation on a Y link, it must be ensured that "DP alarm mode = DPV1" is set in the slave parameterization.  
 See also: p2047 (PROFIBUS additional monitoring time)

**201911 <location>PB/PN clock cycle synchronous operation clock cycle failure**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** Infeed: OFF1  
 Servo: OFF1 (OFF3)  
 Vector: OFF1 (OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The global control telegram to synchronize the clock cycles has failed - in cyclic operation - for several DP clock cycles or has violated the time grid specified in the parameterizing telegram over several consecutive DP clock cycles (refer to the bus cycle time, Tdp and Tplw).  
**Remedy:** - check the physical bus configuration (cable,connector, terminating resistor, shielding, etc.).  
 - check whether communication was briefly or permanently interrupted.  
 - check the bus and controller for utilization level (e.g. bus cycle time Tdp was set too short).  
 Note:  
 PB: PROFIBUS  
 PN: PROFINET

**201912 <location>PB/PN clock cycle synchronous operation sign-of-life failure**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** Infeed: OFF1  
 Servo: OFF1 (OFF3)  
 Vector: OFF1 (OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The maximum permissible number of errors in the controller sign-of-life (clock synchronous operation) has been exceeded in cyclic operation.  
**Remedy:** - physically check the bus (cables, connectors, terminating resistor, shielding, etc.).  
 - correct the interconnection of the controller sign-of-life (p2045).  
 - check whether the controller correctly sends the sign-of-life (e.g. create a trace with STW2.12 ... STW2.15 and trigger signal ZSW1.3).  
 - check the permissible telegram failure rate (p0925).  
 - check the bus and controller for utilization level (e.g. bus cycle time Tdp was set too short).  
 Note:  
 PB: PROFIBUS  
 PN: PROFINET

**201913 <location>COMM INT: Monitoring time sign-of-life expired**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, TOCtrlUnitNX828, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF1 (NONE, OFF2, OFF3)  
 Vector: OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY

**Cause:** The monitoring time for the sign-of-life counter has expired.  
The connection between the drive and the higher-level control (SIMOTION, SINUMERIK) has been interrupted for the following reasons:  
- the control was reset.  
- the data transfer to the control was interrupted.

**Remedy:**  
- wait until the control has re-booted.  
- restore data transfer to the control.

### 201914 <location>COMM INT: Monitoring time configuration expired

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, TOCtrlUnitNX828, VECTOR

**Reaction:**  
Infeed: OFF1 (NONE, OFF2)  
Servo: OFF1 (NONE, OFF2, OFF3)  
Vector: OFF1 (NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The monitoring time for the configuration has expired.  
Fault value (r0949, decimal interpretation):  
0: The transfer time of the send configuration data has been exceeded.  
1: The transfer time of the receive configuration data has been exceeded.

**Remedy:**  
- acknowledge faults that are present.  
- carry out a POWER ON (power off/on) for all components.  
- upgrade firmware to later version.  
- contact the Hotline.

### 201915 <location>PB/PN clock cycle synchronous operation sign-of-life failure drive object 1

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** Group display for problems with the sign-of-life of the master (clock-cycle synchronous operation) on the drive object 1 (Control Unit).  
For central measurements, synchronism with the central master is lost.

**Remedy:**  
Note:  
PB: PROFIBUS  
PN: PROFINET

### 201920 <location>PROFIBUS: Interruption cyclic connection

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The cyclic connection to the PROFIBUS master is interrupted.

**Remedy:** Establish the PROFIBUS connection and activate the PROFIBUS master in the cyclic mode.

---

**201921**                    **<location>PROFIBUS: Receive setpoints after To**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                Output data of PROFIBUS master (setpoints) received at the incorrect instant in time within the PROFIBUS clock cycle.

**Remedy:**               - check bus configuration.  
                              - check parameters for clock cycle synchronization (ensure To > Tdx).  
 Note:  
 To: Time of setpoint acceptance  
 Tdx: Data exchange time

---

**201930**                    **<location>PB/PN current controller clock cycle clock cycle synch. not equal**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The current controller clock cycle of all drives must be set the same for the clock cycle synchronous operation.  
 Alarm value (r2124, interpret decimal):  
 Number of the drive object with different current controller clock cycle.

**Remedy:**               Set current controller clock cycles to identical values (p0115[0]).  
 Note:  
 PB: PROFIBUS  
 PN: PROFINET  
 See also: p0115

---

**201931**                    **<location>PB/PN speed controller clock cycle clock cycle synch. not equal**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The speed controller clock cycle of all drives must be set the same for the clock cycle synchronous operation.  
 Alarm value (r2124, interpret decimal):  
 Number of the drive object with the different speed controller clock cycle.

**Remedy:**               Set the speed controller clock cycles the same (p0115[1]).  
 Note:  
 PB: PROFIBUS  
 PN: PROFINET  
 See also: p0115

---

**201932**                    **<location>PB/PN clock cycle synchronization missing for DSC**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

---

---

<b>Cause:</b>	There is no clock synchronization or clock synchronous sign of life and DSC is selected. Note: DSC: Dynamic Servo Control See also: p0922, p1190, p1191
<b>Remedy:</b>	Set clock synchronization across the bus configuration and transfer clock synchronous sign-of-life. See also: r2064 (PROFIdrive diagnostics clock synchronous mode)

---

### 201940 <location>PB/PN clock cycle synchronism not reached

<b>Message value:</b>	-
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. It was not possible to synchronize to the clock cycle specified by the master. - the master does not send a clock synchronous global control telegram although clock synchronous operation was selected when configuring the bus. - the master is using another clock synchronous DP clock cycle than was transferred to the slave in the parameterizing telegram. - at least one drive object has a pulse enable (not controlled from PROFIBUS/PROFINET either).
<b>Remedy:</b>	- check the master application and bus configuration. - check the consistency between the clock cycle input when configuring the slave and clock cycle setting at the master. - check that no drive object has a pulse enable. Only enable the pulses after synchronizing the PROFIBUS/PROFINET drives. Note: PB: PROFIBUS PN: PROFINET

---

### 201941 <location>PB/PN clock cycle signal missing when establishing bus communication

<b>Message value:</b>	-
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. The global control telegram for synchronization is not being received.
<b>Remedy:</b>	Check the master application and bus configuration. Note: PB: PROFIBUS PN: PROFINET

---

### 201943 <location>PB/PN clock cycle signal error when establishing bus communication

<b>Message value:</b>	-
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. The global control telegram for synchronization is being irregularly received. - the master is sending an irregular global control telegram. - the master is using another clock synchronous DP clock cycle than was transferred to the slave in the parameterizing telegram.

**Remedy:**

- check the master application and bus configuration.
- check the consistency between the clock cycle input when configuring the slave and clock cycle setting at the master.

Note:  
 PB: PROFIBUS  
 PN: PROFINET

**201944 <location>PB/PN sign-of-life synchronism not reached**

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. Synchronization with the master sign-of-life (STW2.12 ... STW2.15) could not be completed because the sign-of-life is changing differently to how it was configured in the Tmapc time grid.

**Remedy:**

- ensure that the master correctly increments the sign-of-life in the master application clock cycle Tmapc.
- correct the interconnection of the master sign-of-life (p2045).

Note:  
 PB: PROFIBUS  
 PN: PROFINET

**201945 <location>PROFIBUS: Connection to the Publisher failed**

**Message value:** Fault cause: %1 bin

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** For PROFIBUS peer-to-peer data transfer, the connection to at least one Publisher has failed.  
 Alarm value (r2124, binary interpretation):  
 Bit 0 = 1: Publisher with address in r2077[0], connection failed.  
 ...  
 Bit 15 = 1: Publisher with address in r2077[15], connection failed.

**Remedy:**

- check the PROFIBUS cables.
- carry out a first commissioning of the Publisher that has the failed connection.

See also: r2077 (PROFIBUS diagnostics peer-to-peer data transfer addresses)

**201946 <location>PROFIBUS: Connection to the Publisher aborted**

**Message value:** Fault cause: %1 bin

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF1 (NONE, OFF2, OFF3)  
 Vector: OFF1 (NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** At this drive object, the connection to at least one Publisher for PROFIBUS peer-to-peer data transfer in cyclic operation has been aborted.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Publisher with address in r2077[0], connection aborted.  
 ...  
 Bit 15 = 1: Publisher with address in r2077[15], connection aborted.

**Remedy:** - check the PROFIBUS cables.  
 - check the state of the Publisher that has the aborted connection.  
 See also: r2077 (PROFIBUS diagnostics peer-to-peer data transfer addresses)

### 201950 <location>PB/PN clock cycle synchronous operation synchronization unsuccessful

**Message value:** -

**Drive object:** All objects

**Reaction:** OFF1 (NONE)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** Synchronization of the internal clock cycle to the global control telegram has failed. The internal clock cycle exhibits an unexpected shift.

**Remedy:** Only for internal Siemens troubleshooting.  
 Note:  
 PB: PROFIBUS  
 PN: PROFINET

### 201951 <location>CU DRIVE-CLiQ: Synchronization application clock cycle missing

**Message value:** %1

**Drive object:** All objects

**Reaction:** OFF2 (NONE)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** If DRIVE-CLiQ components with different application clock cycle are operated on a DRIVE-CLiQ port, this requires synchronization with the Control Unit. This synchronization routine was unsuccessful.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:** - carry out a POWER ON (power off/on) for all components.  
 - upgrade the software of the DRIVE-CLiQ components.  
 - upgrade the Control Unit software.

### 201952 <location>CU DRIVE-CLiQ: Synchronization of component not supported

**Message value:** %1

**Drive object:** All objects

**Reaction:** OFF2 (NONE)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The existing system configuration requires that the connected DRIVE-CLiQ components support the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and the application clock cycle.  
 However, not all DRIVE-CLiQ components have this functionality.  
 Fault value (r0949, decimal interpretation):  
 Component number of the first faulty DRIVE-CLiQ component.

**Remedy:** Upgrade the firmware of the component specified in the fault value.  
 Note:  
 If required, also upgrade additional components in the DRIVE-CLiQ line.

**201953**                    **<location>CU DRIVE-CLiQ: Synchronization not completed**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                After the drive system is powered up, the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started but was not completed within the selected time tolerance.  
Alarm value (r2124, interpret decimal):  
Only for internal Siemens troubleshooting.

**Remedy:**                POWER ON all components (switch the power off and then back on again).  
If the error occurs after the drive sampling times were changed, and if a Terminal Module 31 (TM31) is being used, the sampling times (p0115, p4099) should be set as integer multiples to the drive clock cycles (p0115).

---

**201954**                    **<location>CU DRIVE-CLiQ: Synchronization unsuccessful**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                Synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started and was not able to be successfully completed (e.g. after switch-on).  
Fault value (r0949, decimal interpretation):  
Only for internal Siemens troubleshooting.

**Remedy:**                1. Remove the cause of a possible DRIVE-CLiQ fault.  
2. Initiate a new synchronization, e.g. as follows:  
- remove the PROFIBUS master and re-insert again.  
- restart the PROFIBUS master.  
- switch-off the Control Unit and switch-on again.  
- carry out a Control Unit hardware reset (RESET button, p0972).  
- carry out a parameter reset and download the saved parameters (p0009 = 30, p0976 = 2, 3).

---

**201955**                    **<location>CU DRIVE-CLiQ: Synchronization DO not completed**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                After the drive system is powered up, the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started but was not completed within the selected time tolerance.  
Alarm value (r2124, interpret decimal):  
Only for internal Siemens troubleshooting.

**Remedy:**                Carry out a POWER ON (power off/on) for all components of the DO.

---

**201980**                    **<location>PN: Interruption cyclic connection**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE



**Cause:** The cyclic connection to a PROFINET controller is interrupted.  
Alarm value (r2124, interpret decimal):  
Number of the interrupted connection.

**Remedy:** Establish the PROFINET connection and activate the PROFINET controller in the cyclic mode.

### 201981 <location>PN: Maximum number of controllers exceeded

**Message value:** Info. 1: %1, info. 2: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A controller attempts to establish a connection to the drive, and as a consequence exceeds the permitted number of PROFINET connections.  
The alarm disappears automatically after approx. 30 seconds.  
Alarm value (r2124, interpret hexadecimal):  
yyyyxxx hex: yyyy = info. 1, xxx = info. 2  
Info 1 = 0: number of RT connections exceeded  
Info 1 > 0: number of IRT connections exceeded  
Info 2: permitted number of connections

**Remedy:** Check the configuration of the PROFINET controllers as well as the p8929 setting.  
See also: p8929 (PN remote controller number)

### 201982 <location>PROFINET: Second controller missing

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The PROFINET function "Shared Device" has been activated (p8929 = 2). However, only the connection to a PROFINET controller is present.

**Remedy:** Check the configuration of the PROFINET controllers as well as the p8929 setting.  
See also: p8929 (PN remote controller number)

### 201989 <location>PROFINET: Internal cyclic data transfer error

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The cyclic actual values and/or setpoints were not transferred within the specified times.  
Alarm value (r2124, interpret hexadecimal):  
Only for internal Siemens troubleshooting.

**Remedy:** Correctly set T\_io\_input or T\_io\_output.

---

**201990 <location>USS: PZD configuration error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The configuration of the process data (PZD) for the USS protocol is incorrect.  
 Alarm value (r2124, interpret decimal):  
 2: PZD amount (p2022) too great for the first drive object (p978[0]).  
 The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051.  
**Remedy:** Re alarm value = 2:  
 Check the amount of USS PZD (p2022) and the maximum PZD amount (r2050/p2051) for the first drive object (p0978[0]).

---

**202000 <location>Function generator: Start not possible**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The function generator has already been started.  
**Remedy:** Stop the function generator and restart again if necessary.  
 Note:  
 The alarm is reset as follows:  
 - remove the cause of this alarm.  
 - restart the function generator.  
 See also: p4800 (Function generator control)

---

**202005 <location>Function generator: Drive does not exist**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The drive object specified for connection does not exist.  
 See also: p4815 (Function generator drive number)  
**Remedy:** Use the existing drive object with the corresponding number.  
 Note:  
 The alarm is reset as follows:  
 - remove the cause of this alarm.  
 - restart the function generator.  
 See also: p4815 (Function generator drive number)

---

**202006 <location>Function generator: No drive specified for connection**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** No drive specified for connection in p4815.  
See also: p4815 (Function generator drive number)

**Remedy:** At least one drive to be connected must be specified in p4815.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4815 (Function generator drive number)

### 202007 <location>Function generator: Drive not SERVO / VECTOR / DC\_CTRL

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The drive object specified for connection is not a SERVO / VECTOR or DC\_CTRL.  
See also: p4815 (Function generator drive number)

**Remedy:** Use a SERVO / VECTOR / DC\_CTRL drive object with the corresponding number.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.

### 202008 <location>Function generator: Drive specified a multiple number of times

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The drive object specified for connection is already specified.  
Alarm value (r2124, interpret decimal):  
Drive object number of the drive object that is specified a multiple number of times.

**Remedy:** Specify a different drive object.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.

### 202009 <location>Function generator: Illegal mode

**Message value:** %1

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The set operating mode (p1300) of the drive object is not permissible when using the function generator.  
Alarm value (r2124, interpret decimal):  
Number of the drive object involved.

**Remedy:** Change the operating mode for this drive object to p1300 = 20 (encoderless speed control) or p1300 = 21 (speed control with encoder).  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.

---

**202010**                    **<location>Function generator: Speed setpoint from the drive is not zero**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The speed setpoint of a drive selected for connection is greater than the value for the standstill detection set using p1226.

**Remedy:**                For all of the drives specified for connection, set the speed setpoints to zero.

Note:  
The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

---

**202011**                    **<location>Function generator: The actual drive speed is not zero**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The speed actual value of a drive selected for connection is greater than the value for the standstill detection set using p1226.

**Remedy:**                Set the relevant drives to zero speed before starting the function generator.

Note:  
The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

---

**202015**                    **<location>Function generator: Drive enable signals missing**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The master control and/or enable signals are missing to connect to the specified drive.  
See also: p4815 (Function generator drive number)

**Remedy:**                Fetch the master control to the specified drive object and set all enable signals.

Note:  
The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

---

**202016**                    **<location>Function generator: Magnetizing running**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:** Magnetizing has not yet been completed on a drive object specified for connection.  
Alarm value (r2124, interpret decimal):  
Number of the drive object involved.  
See also: p4815 (Function generator drive number)

**Remedy:** Wait for magnetizing of the motor (r0056.4).  
Note:  
The alarm is reset as follows:  
- restart the function generator.  
See also: r0056 (Status word, closed-loop control)

---

## 202020 <location>Function generator: Parameter cannot be changed

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** This parameter setting cannot be changed when the function generator is active (p4800 = 1).  
See also: p4810, p4812, p4813, p4815, p4820, p4821, p4822, p4823, p4824, p4825, p4826, p4827, p4828, p4829

**Remedy:** - stop the function generator before parameterizing (p4800 = 0).  
- if required, start the function generator (p4800 = 1).  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4800 (Function generator control)

---

## 202025 <location>Function generator: Period too short

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The value for the period is too short.  
See also: p4821 (Function generator period)

**Remedy:** Check and adapt the value for the period.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4821 (Function generator period)

---

## 202026 <location>Function generator: Pulse width too high

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The selected pulse width is too high.  
The pulse width must be less than the period duration.  
See also: p4822 (Function generator pulse width)

**Remedy:** Reduce pulse width.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4821 (Function generator period), p4822 (Function generator pulse width)

---

**202030 <location>Function generator: Physical address equals zero**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The specified physical address is zero.  
See also: p4812 (Function generator physical address)  
**Remedy:** Set a physical address with a value other than zero.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4812 (Function generator physical address)

---

**202040 <location>Function generator: Illegal value for offset**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The value for the offset is higher than the value for the upper limit or lower than the value for the lower limit.  
See also: p4826 (Function generator offset)  
**Remedy:** Adjust the offset value accordingly.  
Note:  
The alarm is reset as follows:  
- remove the cause of this alarm.  
- restart the function generator.  
See also: p4826 (Function generator offset), p4828 (Function generator lower limit), p4829 (Function generator upper limit)

---

**202041 <location>Function generator: Illegal value for bandwidth**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The bandwidth referred to the time slice clock cycle of the function generator has either been set too low or too high.  
Depending on the time slice clock cycle, the bandwidth is defined as follows:  
 $\text{Bandwidth\_max} = 1 / (2 \times \text{time slice clock cycle})$   
 $\text{Bandwidth\_min} = \text{Bandwidth\_max} / 100000$   
Example:  
Assumption: p4830 = 125  $\mu\text{s}$   
-->  $\text{Bandwidth\_max} = 1 / (2 \times 125 \mu\text{s}) = 4000 \text{ Hz}$   
-->  $\text{Bandwidth\_min} = 4000 \text{ Hz} / 100000 = 0.04 \text{ Hz}$

---

Note:

p4823: Function generator bandwidth

p4830: Function generator time slice clock cycle

See also: p4823 (Function generator bandwidth), p4830 (Function generator time slice cycle)

**Remedy:** Check the value for the bandwidth and adapt accordingly.

Note:

The alarm is reset as follows:

- remove the cause of this alarm.

- restart the function generator.

## 202047 <location>Function generator: Time slice clock cycle invalid

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The time slice clock cycle selected does not match any of the existing time slices.  
See also: p4830 (Function generator time slice cycle)

**Remedy:** Enter an existing time slice clock cycle. The existing time slices can be read out via p7901.

Note:

The alarm is reset as follows:

- remove the cause of this alarm.

- restart the function generator.

See also: r7901 (Sampling times)

## 202050 <location>Trace: Start not possible

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The trace has already been started.  
See also: p4700 (Trace control)

**Remedy:** Stop the trace and, if necessary, start again.

## 202055 <location>Trace: Recording time too short

**Message value:** -

**Drive object:** All objects

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The trace duration is too short.  
The minimum is twice the value of the trace clock cycle.  
See also: p4721 (Trace recording time)

**Remedy:** Check the selected recording time and, if necessary, adjust.

---

**202056**                    **<location>Trace: Recording cycle too short**

**Message value:**        -  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                The selected recording cycle is shorter than the selected basic clock cycle 0 (p0110[0]).  
                              See also: p4720 (Trace recording cycle)  
**Remedy:**                Increase the value for the trace cycle.

---

**202057**                    **<location>Trace: Time slice clock cycle invalid**

**Message value:**        -  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                The time slice clock cycle selected does not match any of the existing time slices.  
                              See also: p4723 (Time slice cycle for trace)  
**Remedy:**                Enter an existing time slice clock cycle. The existing time slices can be read out via p7901.  
                              See also: r7901 (Sampling times)

---

**202058**                    **<location>Trace: Time slice clock cycle for endless trace not valid**

**Message value:**        -  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                The selected time slice clock cycle cannot be used for the endless trace  
                              See also: p4723 (Time slice cycle for trace)  
**Remedy:**                Enter the clock cycle of an existing time slice with a cycle time  $\geq$  2 ms for up to 4 recording channels or  $\geq$  4 ms from  
                              5 recording channels per trace.  
                              The existing time slices can be read out via p7901.  
                              See also: r7901 (Sampling times)

---

**202059**                    **<location>Trace: Time slice clock cycle for 2 x 8 recording channels not valid**

**Message value:**        -  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                The selected time slice clock cycle cannot be used for more than 4 recording channels.  
                              See also: p4723 (Time slice cycle for trace)  
**Remedy:**                Enter the clock cycle of an existing time slice with a cycle time  $\geq$  4 ms or reduce the number of recording channels  
                              to 4 per trace.  
                              The existing time slices can be read out via p7901.  
                              See also: r7901 (Sampling times)

---



---

**202060**            **<location>Trace: Signal to be traced missing**

**Message value:**        -

**Drive object:**        All objects

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              - a signal to be traced was not specified.  
- the specified signals are not valid.  
See also: p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)

**Remedy:**              - specify the signal to be traced.  
- check whether the relevant signal can be traced.

---

**202061**            **<location>Trace: Invalid signal**

**Message value:**        -

**Drive object:**        All objects

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              - the specified signal does not exist.  
- the specified signal can no longer be traced (recorded).  
See also: p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)

**Remedy:**              - specify the signal to be traced.  
- check whether the relevant signal can be traced.

---

**202062**            **<location>Trace: Invalid trigger signal**

**Message value:**        -

**Drive object:**        All objects

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              - a trigger signal was not specified.  
- the specified signal does not exist.  
- the specified signal is not a fixed-point signal.  
- the specified signal cannot be used as a trigger signal for the trace.  
See also: p4711 (Trace trigger signal)

**Remedy:**              Specify a valid trigger signal.

---

**202063**            **<location>Trace: Invalid data type**

**Message value:**        %1

**Drive object:**        All objects

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              The specified data type to select a signal using a physical address is invalid.  
See also: p4711 (Trace trigger signal), p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)

**Remedy:**              Use a valid data type.

---

**202070 <location>Trace: Parameter cannot be changed**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The trace parameter settings cannot be changed when the trace is active.  
See also: p4700, p4710, p4711, p4712, p4713, p4714, p4715, p4716, p4720, p4721, p4722, p4730, p4731, p4732, p4733, p4780, p4781, p4782, p4783, p4789, p4795  
**Remedy:** - stop the trace before parameterization.  
- if required, start the trace.

---

**202075 <location>Trace: Pretrigger time too long**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The selected pretrigger time must be shorter than the trace time.  
See also: p4721 (Trace recording time), p4722 (Trace trigger delay)  
**Remedy:** Check the pretrigger time setting and change if necessary.

---

**202080 <location>Trace: Parameterization deleted due to unit changeover**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The trace parameterization in the drive unit was deleted due to a unit changeover or a change in the reference parameters.  
**Remedy:** Restart trace.

---

**202099 <location>Trace: Insufficient Control Unit memory**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The memory space still available on the Control Unit is no longer sufficient for the trace function.  
**Remedy:** Reduce the memory required, e.g. as follows:  
- reduce the trace time.  
- increase the trace clock cycle.  
- reduce the number of signals to be traced.  
See also: r4708 (Trace memory space required), r4799 (Trace memory location free)

---

<b>202100</b>	<b>&lt;location&gt;Drive: Computing dead time current controller too short</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The value in p0118 produces a dead time of one clock cycle because it is prior to setpoint availability. Possible causes: - A parameter backup with a version higher than 4.3 was loaded to a version less than or equal to 4.3. - The system properties after replacing a component no longer match the parameter assignment. Alarm value (r2134, floating point): The minimum value for p0118 where a dead time no longer occurs.
<b>Remedy:</b>	- set p0118 to zero. - set p0118 to a value greater than or equal to the alarm value (for p1810.11 = 1) - set p0117 to an automatic setting (p0117 = 1). - check the firmware versions of the components involved. See also: p0117 (Current controller computing dead time mode), p0118 (Current controller computing dead time)

---

<b>202150</b>	<b>&lt;location&gt;OA: Application cannot be loaded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The system was not able to load an OA application. Alarm value (r2124, interpret hexadecimal): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	- carry out a POWER ON (power off/on) for all components. - upgrade firmware to later version. - contact the Hotline. Note: OA: Open Architecture See also: r4950, r4955, p4956, r4957

---

<b>202151</b>	<b>&lt;location&gt;OA: Internal software error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Vector: OFF2 (NONE, OFF1, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	An internal software error has occurred within an OA application. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	- carry out a POWER ON (power off/on) for all components. - upgrade firmware to later version. - contact the Hotline. - replace the Control Unit. Note: OA: Open Architecture See also: r4950, r4955, p4956, r4957

---

**202152**                    **<location>OA: Insufficient memory**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             OFF1

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                Too many functions have been configured on this Control Unit (e.g. too many drives, function modules, data sets, OA applications, blocks, etc).  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:**                - change the configuration on this Control Unit (e.g. fewer drives, function modules, data sets, OA applications, blocks, etc).  
 - use an additional Control Unit.  
 Note:  
 OA: Open Architecture

---

**203000**                    **<location>NVRAM fault on action**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A fault occurred during execution of action p7770 = 1, 2 for the NVRAM data.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = fault cause, xx = application ID  
 yy = 1:  
 The action p7770 = 1 is not supported by this version if Drive Control Chart (DCC) is activated for the drive object concerned.  
 yy = 2:  
 The data length of the specified application is not the same in the NVRAM and the backup.  
 yy = 3:  
 The data checksum in p7774 is not correct.  
 yy = 4:  
 No data available to load.  
 See also: p7770 (NVRAM action)

**Remedy:**                Perform the remedy according to the results of the troubleshooting.  
 If necessary, start the action again.

---

**203001**                    **<location>NVRAM checksum incorrect**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A checksum error occurred when evaluating the non-volatile data (NVRAM) on the Control Unit.  
 The NVRAM data affected was deleted.

**Remedy:**                POWER ON all components (switch the power off and then back on again).

---

---

<b>203500</b>	<b>&lt;location&gt;TM: Initialization</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF1 (OFF2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	When initializing the Terminal Modules, the terminals of the Control Unit or the Terminal Board 30, an internal software error has occurred. Fault value (r0949, decimal interpretation): yxxx dex y = Only for internal Siemens troubleshooting xxx = component number (p0151)
<b>Remedy:</b>	- power down/power up the power supply for the Control Unit. - check the DRIVE-CLiQ connection. - if required, replace the Terminal Module. The Terminal Module should be directly connected to a DRIVE-CLiQ socket of the Control Unit. If the fault occurs again, replace the Terminal Module.

---

<b>203501</b>	<b>&lt;location&gt;TM: Sampling time change</b>
---------------	---

<b>Message value:</b>	-
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The sampling times of the inputs/outputs were changed. This change only becomes valid after the next boot.
<b>Remedy:</b>	Carry out a POWER ON.

---

<b>203505</b>	<b>&lt;location&gt;TM: Analog input wire breakage</b>
---------------	---

<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_I_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, TOCtrlUnitNX828
<b>Reaction:</b>	OFF1 (NONE, OFF2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The wire-break monitoring for an analog input has responded. The input current of the analog input has exceeded the threshold value parameterized in p4061[x]. Index x = 0: Analog input 0 (X522.1 to .3) Index x = 1: Analog input 1 (X522.4 to .5) Fault value (r0949, decimal interpretation): yxxx dec y = analog input (0 = analog input 0 (AI 0), 1 = analog input 1 (AI 1)) xxx = component number (p0151) Note: For the following analog input type, the wire breakage monitoring is active: p4056[x] = 3 (unipolar current input monitored (+4 ... +20 mA))
<b>Remedy:</b>	- check the wiring for interruptions. - Check the magnitude of the injected current - it is possible that the infed signal is too low. - Check the load resistor (250 Ohm). Note: The input current measured by the Terminal Module can be read out from r4052[x]. For p4056[x] = 3 (unipolar current input monitored (+4 mA ... +20 mA)) the following applies: A current less than 4 mA is not displayed in r4052[x] - but instead r4052[x] = 4 mA is output.

**203505 <location>CU: Analog input wire breakage**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF1 (NONE, OFF2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The wire-break monitoring for an analog input has responded.  
 The input current of the analog input has exceeded the threshold value parameterized in p4061[x].  
 Index x = 0: Analog input 0 (X522.1 to .3)  
 Index x = 1: Analog input 1 (X522.4 to .5)  
 Fault value (r0949, decimal interpretation):  
 yxxx dec  
 y = analog input (0 = analog input 0 (AI 0), 1 = analog input 1 (AI 1))  
 xxx = component number (p0151)  
**Note:**  
 For the following analog input type, the wire breakage monitoring is active:  
 p4056[x] = 3 (unipolar current input monitored (+4 ... +20 mA))  
**Remedy:**  
 - check the wiring for interruptions.  
 - Check the magnitude of the injected current - it is possible that the infed signal is too low.  
 - Check the load resistor (250 Ohm).  
**Note:**  
 The input current measured by the Terminal Module can be read out from r4052[x].  
 For p4056[x] = 3 (unipolar current input monitored (+4 mA ... +20 mA)) the following applies:  
 A current less than 4 mA is not displayed in r4052[x] - but instead r4052[x] = 4 mA is output.

**203506 <location>24 V power supply missing**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The 24 V power supply for the digital outputs (X124) is missing.  
**Remedy:** Check the terminals for the power supply voltage (X124, L1+, M).

**203510 <location>TM: Calibration data not plausible**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, TOCtrlUnitNX828  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** During ramp-up, the Terminal Module 31 (TM31) calibration data is read in and checked for plausibility.  
 At least one calibration data point was determined to be invalid.  
 Alarm value (r2124, binary interpretation):  
 Bit 1: 10 V value, analog input 0 invalid.  
 Bit 3: 10 V value, analog input 1 invalid.  
 Bit 4: Offset, analog output 0 invalid.  
 Bit 5: 10 V value, analog output 0 invalid.  
 Bit 6: Offset, analog output 1 invalid.  
 Bit 7: 10 V value, analog input 1 invalid.

**Remedy:**

- power down/power up the power supply for the Control Unit.
- check the DRIVE-CLiQ connection.

If it reoccurs, replace the module.  
 In principle, operation could continue.  
 The analog channel involved possibly does not achieve the specified accuracy.

**203510 <location>CU: Calibration data not plausible**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** During booting, the calibration data for the analog inputs is read and checked with respect to plausibility. At least one calibration data point was determined to be invalid.  
**Remedy:**

- power down/power up the power supply for the Control Unit.
- check the DRIVE-CLiQ connection.

If it reoccurs, replace the module.  
 In principle, operation could continue.  
 The analog channel involved possibly does not achieve the specified accuracy.

**203550 <location>TM: Speed setpoint filter natural frequency > Shannon frequency**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The natural filter frequency of the speed setpoint filter (p1417) is greater than the Shannon frequency. The Shannon frequency is calculated according to the following formula:  $0.5 / p0115[0]$   
 See also: p1417  
**Remedy:** Reduce the natural frequency of the speed setpoint filter (PT2 low pass) (p1417).

**203590 <location>TM: Module not ready**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** Infeed: OFF2 (NONE)  
 Servo: NONE (ENCODER, IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
 Vector: OFF2 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The Terminal Module involved does not send a ready signal and no valid cyclic data.  
 Fault value (r0949, decimal interpretation):  
 Drive object number of the Terminal Module involved.  
**Remedy:**

- check the 24 V power supply.
- check the DRIVE-CLiQ connection.
- check whether the sampling time of the drive object involved is not equal to zero (p4099[0]).

---

**205000**            **<location>Power unit: Overtemperature heat sink AC inverter**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The alarm threshold for overtemperature at the inverter heat sink has been reached. The response is set using p0290. If the temperature of the heat sink increases by an additional 5 K, then fault F30004 is initiated.

**Remedy:**              Check the following:

- is the ambient temperature within the defined limit values?
- have the load conditions and the load duty cycle been appropriately dimensioned?
- has the cooling failed?

---

**205001**            **<location>Power unit: Overtemperature depletion layer chip**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                Alarm threshold for overtemperature of the power semiconductor in the AC converter has been reached.

**Note:**

- The response is set using p0290.
- If the depletion layer temperature increases by an additional 15 K, then fault F30025 is triggered.

**Remedy:**              Check the following:

- is the ambient temperature within the defined limit values?
- have the load conditions and the load duty cycle been appropriately dimensioned?
- has the cooling failed?
- pulse frequency too high?

See also: r0037, p0290 (Power unit overload response)

---

**205001**            **<location>Power unit: Overtemperature depletion layer chip**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                Alarm threshold for overtemperature of the power semiconductor in the AC converter has been reached.

**Note:**

- The response is set using p0290.
- If the depletion layer temperature increases by an additional 15 K, then fault F30025 is triggered.

**Remedy:**              Check the following:

- is the ambient temperature within the defined limit values?
- have the load conditions and the load duty cycle been appropriately dimensioned?
- has the cooling failed?
- pulse frequency too high?

**Note:**

If the alarm occurs after reducing the current controller sampling time (p0115[0]) during the motor data identification (standstill measurement), then it is recommended that this is initially performed using the standard sampling time and then the sampling time should be subsequently changed over.

See also: r0037, p0290 (Power unit overload response)



---

**205002 <location>Power unit: Air intake overtemperature**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The alarm threshold for the air intake overtemperature has been reached. For air-cooled power units, the threshold is 42 °C (hysteresis 2 K). The response is set using p0290.  
If the air intake temperature increases by an additional 13 K, then fault F30035 is output.

**Remedy:** Check the following:  
- is the ambient temperature within the defined limit values?  
- has the fan failed? Check the direction of rotation.

---

**205003 <location>Power unit: Internal overtemperature**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The alarm threshold for internal overtemperature has been reached.  
If the temperature inside the power unit increases by an additional 5 K, then fault F30036 is triggered.

**Remedy:** Check the following:  
- is the ambient temperature within the defined limit values?  
- has the fan failed? Check the direction of rotation.

---

**205004 <location>Power unit: Rectifier overtemperature**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The alarm threshold for the overtemperature of the rectifier has been reached. The response is set using p0290.  
If the temperature of the rectifier increases by an additional 5 K, then fault F30037 is triggered.

**Remedy:** Check the following:  
- is the ambient temperature within the defined limit values?  
- have the load conditions and the load duty cycle been appropriately dimensioned?  
- has the fan failed? Check the direction of rotation.  
- has a phase of the line supply failed?  
- is an arm of the supply (incoming) rectifier defective?

---

**205005 <location>Cooling system: Cooling medium flow rate too low**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Cooling system: Alarm - flow rate has fallen below the alarm value

**Remedy:** Check the feedback signals and parameter assignment (p0260 ... p0267).  
Check the coolant feed.

---

**205006 <location>Power unit: Overtemperature thermal model**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature difference between the chip and heat sink has exceeded the permissible limit value (blocksize power units only).  
Depending on p0290, an appropriate overload response is initiated.  
See also: r0037  
**Remedy:** Not necessary.  
The alarm disappears automatically once the limit value is undershot.  
**Note:**  
If the alarm does not disappear automatically and the temperature continues to rise, this can result in fault F30024.  
See also: p0290 (Power unit overload response)

---

**205007 <location>Power unit: Overtemperature thermal model (chassis PU)**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature difference between the chip and heat sink has exceeded the permissible limit value (r0293) (chassis power units only).  
Depending on p0290, an appropriate overload response is initiated.  
See also: r0037, r0293 (Power unit alarm threshold model temperature)  
**Remedy:** Not necessary.  
The alarm disappears automatically once the limit value is undershot.  
See also: p0290 (Power unit overload response)

---

**205050 <location>Parallel circuit: Pulse enable in spite of pulse inhibit**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A power unit signals that the pulses are enabled although the pulses are inhibited.  
Fault value (r0949, decimal interpretation):  
Number of the power unit involved.  
**Remedy:** The power unit is defective and must be replaced.

---

**205051 <location>Parallel circuit: Power unit pulse enable missing**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For one or several power units, the pulses were not able to be enabled.  
Fault value (r0949, decimal interpretation):  
Number of the power unit involved.  
**Remedy:** - acknowledge power unit faults that are still present.  
- inhibit the pulses of the power unit involved (p7001).

---

**205052 <location>Parallel circuit: Illegal current dissymmetry**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The deviation of the individual currents of the power units exceeds the alarm threshold specified in p7010.  
Alarm value (r2124, interpret decimal):  
1: Phase U.  
2: Phase V.  
3: Phase W.  
**Remedy:** - inhibit the pulses of the faulted power unit (p7001).  
- check the connecting cables. Loose contacts can cause current spikes.  
- the motor reactors are non-symmetrical or faulty and must be replaced.  
- the CTs must be calibrated or replaced.

---

**205053 <location>Parallel circuit: Inadmissible DC link voltage dissymmetry**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The deviation of the DC link voltage measured values exceeds the alarm threshold specified in p7011.  
**Remedy:** - inhibit the pulses of the faulted power unit (p7001).  
- check the DC link connecting cables.  
- the DC link voltage measurement is incorrect and must be calibrated or renewed.

---

**205054 <location>Parallel circuit: Power unit de-activated**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** For the drive object involved, fewer power units connected in parallel are active than exist in the target topology.  
Operation is only possible at reduced power (power derating).

**Remedy:** Re-activate the de-activated power units if required.  
 See also: p0125 (Activate/de-activate power unit components), p0895 (Activate/de-activate power unit components), p0897 (Parking axis selection)

**205055 <location>Parallel connection: Power units with illegal code numbers**

**Message value:** Parameter: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The code numbers of the power units are not permissible.  
 For parallel circuit configurations, only power units with identical power unit data may be used.  
 Possible causes:  
 - The code numbers of the power units do not match.  
 For booksize drive units, the following additionally applies:  
 - a parallel connection is not possible for the power units being used.  
 - there are too many power units being used in the parallel connection.  
 Fault value (r0949, decimal interpretation):  
 Parameter in which the inadmissible power unit code number was detected.

**Remedy:**  
 - Use power units with the same code number.  
 For booksize drive units, the following additionally applies:  
 - use power units which are permitted for a parallel connection.  
 - reduce the number of power units being used in the parallel connection.

**205055 <location>Parallel connection: Power units with illegal code numbers**

**Message value:** Parameter: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The code numbers of the power units do not match.  
 Fault value (r0949, interpret decimal): parameter in which the first different power unit code number was detected.

**Remedy:** Use power units with the same code number.  
 For parallel circuit configurations, only power units with identical power unit data may be used.

**205056 <location>Parallel circuit: Power unit EPROM versions differ**

**Message value:** Parameter: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The EEPROM versions of the power units do not match.  
 Fault value (r0949, decimal interpretation):  
 Parameter in which the first different version number was detected.

**Remedy:** Use power units with the same EPROM version.  
 For parallel circuit configurations, only power units with identical EEPROM versions may be used.

---

<b>205057</b>	<b>&lt;location&gt;Parallel circuit: Power unit firmware versions differ</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The firmware versions of the power units connected in parallel do not match. Fault value (r0949, decimal interpretation): Parameter in which the first different version number was detected.
<b>Remedy:</b>	Use power units with the same firmware version. For parallel circuit configurations, only power units with identical firmware versions may be used.

---

<b>205058</b>	<b>&lt;location&gt;Parallel circuit: VSM EEPROM versions differ</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The EEPROM versions of the Voltage Sensing Modules (VSM) do not match. Fault value (r0949, decimal interpretation): Parameter in which the first different version number was detected.
<b>Remedy:</b>	For parallel circuit configurations, only Voltage Sensing Modules (VSM) with identical EEPROM versions may be used.

---

<b>205059</b>	<b>&lt;location&gt;Parallel circuit: VSM firmware versions differ</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The firmware versions of the Voltage Sensing Module (VSM) do not match. Fault value (r0949, decimal interpretation): Parameter in which the first different version number was detected.
<b>Remedy:</b>	For parallel circuit configurations, only Voltage Sensing Modules (VSM) with identical firmware versions may be used.

---

<b>205060</b>	<b>&lt;location&gt;Parallel circuit: Power unit firmware version does not match</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Firmware from version V02.30.01.00 is required when connecting the power units in parallel.
<b>Remedy:</b>	Update the firmware of the power units (at least V02.30.01.00).

**205061 <location>Infeed, number of VSM**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The number of active Voltage Sensing Modules (VSM) for the drive object infeed with chassis power units is not correct.  
 For A\_Infeed, each active power unit must be assigned an active VSM also for a parallel circuit configuration.  
 For S\_Infeed, the active drive object, must be assigned at least one active VSM.  
 Fault value (r0949, decimal interpretation):  
 Number of VSMs that are currently assigned to the drive object.  
**Remedy:** Adapts the number of active Voltage Sensing Modules (VSM).

---

**206000 <location>Infeed: Precharging monitoring time expired**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** OFF2 (OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** After the line contactor closes the power unit does not signal the READY state within the monitoring time (p0857).  
 The end of the DC link pre-charging was not able to be completed for one of the following reasons:  
 1) There is no line supply voltage connected.  
 2) The line contactor/line side switch has not been closed.  
 3) The line supply voltage is too low.  
 4) Line supply voltage incorrectly set (p0210).  
 5) The pre-charging resistors are overheated as there were too many pre-charging operations per time unit.  
 6) The pre-charging resistors are overheated as the DC link capacitance is too high.  
 7) The pre-charging resistors are overheated because when there is no "ready for operation" (r0863.0) of the infeed unit, power is taken from the DC link.  
 8) The pre-charging resistors are overheated as the line contactor was closed during the DC link fast discharge through the Braking Module.  
 9) The DC link has either a ground fault or a short-circuit.  
 10) The pre-charging circuit is possibly defective (only for chassis units).  
 See also: p0210 (Drive unit line supply voltage), p0857 (Power unit monitoring time)  
**Remedy:** In general:  
 - check the line supply voltage at the connecting terminals.  
 - check the line supply voltage setting (p0210).  
 - check the monitoring time and, if required, increase (p0857).  
 - where relevant, observe additional power unit messages/signals (e.g. F30027).  
 - the following applies to booksize units: Wait (approx. 8 min.) until the pre-charging resistors have cooled down. For this purpose, preferably disconnect the infeed unit from the line supply.  
 Re 5):  
 - carefully observe the permissible pre-charging frequency (refer to the appropriate Equipment Manual).  
 Re 6):  
 - check the total capacitance of the DC link and reduce in accordance with the maximum permissible DC-link capacitance if necessary (refer to the appropriate Equipment Manual)  
 Re 7):  
 - interconnect the ready-for-operation signal from the infeed unit (r0863.0) in the enable logic of the drives connected to this DC link  
 Re 8):  
 - check the connections of the external line contactor. The line contactor must be open during DC-link fast discharge.  
 Re 9):  
 - check the DC link for ground faults or short circuits.

---

**206010**            **<location>Infeed: Power unit EP 24 V missing in operation**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            OFF2 (OFF1)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**              In operation, the pulse enable via terminal EP at the Line Module (X21.3, X21.4) was withdrawn.  
Note:  
EP: Enable Pulses (pulse enable)

**Remedy:**              - do not open the line side switch in operation - only when the pulses are inhibited.  
- check the wiring of terminal EP (X21.3, X21.4) at the Line Module to exclude any poor contacts.

---

**206050**            **<location>Infeed: Smart Mode not supported**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            OFF2

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**              The power unit does not support the Smart Mode.

**Remedy:**              - set the suitable sampling time  $250 \mu\text{s} \leq p0115[0] \leq 400 \mu\text{s}$  (e.g. by setting p0112 and p0115 to the factory setting).  
- upgrade the power unit software and/or hardware for the Smart Mode. The availability of the Smart Mode function is displayed in r0192.  
- for A\_INF the following applies: De-activate the Smart Mode with p3400.0 = 0 and activate the voltage control with p3400.3 = 1. For booksize power units, it must be noted that for a supply voltage p0210 > 415 V only the Smart Mode is possible in the pre-setting. If DC link voltages above 660 V are permissible in the application, then voltage-controlled operation can be activated with p0280, p0210, p3400 and p3510. The information regarding p0210 should be carefully noted.  
See also: r0192 (Power unit firmware properties)

---

**206052**            **<location>Infeed: Filter temperature evaluation not supported**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            OFF2 (NONE)

**Acknowledge:**        IMMEDIATELY

**Cause:**              The power unit does not support filter temperature evaluation.  
This feature (r0192.11) is required when an Active Interface Module is used as a line filter (p0220 = 41 ... 45).

**Remedy:**              Upgrade the firmware for the power unit to a later version.  
See also: r0192 (Power unit firmware properties), p0220 (Infeed line filter type)

---

**206100**            **<location>Infeed: Shutdown due to line supply undervoltage condition**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            OFF2 (OFF1)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**              The filtered (steady-state) value of the line supply voltage is less than the fault threshold (p0283).  
Fault condition:  $V_{\text{rms}} < p0283 * p0210$   
Fault value (r0949, floating point):  
Actual steady-state line supply voltage.  
See also: p0283 (Line supply undervoltage, shutdown (trip) threshold)

---

**Remedy:**

- check the line supply.
- check the line supply voltage (p0210).
- check the threshold value (p0283).

---

**206105**                    **<location>Infeed: Line supply undervoltage**

**Message value:**        %1  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The filtered (steady-state) value of line supply voltage is lower than the alarm threshold (p0282).  
                               Alarm condition:  $V_{rms} < p0282 * p0210$   
                               Alarm value (r2124, floating point):  
                               Actual steady-state line supply voltage.  
                               See also: p0282 (Line supply undervoltage, alarm threshold)  
**Remedy:**

- check the line supply.
- check the line supply voltage (p0210).
- check the alarm threshold (p0282).

---

**206200**                    **<location>Infeed: Failure of one or several line phases**

**Message value:**        -  
**Drive object:**        A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:**            OFF2 (OFF1)  
**Acknowledge:**        IMMEDIATELY (POWER ON)  
**Cause:**                Failure overvoltage in one or several line supply phases.  
                               The fault can be output in two operating states:  
                               1. During the power-on phase of the infeed unit.  
                               The measured line supply angle deviates from the regular characteristic for a 3-phase system - the PLL cannot be synchronized.  
                               The fault occurs immediately after power-up if, when operating with a VSM, the phase assignment L1, L2, L3 at the VSM differs from the phase assignment at the power unit.  
                               2. While the infeed is operational.  
                               After a voltage dip has been detected or an overvoltage (note A06205) in one or several line phases a fault occurred within 100 ms (also refer to other relevant messages). Generally, before fault message F06200 is output, Alarm A06205 occurs at least once, whose warning value can provide information regarding the cause of the line supply fault.  
                               Probable causes of the fault:  
                               - voltage dip on the line side or phase failure or overvoltage lasting longer than 10 ms.  
                               - overload condition on the load side with peak current.  
                               - line reactor missing.  
**Remedy:**

- check the line supply and fuses.
- check the connection and size (rating) of the line reactor.
- check and correct the phase assignment at the VSM (X521 or X522) and at the power unit.
- check the load.
- if failed in operation, carefully note the previous alarm messages A6205 with alarm values.

See also: p3463 (Infeed, line angle change, phase failure detection)

---

**206205**                    **<location>Infeed: Voltage dip in at least one line supply phase**

**Message value:**        %1  
**Drive object:**        A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE



<b>Cause:</b>	<p>Voltage dip or overvoltage in one or several line supply phases has been detected in operation. The pulses are then inhibited for a time of at least 8 ms. The operating signal of the infeed unit in r0863.0 remains and the pulse inhibit due to the phase failure is displayed in r3405.2.</p> <p>Alarm value (r2124, bitwise coded cause of the alarm):</p> <p>Bit 0: Line angle deviation (limit value p3463) due to a line supply fault</p> <p>Bit 2: Active current deviation</p> <p>Bit 3: Line frequency deviation (limit values: 115 % * p0284, 85 % * p0285)</p> <p>Bit 4: Line overvoltage (limit value 120 % * p0281 * p0210)</p> <p>Bit 5: Line undervoltage (limit value 20 % * p0210)</p> <p>Bit 7: Peak current fault</p> <p>Bit 8: Smart Mode without VSM (p3400.5 = 0): Line angle deviation</p> <p>Bit 9: Smart Mode: DC link voltage dip</p> <p>Bit 10: Smart Mode: Line currents not symmetrical</p>
<b>Remedy:</b>	<p>Generally, the following applies when an alarm message is output:</p> <ul style="list-style-type: none"> <li>- check the line supply and fuses.</li> <li>- check the line supply quality and system fault level.</li> <li>- check the load.</li> </ul> <p>Dependent on the alarm value in r2124, the following applies:</p> <p>Bit 0 = 1: Line fault occurred or poor/incorrect controller setting. For poor line quality or frequent line supply changeover operations, when required, limit value p3463 can be increased until the alarm value no longer occurs.</p> <p>Bit 2 = 1: Line fault occurred or poor/incorrect controller setting. - check the controller setting and load.</p> <p>Bit 3 = 1: Line fault occurred. For poor line quality or frequent line changeover operations, when required, limit values p0284 and p0285 can be increased until the alarm value no longer occurs.</p> <p>Bit 4 = 1: Line interrupted or line overvoltage has occurred.</p> <p>Bit 5 = 1: Line interrupted or line undervoltage has occurred.</p> <p>Bit 7 = 1: Peak current trip due to line fault or overload. Check the load.</p> <p>Bit 8 = 1: Line fault occurred.</p> <p>Bit 9 = 1: Line undervoltage or overload. Check the load.</p> <p>Bit 10 = 1: Line supply interrupted in at least one line phase. Check the fuses.</p> <p>See also: r3405, p3463 (Infeed, line angle change, phase failure detection)</p>

---

## 206207 <location>Infeed: Line currents not symmetrical

<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	OFF1 (NONE, OFF2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	Asymmetry of the currents in the line phase too high. The most probable cause is failure of a line phase.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the line supply and fuses.</li> <li>- check the connection and size (rating) of the line reactor.</li> <li>- check the previous alarm A06205 and the alarm value.</li> </ul>

---

## 206210 <location>Infeed: Summation current too high

<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	OFF2 (OFF1)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>The smoothed total of the phase currents (i1 + i2 + i3) is greater than 4 % of the maximum power unit current (r0209). Possible causes:</p> <ul style="list-style-type: none"> <li>- the DC link has a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter!</li> <li>- the zero point calibration of the current measurement was not carried out (p3491, A06602).</li> <li>- defective current measurement in the power unit.</li> </ul> <p>Fault value (r0949, floating point): Smoothed total of the phase currents.</p>

**Remedy:**

- check the DC link for a low-ohmic or high-ohmic ground fault and if present, remove.
- increase the monitoring time of the current offset measurement (p3491).
- replace the power unit if necessary.

**206211 <location>Infeed: Summation current impermissibly high**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The smoothed sum of the phase currents (i1 + i2 + i3) is impermissibly high. The summed current has exceeded the parameterized threshold for the ground fault monitoring (p0287).  
 Possible causes:  
 - there is a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter!  
 - the zero point calibration of the current measurement was not carried out (p3491, A06602).  
 - the current measurement in the power unit is defective.  
 Fault value (r0949, floating point):  
 Smoothed total of the phase currents.

**Remedy:**

- check the line supply for ground faults and remove any that are present.
- check the set threshold for the ground fault monitoring (p0287).
- if required, replace the power unit.

**206215 <location>Infeed: Summation current too high**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The smoothed total of the phase currents (i1 + i2 + i3) is greater than 3 % of the maximum power unit current (r0209).  
 Possible causes:  
 - the DC link has a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter!  
 - the zero point calibration of the current measurement was not carried out (p3491, A06602).  
 - defective current measurement in the power unit.  
 Alarm value (r2124, floating point):  
 Smoothed total of the phase currents.

**Remedy:**

- check the DC link for a low-ohmic or high-ohmic ground fault and if present, remove.
- increase the monitoring time of the current offset measurement (p3491).
- replace the power unit if necessary.

**206250 <location>Infeed: Defective capacitor(s) in at least one phase of line filter**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A change in the line filter capacitance was detected in at least one line phase.  
 The voltages and phase currents of the line filter, measured using a Voltage Sensing Module (VSM), indicate a deviation of the filter capacitances from the value parameterized in p0221.  
 A change or a defect of the line filter capacitors results in a shift of the resonant frequencies and can result in severe damage to the drive system.

Alarm value (r2124, floating point):

The calculated present capacitance in  $\mu\text{F}$  (rounded-off to an integer number).

The 1st decimal point specifies the number of the phase (1, 2, 3) where the capacitance deviates from the specified value.

- Remedy:**
- check the parameterized value of the filter capacitance (p0221).
  - check the correct wiring of the Voltage Sensing Module (VSM):  
Differential voltages u12 and u23 must be present at the 100 V/690 V inputs of the VSM; the phase currents of the line filter must be connected to the 10 V inputs through a current - voltage converter.
  - check the alarm limits for the permissible filter capacitance deviation (p3676).
  - check the scaling of the line supply voltage measurement using the VSM (p3660).
  - check the scaling of the filter current measurement using the VSM (p3670).
  - check the line filter capacitors and if required, replace the line filter.
- See also: p0221 (Infeed filter capacitance), p3660 (VSM input line supply voltage, voltage scaler), p3670 (VSM 10 V input CT gain), p3676 (VSM line filter capacitance alarm threshold)

## 206260 <location>Infeed: Temperature in the line filter too high

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The temperature monitoring in the line filter has responded.  
If the temperature remains too high during the complete monitoring time, this results in fault F06261.

Note:

The temperature monitoring is only available for an Active Interface Module.

- Remedy:**
- check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in P0220[0].
  - temperature monitoring is mandatory for AIM line filters (refer to P0220). Ensure that the line filter temperature switch is correctly and reliably connected to input X21 of the infeed.
  - reduce the ambient temperature of the line filter.
  - reduce the load on the infeed and the filter module.
  - check the magnitude of the line supply voltage.
  - the internal fan of the filter module is defective. Replace the fan if necessary.
  - defective temperature switch of the filter module. Replace the filter module if necessary.

## 206261 <location>Infeed: Temperature in the line filter permanently too high

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** OFF2 (OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:** After the temperature monitoring responded, the temperature in the line filter was permanently exceeded.

Note:

The temperature monitoring is only available for an Active Interface Module (AIM).

- Remedy:**
- check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in P0220[0].
  - temperature monitoring is mandatory for AIM line filters (refer to P0220). Ensure that the temperature switch in the line filter is correctly and reliably connected to input X21 of the infeed.
  - reduce the ambient temperature of the line filter.
  - reduce the load on the infeed and the line filter.
  - check the magnitude of the line supply voltage.
  - the internal fan of the line filter is defective. Replace the fan if necessary.
  - defective temperature switch of the line filter. Replace the line filter if necessary.

**206262 <location>Infeed: Temperature switch in the line filter open when powering up**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** OFF2 (OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** When powering up the infeed, the temperature in the line filter is too high. Powering up is prevented.  
**Remedy:** - check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in P0220[0].  
 - temperature monitoring is mandatory for AIM line filters (refer to P0220). Ensure that the temperature switch in the line filter is correctly and reliably connected to input X21 of the infeed.  
 - the filter temperature is too high. Allow the system to cool down.  
 - the internal fan of the line filter is defective. Replace the fan if necessary.  
 - defective temperature switch of the line filter. Replace the line filter if necessary.

**206300 <location>Infeed: Line voltage too high at power on**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The RMS line supply voltage Vrms was so high when powering up that controlled operation is not possible without exceeding the permissible maximum voltage in the DC link (p0280).  
 Fault condition: Vrms \* 1.5 > p0280.  
 Fault value (r0949, floating point):  
 Lowest possible controlled DC link voltage for the line supply voltage presently connected.  
 See also: p0280 (DC link voltage maximum steady-state)  
**Remedy:** - check the line supply voltage  
 - check the maximum DC link voltage and if required, increase (p0280).  
 - check the line supply voltage and compare with the actual line supply voltage (p0210).  
 - check whether the power unit is dimensioned for the line supply voltage actually being used.  
 See also: p0210 (Drive unit line supply voltage), p0280 (DC link voltage maximum steady-state)

**206301 <location>Infeed: Line supply overvoltage**

**Message value:** Line supply voltage: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The filtered (steady-state) value of the rms line supply voltage Vrms is higher than the alarm threshold (p0281).  
 Alarm condition: Vrms > p0281 \* p0210.  
 Alarm value (r2124, floating point):  
 Actual steady-state line supply voltage.  
 See also: p0281 (Line supply overvoltage, alarm threshold)  
**Remedy:** - check the line supply.  
 - check the line supply voltage (p0210).  
 - check the alarm threshold (p0281).  
 See also: p0210 (Drive unit line supply voltage), p0281 (Line supply overvoltage, alarm threshold)

---

**206310**            **<location>Infeed: Supply voltage (p0210) incorrectly parameterized**

**Message value:**    Line supply voltage: %1

**Drive object:**     A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**         NONE (OFF1, OFF2)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            After pre-charging was completed, the line supply voltage  $V_{rms}$  was calculated using the measured DC link voltage. This voltage  $V_{rms}$  is not within the tolerance range of the supply voltage. The following applies for the tolerance range:  $85 \% * p0210 < V_{rms} < 110 \% * p0210$ . Alarm value (r2124, floating point):  
Line supply voltage  $V_{rms}$  present.  
See also: p0210 (Drive unit line supply voltage)

**Remedy:**           - check the parameterized supply voltage and if required change (p0210).  
- check the line supply voltage.  
See also: p0210 (Drive unit line supply voltage)

---

**206310**            **<location>Supply voltage (p0210) incorrectly parameterized**

**Message value:**    -

**Drive object:**     SERVO, SERVO\_SINUMERIK

**Reaction:**         NONE (OFF1, OFF2)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            For AC/AC drive units, the measured DC voltage lies outside the tolerance range after pre-charging has been completed. The following applies for the tolerance range:  $1.16 * p0210 < r0070 < 1.6 * p0210$ . The fault can only be acknowledged when the drive is powered down.  
See also: p0210 (Drive unit line supply voltage)

**Remedy:**           - check the parameterized supply voltage and if required change (p0210).  
- check the line supply voltage.  
See also: p0210 (Drive unit line supply voltage)

---

**206310**            **<location>Supply voltage (p0210) incorrectly parameterized**

**Message value:**    -

**Drive object:**     VECTOR

**Reaction:**         NONE (OFF1, OFF2)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            For AC/AC drive units, the measured DC voltage lies outside the tolerance range after pre-charging has been completed:  $1.16 * p0210 < r0070 < 1.6 * p0210$ . The fault can only be acknowledged when the drive is powered down.  
See also: p0210 (Drive unit line supply voltage)

**Remedy:**           - check the parameterized supply voltage and if required change (p0210).  
- check the line supply voltage.  
See also: p0210 (Drive unit line supply voltage)

---

**206311**            **<location>Infeed: Supply voltage (p0210) incorrect**

**Message value:**    Line supply voltage: %1

**Drive object:**     A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**         OFF2 (OFF1)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:** The line voltage nominal value indicated in p0210 is outside the nominal voltage range of the power unit. After pre-charging was completed, the current line supply voltage  $V_{rms}$  was calculated using the measured DC link voltage. This voltage  $V_{rms}$  does not lie within the extended tolerance range of the supply voltage set in p0210. The following applies for the extended tolerance range:  $75\% * p0210 < V_{rms} < 120\% * p0210$   
 Alarm value (r2124, floating point):  
 Line supply voltage  $V_{rms}$  present.  
 See also: p0210 (Drive unit line supply voltage)

**Remedy:**

- check the parameterized supply voltage and if required change (p0210).
- check the line supply voltage.

See also: p0210 (Drive unit line supply voltage)

**206320 <location>Master/slave: 4-channel multiplexer control not valid**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** Values 0, 1, 2, and 3 are valid to control the 4-channel multiplexer via connector input 3572. In this case, an invalid value was identified. The control remains effective with the previous value.  
 Fault value (r0949, decimal interpretation):  
 Invalid value to control the multiplexer.  
 See also: p3572 (Master/slave active current setpoint, multiplexer selection)

**Remedy:**

- check the interconnection to control the multiplexer (CI: p3572).
- check the signal source signal value of the BICO interconnection.

See also: p3572 (Master/slave active current setpoint, multiplexer selection)

**206321 <location>Master/slave: 6-channel multiplexer control not valid**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** For the 6-channel multiplexer control via connector input p3577 an invalid value was identified. Values of 0, 1, 2, 3, 4 and 5 are valid. The control remains effective with the previous value.  
 Fault value (r0949, decimal interpretation):  
 Invalid value used to control the multiplexer.  
 See also: p3577 (Master/slave current distribution factor, multiplexer selection)

**Remedy:**

- check the interconnection to control the multiplexer (CI: p3577).
- check the signal source signal value of the BICO interconnection.

**206350 <location>Infeed: Measured line frequency too high**

**Message value:** Line frequency: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The actual line frequency  $f_{line}$  is higher than the parameterized alarm threshold ( $f_{line} > p0211 * p0284$ ). The alarm can be output in two operating states:  
 1. During the power-on phase of the infeed unit.  
 Consequence:  
 Synchronization of the infeed to the line supply is interrupted and is restarted.  
 2. While the infeed is operational.

## Consequence:

The infeed remains in the operating (run) state and alarm A6350 is output. This signifies a critical operational fault.

Alarm value (r2124, floating point):

Actual line frequency determined.

See also: p0284 (Line supply frequency exceeded, alarm threshold)

**Remedy:**

- check the parameterized line frequency and if required change (p0211).
- check the alarm threshold (p0284).
- check the line supply.
- check the line supply quality.

See also: p0211 (Rated line freq), p0284 (Line supply frequency exceeded, alarm threshold)

**206351 <location>Infeed: Measured line frequency too low**

**Message value:** Line frequency: %1

**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The actual line frequency  $f_{line}$  is lower than the parameterized alarm threshold ( $f_{line} < p0211 * p0285$ ).

The alarm can be output in two operating states:

1. During the power-on phase of the infeed unit.

Consequence:

Synchronization of the infeed to the line supply is interrupted and is restarted.

2. While the infeed is operational.

Consequence:

The infeed remains in the operating (run) state and alarm A06351 is output. This signifies a critical operational fault.

Alarm value (r2124, floating point):

Actual line frequency determined.

See also: p0285 (Line supply frequency undershot, alarm threshold)

**Remedy:**

- check the parameterized line frequency and if required change (p0211).
- check the alarm threshold (p0285).
- check the line supply.
- check the line supply quality.

See also: p0211 (Rated line freq), p0285 (Line supply frequency undershot, alarm threshold)

**206400 <location>Infeed: Line supply data identification selected/active**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The line supply data identification is selected and active.

The line inductance and the DC link capacitance are measured at the next pulse enable.

See also: p3410 (Infeed identification method)

**Remedy:** Not necessary.  
The alarm automatically disappears after the measurement has been completed.

**206401 <location>Infeed: Transformer data identification/test mode selected/active**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A transformer data identification type or a transformer test operation has been selected or is active.  
Alarm value (r2124, interpret decimal):  
11: Identification type 1 selected for transformer data (automatic determination of the magnetizing inductance).  
12: Identification type 2 selected for transformer data (automatic determination of transformer phase shift and gain correction).  
13: Identification type 3 selected for transformer data (determination of total leakage inductance of transformer during line data identification).  
101: Test mode 1 selected.  
102: Test mode 2 selected.  
See also: p5480 (Transformer magnetization mode)

**Remedy:** Not necessary.  
The alarm automatically disappears after the identification has been completed.

---

**206500 <location>Infeed: Line synchronization not possible**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** OFF2 (OFF1)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The line synchronization is not possible within the monitoring time.  
The infeed was re-synchronized to the line supply because it was interrupted due to a line frequency that was determined to be either too low or too high.  
After 20 attempts, synchronization - and therefore also the power-on operation - were interrupted.

**Remedy:** - check the parameterized line frequency and if required change (p0211).  
- check the setting of the threshold values (p0284, p0285).  
- check the line supply.  
When using a voltage sensing module (VSM):  
- check the line supply connection at the terminals (X521, X522).  
- check VSM activation (p0145, p3400).  
- check the line supply quality.  
Note:  
In the case of chassis power units, the availability of correct VSM voltage measured values is imperative for line synchronization.  
See also: p0211, p0284, p0285

---

**206502 <location>Infeed: Unable to achieve line synchronization in transformer magnetization**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Line synchronization is not possible within the monitoring time (p5481[2]).

**Remedy:** - check the setting of the threshold value (p5485).  
- check the setting of the maximum time (p5481[2])  
- check the line supply quality.  
See also: p5481 (Transformer magnetization ramp-up time/bounce time/timeout), p5485 (Transf magnetization voltage threshold)



---

<b>206601</b>	<b>&lt;location&gt;Infeed: Current offset measurement interrupted</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	Defective current measurement or a DC current is present during the offset measurement. Alarm value (r2124, interpret decimal): 1: Excessively high phase current has occurred during the current offset calibration. 2: The measured current offset is greater than the 3% of the maximum permissible converter current (e.g. due to a ground fault in the DC link).
<b>Remedy:</b>	Re alarm value = 1: - possible counter-measure if there is no line contactor: Power up an adequately long time before OFF1 = 1. Re alarm value = 2: - defective current measurement or a DC current is present during the offset measurement. - check the DC link for a ground fault.

---

<b>206602</b>	<b>&lt;location&gt;Infeed: Current offset measurement not possible</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	After an OFF1 = 1 no valid current offset measurement was able to be made within the monitoring time (p3491) before closing the line contactor. The current offset is set to 0. See also: p3491 (Infeed I-offset measurement monitoring time)
<b>Remedy:</b>	- check the DC link for a ground fault. A ground fault can destroy parts and components! - Check the monitoring time setting and if required increase (p3491). At least 100 ms is required for a valid measurement (p3491 > 100 ms). Notice: If there is no valid measurement, then under certain circumstances the quality of the DC link control will be reduced. See also: p3491 (Infeed I-offset measurement monitoring time)

---

<b>206700</b>	<b>&lt;location&gt;Infeed: Switch line contactor for load condition</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	NONE (OFF2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	For an ON command, the infeed line contactor should be switched under load.
<b>Remedy:</b>	- do not load the DC link if the infeed has not issued an operating signal (r0863.0 = 1). - after the infeed has been powered down, all power units connected to the DC link should be powered down. To realize this, the operating signal of the infeed (r0863.0) must be suitably interconnected.

---

<b>206800</b>	<b>&lt;location&gt;Infeed: Maximum steady-state DC link voltage reached</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, S_INF, SIC_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE

**Cause:** The DC link voltage setpoint has reached the maximum steady-state voltage parameterized in p0280. The DC link voltage is increased by the modulation depth reserve controller for the following reasons:

- modulation depth reserve is too low (p3480).
- line supply voltage is too high.
- supply voltage (p0210) parameterized to be too low.
- excessively high setpoint for the reactive line current.

**Remedy:**

- check the line supply voltage setting (p0210).
- check the line supply for an overvoltage condition.
- reduce the modulation depth reserve (p3480).
- reduce the reactive current setpoint.

See also: p0210 (Drive unit line supply voltage), p0280 (DC link voltage maximum steady-state), p3480 (Infeed modulation depth limit)

**206810 <location>Infeed: DC link voltage alarm threshold**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** In operation, the DC link voltage has dropped to below the alarm threshold. The alarm threshold is obtained from the sum of p0279 and r0296.  
Possible causes include:

- line supply voltage dip or another line supply fault.
- overload of the infeed.
- for active line module: Controller incorrectly parameterized.

See also: p0279 (DC link voltage offset alarm threshold), r0296 (DC link voltage undervoltage threshold)

**Remedy:**

- check the line voltage and line supply quality.
- reduce the power drawn, avoid step-like load changes
- for Active Line Module: Adapt the controller parameterization (e.g. automatic line supply identification (p3410 = 4, 5)).

**206849 <location>Infeed: Short-circuit operation active**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The current hysteresis controller sequence control has detected a short circuit (r5452, r5522). The absolute line supply voltage (r5444[0], r5512[0]) is below the short-circuit voltage limit (p5459[2], p5529[2]), and the current limitation is active (r5402.3=1, r5502.3=1).  
Note:  
The effective current limit is obtained from the parameterized overcurrent (p5453) and the hysteresis width (p5454).

**Remedy:**

- check the parameterization of the current hysteresis controller (p5453).
- check the line supply cables for a short-circuit.

See also: r5452 (Current hysteresis controller sequence control status word), p5453 (Current hysteresis controller overcurrent limit)

**206850 <location>Infeed: Short-circuit prevailing for too long**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The maximum permissible duration (p5458[1], p5528[1]) for the short-circuit has been exceeded. The short-circuit could not be cleared within this time.

**Remedy:**

- check the minimum time parameter setting (p5458[1], p5528[1]).
- check the line supply and fuses.

See also: p5458 (Current hysteresis controller minimum time operating state), p5528 (Dynamic grid support minimum time operating state)

### 206851 <location>Infeed: Islanding detection threshold exceeded

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** OFF2 (NONE)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** At least one threshold of the frequency/voltage monitoring for islanding detection was exceeded. The threshold is exceeded for longer than the minimum break-time (p5545[0]).  
Alarm value (r2124, interpret hexadecimal):  
Status word (r5542).

**Remedy:**

- check the line supply.
- check the parameterization of islanding detection (p5543, p5544).

See also: r5542 (Line monitoring status word), p5543 (Line monitoring voltage threshold), p5544 (Line monitoring frequency threshold), p5545 (Line monitoring times)

### 206855 <location>Infeed: Line filter monitor responded

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A threshold value parameterized in p3678 has been exceeded or undershot in the line filter.  
Fault value (r0949, decimal interpretation):  
0: Voltage threshold, alpha/beta voltage monitoring fallen below (p3678[0]).  
1: Current threshold value exceeded (p3678[1]).  
2: Voltage threshold value of the phase voltage monitoring fallen below (p3678[0]).  
See also: p3678 (Filter monitoring threshold values), p3679 (Transformer filter monitoring times)

**Remedy:**

- check the parameterization of the threshold values for filter monitoring (p3678).
- check filter.

Re fault value = 0:  
- check parameterization of the smoothing time for voltage monitoring (3679[0]).

Re fault value = 1:  
- check parameterization of the minimum time for voltage monitoring (3679[1]).

### 206860 <location>Infeed: Function module activation not possible

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Function module activation is not possible. The power unit used does not have the "gating unit with current limitation control" feature (p0192.19).  
 The affected function module is identified in fault code r0949 (the value of r0949 corresponds to the bit of parameter p0108).  
 r0949=7 "Fault ride-through" function module  
 r0949=12 "Line droop control" function module  
 See also: r0192 (Power unit firmware properties), p5401 (Line droop control activation)

**Remedy:** - check whether the power unit used has the "gating unit with current limitation control" feature (p0192.19).  
 - If required, replace the power unit being used by a power unit that has the "gating unit with current limitation control" feature.

**206900 <location>Braking Module: Fault (1 -> 0)**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The Braking Module signals a fault (1 -> 0) via X21.4 ("booksize" format) or terminal X21.5 ("chassis" format). This signal is interconnected via binector input p3866[0...7].  
 See also: p3866 (Braking Module fault)

**Remedy:** - reduce the number of braking operations.  
 - check binector input p3866[0...7] and the wiring from terminal X21.4 ("booksize" format) or terminal X21.5 ("chassis" format).

**206901 <location>Braking Module: Pre-alarm I2t shutdown**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The Braking Module signals "Pre-alarm I2t shutdown" via terminal X21.3. This signal is interconnected via binector input p3865[0...7].  
 Note:  
 The pre-alarm I2t shutdown is only possible for "booksize" formats. This function is not supported for "chassis" formats.

**Remedy:** - reduce the number of braking operations.  
 - check binector input p3865[0...7] and the wiring from terminal X21.3 of the particular Braking Module.

**206904 <location>Braking Module internal is inhibited**

**Message value:** %1  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The internal Braking Module was inhibited via binector input p3680 = 1 signal. In the inhibited state, energy cannot be dissipated using the braking resistor.  
 See also: p3680 (Braking Module internal inhibit)

**Remedy:** Release the internal Braking Module (BI: p3680 = 0 signal).

---

**206905 <location>Braking Module internal I2t shutdown alarm**

**Message value:** %1  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The internal Braking Module outputs an alarm due to the high I2t value.  
80% of the maximum switch-on duration of the braking resistor has been reached.  
**Note:**  
This message is also displayed via BO: p3685.  
See also: r3685 (Digital Braking Module: Pre-alarm I2t shutdown)  
**Remedy:** Reduce the number of braking operations.

---

**206906 <location>Braking Module internal fault**

**Message value:** %1  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The internal Braking Module outputs a fault due to overcurrent or an excessively high I2t value and is therefore inhibited.  
**Note:**  
This message is also displayed via BO: p3686.  
Fault value (r0949, interpret bitwise binary):  
Bit 0 = 1: I2t exceeded  
Bit 1 = 1: overcurrent  
See also: r3686 (Digital Braking Module Fault)  
**Remedy:** Reduce the number of braking operations.

---

**206907 <location>Braking Module internal overtemperature**

**Message value:** -  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The temperature sensor connected to the braking resistor signals an overtemperature.  
The Braking Module is still active. If the overtemperature persists for more than 60 s, fault F06908 is output, and the braking module is switched off.  
See also: r3687 (Digital Braking Module pre-alarm overtemperature)  
**Remedy:**  
- reduce the temperature at the sensor.  
- check the temperature sensor connection.

---

**206908 <location>Braking Module internal overtemperature shutdown**

**Message value:** -  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** OFF2 (OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Braking module shut down due to overtemperature at the temperature sensor of the braking resistor.  
The overtemperature is detected by the sensor for longer than 60 s.  
See also: r3688 (Braking Module internal overtemperature shutdown)

**Remedy:** - reduce the temperature at the sensor.  
- check the temperature sensor connection.

---

**206909 <location>Braking Module internal Vce fault**

**Message value:** %1  
**Drive object:** B\_INF, BIC\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The dip in the collector-emitter voltage (Vce) results in a Vce fault and shutdown.  
See also: r3689 (Digital Braking Module Uce fault)  
**Remedy:** - carry out a POWER ON (power off/on).  
- replace the unit.

---

**206921 <location>Braking resistor phase unsymmetry**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The three resistors of the braking chopper are not symmetrical.  
**Remedy:** - check the feeder cables to the braking resistors.  
- increase p1364.  
See also: p1360 (Braking chopper braking resistor cold), p1362 (Braking chopper activation threshold), r1363 (Braking chopper output voltage), p1364 (Braking chopper resistor asymmetry)

---

**206922 <location>Braking resistor phase failure**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** Phase failure of a braking resistor detected.  
Fault values:  
11 = phase U  
12 = phase V  
13 = phase W  
See also: p3235 (Phase failure signal motor monitoring time)  
**Remedy:** Check the feeder cables to the braking resistors.  
See also: p1360 (Braking chopper braking resistor cold), p1362 (Braking chopper activation threshold), r1363 (Braking chopper output voltage), p1364 (Braking chopper resistor asymmetry)

---

**207011 <location>Drive: Motor overtemperature**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY

---

<b>Cause:</b>	<p>KTY:</p> <p>The motor temperature has exceeded the fault threshold (p0605) or the timer (p0606) after the alarm threshold was exceeded (p0604) has expired.</p> <p>PTC, bimetallic NC contact:</p> <p>The response threshold of 1650 ohms was exceeded (in SME p4600..p4603 or in TM120 p4610..p4613 = 10 or 30), or the timer (p0606) has expired after 1650 ohms was exceeded (in SME p4600..p4603 or in TM120 p4610..p4613 = 12 or 32).</p> <p>Possible causes:</p> <ul style="list-style-type: none"> <li>- Motor is overloaded</li> <li>- motor ambient temperature too high.</li> <li>- PTC / bimetallic NC contact: Wire breakage or sensor not connected.</li> </ul> <p>Fault value (r0949, decimal interpretation):</p> <p>200: The I2t motor model signals an overtemperature (p0612.0 = 1, p0611 &gt; 0).</p> <p>Number of the temperature channel leading to the message (for SME/TM120 (p0601 = 10, 11)).</p> <p>See also: p0604 (Motor temperature alarm threshold), p0605 (Motor temperature fault threshold), p0606 (Motor temperature timer)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Reduce the motor load.</li> <li>- check the ambient temperature and the motor ventilation.</li> <li>- check the wiring and the connection of the PTC or bimetallic NC contact.</li> </ul> <p>See also: p0604 (Motor temperature alarm threshold), p0605 (Motor temperature fault threshold), p0606 (Motor temperature timer)</p>

---

## 207011 <location>Drive: Motor overtemperature

<b>Message value:</b>	%1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>KTY or no sensor:</p> <p>The measured motor temperature or model temperature has exceeded the fault threshold (p0605) or the timer (p0606) has elapsed following the alarm threshold (p0604) being exceeded.</p> <p>The response parameterized in p0610 becomes active.</p> <p>PTC or bimetallic NC contact:</p> <p>The response threshold of 1650 Ohm was exceeded or the NC contact opened and the timer (p0606) has expired.</p> <p>The response parameterized in p0610 becomes active.</p> <p>Possible causes:</p> <ul style="list-style-type: none"> <li>- Motor is overloaded</li> <li>- motor ambient temperature too high.</li> <li>- PTC / bimetallic NC contact: Wire breakage or sensor not connected.</li> </ul> <p>Fault value (r0949, decimal interpretation):</p> <p>200: The I2t motor model signals an overtemperature (p0612.0 = 1, p0611 &gt; 0).</p> <p>Number of the temperature channel leading to the message (for SME/TM120 (p0601 = 10, 11)).</p> <p>See also: p0604 (Motor temperature alarm threshold), p0605 (Motor temperature fault threshold), p0606 (Motor temperature timer), p0610 (Motor overtemperature response)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Reduce the motor load.</li> <li>- check the ambient temperature and the motor ventilation.</li> <li>- check the wiring and the connection of the PTC or bimetallic NC contact.</li> </ul> <p>See also: p0604 (Motor temperature alarm threshold), p0605 (Motor temperature fault threshold), p0606 (Motor temperature timer)</p>

---

## 207012 <location>Drive: I2t motor model overtemperature

<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE

- Cause:** The thermal I2t motor model (for synchronous motors) identified that the temperature alarm threshold was exceeded. See also: r0034 (Motor utilization), p0605 (Motor temperature fault threshold), p0611 (I2t motor model thermal time constant)
- Remedy:**
- check the motor load and if required, reduce.
  - check the motor ambient temperature.
  - check the thermal time constant p0611.
  - check the overtemperature fault threshold p0605 (= alarm threshold for the I2t motor model, see p0612)

**207015 <location>Drive: Motor temperature sensor alarm**

- Message value:** %1
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** An error was detected when evaluating the temperature sensor set in p0600 and p0601. With the fault, the time in p0607 is started. If the fault is still present after this time has expired, then fault F07016 is output; however, at the earliest, 50 ms after alarm A07015.  
Possible causes:
- wire breakage or sensor not connected (KTY: R > 1630 Ohm).
  - measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).
- Alarm value (r2124, interpret decimal):
- if SME/TM120 is selected (p0601 = 10, 11), this is the number of the temperature channel leading to the message.
- Remedy:**
- make sure that the sensor is connected correctly.
  - check the parameterization (p0600, p0601).
- See also: r0035, p0600, p0601, p0607

**207016 <location>Drive: Motor temperature sensor fault**

- Message value:** %1
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF1 (NONE, OFF2, OFF3, STOP1, STOP2)
- Acknowledge:** IMMEDIATELY
- Cause:** An error was detected when evaluating the temperature sensor set in p0600 and p0601.  
Possible causes:
- wire breakage or sensor not connected (KTY: R > 1630 Ohm).
  - measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).
- Note:
- If alarm A07015 is present, the time in p0607 is started. If the fault is still present after this time has expired, then fault F07016 is output; however, at the earliest, 50 ms after alarm A07015.  
Fault value (r0949, decimal interpretation):
- if SME/TM120 is selected (p0601 = 10, 11), this is the number of the temperature channel leading to the message.
- See also: p0607 (Temperature sensor fault timer)
- Remedy:**
- make sure that the sensor is connected correctly.
  - check the parameterization (p0600, p0601).
  - induction motors: De-activate temperature sensor fault (p0607 = 0).
- See also: r0035, p0600, p0601, p0607



---

<b>207080</b>	<b>&lt;location&gt;Drive: Incorrect control parameter</b>
<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The closed-loop control parameters have been parameterized incorrectly (e.g. p0356 = L_spread = 0). Fault value (r0949, decimal interpretation): The fault value includes the parameter number involved. The following parameter numbers only occur as fault values for vector drives: p0310, for synchronous motors: p0341, p0344, p0350, p0357 The following parameter numbers do not occur as fault values for synchronous motors: p0354, p0358, p0360 See also: p0310, p0311, p0341, p0344, p0350, p0354, p0356, p0357, p0358, p0360, p0400, p0404, p0408, p0640, p1082, r1082, p1300
<b>Remedy:</b>	Modify the parameter indicated in the fault value (r0949) (e.g. p0640 = current limit > 0). See also: p0311, p0341, p0344, p0350, p0354, p0356, p0358, p0360, p0400, p0404, p0408, p0640, p1082, r1082

---

<b>207082</b>	<b>&lt;location&gt;Macro: Execution not possible</b>
<b>Message value:</b>	Fault cause: %1, supplementary information: %2, preliminary parameter number: %3
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The macro cannot be executed. Fault value (r0949, interpret hexadecimal): ccccbbaa hex: cccc = preliminary parameter number, bb = supplementary information, aa = fault cause Fault causes for the trigger parameter itself: 19: Called file is not valid for the trigger parameter. 20: Called file is not valid for parameter 15. 21: Called file is not valid for parameter 700. 22: Called file is not valid for parameter 1000. 23: Called file is not valid for parameter 1500. 24: Data type of a TAG is incorrect (e.g. Index, number or bit is not U16). Fault causes for the parameters to be set: 25: Error level has an undefined value. 26: Mode has an undefined value. 27: A value was entered as string in the tag value that is not "DEFAULT". 31: Entered drive object type unknown. 32: A device was not able to be found for the determined drive object number. 34: A trigger parameter was recursively called. 35: It is not permissible to write to the parameter via macro. 36: Check, writing to a parameter unsuccessful, parameter can only be read, not available, incorrect data type, value range or assignment incorrect. 37: Source parameter for a BICO interconnection was not able to be determined. 38: An index was set for a non-indexed (or CDS-dependent) parameter. 39: No index was set for an indexed parameter. 41: A bit operation is only permissible for parameters with the parameter format DISPLAY_BIN. 42: A value not equal to 0 or 1 was set for a BitOperation. 43: Reading the parameter to be changed by the BitOperation was unsuccessful. 51: Factory setting for DEVICE may only be executed on the DEVICE. 61: The setting of a value was unsuccessful.
<b>Remedy:</b>	- check the parameter involved. - check the macro file and BICO interconnection. See also: p0015, p0700, p1000, p1500

---

**207083**                    **<location>Macro: ACX file not found**

**Message value:**        Parameter: %1  
**Drive object:**         All objects  
**Reaction:**              NONE  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The ACX file (macro) to be executed was not able to be found in the appropriate directory.  
                               Fault value (r0949, decimal interpretation):  
                               Parameter number with which the execution was started.  
                               See also: p0015, p0700, p1000, p1500  
**Remedy:**                - check whether the file is saved in the appropriate directory on the memory card.  
                               Example:  
                               If p0015 is set to 1501, then the selected ACX file must be located in the following directory:  
                               ... /PMACROS/DEVICE/P15/PM001501.ACX

---

**207084**                    **<location>Macro: Condition for WaitUntil not fulfilled**

**Message value:**        Parameter: %1  
**Drive object:**         All objects  
**Reaction:**              NONE  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The WaitUntil condition set in the macro was not fulfilled in a certain number of attempts.  
                               Fault value (r0949, decimal interpretation):  
                               Parameter number for which the condition was set.  
**Remedy:**                Check and correct the conditions for the WaitUntil loop.

---

**207085**                    **<location>Drive: Open-loop/closed-loop control parameters changed**

**Message value:**        Parameter: %1  
**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**              NONE  
**Acknowledge:**        IMMEDIATELY (POWER ON)  
**Cause:**                Open-loop/closed-loop control parameters have had to be changed for the following reasons:  
                               1. As a result of other parameters, they have exceeded the dynamic limits.  
                               2. They cannot be used due to the fact that the hardware detected not having certain features.  
                               Fault value (r0949, decimal interpretation):  
                               Changed parameter number.  
                               340:  
                               The motor and control parameters were automatically calculated (p0340 = 1), because the vector control was subsequently activated as configuration (r0108.2).  
                               See also: p0640, p1082, r1082, p1300, p1800  
**Remedy:**                Not necessary.  
                               It is not necessary to change the parameters as they have already been correctly limited.

---

**207086**                    **<location>Units changeover: Parameter limit violation due to reference value change**

**Message value:**        Parameter: %1  
**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:**              NONE  
**Acknowledge:**        IMMEDIATELY

---

<b>Cause:</b>	A reference parameter was changed in the system. This resulted in the fact that for the parameters involved, the selected value was not able to be written in the per unit representation (cause: e.g. the steady-state minimum/maximum limit or that defined in the application was violated). The values of the parameters were set to the corresponding violated minimum/maximum limit or to the factory setting. Fault value (r0949, parameter): Diagnostics parameter r9450 to display the parameters that were not able to be re-calculated. See also: p0304, p0305, p0310, p0596, p2000, p2001, p2002, p2003, r2004
<b>Remedy:</b>	Check the adapted parameter value and if required correct. See also: r9450 (Reference value change parameter with unsuccessful calculation)

---

### 207087 <location>Drive: Encoderless operation not possible for the selected pulse frequency

<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Encoderless operation is not possible for the selected pulse frequency (p1800). Encoderless operation is activated under the following conditions: - the changeover speed for encoderless operation (p1404) is less than the maximum speed (p0322). - a control type with encoderless operation has been selected (p1300). - encoder faults of the motor encoder result in a fault response with encoderless operation (p0491). See also: p0491, p1300, p1404, p1800
<b>Remedy:</b>	Increase the pulse frequency (p1800). Note: In encoderless operation, the pulse frequency must be at least as high as half the current controller clock cycle (1/p0115[0]).

---

### 207088 <location>Units changeover: Parameter limit violation due to units changeover

<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, ENCODER, ENCSINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A changeover of units was initiated. Possible causes for the violation of a parameter limit are: - when rounding off a parameter corresponding to its decimal places, the steady-state minimum or maximum limit was violated. - inaccuracies for the data type "FloatingPoint". In these cases, when the minimum limit is violated then the parameter value is rounded up and when the maximum limited is violated the parameter value is rounded down. Fault value (r0949, decimal interpretation): Diagnostics parameter r9451 to display all parameters whose value had to be adapted. See also: p0100 (IEC/NEMA mot stds), p0349 (System of units, motor equivalent circuit diagram data), p0505 (Selecting the system of units), p0595 (Selecting technological units)
<b>Remedy:</b>	Check the adapted parameter values and if required correct. See also: r9451 (Units changeover adapted parameters)

---

**207089**                    **<location>Changing over units: Function module activation is blocked because the units have been changed over**

**Message value:**        -  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                An attempt was made to activate a function module. This is not permissible if the units have already been changed over.  
                               See also: p0100 (IEC/NEMA mot stds), p0349 (System of units, motor equivalent circuit diagram data), p0505 (Selecting the system of units)  
**Remedy:**                Restore units that have been changed over to the factory setting.

---

**207090**                    **<location>Drive: Upper torque limit less than the lower torque limit**

**Message value:**        -  
**Drive object:**         SERVO, SERVO\_SINUMERIK  
**Reaction:**             OFF2 (NONE, OFF1, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The upper torque limit is lower than the lower torque limit.  
**Remedy:**                P1 must be >= P2 if parameter P1 is connected to p1522 and parameter P2 to p1523.

---

**207100**                    **<location>Drive: Sampling times cannot be reset**

**Message value:**        Parameter: %1  
**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**             NONE  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                When resetting drive parameter (p0976) sampling times cannot be reset using p0111, p0112, p0115.  
                               Fault value (r0949, decimal interpretation):  
                               Parameter whose setting prevents the sampling times being reset.  
                               See also: r0110 (Basic sampling times)  
**Remedy:**                - continue to work with the set sampling times.  
                               - before resetting the drive parameters, set the basic clock cycle p0110[0] to the original value.  
                               See also: r0110 (Basic sampling times)

---

**207110**                    **<location>Drive: Sampling times and basic clock cycle do not match**

**Message value:**        Parameter: %1  
**Drive object:**         All objects  
**Reaction:**             NONE  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The parameterized sampling times do not match the basic clock cycle.  
                               Fault value (r0949, decimal interpretation):  
                               The fault value specifies the parameter involved.  
                               See also: r0110, r0111, p0115  
**Remedy:**                Enter the current controller sampling times so that they are identical to the basic clock cycle, e.g. by selecting p0112.  
                               Note which basic clock cycle is selected in p0111.  
                               The sampling times in p0115 can only be changed manually in the sampling times pre-setting "Expert" (p0112).  
                               See also: r0110, r0111, p0112, p0115

---

**207140 <location>Drive: Current controller sampling time for spindle does not match**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The parameterized current controller sampling time for the spindle has been set too high.  
**Remedy:** Set the sampling time equal to or less than the value in r5034 (p0112, p0115).  
 See also: p0112, p0115, r5034

---

**207200 <location>Drive: Master control ON command present**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The ON/1 command is present (no 0 signal).  
 The command is either influenced via binector input p0840 (current CDS) or control word bit 0 via the master control.  
**Remedy:** Switch the signal via binector input p0840 (aktueller CDS) or control word bit 0 via the master control to 0.

---

**207220 <location>Drive: Master control by PLC missing**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF1 (NONE, OFF2, OFF3, STOP1, STOP2)  
 Vector: OFF1 (NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The "master control by PLC" signal was missing in operation.  
 - interconnection of the binector input for "master control by PLC" is incorrect (p0854).  
 - the higher-level control has withdrawn the "master control by PLC" signal.  
 - data transfer via the fieldbus (master/drive) was interrupted.  
**Remedy:**  
 - check the interconnection of the binector input for "master control by PLC" (p0854).  
 - check the "master control by PLC" signal and, if required, switch in.  
 - check the data transfer via the fieldbus (master/drive).  
**Note:**  
 If the drive should continue to operate after withdrawing "master control by PLC" then fault response must be parameterized to NONE or the message type should be parameterized as alarm.

---

**207300 <location>Drive: Line contactor feedback signal missing**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY

- Cause:**
- the line contactor was not able to be closed within the time in p0861.
  - the line contactor was not able to be opened within the time in p0861.
  - the line contactor dropped out during operation
  - the line contactor has closed although the drive converter is powered down.
- Remedy:**
- check the setting of p0860.
  - check the feedback circuit from the line contactor.
  - increase the monitoring time in p0861.
- See also: p0860 (Line cont. fdbk sig), p0861 (Line contactor monitoring time)

**207311**                    **<location>Bypass motor switch**

- Message value:**      Fault cause: %1 bin
- Drive object:**        VECTOR
- Reaction:**            OFF2
- Acknowledge:**        IMMEDIATELY
- Cause:**              Fault value (r0949, interpret bitwise binary):
- Bit 1: Switch "Closed" feedback signal missing.
  - Bit 2: Switch "Open" feedback signal missing.
  - Bit 3: Switch feedback signal too slow.
- After switching, the system waits for the positive feedback signal. If the feedback signal is received later than the specified time, then a fault trip (shutdown) is issued.
- Bit 6: Drive switch feedback signal not consistent with the bypass state.
- When powering up or for staging, the drive switch is closed.
- See also: p1260 (Bypass configuration), r1261 (Bypass control/status word), p1266 (Bypass, control command), p1267 (Bypass changeover source configuration), p1269 (Bypass switch feedback signal), p1274 (Bypass switch monitoring time)
- Remedy:**
- check the transfer of the feedback signals.
  - check the switch.

**207312**                    **<location>Bypass LSS:**

- Message value:**      Fault cause: %1 bin
- Drive object:**        VECTOR
- Reaction:**            OFF2
- Acknowledge:**        IMMEDIATELY
- Cause:**              Fault value (r0949, interpret bitwise binary):
- Bit 1: Switch "Closed" feedback signal missing.
  - Bit 2: Switch "Open" feedback signal missing.
  - Bit 3: Switch feedback signal too slow.
- After switching, the system waits for the positive feedback signal. If the feedback signal is received later than the specified time, then a fault trip (shutdown) is issued.
- Bit 6: Line Side Switch feedback signal not consistent with the bypass state.
- When powering up or for staging, the Line Side Switch is closed without this having been requested from the bypass.
- See also: p1260 (Bypass configuration), r1261 (Bypass control/status word), p1266 (Bypass, control command), p1267 (Bypass changeover source configuration), p1269 (Bypass switch feedback signal), p1274 (Bypass switch monitoring time)
- Remedy:**
- check the transfer of the feedback signals.
  - check the switch.

---

<b>207320</b>	<b>&lt;location&gt;Drive: Automatic restart interrupted</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<ul style="list-style-type: none"> <li>- The specified number of restart attempts (p1211) has been completely used up because within the monitoring time (p1213) the faults were not able to be acknowledged. The number of restart attempts (p1211) is decremented at each new start attempt.</li> <li>- there is no active ON command.</li> <li>- the monitoring time for the power unit has expired (p0857).</li> <li>- when exiting commissioning or at the end of the motor identification routine or the speed controller optimization, the drive unit is not automatically powered up again.</li> </ul> Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- increase the number of restart attempts (p1211). The actual number of starting attempts is displayed in r1214.</li> <li>- increase the delay time in p1212 and/or the monitoring time in p1213.</li> <li>- issue an ON command (p0840).</li> <li>- either increase or disable the monitoring time of the power unit (p0857).</li> </ul>

---

<b>207320</b>	<b>&lt;location&gt;Drive: Automatic restart interrupted</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<ul style="list-style-type: none"> <li>- The specified number of restart attempts (p1211) has been completely used up because within the monitoring time (p1213) the faults were not able to be acknowledged. The number of restart attempts (p1211) is decremented at each new start attempt.</li> <li>- there is no active ON command.</li> <li>- the monitoring time for the power unit has expired (p0857).</li> <li>- when exiting commissioning or at the end of the motor identification routine or the speed controller optimization, the drive unit is not automatically powered up again.</li> </ul> Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- increase the number of restart attempts (p1211). The actual number of starting attempts is displayed in r1214.</li> <li>- increase the delay time in p1212 and/or the monitoring time in p1213.</li> <li>- issue an ON command (p0840).</li> <li>- either increase or disable the monitoring time of the power unit (p0857).</li> <li>- Reduce the delay time for resetting the start counter p1213[1] so that fewer faults are registered in the time interval.</li> </ul>

---

<b>207321</b>	<b>&lt;location&gt;Drive: Automatic restart active</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The automatic restart (AR) is active. When the line supply returns and/or the causes of the existing faults are removed the drive is automatically restarted. The pulses are enabled and the motor starts to rotate.
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- the automatic restart (AR) should, if required, be inhibited (p1210 = 0).</li> <li>- an automatic restart can be directly interrupted by withdrawing the power-on command (BI: p0840).</li> </ul>

**207329 <location>Drive: kT estimator, kT(iq) characteristic or voltage compensation does not function**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A function of the function module "extended torque control" (r0108.1) was activated - however the (complete) function is not available.  
 Fault value (r0949, decimal interpretation):  
 1 ... 3: The kT estimator is active (p1780.3 = 1) without a functioning compensation of the voltage emulation error in the drive converter. This means that the accuracy is severely restricted.  
 1: The drive converter voltage emulation error "final value" is 0 (p1952).  
 2: The drive converter voltage emulation error "current offset" is 0 (p1953).  
 3: The compensation of the voltage emulation error is disabled (p1780.8 = 0).  
 4: The kT estimator (p1780.3 = 1), the kT(iq) characteristic (p1780.9 = 1) or the compensation of the voltage emulation error (p1780.8 = 1) was activated without activating the function module "extended torque control" (when the function module is activated, the following must apply: r0108.1 = 1).  
**Remedy:** Re fault value = 1, 2:  
 - carry out an identification of the voltage emulation error in the drive converter (p1909.14 = 1, p1910 = 1).  
 - set the parameter to compensate the voltage emulation error in the drive converter (p1952, p1953).  
 For fault value = 3:  
 - enable the compensation of the voltage emulation error in the drive converter (p1780.8 = 1).  
 For fault value = 4:  
 - activate the function module "extended torque control" (r0108.1 = 1) or de-activate the corresponding functions (p1780.3 = 0, p1780.8 = 0, p1780.9 = 0).

---

**207330 <location>Flying restart: Measured search current too low**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** During a flying restart, it was identified that the search current reached is too low.  
 It is possible that the motor is not connected.  
**Remedy:** Check the motor feeder cables.

---

**207331 <location>Flying restart: Function not supported**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** It is not possible to power up with the motor rotating (no flying restart). In the following cases, the "flying restart" function is not supported:  
 Permanent-magnet and separately-excited synchronous motors (PEM, FEM): Operation with U/f characteristic.  
 Permanent-magnet synchronous motor (PEM): Encoderless operation without a Voltage Sensing Module (VSM) being connected.  
**Remedy:**  
 - de-activate the "flying restart" function (p1200 = 0).  
 - change the open-loop/closed-loop control mode (p1300).  
 - connect a Voltage Sensing Module (VSM) (voltage measurement).



---

**207350 <location>Drive: Measuring probe parameterized to a digital output**

<b>Message value:</b>	%1
<b>Drive object:</b>	All objects
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The measuring probe is connected to a bi-directional digital input/output and the terminal is set as output. Alarm value (r2124, interpret decimal): 8: DI/DO 8 (X122.9/X132.1) 9: DI/DO 9 (X122.10/X132.2) 10: DI/DO 10 (X122.12/X132.3) 11: DI/DO 11 (X122.13/X132.4) 12: DI/DO 12 (X132.9) 13: DI/DO 13 (X132.10) 14: DI/DO 14 (X132.12) 15: DI/DO 15 (X132.13) To the terminal designation: The first designation is valid for CU320, the second for CU305.
<b>Remedy:</b>	- set the terminal as input (p0728). - de-select the measuring probe (p0488, p0489, p0580).

---

**207400 <location>Drive: DC link voltage maximum controller active**

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The DC link voltage controller has been activated because of the upper switch-in threshold (r1244). A system deviation can occur between the setpoint and actual speed. See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration)
<b>Remedy:</b>	Not necessary. This alarm automatically disappears after the upper threshold has been distinctly undershot. Otherwise, apply the following measures: - use a Braking Module or regenerative feedback unit. - increase the ramp-down times (p1121, p1135). - shut down the Vdc_max controller (p1240 = 0).

---

**207400 <location>Drive: DC link voltage maximum controller active**

<b>Message value:</b>	-
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The DC link voltage controller has been activated because the upper switch-in threshold has been exceeded (r1242, r1282). The ramp-down times are automatically increased in order to maintain the DC link voltage (r0070) within the permissible limits. There is a system deviation between the setpoint and actual speeds. When the DC link voltage controller is switched out (disabled), this is the reason that the ramp-function generator output is set to the speed actual value. See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration), p1280 (Vdc controller or Vdc monitoring configuration (U/f))

**Remedy:** If the controller is not to intervene:  
- increase the ramp-down times.  
- switch-off the Vdc\_max controller (p1240 = 0 for vector control, p1280 = 0 for U/f control).  
If the ramp-down times are not to be changed:  
- use a chopper or regenerative feedback unit.

---

**207401 <location>Drive: DC link voltage maximum controller de-activated**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The Vdc\_max controller can no longer maintain the DC link voltage (r0070) below the limit value (r1242, r1282) and was therefore switched out (disabled).  
- the line supply voltage is permanently higher than specified for the power unit.  
- the motor is permanently in the regenerative mode as a result of a load that is driving the motor.  
**Remedy:**  
- check whether the input voltage is within the permissible range.  
- check whether the load duty cycle and load limits are within the permissible limits.

---

**207402 <location>Drive: DC link voltage minimum controller active**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The DC link voltage controller has been activated due to the lower switch-in threshold (r1248).  
A system deviation can occur between the setpoint and actual speed.  
A possible cause can be e.g. that the line supply has failed.  
See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration), p1248 (DC link voltage threshold lower)  
**Remedy:** Not necessary.  
This alarm automatically disappears after the lower threshold has been distinctly exceeded.  
Otherwise, apply the following measures:  
- check the line supply and infeed.  
- increase the ramp-up times (p1120).  
- shut down the Vdc\_min controller (p1240 = 0).

---

**207402 <location>Drive: DC link voltage minimum controller active**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The DC link voltage controller has been activated as the lower switch-in threshold has been undershot (r1246, r1286).  
The kinetic energy of the motor is used to buffer the DC link. The drive is therefore braked.  
See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration), p1280 (Vdc controller or Vdc monitoring configuration (U/f))  
**Remedy:** The alarm disappears when power supply returns.

---

---

**207403**            **<location>Drive: Lower DC link voltage threshold reached**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             OFF1 (NONE, OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The DC link voltage monitoring is active (p1240 = 5, 6) and the lower DC link voltage threshold (p1248) was reached in the "Operation" state.

**Remedy:**               - check the line supply voltage.  
- check the infeed.  
- reduce the lower DC link threshold (p1248).  
- switch out (disable) the DC link voltage monitoring (p1240 = 0).

---

**207403**            **<location>Drive: Lower DC link voltage threshold reached**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             OFF1 (NONE, OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The DC link voltage monitoring is active (p1240 , p1280 = 5, 6) and the lower DC link voltage threshold (r1246, r1286) was reached in the "Operation" state.

**Remedy:**               - check the line supply voltage.  
- check the infeed.  
- adapt the device supply voltage (p0210) or the switch-on level (p1245, p1285).  
- disable the DC link voltage monitoring (p1240, p1280 = 0).

---

**207404**            **<location>Drive: Upper DC link voltage threshold reached**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The DC link voltage monitoring is active (p1240 = 4, 6) and the upper DC link voltage threshold (p1244) was reached in the "Operation" state.

**Remedy:**               - check the line supply voltage.  
- check the infeed module or the Braking Module.  
- increase the upper DC link voltage threshold (p1244).  
- switch out (disable) the DC link voltage monitoring (p1240 = 0).

---

**207404**            **<location>Drive: Upper DC link voltage threshold reached**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The DC link voltage monitoring is active (p1240 , p1280 = 4, 6) and the upper DC link voltage threshold (r1242, r1282) was reached in the "Operation" state.

**Remedy:**               - check the line supply voltage.  
- check the infeed module  
- adapt the device supply voltage (p0210).  
- disable the DC link voltage monitoring (p1240, p1280 = 0).

---

---

**207405**                    **<location>Drive: Kinetic buffering minimum speed not reached**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                During kinetic buffering the speed fell below minimum speed (p1257 or p1297 for vector drives with U/f control) and the line supply did not return.

**Remedy:**               Check the speed threshold for the Vdc\_min controller (kinetic buffering) (p1257, p1297).  
See also: p1257 (Vdc\_min controller speed threshold), p1297 (Vdc\_min controller speed threshold (U/f))

---

**207406**                    **<location>Drive: Kinetic buffering maximum time exceeded**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             OFF3 (IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The maximum buffer time (p1255 and p1295 for vector drives with U/f control) has been exceeded without the line supply having returned.

**Remedy:**               Check the time threshold for Vdc-min controller (kinetic buffering) (p1255, p1295).  
See also: p1255 (Vdc\_min controller time threshold), p1295 (Vdc\_min controller time threshold (U/f))

---

**207409**                    **<location>Drive: U/f control, current limiting controller active**

**Message value:**        %1

**Drive object:**         VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The current limiting controller of the U/f control was activated because the current limit was exceeded.

**Remedy:**               The alarm automatically disappears after one of the following measures:  
- increase current limit (p0640).  
- reduce the load.  
- slow down the ramp up to the setpoint speed.

---

**207410**                    **<location>Drive: Current controller output limited**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             OFF2 (NONE, OFF1)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The condition " $I_{act} = 0$  and  $U_{q\_set\_1}$  longer than 16 ms at its limit" is present and can be caused by the following:  
- motor not connected or motor contactor open.  
- no DC link voltage present.  
- Motor Module defective.

**Remedy:**               - connect the motor or check the motor contactor.  
- check the DC link voltage (r0070).  
- check the Motor Module.

---

---

**207410 <location>Drive: Current controller output limited**

<b>Message value:</b>	-
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2 (NONE, OFF1)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The condition " $I_{act} = 0$ and $U_q_{set\_1}$ longer than 16 ms at its limit" is present and can be caused by the following: <ul style="list-style-type: none"> <li>- motor not connected or motor contactor open.</li> <li>- motor data and motor configuration (star-delta) do not match.</li> <li>- no DC link voltage present.</li> <li>- power unit defective.</li> <li>- the "flying restart" function is not activated.</li> </ul>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- connect the motor or check the motor contactor.</li> <li>- check the motor parameterization and the connection type (star-delta).</li> <li>- check the DC link voltage (r0070).</li> <li>- check the power unit.</li> <li>- activate the "flying restart" function (p1200).</li> </ul>

---

**207411 <location>Drive: Flux controller output limited**

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	OFF2 (NONE, OFF1)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The specified flux setpoint cannot be reached although 90% of the maximum current has been specified. <ul style="list-style-type: none"> <li>- incorrect motor data.</li> <li>- motor data and motor configuration (star-delta) do not match.</li> <li>- the current limit has been set too low for the motor.</li> <li>- induction motor (encoderless, open-loop controlled) in I<sub>2t</sub> limiting.</li> <li>- the Motor Module is too small.</li> </ul>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- correct the motor data.</li> <li>- check the motor configuration.</li> <li>- correct the current limits (p0640, p0323).</li> <li>- reduce the induction motor load.</li> <li>- if required, use a larger Motor Module.</li> </ul>

---

**207412 <location>Drive: Commutation angle incorrect (motor model)**

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (NONE, OFF2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	An incorrect commutation angle was detected that can result in a positive coupling in the speed controller. Possible causes: <ul style="list-style-type: none"> <li>- the motor encoder is incorrectly adjusted with respect to the magnet position.</li> <li>- the motor encoder is damaged.</li> <li>- the angular commutation offset is incorrectly set (p0431).</li> <li>- data to calculate the motor model has been incorrectly set (p0356 (motor-stator leakage inductance) and/or p0350 (motor-stator resistance) and/or p0352 (cable resistance)).</li> <li>- the changeover speed for the motor model is too low (p1752). The monitoring function only becomes effective above the changeover speed.</li> <li>- pole position identification might have calculated an incorrect value when activated (p1982 = 1).</li> <li>- the motor encoder speed signal is faulted.</li> <li>- the control loop is instable due to incorrect parameterization.</li> </ul> Fault value (r0949, decimal interpretation):

SERVO:  
 0: The comparison of the pole position angle from the encoder and motor model resulted in an excessively high value (> 80 ° electrical).  
 1: -

VECTOR:  
 0: The comparison of the pole position angle from the encoder and motor model resulted in an excessively high value (> 45 ° electrical).  
 1: The change in the speed signal from the motor encoder has changed by > p0492 within a current controller clock cycle.

**Remedy:**

- if the encoder mounting was changed - re-adjust the encoder.
- replace the defective motor encoder.
- correctly set the angular commutation offset (p0431). If required, determine using p1990.
- correctly set the motor stator resistance, cable resistance and motor-stator leakage inductance (p0350, p0352, p0356).  
 Calculate the cable resistance from the cross-section and length, check the inductance and stator resistance using the motor data sheet, measure the stator resistance, e.g. using a multimeter - and if required, again identify the values using the stationary motor data identification (p1910).
- increase the changeover speed for the motor model (p1752). The monitoring is completely de-activated for p1752 > p1082 (maximum speed).
- with pole position identification activated (p1982 = 1) check the procedure for pole position identification (p1980) and force a new pole position identification procedure by means of de-selection followed by selection (p1982 = 0 -> 1).

**Note:**  
 For High Dynamic Motors (1FK7xxx-7xxx), for applications with a higher current, if necessary, the monitoring should be disabled.

**207413 <location>Drive: Commutation angle incorrect (pole position identification)**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (NONE, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** An incorrect commutation angle was detected that can result in a positive coupling in the speed controller. Within the pole position identification routine (p1982 = 2):  
 - a difference of > 45° electrical to the encoder angle was determined.  
 For VECTOR, within the encoder adjustment (p1990 = 2):  
 - a difference of > 6 ° electrical to the encoder angle was determined.

**Remedy:**

- correctly set the angular commutation offset (p0431).
- re-adjust the motor encoder after the encoder has been replaced.
- replace the defective motor encoder.
- check the pole position identification routine. If the pole position identification routine is not suitable for this motor type, then disable the plausibility check (p1982 = 0).

**207414 <location>Drive: Encoder serial number changed**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** ENCODER (NONE, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The serial number of the motor encoder of a synchronous motor has changed. The change was only checked for encoders with serial number (e.g. EnDat encoders) and build-in motors (e.g. p0300 = 401) or third-party motors (p0300 = 2).  
 Cause 1:  
 The encoder was replaced.  
 Cause 2:  
 A third-party, build-in or linear motor was re-commissioned.

Cause 3:  
The motor with integrated and adjusted encoder was replaced.  
Cause 4:  
The firmware was updated to a version that checks the encoder serial number.

**Remedy:** Re causes 1, 2:  
Carry out an automatic adjustment using the pole position identification routine. Acknowledge the fault. Initiate the pole position identification routine with p1990 = 1. Then check that the pole position identification routine is correctly executed.  
SERVO:  
If a pole position identification technique is selected in p1980, and if p0301 does not contain a motor type with an encoder adjusted in the factory, then p1990 is automatically activated.  
or  
Set the adjustment via p0431. In this case, the new serial number is automatically accepted.  
or  
Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.  
Re causes 3, 4:  
Accept the new serial number with p0440 = 1.

---

### 207415 <location>Drive: Angular commutation offset transfer running

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** NONE  
**Cause:** The angular commutation offset was automatically determined using p1990 = 1. This fault causes the pulses to be suppressed - this is necessary to transfer the angular commutation offset to p0431. See also: p1990 (Encoder adjustment, determine angular commutation offset)  
**Remedy:** The fault can be acknowledged without any additional measures.

---

### 207416 <location>Drive: Flux controller configuration

**Message value:** Parameter: %1, Index: %2, fault cause: %3  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The configuration of the flux control (p1401) is contradictory. Alarm value (r2124, interpret hexadecimal):  
ccbbaaaa hex  
aaaa = Parameter  
bb = Index  
cc = fault cause  
cc = 01 hex = 1 dec:  
Quick magnetizing (p1401.6) for soft start (p1401.0).  
cc = 02 hex = 2 dec:  
Quick magnetizing (p1401.6) for flux build-up control (p1401.2).  
cc = 03 hex = 3 dec:  
Quick magnetizing (p1401.6) for Rs identification after restart (p0621 = 2).  
**Remedy:** Re fault cause = 1:  
- Shut down soft start (p1401.0 = 0).  
- Shut down quick magnetizing (p1401.6 = 0).  
Re fault cause = 2:  
- De-energize flux build-up control (p1401.2 = 0).  
- Shut down quick magnetizing (p1401.6 = 0).  
Re fault cause = 3:  
- Re-parameterize Rs identification (p0621 = 0, 1)  
- Shut down quick magnetizing (p1401.6 = 0).

**207417**                    **<location>Drive: Pulse technique not plausible (motor model)**

**Message value:**        %1

**Drive object:**         VECTOR

**Reaction:**              OFF2 (NONE)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The evaluation of the test pulse response indicated incorrect values.  
 Fault value (r0949, decimal interpretation):  
 0:  
 An impermissible pulse technique configuration was detected during ramp-up.  
 Possible causes:  
 - The pulse technique was initially selected when the system powered up (p1750.5 = 1) but the power unit component does not support the current oversampling required (see r0192.23). As a consequence, p1750.0 was de-selected automatically.  
 10:  
 The pulse response is repeatedly implausible.  
 Possible causes:  
 - Incorrect configuration of the power unit component  
 - The power unit component is faulty.  
 20:  
 For the specified pulse amplitude, the measured pulse response is much higher than the expected value.  
 Possible causes:  
 - The orientation loop has been affected by major vibration phenomena.  
 - The motor is short-circuited for high frequencies (output filter).  
 - The motor is damaged.

**Remedy:**                For fault value = 0:  
 Once the pulse technique has been de-selected automatically (p1750.5=0), there are two possible options:  
 - acknowledge the fault and save parameter p1750.5 = 0 -> field-oriented control mode to standstill is not used and replaced by transition to open-loop control at low speeds.  
 - upgrade the power unit firmware (at least V04.30) -> field-oriented control mode to standstill is available.  
 For fault value = 10:  
 With active selection of the pulse technique (p1750.5 = 1):  
 - POWER ON (switch-off/switch-on) the Control Unit and the power unit together again.  
 or  
 - carry out a manual warm restart (p0009 = 30, p0976 = 2, 3).  
 If this does not solve the problem: Replace the power unit component.  
 For fault value = 20:  
 - control parameters might have been adjusted (factory setting, commissioning).  
 - filters must not be connected between motor and converter/inverter.  
 - check the motor.

---

**207418**                    **<location>Drive: Higher current controller dynamic performance possible**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**

**Remedy:**



---

**207420 <location>Drive: Current setpoint filter natural frequency > Shannon frequency**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** One of the filter natural frequencies is greater than the Shannon frequency.  
The Shannon frequency is calculated according to the following formula:  $0.5 / p0115[0]$   
Fault value (r0949, interpret hexadecimal):  
Bit 0: Filter 1 (p1658, p1660)  
Bit 1: Filter 2 (p1663, p1665)  
Bit 2: Filter 3 (p1668, p1670)  
Bit 3: Filter 4 (p1673, p1675)  
Bit 8 ... 15: Data set number (starting from zero)  
**Remedy:** - reduce the numerator or denominator natural frequency of the current setpoint filter involved.  
- reduce the current controller sampling time (p0115[0]).  
- switch out the filter involved (p1656).

---

**207421 <location>Drive: Speed filter natural frequency > Shannon frequency**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** One of the filter natural frequencies is greater than the Shannon frequency.  
The Shannon frequency is calculated according to the following formula:  $0.5 / p0115[1]$   
Fault value (r0949, interpret hexadecimal):  
Bit 0: Filter 1 (p1417, p1419)  
Bit 1: Filter 2 (p1423, p1425)  
Bit 4: Actual value filter (p1447, p1449)  
Bit 8 ... 15: Data set number (starting from zero)  
**Remedy:** - reduce the numerator or denominator natural frequency of the speed setpoint filter involved.  
- reduce the speed controller sampling time (p0115[1]).  
- switch off the filter involved (p1413, p1414).

---

**207422 <location>Drive: Reference model natural frequency > Shannon frequency**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The natural filter frequency of the PT2 element for the reference model (p1433) is greater than the Shannon frequency.  
The Shannon frequency is calculated according to the following formula:  $0.5 / p0115[1]$   
**Remedy:** - reduce the natural frequency of PT2 element for reference model (p1433).  
- reduce the speed controller sampling time (p0115[1]).

---

**207423 <location>Drive: APC filter natural frequency > Shannon frequency**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** One of the filter natural frequencies is greater than the Shannon frequency.  
The Shannon frequency is calculated according to the following formula:  $0.5 / (p0115[1] * x)$   
Fault value (r0949, interpret hexadecimal):  
Bit 0: Filter 1.1 (p3711, p3713), x = 1  
Bit 4: Filter 2.1 (p3721, p3723), x = p3706  
Bit 5: Filter 2.2 (p3726, p3728), x = p3706  
Bit 8: Filter 3.1 (p3731, p3733), x = p3707  
Bit 9: Filter 3.2 (p3736, p3738), x = p3707  
Bit 16 ... 32: Data set number (starting from zero)

**Remedy:**

- reduce the numerator or denominator natural frequency of the filter involved.
- reduce the speed controller sampling time (p0115[1]) or the sub-sampling (p3706, p3707).
- switch out the filter involved (p3704).

---

**207424 <location>Drive: Operating condition for APC not valid**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The APC function (Advanced Positioning Control) has identified an invalid operating condition.  
Alarm value (r2124, interpret hexadecimal):  
Bit 0 = 1:  
APC is operating without encoder  
Bit 1 = 1:  
The load measuring system for APC, selected using p3701, has a fault. The APC function is disabled.  
Bit 2 = 1:  
The load measuring system for APC, selected using p3701, has a fault. The pulse de-coupling is disabled, i.e. the speed of the motor measuring system is used as speed for the closed-loop motor speed control.

**Remedy:**

Re bit 0:  
Only use the APC function in operation with an encoder.  
Re bit 1, 2:  
Check the load measuring system.

---

**207425 <location>Drive: APC monitoring time for speed limit expired**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF1  
**Acknowledge:** IMMEDIATELY  
**Cause:** The limit value (p3778) for the speed/velocity was exceeded for a time longer than that set in the monitoring time (p3779).  
Note:  
APC: Advanced Positioning Control

**Remedy:**

- check the measured value.
- check the limit value and monitoring time (p3778, p3779).

---

**207426 <location>Technology controller actual value limited**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY

**Cause:** The actual value for the technology controller, interconnected via connector input p2264, has reached a limit.  
 Fault value (r0949, decimal interpretation):  
 1: upper limit reached.  
 2: lower limit reached.

**Remedy:** - adapt the limits to the signal level (p2267, p2268).  
 - check the scaling of the actual value (p2264).  
 See also: p2264 (Technology controller actual value), p2267 (Technology controller upper limit actual value), p2268 (Technology controller lower limit actual value)

### 207429 <location>Drive: DSC without encoder not possible

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The function DSC (Dynamic Servo Control) was activated although there is no encoder.  
 See also: p1191 (DSC position controller gain KPC)

**Remedy:** If there is no encoder and connector input p1191 (DSC position controller gain) is interconnected, then connector input p1191 must have a 0 signal.

### 207430 <location>Drive: Changeover to open-loop torque controlled operation not possible

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (NONE, OFF1, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** For encoderless operation, the converter cannot change over to closed-loop torque-controlled operation (BI: p1501).

**Remedy:** Do not attempt to cover over to closed-loop torque-controlled operation.

### 207431 <location>Drive: Changeover to encoderless operation not possible

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:** For closed-loop torque control, the converter cannot change over to encoderless operation (p1404).

**Remedy:** Do not attempt to change over to encoderless operation.

### 207432 <location>Drive: Motor without overvoltage protection

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:** In the case of a fault at maximum speed, the motor can generate an overvoltage that can destroy the drive system.  
 Fault value (r0949, interpret hexadecimal):  
 Associated Drive Data Set (DDS).

**Remedy:** Overvoltage protection can be implemented in the following ways:

- limit the maximum speed (p1082) without any additional protection.

The maximum speed without protection is calculated as follows:

Rotary synchronous motors:  $p1082 \text{ [rpm]} \leq 11.695 * p0297/p0316 \text{ [Nm/A]}$

Linear motors:  $p1082 \text{ [m/min]} \leq 73.484 * p0297/p0316 \text{ [N/A]}$

Rotary synchronous motors connected to a high-frequency converter:  $p1082 \text{ [rpm]} \leq 4.33165 * (-p0316 + \text{square root}(p0316^2 + 4.86E-9 * (p0297 * r0313)^2 * (r0377 - r0233) \text{ [mH]} * r0234 \text{ [\mu F]})) / (p0297 * r0313^2 * (r0377 - r0233) \text{ [mH]} * r0234 \text{ [\mu F]})$

Linear motor connected to a high-frequency converter:  $p1082 \text{ [m/min]} \leq 0.6894 * (-p0316 + \text{square root}(p0316^2 + 1.91865E-7 * (p0297 * r0313 * 3.1415)^2 * (r0377 - r0233) \text{ [mH]} * r0234 \text{ [\mu F]})) / (p0297 * r0313^2 * (r0377 - r0233) \text{ [mH]} * r0234 \text{ [\mu F]})$

Rotary induction motor connected to a high-frequency converter:  $p1082 \text{ [rpm]} \leq \text{Maximum}(2.11383E5 / (r313 * \text{square root}((r0377 \text{ [mH]} + r0382 \text{ [mH]} * r0234 \text{ [\mu F]}))) ; 0.6364 * p0297 * p0311 \text{ [rpm]} / p0304)$

- use a voltage protection module (VPM) in conjunction with the function "Safe Torque Off" (p9601, p9801) (only for synchronous motors).

When using a synchronous motor with VPM connected to a high-frequency converter, the following must apply:  $p1082 \text{ [rpm]} \leq p0348 * (r0377 + p0233) / p0233$

When a fault condition exists, the VPM short-circuits the motors. During the short-circuit, the pulses must be suppressed - this means that the terminals for the function "Safe Torque Off" (STO) must be connected to the VPM.

When using a VPM, p0643 must be set to 1.

- activating the internal voltage protection (IVP) with p1231 = 3 (only for synchronous motors).

See also: p0643 (Overvoltage protection for synchronous motors), p1231 (Armature short-circuit / DC braking configuration)

---

**207433**      **<location>Drive: Closed-loop control with encoder is not possible as the encoder has not been unparked**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The changeover to closed-loop control with encoder is not possible as the encoder has not been unparked.

**Remedy:**

- check whether the encoder firmware supports the "parking" function (r0481.6 = 1).
- upgrade the firmware.

Note:

For long-stator motors (p3870.0 = 1), the following applies:

The encoder must have completed the unparking procedure (r3875.0 = 1) before a changeover can be made to closed-loop control with encoder. The encoder is unparked using binector input p3876 = 0/1 signal and remains until a 0 signal in this state.

---

**207434**      **<location>Drive: It is not possible to change the direction of rotation with the pulses enabled**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A drive data set was selected - with the pulses enabled - which has a different parameterized direction of rotation (p1821).

It is only possible to change the motor direction of rotation using p1821 when the pulses are inhibited.

**Remedy:**

- change over the drive data set with the pulses inhibited.
- ensure that the changeover to a drive data set does not result in the motor direction of rotation being changed (i.e. for these drive data sets, the same value must be in p1821).

See also: p1821

---

**207435**            **<location>Drive: Setting the ramp-function generator for sensorless vector control**

**Message value:**    Parameter: %1

**Drive object:**     VECTOR

**Reaction:**         OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3)

**Acknowledge:**    IMMEDIATELY

**Cause:**            During operation with sensorless vector control (r1407.1) the ramp-function generator was stopped (p1141) or bypassed (p1122). An internal setting command of the ramp-function generator output caused the set setpoint speed to be frozen or was not able to be realized.

**Remedy:**           - de-activate the holding command for the ramp-function generator (p1141).  
 - do not bypass the ramp-function generator (p1122).  
 - suppress the fault (p2101, p2119). This is necessary if the ramp-function generator is held using jogging and the speed setpoint is simultaneously inhibited (r0898.6).

**Note:**  
 For sensorless vector control it is not practical to read in the main setpoint of the speed control via p1155 or p1160 (p0922). In this case, the main setpoint should be injected before the ramp-function generator (p1070). The reason for this is that the ramp-function generator output is automatically set when transitioning from closed-loop speed controlled into open-loop speed controlled operation.

---

**207439**            **<location>Drive: Higher current controller dynamic performance not possible**

**Message value:**    %1

**Drive object:**     SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**         OFF2 (NONE)

**Acknowledge:**    IMMEDIATELY

**Cause:**            The function "Current controller dynamics higher" (p1810.11 = 1) is selected, however is not supported by the power unit (r0192.27 = 0) or by the safety technology without encoder (9506 = 1).  
 Fault value (r0949, decimal interpretation):  
 1:  
 - firmware of the booksize power unit is not up-to-date.  
 - blocksize or S120 combi power unit was used.  
 2:  
 - a sine-cosine encoder with encoderless safety technology is used.

**Remedy:**           In general:  
 - Deselect the function "Current controller dynamics higher" (p1810.11 = 0) and if required, set the current, speed and position controller again or calculate (p0340 = 4).  
 For fault value = 1:  
 - If necessary, upgrade the firmware of the booksize power unit to a later version (version >= 4.4).  
 - Use a booksize power unit (version >= 4.4).  
 For fault value = 2:  
 - Re-parameterize encoderless safety technology (9506 = 1) to safety technology with an encoder (p9506 = 0).  
 See also: r0192 (Power unit firmware properties), p1810 (Modulator configuration), p9506 (SI Motion function specification (Control Unit))

---

**207440**            **<location>EPOS: Jerk time is limited**

**Message value:**    -

**Drive object:**     SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            The calculation of the jerk time  $T_r = \max(p2572, p2573) / p2574$  resulted in an excessively high value so that the jerk time is internally limited to 1000 ms.

**Note:**  
 The alarm is also output if jerk limiting is not active.

---

**Remedy:** - increase the jerk limiting (p2574).  
 - reduce maximum acceleration or maximum deceleration (p2572, p2573).  
 See also: p2572 (EPOS maximum acceleration), p2573 (EPOS maximum deceleration), p2574 (EPOS jerk limiting)

**207441 <location>LR: Save the position offset of the absolute encoder adjustment**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The status of the absolute encoder adjustment has changed.  
 In order to permanently save the determined position offset (p2525) it must be saved in a non-volatile fashion (p0971, p0977).  
**Remedy:** Not necessary.  
 This alarm automatically disappears after the offset has been saved.  
 See also: p2507 (LR absolute encoder adjustment status), p2525 (LR encoder adjustment, offset)

**207442 <location>LR: Multiturn does not match the modulo range**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The ratio between the multiturn resolution and the modulo range (p2576) is not an integer number.  
 This results in the adjustment being set back, as the position actual value cannot be reproduced after power-off/power-on.  
**Remedy:** Make the ration between the multiturn resolution and the modulo range an integer number.  
 The ratio v is calculated as follows:  
 1. Motor encoder without position tracking:  
 $v = (p0421 * p2506 * p0433 * p2505) / (p0432 * p2504 * p2576)$   
 2. Motor encoder with position tracking for the measuring gear:  
 $v = (p0412 * p2506 * p2505) / (p2504 * p2576)$   
 3. Motor encoder with position tracking for the load gear:  
 $v = (p2721 * p2506 * p0433) / (p0432 * p2576)$   
 4. Motor encoder with position tracking for the load and measuring gear:  
 $v = (p2721 * p2506) / p2576$   
 5. Direct encoder without position tracking:  
 $v = (p0421 * p2506 * p0433) / (p0432 * p2576)$   
 6. Direct encoder with position tracking for the measuring gear:  
 $v = (p0412 * p2506) / p2576$   
**Note:**  
 With position tracking, it is recommended that p0412 and p2721 are changed  
 See also: p0412, p0432, p0433, p2504, p2505, p2506, p2576, p2721

**207443 <location>LR: Reference point coordinate not in the permissible range**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY

**Cause:** The reference point coordinate received when adjusting the encoder via connector input p2599 lies outside the half of the encoder range and cannot be set as actual axis position.  
 Fault value (r0949, decimal interpretation):  
 Maximum permissible value for the reference point coordinate.

**Remedy:** Set the reference point coordinate to a lower value than specified in the fault value.  
 See also: p2598 (EPOS reference point coordinate, signal source), p2599 (EPOS reference point coordinate value)

### 207446 <location>Load gear: Position tracking cannot be reset

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The position tracking cannot be reset.  
**Remedy:** Reset the position tracking as follows:  
 - select encoder commissioning (p0010 = 4).  
 - reset position tracking, position (p2720.2 = 1).  
 - de-select encoder commissioning (p0010 = 0).  
 The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).

### 207447 <location>Load gear: Position tracking, maximum actual value exceeded

**Message value:** Component number: %1, encoder data set: %2, drive data set: %3  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** When the position tracking of the load gear is configured, the drive/encoder (motor encoder) identifies a maximum possible absolute position actual value (r2723) that can no longer be represented within 32 bits.  
 Maximum value:  $p0408 * p2721 * 2^{p0419}$   
 Fault value (r0949, interpret hexadecimal):  
 ccbbaa hex  
 aa = encoder data set  
 bb = component number  
 cc = drive data set  
 See also: p0408, p0419 (Fine resolution absolute value Gx\_XIST2 (in bits)), p2721 (Load gear, rotary absolute gearbox, revolutions, virtual)  
**Remedy:**  
 - reduce the fine resolution (p0419).  
 - reduce the multiturn resolution (p2721).  
 See also: p0419 (Fine resolution absolute value Gx\_XIST2 (in bits)), p2721 (Load gear, rotary absolute gearbox, revolutions, virtual)

### 207448 <location>Load gear: Position tracking, linear axis has exceeded the maximum range

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For a configured linear axis/no modulo axis, the currently effective motor encoder (encoder 1) has exceeded the maximum possible traversing range.  
 For the configured linear axis, the maximum traversing range is defined to be  $64x (+/- 32x)$  of p0421. It should be read in p2721 and interpreted as the number of load revolutions.

Note:

Only the motor encoder in the currently effective drive data set is monitored here. The actual effective drive data set is displayed in x = r0051 and the corresponding motor encoder is specified in in p0187[x].

**Remedy:**

The fault should be resolved as follows:

- select encoder commissioning (p0010 = 4).
- reset position tracking, position (p2720.2 = 1).
- de-select encoder commissioning (p0010 = 0).

The fault should then be acknowledged and the absolute encoder adjusted.

**207449**

**<location>Load gear: Position tracking, actual position outside tolerance window**

**Message value:**

%1

**Drive object:**

ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**

OFF1 (NONE, OFF2, OFF3)

**Acknowledge:**

IMMEDIATELY

**Cause:**

When powered down, the currently effective motor encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder.

Note:

Only the motor encoder in the currently effective drive data set is monitored here. The actual effective drive data set is displayed in x = r0051 and the corresponding motor encoder is specified in in p0187[x].

Fault value (r0949, decimal interpretation):

Deviation (difference) to the last encoder position in increments of the absolute value after the measuring gear - if one is being used. The sign designates the traversing direction.

Note:

The deviation (difference) found is also displayed in r2724.

See also: p2722 (Load gear, position tracking tolerance window), r2724 (Load gear position difference)

**Remedy:**

Reset the position tracking as follows:

- select encoder commissioning (p0010 = 4).
- reset position tracking, position (p2720.2 = 1).
- de-select encoder commissioning (p0010 = 0).

The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).

See also: p0010, p2507

**207450**

**<location>LR: Standstill monitoring has responded**

**Message value:**

-

**Drive object:**

SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**

OFF1 (OFF2, OFF3)

**Acknowledge:**

IMMEDIATELY

**Cause:**

After the standstill monitoring time (p2543) expired, the drive left the standstill window (p2542).

- position actual value inversion incorrectly set (p0410).
- standstill window set too small (p2542).
- standstill monitoring time set too low (p2543).
- position loop gain too low (p2538).
- position loop gain too high (instability/oscillation, p2538).
- mechanical overload.
- check the connecting cable, motor/drive converter (phase missing, interchange).
- when selecting motor identification, select tracking mode (BI: p2655[0] = 1 signal).
- when selecting function generator, select tracking mode (BI: p2655[0] = 1 signal) and de-activate position control (BI: p2550 = 0 signal).

**Remedy:**

Check the causes and resolve.



---

**207451 <location>LR: Position monitoring has responded**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** When the position monitoring time (p2545) expired, the drive had still not reached the positioning window (p2544).  
- positioning window parameterized too small (p2544).  
- position monitoring time parameterized too short (p2545).  
- position loop gain too low (p2538).  
- position loop gain too high (instability/oscillation, p2538).  
- drive mechanically locked.  
**Remedy:** Check the causes and resolve.

---

**207452 <location>LR: Following error too high**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The difference between the position setpoint position actual value (following error dynamic model, r2563) is greater than the tolerance (p2546).  
- the drive torque or accelerating capacity exceeded.  
- position measuring system fault.  
- position control sense incorrect.  
- mechanical system locked.  
- excessively high traversing velocity or excessively high position reference value (setpoint) differences  
**Remedy:** Check the causes and resolve.

---

**207453 <location>LR: Position actual value preprocessing error**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** An error has occurred during the position actual value preprocessing.  
**Remedy:** Check the encoder for the position actual value preprocessing.  
See also: p2502 (LR encoder assignment)

---

**207454 <location>LR: Position actual value preprocessing does not have a valid encoder**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** One of the following problems has occurred with the position actual value preprocessing:  
- an encoder is not assigned for the position actual value preprocessing (p2502 = 0).  
- an encoder is assigned, but no encoder data set (p0187 = 99 or p0188 = 99 or p0189 = 99).  
- an encoder an an encoder data set have been assigned, however, the encoder data set does not contain any encoder data (p0400 = 0) or invalid data (e.g. p0408 = 0).

**Remedy:** Check the drive data sets, encoder data sets and encoder assignment.  
 See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number), p0400 (Encoder type selection), p2502 (LR encoder assignment)

**207455 <location>EPOS: Maximum velocity limited**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The maximum velocity (p2571) is too high to correctly calculate the modulo correction. Within the sampling time for positioning (p0115[5]), with the maximum velocity, a maximum of the half modulo length must be moved through. p2571 was limited to this value.  
**Remedy:** - reduce the maximum velocity (p2571).  
 - increase the sampling time for positioning (p0115[5]).

**207456 <location>EPOS: Setpoint velocity limited**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The actual setpoint velocity is greater than the parameterized maximum velocity (p2571) and is therefore limited.  
**Remedy:** - check the entered setpoint velocity.  
 - reduce the velocity override (CI: p2646).  
 - increase the maximum velocity (p2571).  
 - check the signal source for the externally limited velocity (CI: p2594).

**207457 <location>EPOS: Combination of input signals illegal**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An illegal combination of input signals that are simultaneously set was identified.  
 Alarm value (r2124, interpret decimal):  
 0: Jog 1 and jog 2 (p2589, p2590).  
 1: Jog 1 or jog 2 and direct setpoint input/MDI (p2589, p2590, p2647).  
 2: Jog 1 or jog 2 and start referencing (p2589, p2590, p2595).  
 3: Jog 1 or jog 2 and activate traversing task (p2589, p2590, p2631).  
 4: Direct setpoint input/MDI and starting referencing (p2647, p2595).  
 5: Direct setpoint input/MDI and activate traversing task (p2647, p2631).  
 6: Start referencing and activate traversing task (p2595, p2631).  
**Remedy:** Check the appropriate input signals and correct.

---

**207458 <location>EPOS: Reference cam not found**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** After starting the search for reference, the axis moved through the maximum permissible distance to search for the reference cam without actually finding the reference cam.  
**Remedy:** - check the "reference cam" binector input (BI: p2612).  
- check the maximum permissible distance to the reference cam (p2606).  
- if axis does not have any reference cam, then set p2607 to 0.  
See also: p2606 (EPOS search for reference, reference cam, maximum distance), p2607 (EPOS search for reference, reference cam present), p2612 (EPOS search for reference, reference cam)

---

**207459 <location>EPOS: No zero mark**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** After leaving the reference cam, the axis has traversed the maximum permissible distance between the reference cam and zero mark without finding the zero mark.  
**Remedy:** - check the encoder regarding the zero mark  
- check the maximum permissible distance between the reference cam and zero mark (p2609).  
- use an external encoder zero mark (equivalent zero mark) (p0495).  
See also: p0495 (Equivalent zero mark, input terminal), p2609 (EPOS search for reference, max. distance ref. cam and zero mark)

---

**207460 <location>EPOS: End of reference cam not found**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** During the search for reference, when the axis reached the zero mark it also reached the end of the traversing range without detecting an edge at the binector input "reference cam" (BI: p2612).  
Maximum traversing range: -2147483648 [LU] ... -2147483647 [LU]  
**Remedy:** - check the "reference cam" binector input (BI: p2612).  
- repeat the search for reference.  
See also: p2612 (EPOS search for reference, reference cam)

---

**207461 <location>EPOS: Reference point not set**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When starting a traversing block/direct setpoint input, a reference point is not set (r2684.11 = 0).  
**Remedy:** Reference the system (search for reference, flying referencing, set reference point).

---

**207462**                    **<location>EPOS: Selected traversing block number does not exist**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              A traversing block selected via BI: p2625 to BI: p2630 was started via BI: p2631 = 0/1 edge "Activate traversing task".

- the number of the started traversing block is not contained in p2616[0...n].
- the started traversing block is suppressed.

Alarm value (r2124, interpret decimal):

Number of the selected traversing block that is also not available.

**Remedy:**              - correct the traversing program.

- select an available traversing block number.

---

**207463**                    **<location>EPOS: External block change not requested in the traversing block**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              For a traversing block with the block change enable CONTINUE\_EXTERNAL\_ALARM, the external block change was not requested.

Alarm value (r2124, interpret decimal):

Number of the traversing block.

**Remedy:**              Resolve the reason as to why the edge is missing at binector input (BI: p2632).

---

**207464**                    **<location>EPOS: Traversing block is inconsistent**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**              The traversing block does not contain valid information.

Alarm value (r2124, interpret decimal):

Number of the traversing block with invalid information.

**Remedy:**              Check the traversing block and where relevant, take into consideration alarms that are present.

---

**207465**                    **<location>EPOS: Traversing block does not have a subsequent block**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              There is no subsequent block in the traversing block.

Alarm value (r2124, interpret decimal):

Number of the traversing block with the missing subsequent block.

**Remedy:**              - parameterize this traversing block with the block change enable END.

- parameterize additional traversing blocks with a higher block number and for the last block, using the block change enable END.

---

---

<b>207466</b>	<b>&lt;location&gt;EPOS: Traversing block number assigned a multiple number of times</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The same traversing block number was assigned a multiple number of times. Alarm value (r2124, interpret decimal): Number of the traversing block that was assigned a multiple number of times.
<b>Remedy:</b>	Correct the traversing blocks.

---

<b>207467</b>	<b>&lt;location&gt;EPOS: Traversing block has illegal task parameters</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The task parameter in the traversing block contains an illegal value. Alarm value (r2124, interpret decimal): Number of the traversing block with an illegal task parameter.
<b>Remedy:</b>	Correct the task parameter in the traversing block.

---

<b>207468</b>	<b>&lt;location&gt;EPOS: Traversing block jump destination does not exist</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	In a traversing block, a jump was programmed to a non-existent block. Alarm value (r2124, interpret decimal): Number of the traversing block with a jump destination that does not exist.
<b>Remedy:</b>	- correct the traversing block. - add the missing traversing block.

---

<b>207469</b>	<b>&lt;location&gt;EPOS: Traversing block &lt; target position &lt; software limit switch minus</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	In the traversing block the specified absolute target position lies outside the range limited by the software limit switch minus. Alarm value (r2124, interpret decimal): Number of the traversing block with illegal target position.
<b>Remedy:</b>	- correct the traversing block. - change software limit switch minus (CI: p2578, p2580).

---

**207470**                    **<location>EPOS: Traversing block> target position > software limit switch plus**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                In the traversing block the specified absolute target position lies outside the range limited by the software limit switch plus.  
Alarm value (r2124, interpret decimal):  
Number of the traversing block with illegal target position.

**Remedy:**                - correct the traversing block.  
- change software limit switch plus (CI: p2579, p2581).

---

**207471**                    **<location>EPOS: Traversing block target position outside the modulo range**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                In the traversing block the target position lies outside the modulo range.  
Alarm value (r2124, interpret decimal):  
Number of the traversing block with illegal target position.

**Remedy:**                - in the traversing block, correct the target position.  
- change the modulo range (p2576).

---

**207472**                    **<location>EPOS: Traversing block ABS\_POS/ABS\_NEG not possible**

**Message value:**        %1

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                In the traversing block the positioning mode ABS\_POS or ABS\_NEG were parameterized with the modulo correction not activated.  
Alarm value (r2124, interpret decimal):  
Number of the traversing block with the illegal positioning mode.

**Remedy:**                Correct the traversing block.

---

**207473**                    **<location>EPOS: Beginning of traversing range reached**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                When traversing, the axis has moved to the traversing range limit.

**Remedy:**                Move away in the positive direction.

---

---

**207474 <location>EPOS: End of traversing range reached**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When traversing, the axis has moved to the traversing range limit.  
**Remedy:** Move away in the negative direction.

---

**207475 <location>EPOS: Target position < start of traversing range**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The target position for relative traversing lies outside the traversing range.  
**Remedy:** Correct the target position.

---

**207476 <location>EPOS: Target position > end of the traversing range**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The target position for relative traversing lies outside the traversing range.  
**Remedy:** Correct the target position.

---

**207477 <location>EPOS: Target position < software limit switch minus**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the actual traversing operation, the target position is less than the software limit switch minus.  
**Remedy:** - correct the target position.  
- change software limit switch minus (CI: p2578, p2580).  
See also: p2578 (EPOS software limit switch minus signal source), p2580 (EPOS software limit switch minus), p2582 (EPOS software limit switch activation)

---

**207478 <location>EPOS: Target position > software limit switch plus**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the actual traversing operation, the target position is greater than the software limit switch plus.

**Remedy:**

- correct the target position.
- change software limit switch plus (CI: p2579, p2581).

See also: p2579 (EPOS software limit switch plus signal source), p2581 (EPOS software limit switch plus), p2582 (EPOS software limit switch activation)

---

**207479 <location>EPOS: Software limit switch minus reached**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The axis is at the position of the software limit switch minus. An active traversing block was interrupted.  
**Remedy:**

- correct the target position.
- change software limit switch minus (CI: p2578, p2580).

See also: p2578 (EPOS software limit switch minus signal source), p2580 (EPOS software limit switch minus), p2582 (EPOS software limit switch activation)

---

**207480 <location>EPOS: Software limit switch plus reached**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The axis is at the position of the software limit switch plus. An active traversing block was interrupted.  
**Remedy:**

- correct the target position.
- change software limit switch plus (CI: p2579, p2581).

See also: p2579 (EPOS software limit switch plus signal source), p2581 (EPOS software limit switch plus), p2582 (EPOS software limit switch activation)

---

**207481 <location>EPOS: Axis position < software limit switch minus**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The actual position of the axis is less than the position of the software limit switch minus.  
**Remedy:**

- correct the target position.
- change software limit switch minus (CI: p2578, p2580).

See also: p2578 (EPOS software limit switch minus signal source), p2580 (EPOS software limit switch minus), p2582 (EPOS software limit switch activation)

---

**207482 <location>EPOS: Axis position > software limit switch plus**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The actual position of the axis is greater than the position of the software limit switch plus.



**Remedy:**

- correct the target position.
- change software limit switch plus (CI: p2579, p2581).

See also: p2579 (EPOS software limit switch plus signal source), p2581 (EPOS software limit switch plus), p2582 (EPOS software limit switch activation)

### 207483 <location>EPOS: Travel to fixed stop clamping torque not reached

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The fixed stop in the traversing block was reached without the clamping torque/clamping force having been achieved.

**Remedy:**

- Check the maximum torque-generating current (r1533).
- check the torque limits (p1520, p1521).
- check the power limits (p1530, p1531).
- check the BICO interconnections of the torque limits (p1522, p1523, p1528, p1529).

### 207484 <location>EPOS: Fixed stop outside the monitoring window

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF3 (OFF1, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** In the "fixed stop reached" state, the axis has moved outside the defined monitoring window (p2635).

**Remedy:**

- check the monitoring window (p2635).
- check the mechanical system.

### 207485 <location>EPOS: Fixed stop not reached

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** In a traversing block with the task FIXED STOP, the end position was reached without detecting a fixed stop.

**Remedy:**

- check the traversing block and locate the target position further into the workpiece.
- check the "fixed stop reached" control signal (p2637).
- if required, reduce the maximum following error window to detect the fixed stop (p2634).

### 207486 <location>EPOS: Intermediate stop missing

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** In the modes "traversing blocks" or "direct setpoint input/MDI" at the start of motion, the binector input "no intermediate stop/intermediate stop" (BI: p2640) did not have a 1 signal.

**Remedy:** Connect a 1 signal to the binector input "no intermediate stop/intermediate stop" (BI: p2640) and re-start motion. See also: p2640 (EPOS intermediate stop (0 signal))

---

**207487**            **<location>EPOS: Reject traversing task missing**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              In the modes "traversing blocks" or "direct setpoint input/MDI" at the start of motion, the binector input "do not reject traversing task/reject traversing task" (BI: p2641) does not have a 1 signal.

**Remedy:**              Connect a 1 signal to the binector input "do not reject traversing task/reject traversing task" (BI: p2641) and restart motion.  
See also: p2641 (EPOS reject traversing task (0 signal))

---

**207488**            **<location>EPOS: Relative positioning not possible**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**              In the mode "direct setpoint input/MDI", for continuous transfer (p2649 = 1) relative positioning was selected (BI: p2648 = 0 signal).

**Remedy:**              Check the control.

---

**207489**            **<location>EPOS: Reference point correction outside the window**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              For the function "flying referencing" the difference between the measured position at the measuring probe and the reference point coordinate lies outside the parameterized window.

**Remedy:**              - check the mechanical system.  
- check the parameterization of the window (p2602).

---

**207490**            **<location>EPOS: Enable signal withdrawn while traversing**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**              - for a standard assignment, another fault may have occurred as a result of withdrawing the enable signals.  
- the drive is in the "switching on inhibited" state (for a standard assignment).

**Remedy:**              - set the enable signals or check the cause of the fault that first occurred and then result (for a standard assignment).  
- check the assignment to enable the basic positioning function.

---

---

**207491 <location>EPOS: STOP cam minus reached**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF3  
**Acknowledge:** IMMEDIATELY  
**Cause:** A 0 signal was detected at binector input BI: p2569, i.e. the STOP cam minus was reached.  
For a positive traversing direction, the STOP cam minus was reached - i.e. the wiring of the STOP cam is incorrect.  
See also: p2569 (EPOS STOP cam minus)  
**Remedy:** - leave the STOP cam minus in the positive traversing direction and return the axis to the valid traversing range.  
- check the wiring of the STOP cam.

---

**207492 <location>EPOS: STOP cam plus reached**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF3  
**Acknowledge:** IMMEDIATELY  
**Cause:** A 0 signal was detected at binector input BI: p2570, i.e. the STOP cam plus was reached.  
For a negative traversing direction, the STOP cam plus was reached - i.e. the wiring of the STOP cam is incorrect.  
See also: p2570 (EPOS STOP cam plus)  
**Remedy:** - leave the STOP cam plus in the negative traversing direction and return the axis to the valid traversing range.  
- check the wiring of the STOP cam.

---

**207493 <location>LR: Overflow of the value range for position actual value**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The value range (-2147483648 ... 2147483647) for the position actual value representation was exceeded.  
When the overflow occurs, the "referenced" or "adjustment absolute measuring system" status is reset.  
Fault value (r0949, decimal interpretation):  
1: The position actual value (r2521) has exceeded the value range.  
2: The encoder position actual value Gn\_XIST2 (r0483) or the absolute value after the load gear (r2723) has exceeded the value range.  
3: The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range for displaying the position actual value.  
**Remedy:** If required, reduce the traversing range or position resolution (p2506).  
Increase the fine resolution of absolute position actual value (p0419).  
Note for fault value = 3:  
If the value for the maximum possible absolute position (LU) is greater than 4294967296, then it is not possible to make an adjustment due to an overflow.  
For rotary encoders, the maximum possible absolute position (LU) is calculated as follows:  
1. Motor encoder without position tracking  
 $p2506 * p0433 * p2505 / (p0432 * p2504)$   
 $p2506 * p0433 * p2505 * p0421 / (p0432 * p2504)$  for multiturn encoders  
2. Motor encoder with position tracking for measuring gear:  
 $p2506 * p0412 * p2505 / p2504$   
3. Motor encoder with position tracking for load gear  
 $p2506 * p2721 * p0433 / p0432$   
4. Motor encoder with position tracking for load and measuring gear  
 $p2506 * p2721$

- 5. Direct encoder without position tracking  
p2506 \* p0433 / p0432  
p2506 \* p0433 \* p0421 / p0432 for multiturn encoders
- 6. Direct encoder with position tracking for measuring gear  
p2506 \* p0412

---

**207494**                    **<location>LR: Drive Data Set changeover in operation**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            OFF1 (OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**              A Drive Data Set changeover (DDS) with a change of the mechanical relationships (p2503 ... 2506), direction of rotation (p1821) or the encoder assignment (p2502) was requested in operation.  
Note:  
DDS: Drive Data Set  
**Remedy:**             To changeover the drive data set, initially, exit the "operation" mode.

---

**207495**                    **<location>LR: Reference function interrupted**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              An activated reference function (reference mark search or measuring probe evaluation) was interrupted.  
- an encoder fault has occurred (Gn\_ZSW.15 = 1).  
- position actual value was set during an activated reference function.  
- simultaneously activate reference mark search and measuring probe evaluation (BI: p2508 and BI: p2509 = 1 signal).  
- activated reference function (reference mark search or measuring probe evaluation) was de-activated (BI: p2508 and BI: p2509 = 0 signal).  
**Remedy:**             - check the causes and resolve.  
- reset the control (BI: p2508 and BI: p2509 = 0 signal) and activate the requested function.

---

**207496**                    **<location>EPOS: Enable not possible**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              It is not possible to enable the basic positioner because at least one signal is missing.  
Alarm value (r2124, interpret decimal):  
1: EPOS enable missing (BI: p2656).  
2: Position actual value, valid feedback signal missing (BI: p2658).  
See also: p2656 (EPOS enable basic positioner), p2658 (EPOS pos. actual value valid, feedback signal)  
**Remedy:**             Check the appropriate binector inputs and signals.

---

<b>207497</b>	<b>&lt;location&gt;LR: Position setting value activated</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The position actual value is set to the value received via CI: p2515 while BI: p2514 = 1 signal. A possible system deviation cannot be corrected.
<b>Remedy:</b>	Not necessary. The alarm automatically disappears with BI: p2514 = 0 signal.

---

<b>207498</b>	<b>&lt;location&gt;LR: Measuring probe evaluation not possible</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	When evaluating the measuring probe, an error occurred. Alarm value (r2124, interpret decimal): 6: The input terminal for the measuring probe is not set. 4098: Error when initializing the measuring probe. 4100: The measuring pulse frequency is too high. > 50000: The measuring clock cycle is not a multiple integer of the position controller clock cycle.
<b>Remedy:</b>	De-activate the measuring probe evaluation (BI: p2509 = 0 signal). Re alarm value = 6: Set the input terminal for the measuring probe (p0488, p0489 or p2517, p2518). Re alarm value = 4098: Check the Control Unit hardware. Re alarm value = 4100: Reduce the frequency of the measuring pulses at the measuring probe. Re alarm value > 50000: Set the clock cycle ratio of the measuring clock cycle to the position controller clock cycle to an integer multiple. To do this, the currently effective measuring clock cycle can be determined from the alarm value as follows: $T_{meas} [125 \mu s] = \text{alarm value} - 50000$ With PROFIBUS, the measuring clock cycle corresponds to the PROFIBUS clock cycle (r2064[1]). Without PROFIBUS, the measuring clock cycle is an internal cycle time that cannot be influenced.

---

<b>207499</b>	<b>&lt;location&gt;EPOS: Reversing cam approached with the incorrect traversing direction</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF3
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The reversing cam MINUS was approached in the positive traversing direction or the reversing cam PLUS was approached in the negative traversing direction. See also: p2613 (EPOS search for reference reversing cam minus), p2614 (EPOS search for reference reversing cam plus)
<b>Remedy:</b>	- check the wiring of the reversing cam (BI: p2613, BI: p2614). - check the traversing direction to approach the reversing cam.

---

**207500**                    **<location>Drive: Power unit data set PDS not configured**

**Message value:**        Drive data set: %1

**Drive object:**         All objects

**Reaction:**              NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                Only for controlled line supply infeed/regenerative feedback units:  
The power unit data set was not configured - this means that a data set number was not entered into the drive data set.  
Fault value (r0949, decimal interpretation):  
Drive data set number of p0185.

**Remedy:**                The index of the power unit data set associated with the drive data set should be entered into p0185.

---

**207501**                    **<location>Drive: Motor Data Set MDS not configured**

**Message value:**        Drive data set: %1

**Drive object:**         All objects

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                Only for power units:  
The motor data set was not configured - this means that a data set number was not entered into the associated drive data set.  
Fault value (r0949, decimal interpretation):  
The fault value includes the drive data set number of p0186.

**Remedy:**                The index of the motor data set associated with the drive data set should be entered into p0186.  
See also: p0186 (Motor Data Sets (MDS) number)

---

**207502**                    **<location>Drive: Encoder Data Set EDS not configured**

**Message value:**        Drive data set: %1

**Drive object:**         All objects

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                Only for power units:  
The encoder data set was not configured - this means that a data set number was not entered into the associated drive data set.  
Fault value (r0949, decimal interpretation):  
The fault value includes the drive data set number of p0187, p0188 and p0189.  
The fault value is increased by 100 \* encoder number (e.g. for p0189: Fault value 3xx with xx = data set number).

**Remedy:**                The index of the encoder data set associated with the drive data set should be entered into p0187 (1st encoder), p0188 (2nd encoder) and p0189 (3rd encoder).

---

**207503**                    **<location>EPOS: STOP cam approached with the incorrect traversing direction**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              Servo: NONE (OFF1, OFF2, OFF3)  
Vector: NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**

**Remedy:**

---

---

<b>207504</b>	<b>&lt;location&gt;Drive: Motor data set is not assigned to a drive data set</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, ENCODER, ENCSINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	A motor data set is not assigned to a drive object. All of the existing motor data sets in the drive data sets must be assigned using the MDS number (p0186[0...n]). There must be at least as many drive data sets as motor data sets. Alarm value (r2124, interpret decimal): Number of the motor data set that has not been assigned.
<b>Remedy:</b>	In the drive data sets, assign the non-assigned motor data set using the MDS number (p0186[0...n]). - check whether all of the motor data sets are assigned to drive data sets. - if required, delete superfluous motor data sets. - if required, set up new drive data sets and assign to the corresponding motor data sets. See also: p0186 (Motor Data Sets (MDS) number)

---

<b>207505</b>	<b>&lt;location&gt;EPOS: Travel to fixed stop not possible in the V/f control mode</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The traversing task "travel to fixed stop" is not possible in the V/f control mode. Alarm value (r2124, interpret decimal): Number of the traversing block with an illegal task parameter. See also: p1300 (Open-loop/closed-loop control operating mode), p2621 (EPOS traversing block task)
<b>Remedy:</b>	Change the EPOS traversing block task type or change the open-loop/closed-loop control mode. See also: p1300 (Open-loop/closed-loop control operating mode), p2621 (EPOS traversing block task)

---

<b>207509</b>	<b>&lt;location&gt;Drive: Component number missing</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, ENCODER, ENCSINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A Drive Data Set (DDS) is assigned to a Motor Data Set (MDS) or Encoder Data Set (EDS) that does not have a component number. Alarm value (r2124, interpret decimal): nnmmmxxyyy nn: Number of the MDS/EDS. mmm: Parameter number of the missing component number. xx: Number of the DDS that is assigned to the MDS/EDS. yyy: Parameter number that references the MDS/EDS. Example: p0186[7] = 5: DDS 7 is assigned MDS 5. p0131[5] = 0: There is no component number set in MDS 5. Alarm value = 0513107186
<b>Remedy:</b>	In the drive data sets, no longer assign MDS/EDS using p0186, p0187, p0188, p0189 or set a valid component number. See also: p0131, p0141, p0142, p0186, p0187, p0188, p0189

**207510**                    **<location>Drive: Identical encoder in the drive data set**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                More than one encoder with identical component number is assigned to a single drive data set. In one drive data set, it is not permissible that identical encoders are operated together.  
 Fault value (r0949, decimal interpretation):  
 1000 \* first identical encoder + 100 \* second identical encoder + drive data set.  
 Example:  
 Fault value = 1203 means:  
 In drive data set 3, the first (p0187[3]) and second encoder (p0188[3]) are identical.

**Remedy:**                Assign the drive data set to different encoders.  
 See also: p0141, p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number)

---

**207511**                    **<location>Drive: Encoder used a multiple number of times**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                Each encoder may only be assigned to one drive and within a drive must - in each drive data set - either always be encoder 1, always encoder 2 or always encoder 3. This unique assignment has been violated.  
 Fault value (r0949, decimal interpretation):  
 The two parameters in coded form, that refer to the same component number.  
 First parameter:  
 Index: First and second decimal place (99 for EDS, not assigned DDS)  
 Parameter number: Third decimal place (1 for p0187, 2 for p0188, 3 for p0189, 4 for EDS not assigned DDS)  
 Drive number: Fourth and fifth decimal place  
 Second parameter:  
 Index: Sixth and seventh decimal place (99 for EDS, not assigned DDS)  
 Parameter number: Eighth decimal place (1 for p0187, 2 for p0188, 3 for p0189, 4 for EDS, not assigned DDS)  
 Drive number: Ninth and tenth decimal place  
 See also: p0141

**Remedy:**                Correct the double use of a component number using the two parameters coded in the fault value.

---

**207512**                    **<location>Drive: Encoder data set changeover cannot be parameterized**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                Using p0141, a changeover of the encoder data set is prepared that is illegal. In this firmware release, an encoder data set changeover is only permitted for the components in the actual topology.  
 Alarm value (r2124, interpret decimal):  
 Incorrect EDS data set number.  
 See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number)

**Remedy:**                Every encoder data set must be assigned its own dedicated DRIVE-CLiQ socket. The component numbers of the encoder interfaces (p0141) must have different values within a drive object.  
 The following must apply:  
 p0141[0] not equal to p0141[1] not equal to ... not equal to p0141[n]



---

**207514 <location>Drive: Data structure does not correspond to the interface module**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The interface mode "SIMODRIVE 611 universal" was set (p2038 = 1) and the data structure does not correspond to this mode.  
For the data structure, the following rule must be complied with.  
Within the group of 8 drive data sets, the assignment to the motor data set must be set the same:  
p0186[0] = p0186[1] = ... = p0186[7]  
p0186[8] = p0186[9] = ... = p0186[15]  
p0186[16] = p0186[17] = ... = p0186[23]  
p0186[24] = p0186[25] = ... = p0186[31]  
See also: p0180 (Number of Drive Data Sets (DDS)), p0186 (Motor Data Sets (MDS) number), p2038 (IF1 PROFIdrive STW/ZSW interface mode)

**Remedy:** - structure the data according to the rules of the "SIMODRIVE 611 universal" interface mode.  
- check the interface mode (p2038).

---

**207515 <location>Drive: Power unit and motor incorrectly connected**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A power unit (via PDS) was assigned to a motor (via MDS) in a drive data set that is not connected in the target topology.  
Alarm value (r2124, interpret decimal):  
Number of the incorrectly parameterized drive data set.

**Remedy:** - assign the drive data set to a combination of motor and power unit permitted by the target topology.  
- adapt the target topology.  
See also: p0121 (Power unit component number), p0131 (Motor component number), p0186 (Motor Data Sets (MDS) number)

---

**207516 <location>Drive: Re-commission the data set**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The assignment between the drive data set and motor data set (p0186) or between the drive data set and the encoder data set was modified (p0187). This is the reason that the drive data set must re-commissioned.  
Fault value (r0949, decimal interpretation):  
Drive data set to be re-commissioned.

**Remedy:** Commission the drive data set specified in the fault value (r0949).

**207517**                    **<location>Drive: Encoder data set changeover incorrectly parameterized**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                An MDS cannot have different motor encoders in two different DDS.  
 The following parameterization therefore results results in an error:  
 p0186[0] = 0, p0187[0] = 0  
 p0186[0] = 0, p0187[0] = 1  
 Alarm value (r2124, interpret decimal):  
 The lower 16 bits indicate the first DDS and the upper 16 bits indicate the second DDS.

**Remedy:**                If you wish to operate a motor once with one motor encoder and then another time with the other motor encoder, then you must set up two different MDSs, in which the motor data are the same.  
 Example:  
 p0186[0] = 0, p0187[0] = 0  
 p0186[0] = 1, p0187[0] = 1

---

**207518**                    **<location>Drive: Motor data set changeover incorrectly parameterized**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**              NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                The system has identified that two motor data sets were incorrectly parameterized.  
 Parameter r0313 (calculated from p0314, p0310, p0311), r0315 and p1982 may only have different values if the motor data sets are assigned different motors. p0827 is used to assign the motors and/contactors.  
 It is not possible to toggle between motor data sets.  
 Alarm value (r2124, interpret hexadecimal):  
 xxxxyyyy:  
 xxxx: First DDS with assigned MDS, yyyy: Second DDS with assigned MDS

**Remedy:**                Correct the parameterization of the motor data sets.

---

**207519**                    **<location>Drive: Motor changeover incorrectly parameterized**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                With the setting p0833.0 = 1, a motor changeover via the application is selected. This is the reason that p0827 must have different values in the appropriate motor data set.  
 Alarm value (r2124, interpret hexadecimal):  
 xxxxyyyy:  
 xxxx: First MDS, yyyy: Second MDS

**Remedy:**                - parameterize the appropriate motor data sets differently (p0827).  
 - select the setting p0833.0 = 0 (motor changeover via the drive).

---

**207520**                    **<location>Drive: Motor cannot be changed over**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The motor cannot be changed over.  
Alarm value (r2124, interpret decimal):  
1:  
The contactor for the motor that is presently active cannot be opened, because for a synchronous motor, the speed (r0063) is greater than the speed at the start of field weakening (p3048). As long as r0063 > p0348, the current in the motor does not decay in spite of the pulses being suppressed.  
2:  
The "contactor opened" feedback signal was not detected within 1 s.  
3:  
The "contactor closed" feedback signal was not detected within 1 s.

**Remedy:**                Re alarm value = 1:  
Set the speed lower than the speed at the start of field weakening (r0063 < p0348).  
Re alarm value = 2, 3:  
Check the feedback signals of the contactor involved.

---

**207530**                    **<location>Drive: Drive Data Set DDS not present**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The selected drive data set is not available (p0837 > p0180). The drive data set was not changed over.  
See also: p0180, p0820, p0821, p0822, p0823, p0824, r0837

**Remedy:**                - select the existing drive data set.  
- set up additional drive data sets.

---

**207531**                    **<location>Drive: Command Data Set CDS not present**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The selected command data set is not available (p0836 > p0170). The command data set was not changed over.  
See also: p0810 (Command data set selection CDS bit 0), p0811 (Command data set selection CDS bit 1), r0836 (Command Data Set CDS selected)

**Remedy:**                - select the existing command data set.  
- set up additional command data sets.

---

**207541**                    **<location>Drive: Data set changeover not possible**

**Message value:**        -

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, ENCODER, ENCSINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:** The selected drive data set changeover and the assigned motor changeover are not possible and are not carried out. For synchronous motors, the motor contactor may only be switched for actual speeds less than the speed at the start of field weakening (r0063 < p0348).  
See also: r0063, p0348

**Remedy:** Reduce the speed below the speed at the start of field weakening.

**207550 <location>Drive: Not possible to reset encoder parameters**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When carrying out a factory setting (e.g. using p0970 = 1), it was not possible to reset the encoder parameters. The encoder parameters are directly read out of the encoder via DRIVE-CLiQ.  
Alarm value (r2124, interpret decimal):  
Component number of the encoder involved.

**Remedy:** - repeat the operation.  
- check the DRIVE-CLiQ connection.

**207551 <location>Drive encoder: No commutation angle information**

**Message value:** Fault cause: %1, drive data set: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (IASC/DCBRAKE)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The commutation angle information is missing. This means that synchronous motors cannot be controlled (closed-loop control)  
Fault value (r0949, decimal interpretation):  
yyyyxxx dec: yyyy = fault cause, xxxx = drive data set  
yyyy = 1 dec:  
The motor encoder used does not supply an absolute commutation angle.  
yyyy = 2 dec:  
The selected ratio of the measuring gear does not match the motor pole pair number.

**Remedy:** Re fault cause = 1:  
- check the encoder parameterization (p0404).  
- use an encoder with track C/D, EnDat interface of Hall sensors.  
- use an encoder with sinusoidal A/B track for which the motor pole pair number (r0313) is an integer multiple of the encoder pulse number (p0408).  
- activate the pole position identification routine (p1982 = 1).  
Re fault cause = 2:  
- the quotient of the pole pair number divided by the ratio of the measuring gear must be an integer number: (p0314 \* p0433) / p0432.  
Note:  
For operation with track C/D, this quotient must be less than 8.  
See also: p0402 (Gearbox type selection), p0404 (Encoder configuration effective), p0432 (Gearbox factor, encoder revolutions), p0433 (Gearbox factor, motor/load revolutions)

**207552 <location>Drive encoder: Encoder configuration not supported**

**Message value:** Fault cause: %1, component number: %2, encoder data set: %3  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)

<b>Cause:</b>	<p>The requested encoder configuration is not supported. Only bits may be requested in p0404 that are signaled as being supported by the encoder evaluation in r0456.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>ccccbbaa hex: cccc = fault cause, bb = component number, aa = encoder data set</p> <p>cccc = 1: encoder sin/cos with absolute track (is supported by SME25).</p> <p>cccc = 3: Squarewave encoder (this is supported by SMC30).</p> <p>cccc = 4: sin/cos encoder (this is supported by SMC20, SMI20, SME20, SME25).</p> <p>cccc = 10: DRIVE-CLiQ encoder (is supported by DQI).</p> <p>cccc = 12: sin/cos encoder with reference mark (this is supported by SME20).</p> <p>cccc = 15: Commutation with zero mark for separately-excited synchronous motors with VECTORMV.</p> <p>cccc = 23: Resolver (this is supported by SMC10, SMI10).</p> <p>cccc = 65535: Other function (compare r0456 and p0404).</p> <p>See also: p0404 (Encoder configuration effective), r0456 (Encoder configuration supported)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the encoder parameterization (p0400, p0404).</li> <li>- use the matching encoder evaluation (r0456).</li> </ul>

### 207553 <location>Drive encoder: Sensor Module configuration not supported

<b>Message value:</b>	Encoder data set: %1, first incorrect bit: %2, incorrect parameter: %3
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>The Sensor Module does not support the requested configuration.</p> <p>For incorrect p0430 (cc = 0), the following applies:</p> <ul style="list-style-type: none"> <li>- In p0430 (requested functions), at least 1 bit was set that is not set in r0458 (supported functions) (exception: Bit 19, 28, 29, 30, 31).</li> <li>- p1982 &gt; 0 (pole position identification requested), but r0458.16 = 0 (pole position identification not supported).</li> </ul> <p>For incorrect p0437 (cc = 1), the following applies:</p> <ul style="list-style-type: none"> <li>- In p0437 (requested functions), at least 1 bit was set that is not set in r0459 (supported functions).</li> </ul> <p>Fault value (r0949, interpret hexadecimal):</p> <p>ddccbbaa hex</p> <p>aa: encoder data set number</p> <p>bb: first incorrect bit</p> <p>cc: incorrect parameter</p> <p>cc = 0: incorrect parameter is p0430</p> <p>cc = 1: incorrect parameter is p0437</p> <p>cc = 2: incorrect parameter is r0459</p> <p>dd: reserved (always 0)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the encoder parameterization (p0430, p0437).</li> <li>- check the pole position identification routine (p1982).</li> <li>- use the matching encoder evaluation (r0458, r0459).</li> </ul> <p>See also: p0430, p0437, r0458, r0459, p1982</p>

### 207555 <location>Drive encoder: Configuration position tracking

<b>Message value:</b>	Component number: %1, encoder data set: %2, drive data set: %3, fault cause: %4
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>For position tracking, the configuration is not supported.</p> <p>Position tracking can only be activated for absolute encoders.</p> <p>For linear axes, it is not possible to simultaneously activate the position tracking for load and measuring gears.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>ddccbbaa hex</p> <p>aa = encoder data set</p> <p>bb = component number</p>

cc = drive data set  
 dd = fault cause  
 dd = 00 hex = 0 dec  
 An absolute encoder is not being used.  
 dd = 01 hex = 1 dec  
 Position tracking cannot be activated because the memory of the internal NVRAM is not sufficient or a Control Unit does not have an NVRAM.  
 dd = 02 hex = 2 dec  
 For a linear axis, the position tracking was activated for the load and measuring gear.  
 dd = 03 hex = 3 dec  
 Position tracking cannot be activated because position tracking with another gear ratio, axis type or tolerance window has already been detected for this encoder data set.  
 dd = 04 hex = 4 dec  
 A linear encoder is being used.  
 See also: p0404 (Encoder configuration effective), p0411 (Measuring gear, configuration)

**Remedy:**

- use an absolute encoder.
- if necessary, de-select the position tracking (p0411 for the measuring gear, p2720 for the load gear).
- use a Control Unit with sufficient NVRAM.
- Only activate position tracking of the load gear in the same encoder data set if the gear ratio (p2504, p2505), axis type (p2720.1) and tolerance window (p2722) are also the same.

**207556 <location>Measuring gear: Position tracking, maximum actual value exceeded**

**Message value:** Component number: %1, encoder data set: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** When the position tracking of the measuring gear is configured, the drive/encoder identifies a maximum possible absolute position actual value (r0483) that cannot be represented within 32 bits.  
 Maximum value:  $p0408 * p0412 * 2^{p0419}$   
 Fault value (r0949, decimal interpretation):  
 aaaayyxx hex: yy = component number, xx = encoder data set  
 See also: p0408, p0412 (Measuring gear, absolute encoder, rotary, revolutions, virtual), p0419 (Fine resolution absolute value Gx\_XIST2 (in bits))

**Remedy:**

- reduce the fine resolution (p0419).
- reduce the multiturn resolution (p0412).

See also: p0412 (Measuring gear, absolute encoder, rotary, revolutions, virtual), p0419 (Fine resolution absolute value Gx\_XIST2 (in bits))

**207557 <location>Encoder 1: Reference point coordinate not in the permissible range**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The reference point coordinate received when adjusting the encoder via connector input C1:p2599 lies outside the half of the encoder range and cannot be set as actual axis position. The maximum permissible value is displayed in the supplementary information.

**Remedy:** Set the reference point coordinate less than the value from the supplementary information.  
 See also: p2598 (EPOS reference point coordinate, signal source)

---

<b>207558</b>	<b>&lt;location&gt;Encoder 2: Reference point coordinate not in the permissible range</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The reference point coordinate received when adjusting the encoder via connector input CI:p2599 lies outside the half of the encoder range and cannot be set as actual axis position. The maximum permissible value is displayed in the supplementary information.
<b>Remedy:</b>	Set the reference point coordinate less than the value from the supplementary information. See also: p2598 (EPOS reference point coordinate, signal source)

---

<b>207559</b>	<b>&lt;location&gt;Encoder 3: Reference point coordinate not in the permissible range</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The reference point coordinate received when adjusting the encoder via connector input CI:p2599 lies outside the half of the encoder range and cannot be set as actual axis position. The maximum permissible value is displayed in the supplementary information.
<b>Remedy:</b>	Set the reference point coordinate less than the value from the supplementary information. See also: p2598 (EPOS reference point coordinate, signal source)

---

<b>207560</b>	<b>&lt;location&gt;Drive encoder: Number of pulses is not to the power of two</b>
<b>Message value:</b>	Encoder data set: %1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	For rotary absolute encoders, the pulse number in p0408 must be to the power of two. Fault value (r0949, decimal interpretation): The fault value includes the encoder data set number involved.
<b>Remedy:</b>	- check the parameterization (p0408, p0404.1, r0458.5). - upgrade the Sensor Module firmware if necessary

---

<b>207561</b>	<b>&lt;location&gt;Drive encoder: Number of multiturn pulses is not to the power of two</b>
<b>Message value:</b>	Encoder data set: %1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The multiturn resolution in p0421 must be to the power of two. Fault value (r0949, decimal interpretation): The fault value includes the encoder data set number involved.
<b>Remedy:</b>	- check the parameterization (p0421, p0404.1, r0458.5). - upgrade the Sensor Module firmware if necessary

**207562 <location>Drive, encoder: Position tracking, incremental encoder not possible**

**Message value:** Fault cause: %1, component number: %2, encoder data set: %3  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The requested position tracking for incremental encoders is not supported.  
 Fault value (r0949, interpret hexadecimal):  
 ccccbbaa hex  
 aa = encoder data set  
 bb = component number  
 cccc = fault cause  
 cccc = 00 hex = 0 dec  
 The encoder type does not support the "Position tracking incremental encoder" function.  
 cccc = 01 hex = 1 dec  
 Position tracking cannot be activated because the memory of the internal NVRAM is not sufficient or a Control Unit does not have an NVRAM.  
 cccc = 04 hex = 4 dec  
 A linear encoder is used that does not support the "position tracking" function.  
 See also: p0404 (Encoder configuration effective), p0411 (Measuring gear, configuration), r0456 (Encoder configuration supported)  
**Remedy:** - check the encoder parameterization (p0400, p0404).  
 - use a Control Unit with sufficient NVRAM.  
 - if required, de-select position tracking for the incremental encoder (p0411.3 = 0).

**207565 <location>Drive: Encoder error in PROFIdrive encoder interface 1**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An encoder error was signaled for encoder 1 via the PROFIdrive encoder interface (G1\_ZSW.15).  
 Alarm value (r2124, interpret decimal):  
 Error code from G1\_XIST2, refer to the description regarding r0483.  
 Note:  
 This alarm is only output if p0480[0] is not equal to zero.  
**Remedy:** Acknowledge the encoder error using the encoder control word (G1\_STW.15 = 1).

**207566 <location>Drive: Encoder error in PROFIdrive encoder interface 2**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An encoder error was signaled for encoder 2 via the PROFIdrive encoder interface (G2\_ZSW.15).  
 Alarm value (r2124, interpret decimal):  
 Error code from G2\_XIST2, refer to the description regarding r0483.  
 Note:  
 This alarm is only output if p0480[1] is not equal to zero.  
**Remedy:** Acknowledge the encoder error using the encoder control word (G2\_STW.15 = 1).



---

<b>207567</b>	<b>&lt;location&gt;Drive: Encoder error in PROFIdrive encoder interface 3</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	An encoder error was signaled for encoder 3 via the PROFIdrive encoder interface (G3_ZSW.15). Alarm value (r2124, interpret decimal): Error code from G3_XIST2, refer to the description regarding r0483. Note: This alarm is only output if p0480[2] is not equal to zero.
<b>Remedy:</b>	Acknowledge the encoder error using the encoder control word (G3_STW.15 = 1).

---

<b>207569</b>	<b>&lt;location&gt;Encoder could not be identified</b>
<b>Message value:</b>	-
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	During encoder identification (waiting) with p0400 = 10100, the encoder could not be identified. Either the wrong encoder has been installed or no encoder has been installed, the wrong encoder cable has been connected or no encoder cable has been connected to the Sensor Module, or the DRIVE-CLiQ component has not been connected to DRIVE-CLiQ. Note: Encoder identification must be supported by the encoder and is possible in the following cases: - Encoder with EnDat interface - Motor with DRIVE-CLiQ
<b>Remedy:</b>	- check and, if necessary, connect the encoder and/or encoder cable. - check and, if necessary, establish the DRIVE-CLiQ connection. - in the case of encoders that cannot be identified (e.g. encoders without EnDat interface), the correct encoder type must be entered in p0400.

---

<b>207575</b>	<b>&lt;location&gt;Drive: Motor encoder not ready</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, ENCODER, ENCSINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF2 Servo: OFF2 (ENCODER) Vector: OFF2 (ENCODER)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The motor encoder signals that it is not ready. - initialization of encoder 1 (motor encoder) was unsuccessful. - the function "parking encoder" is active (encoder control word G1_STW.14 = 1). - the encoder interface (Sensor Module) is de-activated (p0145). - the Sensor Module is defective.
<b>Remedy:</b>	Evaluate other queued faults via encoder 1.

---

**207576 <location>Drive: Encoderless operation due to a fault active**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Encoderless operation is active due to a fault (r1407.13 = 1).  
 Note:  
 The behavior for faults has been set to ENCODER fault response in p0491.  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** - remove the cause of a possible encoder fault.  
 - carry out a POWER ON (power off/on) for all components.

---

**207577 <location>Encoder 1: Measuring probe evaluation not possible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the measuring probe, an error occurred.  
 Alarm value (r2124, interpret decimal):  
 6: The input terminal for the measuring probe is not set.  
 4098: Error when initializing the measuring probe.  
 4100: The measuring pulse frequency is too high.  
 4200: The PROFIBUS clock cycle is not a multiple of integer of the position controller clock cycle.  
**Remedy:** De-activate the measuring probe evaluation (BI: p2509 = 0 signal).  
 Re alarm value = 6:  
 Set the input terminal for the measuring probe (p0488, p0489 or p2517, p2518).  
 Re alarm value = 4098:  
 Check the Control Unit hardware.  
 Re alarm value = 4100:  
 Reduce the frequency of the measuring pulses at the measuring probe.  
 Re alarm value = 4200:  
 Set the clock cycle ratio between the PROFIBUS clock cycle and the position controller clock cycle to an integer multiple.

---

**207578 <location>Encoder 2: Measuring probe evaluation not possible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the measuring probe, an error occurred.  
 Alarm value (r2124, interpret decimal):  
 6: The input terminal for the measuring probe is not set.  
 4098: Error when initializing the measuring probe.  
 4100: The measuring pulse frequency is too high.  
 4200: The PROFIBUS clock cycle is not a multiple of integer of the position controller clock cycle.  
**Remedy:** De-activate the measuring probe evaluation (BI: p2509 = 0 signal).  
 Re alarm value = 6:  
 Set the input terminal for the measuring probe (p0488, p0489 or p2517, p2518).  
 Re alarm value = 4098:  
 Check the Control Unit hardware.

Re alarm value = 4100:  
Reduce the frequency of the measuring pulses at the measuring probe.  
Re alarm value = 4200:  
Set the clock cycle ratio between the PROFIBUS clock cycle and the position controller clock cycle to an integer multiple.

---

**207579**                    **<location>Encoder 3: Measuring probe evaluation not possible**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                When evaluating the measuring probe, an error occurred.  
                               Alarm value (r2124, interpret decimal):  
                               6: The input terminal for the measuring probe is not set.  
                               4098: Error when initializing the measuring probe.  
                               4100: The measuring pulse frequency is too high.  
                               4200: The PROFIBUS clock cycle is not a multiple of integer of the position controller clock cycle.  
**Remedy:**                De-activate the measuring probe evaluation (BI: p2509 = 0 signal).  
                               Re alarm value = 6:  
                               Set the input terminal for the measuring probe (p0488, p0489 or p2517, p2518).  
                               Re alarm value = 4098:  
                               Check the Control Unit hardware.  
                               Re alarm value = 4100:  
                               Reduce the frequency of the measuring pulses at the measuring probe.  
                               Re alarm value = 4200:  
                               Set the clock cycle ratio between the PROFIBUS clock cycle and the position controller clock cycle to an integer multiple.

---

**207580**                    **<location>Drive: No Sensor Module with matching component number**

**Message value:**        Encoder data set: %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                A Sensor Module with the component number specified in p0141 was not found.  
                               Alarm value (r2124, interpret decimal):  
                               Encoder data set involved (index of p0141).  
**Remedy:**                Correct parameter p0141.

---

**207581**                    **<location>Encoder 1: Position actual value preprocessing error**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                An error has occurred during the position actual value preprocessing.  
**Remedy:**                Check the encoder for the position actual value preprocessing.  
                               See also: p2502 (LR encoder assignment)

---

**207582 <location>Encoder 2: Position actual value preprocessing error**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An error has occurred during the position actual value preprocessing.  
**Remedy:** Check the encoder for the position actual value preprocessing.  
See also: p2502 (LR encoder assignment)

---

**207583 <location>Encoder 3: Position actual value preprocessing error**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An error has occurred during the position actual value preprocessing.  
**Remedy:** Check the encoder for the position actual value preprocessing.  
See also: p2502 (LR encoder assignment)

---

**207584 <location>Encoder 1: Position setting value activated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The position actual value is set to the value received via CI: p2515while BI: p2514 = 1 signal. A possible system deviation cannot be corrected.  
**Remedy:** Not necessary.  
The alarm automatically disappears with BI: p2514 = 0 signal.

---

**207585 <location>Encoder 2: Position setting value activated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The position actual value is set to the value received via CI: p2515while BI: p2514 = 1 signal. A possible system deviation cannot be corrected.  
**Remedy:** Not necessary.  
The alarm automatically disappears with BI: p2514 = 0 signal.

---

**207586 <location>Encoder 3: Position setting value activated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The position actual value is set to the value received via CI: p2515 while BI: p2514 = 1 signal. A possible system deviation cannot be corrected.

**Remedy:** Not necessary.  
The alarm automatically disappears with BI: p2514 = 0 signal.

---

### 207587 <location>Encoder 1: Position actual value preprocessing does not have a valid encoder

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The following problem has occurred during the position actual value preprocessing.  
- an encoder data set has been assigned, however, the encoder data set does not contain any encoder data (p0400 = 0) or invalid data (e.g. p0408 = 0).

**Remedy:** Check the drive data sets, encoder data sets.  
See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number), p0400 (Encoder type selection), p2502 (LR encoder assignment)

---

### 207588 <location>Encoder 2: Position actual value preprocessing does not have a valid encoder

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The following problem has occurred during the position actual value preprocessing.  
- an encoder data set has been assigned, however, the encoder data set does not contain any encoder data (p0400 = 0) or invalid data (e.g. p0408 = 0).

**Remedy:** Check the drive data sets, encoder data sets.  
See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number), p0400 (Encoder type selection), p2502 (LR encoder assignment)

---

### 207589 <location>Encoder 3: Position actual value preprocessing does not have a valid encoder

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The following problem has occurred during the position actual value preprocessing.  
- an encoder data set has been assigned, however, the encoder data set does not contain any encoder data (p0400 = 0) or invalid data (e.g. p0408 = 0).

**Remedy:** Check the drive data sets, encoder data sets.  
See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number), p0400 (Encoder type selection), p2502 (LR encoder assignment)

---

**207590**                    **<location>Encoder 1: Drive Data Set changeover in operation**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                A Drive Data Set changeover (DDS) with a change of the mechanical relationships and the encoder assignment (p2502) was requested in operation.

**Remedy:**                To changeover the drive data set, initially, exit the "operation" mode.

---

**207591**                    **<location>Encoder 2: Drive Data Set changeover in operation**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                A Drive Data Set changeover (DDS) with a change of the mechanical relationships and the encoder assignment (p2502) was requested in operation.

**Remedy:**                To changeover the drive data set, initially, exit the "operation" mode.

---

**207592**                    **<location>Encoder 3: Drive Data Set changeover in operation**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                A Drive Data Set changeover (DDS) with a change of the mechanical relationships and the encoder assignment (p2502) was requested in operation.

**Remedy:**                To changeover the drive data set, initially, exit the "operation" mode.

---

**207593**                    **<location>Encoder 1: Value range for position actual value exceeded**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The value range (-2147483648 ... 2147483647) for the position actual value representation was exceeded. When the overflow occurs, the "referenced" or "adjustment absolute measuring system" status is reset.  
 Fault value (r0949, decimal interpretation):  
 1: The position actual value (r2521) has exceeded the value range.  
 2: The encoder position actual value Gn\_XIST2 (r0483) or the absolute value after the load gear (r2723) has exceeded the value range.  
 3: The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range for displaying the position actual value.

**Remedy:**                If required, reduce the traversing range or position resolution.  
 Re alarm value = 3:  
 Reducing the position resolution and conversion factor:  
 - reduce the length unit (LU) per load revolution for rotary encoders (p2506).  
 - increase the fine resolution of absolute position actual values (p0419).

---

---

<b>207594</b>	<b>&lt;location&gt;Encoder 2: Value range for position actual value exceeded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The value range (-2147483648 ... 2147483647) for the position actual value representation was exceeded. When the overflow occurs, the "referenced" or "adjustment absolute measuring system" status is reset. Fault value (r0949, decimal interpretation): 1: The position actual value (r2521) has exceeded the value range. 2: The encoder position actual value Gn_XIST2 (r0483) or the absolute value after the load gear (r2723) has exceeded the value range. 3: The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range for displaying the position actual value.
<b>Remedy:</b>	If required, reduce the traversing range or position resolution. Re alarm value = 3: Reducing the position resolution and conversion factor: - reduce the length unit (LU) per load revolution for rotary encoders (p2506). - increase the fine resolution of absolute position actual values (p0419).

---

<b>207595</b>	<b>&lt;location&gt;Encoder 3: Value range for position actual value exceeded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The value range (-2147483648 ... 2147483647) for the position actual value representation was exceeded. When the overflow occurs, the "referenced" or "adjustment absolute measuring system" status is reset. Fault value (r0949, decimal interpretation): 1: The position actual value (r2521) has exceeded the value range. 2: The encoder position actual value Gn_XIST2 (r0483) or the absolute value after the load gear (r2723) has exceeded the value range. 3: The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range for displaying the position actual value.
<b>Remedy:</b>	If required, reduce the traversing range or position resolution. Re alarm value = 3: Reducing the position resolution and conversion factor: - reduce the length unit (LU) per load revolution for rotary encoders (p2506). - increase the fine resolution of absolute position actual values (p0419).

---

<b>207596</b>	<b>&lt;location&gt;Encoder 1: Reference function interrupted</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	An activated reference function (reference mark search or measuring probe evaluation) was interrupted. - an encoder fault has occurred (Gn_ZSW.15 = 1). - position actual value was set during an activated reference function. - simultaneously activate reference mark search and measuring probe evaluation (BI: p2508 and BI: p2509 = 1 signal). - activated reference function (reference mark search or measuring probe evaluation) was de-activated (BI: p2508 and BI: p2509 = 0 signal).
<b>Remedy:</b>	- check the causes and resolve. - reset the control (BI: p2508 and BI: p2509 = 0 signal) and activate the requested function.

---

**207597 <location>Encoder 2: Reference function interrupted**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An activated reference function (reference mark search or measuring probe evaluation) was interrupted.  
 - an encoder fault has occurred (Gn\_ZSW.15 = 1).  
 - position actual value was set during an activated reference function.  
 - simultaneously activate reference mark search and measuring probe evaluation (BI: p2508 and BI: p2509 = 1 signal).  
 - activated reference function (reference mark search or measuring probe evaluation) was de-activated (BI: p2508 and BI: p2509 = 0 signal).  
**Remedy:**  
 - check the causes and resolve.  
 - reset the control (BI: p2508 and BI: p2509 = 0 signal) and activate the requested function.

---

**207598 <location>Encoder 3: Reference function interrupted**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An activated reference function (reference mark search or measuring probe evaluation) was interrupted.  
 - an encoder fault has occurred (Gn\_ZSW.15 = 1).  
 - position actual value was set during an activated reference function.  
 - simultaneously activate reference mark search and measuring probe evaluation (BI: p2508 and BI: p2509 = 1 signal).  
 - activated reference function (reference mark search or measuring probe evaluation) was de-activated (BI: p2508 and BI: p2509 = 0 signal).  
**Remedy:**  
 - check the causes and resolve.  
 - reset the control (BI: p2508 and BI: p2509 = 0 signal) and activate the requested function.

---

**207599 <location>Encoder 1: Adjustment not possible**

**Message value:** Drive data set: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range (-2147483648 ... 2147483647) for displaying the position actual value.  
**Remedy:** If the value for the maximum possible absolute position (LU) is greater than 4294967296, then it is not possible to make an adjustment due to an overflow.  
 For rotary encoders, the maximum possible absolute position (LU) is calculated as follows:  
 1. Motor encoder without position tracking:  
 $p2506 * p0433 * p2505 / (p0432 * p2504)$   
 $p2506 * p0433 * p2505 * p0421 / (p0432 * p2504)$  for multiturn encoders  
 2. Motor encoder with position tracking for measuring gear:  
 $p2506 * p0412 * p2505 / p2504$   
 3. Motor encoder with position tracking for load gear:  
 $p2506 * p2721 * p0433 / p0432$   
 4. Motor encoder with position tracking for load and measuring gear:  
 $p2506 * p2721$



5. Direct encoder without position tracking:  
 $p2506 * p0433 / p0432$   
 $p2506 * p0433 * p0421 / p0432$  for multiturn encoders  
 6. Direct encoder with position tracking for measuring gear:  
 $p2506 * p0412$

---

## 207600 <location>Encoder 2: Adjustment not possible

<b>Message value:</b>	Drive data set: %1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range (-2147483648 ... 2147483647) for displaying the position actual value.
<b>Remedy:</b>	<p>If the value for the maximum possible absolute position (LU) is greater than 4294967296, then it is not possible to make an adjustment due to an overflow.</p> <p>For rotary encoders, the maximum possible absolute position (LU) is calculated as follows:</p> <ol style="list-style-type: none"> <li>Motor encoder without position tracking:  <math>p2506 * p0433 * p2505 / (p0432 * p2504)</math>  <math>p2506 * p0433 * p2505 * p0421 / (p0432 * p2504)</math> for multiturn encoders</li> <li>Motor encoder with position tracking for measuring gear:  <math>p2506 * p0412 * p2505 / p2504</math></li> <li>Motor encoder with position tracking for load gear:  <math>p2506 * p2721 * p0433 / p0432</math></li> <li>Motor encoder with position tracking for load and measuring gear:  <math>p2506 * p2721</math></li> <li>Direct encoder without position tracking:  <math>p2506 * p0433 / p0432</math>  <math>p2506 * p0433 * p0421 / p0432</math> for multiturn encoders</li> <li>Direct encoder with position tracking for measuring gear:  <math>p2506 * p0412</math></li> </ol>

---

## 207601 <location>Encoder 3: Adjustment not possible

<b>Message value:</b>	Drive data set: %1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The maximum encoder value times the factor to convert the absolute position (r0483 and/or r2723) from increments to length units (LU) has exceeded the value range (-2147483648 ... 2147483647) for displaying the position actual value.
<b>Remedy:</b>	<p>If the value for the maximum possible absolute position (LU) is greater than 4294967296, then it is not possible to make an adjustment due to an overflow.</p> <p>For rotary encoders, the maximum possible absolute position (LU) is calculated as follows:</p> <ol style="list-style-type: none"> <li>Motor encoder without position tracking:  <math>p2506 * p0433 * p2505 / (p0432 * p2504)</math>  <math>p2506 * p0433 * p2505 * p0421 / (p0432 * p2504)</math> for multiturn encoders</li> <li>Motor encoder with position tracking for measuring gear:  <math>p2506 * p0412 * p2505 / p2504</math></li> <li>Motor encoder with position tracking for load gear:  <math>p2506 * p2721 * p0433 / p0432</math></li> <li>Motor encoder with position tracking for load and measuring gear:  <math>p2506 * p2721</math></li> </ol>

- 5. Direct encoder without position tracking:  
 p2506 \* p0433 / p0432  
 p2506 \* p0433 \* p0421 / p0432 for multiturn encoders
- 6. Direct encoder with position tracking for measuring gear:  
 p2506 \* p0412

**207800 <location>Drive: No power unit present**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The power unit parameters cannot be read or no parameters are stored in the power unit.  
 Connection between Control Unit and power unit was interrupted or is defective.  
 Note:  
 This fault also occurs if an incorrect topology was selected in the commissioning software and this parameterization is then downloaded to the Control Unit.  
 See also: r0200 (Power unit code number actual)

**Remedy:**

- connect the data line to power unit and restart the CU (POWER ON).
- check or replace the CU.
- Check the cable between the CU and power unit.
- after correcting the topology, the parameters must be again downloaded using the commissioning software.

**207801 <location>Drive: Motor overcurrent**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (NONE, OFF1, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The permissible motor limit current was exceeded.

- effective current limit set too low.
- current controller not correctly set.
- motor was braked with an excessively high stall torque correction factor.
- U/f operation: Up ramp was set too short or the load is too high.
- U/f operation: Short-circuit in the motor cable or ground fault.
- U/f operation: Motor current does not match the current of Motor Module.

Note:  
 Synchronous motor: Limit current= 1.3 x p0323  
 Induction motor: Limit current= 1.3 x r0209

**Remedy:**

- check the current limits (p0323, p0640).
- check the current controller (p1715, p1717).
- reduce the stall torque correction factor (p0326).
- increase the up ramp (p1318) or reduce the load.
- check the motor and motor cables for short-circuit and ground fault.
- check the Motor Module and motor combination.

**207801 <location>Drive: Motor overcurrent**

**Message value:** -

**Drive object:** VECTOR

**Reaction:** OFF2 (NONE, OFF1, OFF3)

**Acknowledge:** IMMEDIATELY

- Cause:** The permissible motor limit current was exceeded.
- effective current limit set too low.
  - current controller not correctly set.
  - U/f operation: Up ramp was set too short or the load is too high.
  - U/f operation: Short-circuit in the motor cable or ground fault.
  - U/f operation: Motor current does not match current of power unit.
  - Switch to rotating motor without flying restart function (p1200).
- Note:  
Limit current = 2 x minimum (p0640, 4 x p0305 x p0306) >= 2 x p0305 x p0306
- Remedy:**
- check the current limits (p0640).
  - vector control: Check the current controller (p1715, p1717).
  - U/f control: Check the current limiting controller (p1340 ... p1346).
  - increase the up ramp (p1120) or reduce the load.
  - check the motor and motor cables for short-circuit and ground fault.
  - check the motor for the star-delta configuration and rating plate parameterization.
  - check the power unit and motor combination.
  - Choose "flying restart" function (p1200) if switched to rotating motor.

## 207802 <location>Drive: Infeed or power unit not ready

- Message value:** -
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF2 (NONE)
- Acknowledge:** IMMEDIATELY
- Cause:** After an internal power-on command, the infeed or drive does not signal ready.
- monitoring time is too short.
  - DC link voltage is not present.
  - associated infeed or drive of the signaling component is defective.
  - supply voltage incorrectly set.
- Remedy:**
- increase the monitoring time (p0857).
  - ensure that there is a DC link voltage. Check the DC link busbar. Enable the infeed.
  - replace the associated infeed or drive of the signaling component.
  - check the line supply voltage setting (p0210).
- See also: p0857 (Power unit monitoring time)

## 207805 <location>Infeed: Power unit overload I2t

- Message value:** -
- Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** Alarm threshold for I2t overload (p0294) of the power unit exceeded.
- Remedy:**
- reduce the continuous load.
  - adapt the load duty cycle.

## 207805 <location>Drive: Power unit overload I2t

- Message value:** -
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** NONE
- Acknowledge:** NONE

**Cause:** Alarm threshold for I2t overload (p0294) of the power unit exceeded.  
 The response parameterized in p0290 becomes active.  
 See also: p0290 (Power unit overload response)

**Remedy:**

- reduce the continuous load.
- adapt the load duty cycle.
- check the assignment of the rated currents of the motor and Motor Module.

**207807 <location>Drive: Short-circuit detected**

**Message value:** -

**Drive object:** VECTOR

**Reaction:** OFF2 (NONE)

**Acknowledge:** IMMEDIATELY

**Cause:** A phase-phase short-circuit was detected at the motor-side output terminals of the converter.  
 Note:  
 Also when interchanging the line and motor cables is identified as a motor-side short circuit.

**Remedy:**

- check the motor-side converter connection for a phase-phase short-circuit.
- rule-out interchanged line and motor cables.

**207808 <location>HF damping module: damping not ready**

**Message value:** New message: %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2 (NONE, OFF1, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:**

**Remedy:**

**207810 <location>Drive: Power unit EEPROM without rated data**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** No rated data are stored in the power unit EEPROM.  
 See also: p0205 (Power unit application), r0206 (Rated power unit power), r0207 (Rated power unit current), r0208 (Rated power unit line supply voltage), r0209 (Power unit, maximum current)

**Remedy:** Replace the power unit or inform Siemens Customer Service.

**207815 <location>Drive: Power unit has been changed**

**Message value:** Parameter: %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

---

<b>Cause:</b>	The code number of the actual power unit does not match the saved number. This only occurs if the comparator in p9906 or p9908 is not at 2 (low) or 3 (minimum). Fault value (r0949, decimal interpretation): Number of the incorrect parameter. See also: r0200 (Power unit code number actual), p0201 (Power unit code number)
<b>Remedy:</b>	Connect the original power unit and power up the Control Unit again (POWER ON) or set p0201 to r0200 and exit commissioning with p0010 = 0. For infeeds, the following applies: Line reactors or line filters must be used that are specified for the new power unit. A line supply and DC link identification routine (p3410 = 5) must then be carried out. It is not possible to change the power unit without re-commissioning the system if the type of infeed (A_Infeed, B_Infeed, S_Infeed), the type of construction/design (booksize, chassis) or the voltage class differ between the old and new power units. For inverters, the following applies: If the new power unit is accepted, then if required, the current limit (p0640) can be reduced by a lower maximum current of the power unit (r0209) (torque limits stay the same). If not only the power unit is changed, but also the motor, then the motor must be re-commissioned (e.g. using p0010 = 1). This is also necessary if motor data is still to be downloaded via DRIVE-CLiQ. See also: r0200 (Power unit code number actual)

---

### 207815 <location>Drive: Power unit has been changed

<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The code number of the actual power unit does not match the saved number. This only occurs if the comparator in p9906 or p9908 is not at 2 (low) or 3 (minimum). Fault value (r0949, decimal interpretation): Number of the incorrect parameter. See also: r0200 (Power unit code number actual), p0201 (Power unit code number)
<b>Remedy:</b>	Connect the original power unit and power up the Control Unit again (POWER ON) or set p0201 to r0200 and exit commissioning with p0010 = 0. For infeeds, the following applies: Line reactors or line filters must be used that are specified for the new power unit. A line supply and DC link identification routine (p3410 = 5) must then be carried out. It is not possible to change the power unit without re-commissioning the system if the type of infeed (A_Infeed, B_Infeed, S_Infeed), the type of construction/design (booksize, chassis) or the voltage class differ between the old and new power units. For inverters, the following applies: If the new power unit is accepted, then if required, the current limit (p0640) can be reduced by a lower maximum current of the power unit (r0209) (torque limits stay the same). If not only the power unit is changed, but also the motor, then the motor must be re-commissioned (e.g. using p0010 = 1). This is also necessary if motor data is still to be downloaded via DRIVE-CLiQ. If the comparison stage in p9906 is set to 2, 3, then commissioning can be exited (p0010 = 0) and the fault acknowledged. See also: r0200 (Power unit code number actual)

---

### 207815 <location>Drive: Power unit has been changed

<b>Message value:</b>	Parameter: %1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The code number of the actual power unit does not match the saved number. This only occurs if the comparator in p9906 or p9908 is not at 2 (low) or 3 (minimum). Fault value (r0949, decimal interpretation): Number of the incorrect parameter. See also: r0200 (Power unit code number actual), p0201 (Power unit code number)

**Remedy:** Connect the original power unit and power up the Control Unit again (POWER ON) or set p0201 to r0200 and exit commissioning with p0010 = 0.  
 If the new power unit is accepted, then if required, the current limit p0640 can be reduced by a lower maximum current of the power unit (r0209) (torque limits stay the same).  
 If not only the power unit is changed, but also the motor, then the motor must be re-commissioned (e.g. using p0010 = 1). This is also necessary if motor data is still to be downloaded via DRIVE-CLiQ.  
 If the comparison stage in p9906 is set to 2, 3, then commissioning can be exited (p0010 = 0) and the fault acknowledged.  
 See also: r0200 (Power unit code number actual)

**207820 <location>Drive: Temperature sensor not connected**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature sensor for monitoring the motor temperature, specified in p0600, is not available.  
 Alarm value (r2124, interpret decimal):  
 1: p0601 = 10 (SME), but in p0600 - not evaluated via encoder is selected.  
 2: p0600 = 10 (BICO), but the signal source (p0603) is not interconnected.  
 3: p0601 = 11 (BICO), but in p0600 - not evaluated via BICO interconnection is selected (20 or 21).  
 4: p0601 = 11 (BICO) and p4610-p4613 > 0, but the associated signal source (p0608, p0609) is not interconnected.  
 5: Component with sensor evaluation not present or has been removed in the meantime.  
 6: Evaluation via Motor Module not possible (r0192.21).

**Remedy:** Re alarm value = 1:  
 - In p0600 set an encoder with temperature sensor.  
 Re alarm value = 2:  
 - interconnect p0603 with the temperature signal.  
 Re alarm value = 3, 4:  
 - set the available temperature sensor (p0600, p0601).  
 - set p4610 ... p4613 = 0 (no sensor), or interconnect p0608 or p0609 with an external temperature signal.  
 Re alarm value = 5:  
 - connect the component with the temperature sensor. Check the DRIVE-CLiQ connection.  
 Re alarm value = 6:  
 - update the Motor Module firmware. Connect temperature sensor via encoder.  
 See also: p0600 (Motor temperature sensor for monitoring), p0601

**207825 <location>Drive: Simulation mode activated**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The simulation mode is activated.  
 The drive can only be powered up if the DC link voltage is less than 40 V.

**Remedy:** Not necessary.  
 The alarm automatically disappears if simulation mode is de-activated with p1272 = 0.

**207826 <location>Drive: DC link voltage for simulation operation too high**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** The simulation mode is activated and the DC link voltage is greater than the permissible value of 40 V.  
**Remedy:** - switch out (disable) simulation mode (p1272 = 0) and acknowledge the fault.  
 - reduce the input voltage in order to reach a DC link voltage below 40 V.

### 207840 <location>Drive: Infeed operation missing

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The signal "infeed operation" is not present although the enable signals for the drive have been present for longer than the parameterized monitoring time (p0857).  
 - infeed not operational.  
 - interconnection of the binector input for the ready signal is either incorrect or missing (p0864).  
 - infeed is presently carrying out a line supply identification routine.  
**Remedy:** - bring the infeed into an operational state.  
 - check the interconnection of the binector input for the signal "infeed operation" (p0864).  
 - increase the monitoring time (p0857).  
 - wait until the infeed has completed the line supply identification routine.  
 See also: p0857 (Power unit monitoring time), p0864 (Infeed operation)

### 207841 <location>Drive: Infeed operation withdrawn

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE, OFF1, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The signal "infeed operation" was withdrawn in operation.  
 - interconnection of the binector input for the signal "infeed operation" is either incorrect or missing (p0864).  
 - the enable signals of the infeed were disabled.  
 - due to a fault, the infeed withdraws the signal "infeed operation".  
**Remedy:** - check the interconnection of the binector input for the "infeed operation" signal (p0864).  
 - check the enable signals of the infeed and if required, enable.  
 - remove and acknowledge an infeed fault.  
**Note:**  
 If this drive is intended to back up the DC link regeneratively, then the fault response must be parameterized for NONE, OFF1 or OFF3. so that the drive can continue to operate even after the infeed fails.

### 207850 <location>External alarm 1

**Message value:** -  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The BICO signal for "external alarm 1" was triggered.  
 The condition for this external alarm is fulfilled.  
 See also: p2112 (External alarm 1)  
**Remedy:** Eliminate the causes of this alarm.

---

**207851**            **<location>External alarm 2**

**Message value:**    -

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            The BICO signal for "external alarm 2" was triggered.  
The condition for this external alarm is fulfilled.  
See also: p2116 (External alarm 2)

**Remedy:**           Eliminate the causes of this alarm.

---

**207852**            **<location>External alarm 3**

**Message value:**    -

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            The BICO signal for "external alarm 3" was triggered.  
The condition for this external alarm is fulfilled.  
See also: p2117 (External alarm 3)

**Remedy:**           Eliminate the causes of this alarm.

---

**207860**            **<location>External fault 1**

**Message value:**    -

**Drive object:**     All objects

**Reaction:**         Infeed: OFF2 (NONE, OFF1)  
Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            The BICO signal "external fault 1" was triggered.  
See also: p2106 (External fault 1)

**Remedy:**           Eliminate the causes of this fault.

---

**207861**            **<location>External fault 2**

**Message value:**    -

**Drive object:**     All objects

**Reaction:**         Infeed: OFF2 (NONE, OFF1)  
Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)

**Acknowledge:**    IMMEDIATELY (POWER ON)

**Cause:**            The BICO signal "external fault 2" was triggered.  
See also: p2107 (External fault 2)

**Remedy:**           Eliminate the causes of this fault.

---



---

**207862**      **<location>External fault 3**

**Message value:** -  
**Drive object:** All objects  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
 Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The BICO signal "external fault 3" was triggered.  
 See also: p2108, p3111, p3112  
**Remedy:** Eliminate the causes of this fault.

---

**207890**      **<location>Internal voltage protection / internal armature short-circuit with STO active**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The internal armature short-circuit (p1231 = 4) is not possible as Safe Torque Off (STO) is enabled. The pulses cannot be enabled.  
**Remedy:** Switch out the internal armature short-circuit (p1231=0) or de-activate Safe Torque Off (p9501 = p9561 = 0).  
 Note:  
 STO: Safe Torque Off / SH: Safe standstill

---

**207900**      **<location>Drive: Motor locked/speed controller at its limit**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Motor has been operating at the torque limit longer than the time specified in p2177 and below the speed threshold in p2175.  
 This signal can also be initiated if the speed actual value is oscillating and the speed controller output repeatedly goes to its limit.  
 See also: p2175, p2177 (Motor locked delay time)  
**Remedy:**

- check that the motor can rotate freely.
- check the torque limit: For a positive direction of rotation r1538, for a negative direction of rotation r1539.
- check the parameter, message "Motor locked" and if required, correct (p2175, p2177).
- check the inversion of the actual value (p0410).
- check the motor encoder connection.
- check the encoder pulse number (p0408).
- for SERVO with encoderless operation and motors with low power ratings (< 300 W), increase the pulse frequency (p1800).
- after de-selecting the "Basic positioner" (EPOS) function mode, check the motoring (p1528) and regenerative (p1529) torque limit and modify again.

---

**207900**      **<location>Drive: Motor blocked**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** OFF2 (NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY

**Cause:** Motor has been operating at the torque limit longer than the time specified in p2177 and below the speed threshold in p2175.  
 This signal can also be initiated if the speed actual value is oscillating and the speed controller output repeatedly goes to its limit.  
 If the simulation mode is enabled (p1272 = 1) and the closed-loop control with speed encoder activated (p1300 = 21), then the inhibit signal is generated if the encoder signal is not received from a motor that is driven with the torque setpoint of the closed-loop control.  
 See also: p2175, p2177 (Motor locked delay time)

**Remedy:**

- check that the motor can rotate freely.
- check the torque limit: For a positive direction of rotation r1538, for a negative direction of rotation r1539.
- check the parameter, message "Motor locked" and if required, correct (p2175, p2177).
- check the inversion of the actual value (p0410).
- check the motor encoder connection.
- check the encoder pulse number (p0408).
- for SERVO with encoderless operation and motors with low power ratings (< 300 W), increase the pulse frequency (p1800).
- after de-selecting the "Basic positioner" (EPOS) function mode, check the motoring (p1528) and regenerative (p1529) torque limit and modify again.
- in the simulation mode and operation with speed encoder, the power unit to which the motor is connected must be powered up and must be supplied with the torque setpoint of the simulated closed-loop control. Otherwise, change over to encoderless control (see p1300).

**207901**                    **<location>Drive: Motor overspeed**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (IASC/DCBRAKE)

**Acknowledge:** IMMEDIATELY

**Cause:** The maximum permissible speed was either positively or negatively exceeded.  
 The maximum permissible positive speed is formed as follows: Minimum (p1082, CI: p1085) + p2162  
 The maximum permissible negative speed is formed as follows: Maximum (-p1082, CI: 1088) - p2162

**Remedy:** The following applies for a positive direction of rotation:  
 - check r1084 and if required, correct p1082, CI:p1085 and p2162.  
 The following applies for a negative direction of rotation:  
 - check r1087 and if required, correct p1082, CI:p1088 and p2162.

**207901**                    **<location>Drive: Motor overspeed**

**Message value:** -

**Drive object:** VECTOR

**Reaction:** OFF2 (IASC/DCBRAKE)

**Acknowledge:** IMMEDIATELY

**Cause:** The maximum permissible speed was either positively or negatively exceeded.  
 The maximum permissible positive speed is formed as follows: Minimum (p1082, CI: p1085) + p2162  
 The maximum permissible negative speed is formed as follows: Maximum (-p1082, CI: 1088) - p2162

**Remedy:** The following applies for a positive direction of rotation:  
 - check r1084 and if required, correct p1082, CI:p1085 and p2162.  
 The following applies for a negative direction of rotation:  
 - check r1087 and if required, correct p1082, CI:p1088 and p2162.  
 Activate pre-control of the speed limiting controller (p1401.7 = 1).  
 Increase the hysteresis for the overspeed signal p2162. This upper limit is dependent upon the maximum motor speed p0322 and the maximum speed p1082 of the setpoint channel.

**207902 <location>Drive: Motor stalled****Message value:** %1**Drive object:** SERVO, SERVO\_SINUMERIK**Reaction:** OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)**Acknowledge:** IMMEDIATELY**Cause:** For a vector drive the system has identified that the motor has stall for a time longer than is set in p2178.

Fault value (r0949, decimal interpretation):

1: Stall detection using r1408.11 (p1744 or p0492).

2: Stall detection using r1408.12 (p1745).

3: Stall detection using r0056.11 (only for separately excited synchronous motors).

See also: p1744 (Motor model speed threshold stall detection), p2178 (Motor stalled delay time)

**Remedy:**

For closed-loop speed and torque control with speed encoder, the following applies:

- check the speed signal (interrupted cable, polarity, pulse number, broken encoder shaft).

- check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the same motor that is controlled for the data set changeover.

If there is no fault, then the fault tolerance (p1744 and p0492) can be increased.

For closed-loop speed and torque control without speed encoder, the following applies:

- check whether the drive in the open-loop controlled mode (r1750.0) stalls under load. If yes, then increase the current setpoint using p1610.

- check whether the drive stalls due to the load if the speed setpoint is still zero. If yes, then increase the current setpoint using p1610.

- if the motor excitation (magnetizing) time (r0346) was significantly reduced, then it should be increased again.

- check the current limits (p0640, r0067). If the current limits are too low, then the drive cannot be magnetized.

- check the current controller (p1715, p1717) and the speed adaptation controller (p1764, p1767). If the dynamic response was significantly reduced, then this should be increased again.

- check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the motor that is controlled for the data set changeover.

If there is no fault, then the fault tolerance (p1745) or the delay time (p2178) can be increased.

For separately-excited synchronous motors (closed-loop control with speed encoder), the following applies:

- check the speed signal (interrupted cable, polarity, pulse number).

- ensure the correct motor parameterization (rating plate and equivalent circuit diagram parameters).

- check the excitation equipment and the interface to the closed-loop control.

- encoder the highest possible dynamic response of the closed-loop excitation current control.

- check the speed control for any tendency to oscillate and if resonance effects occur, use a bandstop filter.

- do not exceed the maximum speed (p2162).

If there is no fault, then the delay time can be increased (p2178).

**207902 <location>Drive: Motor stalled****Message value:** %1**Drive object:** VECTOR**Reaction:** OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)**Acknowledge:** IMMEDIATELY**Cause:** For a vector drive the system has identified that the motor has stall for a time longer than is set in p2178.

Fault value (r0949, decimal interpretation):

1: Stall detection using r1408.11 (p1744 or p0492).

2: Stall detection using r1408.12 (p1745).

3: Stall detection using r0056.11 (only for separately excited synchronous motors).

See also: p1744 (Motor model speed threshold stall detection), p2178 (Motor stalled delay time)

**Remedy:**

It should always be carefully ensured that the motor data identification (p1910) as well as the rotating measurement (p1960) were carried out (also refer to r3925). For synchronous motors with encoder, the encoder must have been adjusted (p1990).

For closed-loop speed and torque control with speed encoder, the following applies:

- check the speed signal (interrupted cable, polarity, pulse number, broken encoder shaft).

- check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the same motor that is controlled for the data set changeover.

If there is no fault, then the fault tolerance (p1744 and p0492) can be increased. For resolvers with a high signal ripple, e.g. p0492 should be increased and the speed signal smoothed (p1441, p1442).

If the stalled motor should take place in the range of the monitor model and for speeds of less than 30 % of the rated motor speed, then a change can be made directly from the current model into the flux impression (p1401.5 = 1). We therefore recommend that the time-controlled model change is switched in (p1750.4 = 1) or the model changeover limits are significantly increased (p1752 > 0.35 x p0311; p1753 = 5 %).

For closed-loop speed and torque control without speed encoder, the following applies:

- Check whether the drive stalls solely due to the load in controlled mode (r1750.0) or when the speed setpoint is still zero. If so, increase the current setpoint via p1610 or set p1750.2 = 1 (sensorless vector control to standstill for passive loads).

- If the motor excitation time (p0346) was significantly reduced and the drive stalls when it is switched on and run immediately, p0346 should be increased again or quick magnetizing selected (p1401).

- check the current limits (p0640, r0067, r0289). If the current limits are too low, then the drive cannot be magnetized.

- check the current controller (p1715, p1717) and the speed adaptation controller (p1764, p1767). If the dynamic response was significantly reduced, then this should be increased again.

- check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the motor that is controlled for the data set changeover.

If there is no fault, then the fault tolerance (p1745) or the delay time (p2178) can be increased.

The following generally apply for closed-loop and torque control:

- Check whether the motor cables are disconnected.

- If the fault occurs with fault value 2 when the motor accelerates very quickly to the field weakening range, the deviation between the flux setpoint and flux actual value can be reduced and, in turn, the message prevented, by reducing p1596.

For separately-excited synchronous motors (closed-loop control with speed encoder), the following applies:

- check the speed signal (interrupted cable, polarity, pulse number).

- ensure the correct motor parameterization (rating plate and equivalent circuit diagram parameters).

- check the excitation equipment and the interface to the closed-loop control.

- encoder the highest possible dynamic response of the closed-loop excitation current control.

- check the speed control for any tendency to oscillate and if resonance effects occur, use a bandstop filter.

- do not exceed the maximum speed (p2162).

If there is no fault, then the delay time can be increased (p2178).

## 207903

### <location>Drive: Motor speed deviation

**Message value:**

-

**Drive object:**

SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The absolute value of the speed difference from the two setpoints (p2151, p2154) and the speed actual value (r2169) exceeds the tolerance threshold (p2163) longer than tolerated (p2164, p2166).

The alarm is only enabled for p2149.0 = 1.

Possible causes could be:

- the load torque is greater than the torque setpoint.

- when accelerating, the torque/current/power limit is reached. If the limits are not sufficient, then it is possible that the drive has been dimensioned too small.

- for closed-loop torque control, the speed setpoint does not track the speed actual value.

- for active Vdc controller.

For U/f control, the overload condition is detected as the I<sub>max</sub> controller is active.

See also: p2149 (Monitoring configuration)

**Remedy:**

- increase p2163 and/or p2166.

- increase the torque/current/power limits.

- for closed-loop torque control: The speed setpoint should track the speed actual value.

- de-activate alarm with p2149.0 = 0.

---

<b>207904</b>	<b>&lt;location&gt;External armature short-circuit: Contactor feedback signal "Closed" missing</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	When closing, the contactor feedback signal (p1235) did not issue the signal "Closed" (r1239.1 = 1) within the monitoring time (p1236).
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the contactor feedback signal is correctly connected (p1235).</li> <li>- check the logic of the contactor feedback signal (r1239.1 = 1: "Closed", r1239.1 = 0: "Open").</li> <li>- increase the monitoring time (p1236).</li> <li>- if required, set the external armature short-circuit without contactor feedback signal (p1231 = 2).</li> </ul>

---

<b>207905</b>	<b>&lt;location&gt;External armature short-circuit: Contactor feedback signal "Open" missing</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2 (NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	When opening, the contactor feedback signal (p1235) did not issue the signal "Open" (r1239.1 = 0) within the monitoring time (p1236).
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the contactor feedback signal is correctly connected (p1235).</li> <li>- check the logic of the contactor feedback signal (r1239.1 = 1: "Closed", r1239.1 = 0: "Open").</li> <li>- increase the monitoring time (p1236).</li> <li>- if required, set the external armature short-circuit without contactor feedback signal (p1231 = 2).</li> </ul>

---

<b>207906</b>	<b>&lt;location&gt;Armature short-circuit / internal voltage protection: Parameterization error</b>
<b>Message value:</b>	Fault cause: %1, motor data set: %2
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The armature short-circuit is incorrectly parameterized.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>zzzzyyxx: zzzz = fault cause, xx = motor data set</p> <p>zzzz = 1: A permanent-magnet synchronous motor has not been selected.</p> <p>zzzz = 2: An induction motor has not been selected.</p> <p>zzzz = 101: External armature short-circuit: Output (r1239.0) not connected up.</p> <p>zzzz = 102: External armature short-circuit with contactor feedback signal: No feedback signal connected (BI:p1235).</p> <p>zzzz = 103: External armature short-circuit without contactor feedback signal: Delay time when opening (p1237) is 0.</p> <p>zzzz = 201: Internal voltage protection: The maximum output current of the Motor Module (r0209) is less than 1.8 x motor short-circuit current (r0331).</p> <p>zzzz = 202: Internal voltage protection: A Motor Module in booksize or chassis format is not being used.</p> <p>zzzz = 203: Internal voltage protection: The motor short-circuit current (p0320) is greater than the maximum motor current (p0323).</p> <p>zzzz = 204: Internal voltage protection: The activation (p1231 = 4) is not given for all motor data sets with synchronous motors (p0300 = 2xx, 4xx).</p>

- Remedy:**
- For fault value = 1:
    - an armature short-circuit / voltage protection is only permissible for permanent-magnetic synchronous motors. The highest position of the motor type in p0300 must either be 2 or 4.
  - For fault value = 101:
    - the contactor for the external armature short-circuit configuration should be controlled using output signal r1239.0. The signal can, e.g. be connected to an output terminal via binector input p0738. Before this fault can be acknowledged, p1231 must be set again.
  - For fault value = 102:
    - if the external armature short-circuit with contactor feedback signal (p1231 = 1) is selected, this feedback signal must be connected to an input terminal (e.g. r722.x) and then connected to BI: p1235.
    - alternatively, the external armature short-circuit without contactor feedback signal (p1231 = 2) can be selected.
  - For fault value = 103:
    - if the external armature short-circuit without contactor feedback signal (p1231 = 2) is selected, then a delay time must be parameterized in p1237. This time must always be greater than the actual contactor opening time, as otherwise the Motor Module would be short-circuited!
  - For fault value = 201:
    - a Motor Module with a higher maximum current or a motor with a lower short-circuit current must be used. The maximum Motor Module current must be higher than 1.8 x short-circuit current of the motor.
  - For fault value = 202:
    - for internal voltage protection, use a Motor Module in booksize or chassis format.
  - For fault value = 203:
    - for internal voltage protection, only use short-circuit proof motors.
  - For fault value = 204:
    - The internal voltage protection must either be activated for all motor data sets with synchronous motors (p0300 = 2xx, 4xx) (p1231 = 3) or it must be de-activated for all motor data sets (p1231 not equal to 3). This therefore ensures that the protection cannot be accidentally withdrawn as a result of a data set changeover. The fault can only be acknowledged if this condition is fulfilled.

---

**207907**                      **<location>Internal armature short-circuit: Motor terminals are not at zero potential after pulse suppression**

- Message value:** -
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** NONE
- Acknowledge:** IMMEDIATELY
- Cause:** The function "Internal voltage protection" (p1231 = 3) was activated.  
 The following must be observed:
- when the internal voltage protection is active, after pulse suppression, all of the motor terminals are at half of the DC link voltage (without an internal voltage protection, the motor terminals are at zero potential)!
  - it is only permissible to use motors that are short-circuit proof (p0320 < p0323).
  - the Motor Module must be able to continually conduct 180% short-circuit current (r0331) of the motor (r0289).
  - the internal voltage protection cannot be interrupted due to a fault response. If an overcurrent condition occurs during the active, internal voltage protection, then this can destroy the Motor Module and/or the motor.
  - if the Motor Module does not support the autonomous, internal voltage protection (r0192.10 = 0), in order to ensure safe, reliable functioning when the line supply fails, an external 24 V power supply (UPS) must be used for the components.
  - if the Motor Module does support the autonomous, internal voltage protection (r0192.10 = 1), in order to ensure safe, reliable functioning when the line supply fails, the 24 V power supply for the components must be provided through a Control Supply Module.
  - if the internal voltage protection is active, it is not permissible that the motor is driven by the load for a longer period of time (e.g. as a result of loads that move the motor or another coupled motor).
- Remedy:** Not necessary.  
 This a note for the user.

---

<b>207908</b>	<b>&lt;location&gt;Internal armature short-circuit active</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The Motor Module signals that the motor is short-circuited through the power semiconductors (r1239.5 = 1). The pulses cannot be enabled. The internal armature short-circuit is selected (p1231 = 4):
<b>Remedy:</b>	For synchronous motors, the armature short-circuit braking is activated with binector input p1230 = 1 signal. See also: p1230 (Armature short-circuit / DC braking activation), p1231 (Armature short-circuit / DC braking configuration)

---

<b>207909</b>	<b>&lt;location&gt;Internal voltage protection: De-activation only effective after POWER ON</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	The de-activation of the internal voltage protection (p1231 not equal to 3) only becomes effective after POWER ON. The status signal r1239.6 = 1 indicates that the internal voltage protection is ready.
<b>Remedy:</b>	Not necessary. This a note for the user.

---

<b>207910</b>	<b>&lt;location&gt;Drive: Motor overtemperature</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	KTY: The motor temperature has exceeded the fault threshold (p0604 or p0616). PTC: The response threshold of 1650 Ohm was exceeded. Alarm value (r2124, interpret decimal): this is the number of the temperature channel leading to the message. See also: p0604 (Motor temperature alarm threshold)
<b>Remedy:</b>	- check the motor load. - check the motor ambient temperature and cooling. - check PTC or bimetallic NC contact.

---

<b>207910</b>	<b>&lt;location&gt;Drive: Motor overtemperature</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	KTY or no sensor: The measured motor temperature or temperature of the thermal model has exceeded the alarm threshold (p0604 or p0616). The response parameterized in p0610 becomes active. PTC or bimetallic NC contact:

The response threshold of 1650 Ohm was exceeded or the NC contact opened.  
 Alarm value (r2124, interpret decimal):  
 SME not selected in p0601:  
 11: No output current reduction.  
 12: Output current reduction active.  
 SME or TM120 selected in p0601 (p0601 = 10, 11):  
 The number specifies the sensor channel that resulted in the alarm being output.  
 See also: p0604 (Motor temperature alarm threshold), p0610 (Motor overtemperature response)

**Remedy:**

- check the motor load.
- check the motor ambient temperature and cooling.
- check PTC or bimetallic NC contact.

**207913 <location>Excitation current outside the tolerance range**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The difference between the excitation current actual value and setpoint has exceeded the tolerance:  
 $\text{abs}(r1641 - r1626) > p3201 + p3202$   
 The cause of this fault is again reset for  $\text{abs}(r1641 - r1626) < p3201$ .  
**Remedy:**

- check the parameterization (p1640, p3201, p3202).
- check the interfaces to the excitation equipment (r1626, p1640).
- check the excitation equipment.

**207914 <location>Flux out of tolerance**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The difference between the flux actual value and setpoint has exceeded the tolerance:  
 $\text{abs}(r0084 - r1598) > p3204 + p3205$   
 The cause of this fault is again reset for  $\text{abs}(r0084 - r1598) < p3204$ .  
 The fault is only issued after the delay time in p3206 has expired.  
**Remedy:**

- check the parameterization (p3204, p3205).
- check the interfaces to the excitation equipment (r1626, p1640).
- check the excitation equipment.
- check the flux control (p1590, p1592, p1597).
- check the control for oscillation and take the appropriate counter measures (e.g. optimize the speed control loop, parameterize a bandstop filter).

**207918 <location>Three-phase setpoint generator operation selected/active**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE



**Cause:** Only for separately excited synchronous motors (p0300 = 5):  
 The actual open-loop/closed-loop control mode is I/f control (open-loop) with a fixed current (p1300 = 18).  
 The speed is entered via the setpoint channel and the current setpoint is given by the minimum current (p1620).  
 It must be ensured that in this mode, the control dynamic performance is very limited. This is the reason that longer ramp-up times should be set for the setpoint speed than for normal operation.  
 See also: p1620 (Stator current, minimum)

**Remedy:** Select another open-loop/closed-loop control mode  
 See also: p1300 (Open-loop/closed-loop control operating mode)

### 207920 <location>Drive: Torque/speed too low

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The torque deviates from the torque/speed envelope characteristic (too low).  
 See also: p2181 (Load monitoring response)

**Remedy:** - check the connection between the motor and load.  
 - adapt the parameterization corresponding to the load.

### 207921 <location>Drive: Torque/speed too high

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The torque deviates from the torque/speed envelope characteristic (too high).

**Remedy:** - check the connection between the motor and load.  
 - adapt the parameterization corresponding to the load.

### 207922 <location>Drive: Torque/speed out of tolerance

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The torque deviates from the torque/speed envelope characteristic.

**Remedy:** - check the connection between the motor and load.  
 - adapt the parameterization corresponding to the load.

### 207923 <location>Drive: Torque/speed too low

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The torque deviates from the torque/speed envelope characteristic (too low).

**Remedy:** - check the connection between the motor and load.  
 - adapt the parameterization corresponding to the load.

---

**207924**                    **<location>Drive: Torque/speed too high**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The torque deviates from the torque/speed envelope characteristic (too high).  
**Remedy:**              - check the connection between the motor and load.  
                              - adapt the parameterization corresponding to the load.

---

**207925**                    **<location>Drive: Torque/speed out of tolerance**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                The torque deviates from the torque/speed envelope characteristic.  
**Remedy:**              - check the connection between the motor and load.  
                              - adapt the parameterization corresponding to the load.

---

**207926**                    **<location>Drive: Envelope curve, parameter invalid**

**Message value:**        Parameter: %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                Invalid parameter values were entered for the envelope characteristic of the load monitoring.  
                              The following rules apply for the speed thresholds:  
                              p2182 < p2183 < p2184  
                              The following rules apply for the torque thresholds:  
                              p2185 > p2186  
                              p2187 > p2188  
                              p2189 > p2190  
                              Alarm value (r2124, interpret decimal):  
                              Number of the parameter with the invalid value.  
**Remedy:**              Set the parameters for the load monitoring according to the applicable rules or de-activate load monitoring (p2181 = 0, p2193 = 0).

---

**207927**                    **<location>DC braking active**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The motor is braked with DC current. DC braking is active.  
                              1)  
                              A message with response DCBRK is active. The motor is braked with the braking current set in p1232 for the duration set in p1233. If the standstill threshold p1226 is undershot, then braking is prematurely canceled.  
                              2)  
                              DC braking has been activated at binector input p1230 with the DC braking set (p1230 = 4). Braking current p1232 is injected until this binector input becomes inactive.

**Remedy:** Not necessary.  
The alarm automatically disappears once DC braking has been executed.

## 207928 <location>Internal voltage protection initiated

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The Motor Module signals that the motor is short-circuited through the power semiconductors (r1239.5 = 1). The pulses cannot be enabled. The internal voltage protection is selected (p1231 = 3).

**Remedy:** If the Motor Module supports the autonomous internal voltage protection (r0192.10 = 1), then the Motor Module automatically decides - using the DC link voltage - as to whether the armature short-circuit should be activated. The armature short-circuit is activated and response OFF2 is initiated if the DC link voltage exceeds 800 V. If the DC link voltage falls below 450 V, then the armature short-circuit is withdrawn. If the motor is still in a critical speed range, the armature short-circuit is re-activated once the DC link voltage exceeds the threshold of 800 V. If the autonomous (independent) internal voltage protection is active (r1239.5 = 1) and the line supply returns (450 V < DC link voltage < 800 V), the armature short-circuit is withdrawn after 3 minutes.

## 207930 <location>Drive: Brake control error

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The Control Unit has detected a brake control error.  
Fault value (r0949, decimal interpretation):  
10, 11: Fault in "open holding brake" operation.  
- No brake connected or wire breakage (check whether brake releases for p1278 = 1).  
- Ground fault in brake cable.  
20: Fault in "brake open" state.  
- Short-circuit in brake winding.  
30, 31: Fault in "close holding brake" operation.  
- No brake connected or wire breakage (check whether brake releases for p1278 = 1).  
- Short-circuit in brake winding.  
40: Fault in "brake closed" state.  
50: Fault in the brake control circuit of the Control Unit or communication fault between Control Unit and Motor Module (brake control diagnostics).  
80: When using the Safe Brake Adaptor (SBA), a fault has occurred in the brake control of the Control Unit.

**Note:**  
The following causes may apply to fault values:  
- motor cable is not shielded correctly.  
- defect in control circuit of the Motor Module.  
See also: p1278 (Brake control, diagnostics evaluation)

**Remedy:** - check the motor holding brake connection.  
- check the function of the motor holding brake.  
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.  
- check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).  
- replace the Motor Module involved.

Operation with Safe Brake Module:  
 - check the Safe Brake Modules connection.  
 - replace the Safe Brake Module.  
 Operation with Safe Brake Module (SBA):  
 - check the SBA connection and if required, replace the SBA.  
 See also: p1215 (Motor holding brake configuration), p1278 (Brake control, diagnostics evaluation)

---

**207931**            **<location>Brake does not open**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                This alarm is output for r1229.4 = 1.  
                             See also: p1216 (Motor holding brake, opening time), r1229 (Motor holding brake status word)  
**Remedy:**               - check the functionality of the motor holding brake.  
                             - check the feedback signal (p1223).

---

**207932**            **<location>Brake does not close**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                This alarm is output for r1229.5 = 1.  
                             For r1229.5 = 1, OFF1/OFF3 are suppressed to prevent the drive accelerating by a load that drives the motor -  
                             whereby OFF2 remains effective.  
                             See also: p1217 (Motor holding brake closing time), r1229 (Motor holding brake status word)  
**Remedy:**               - check the functionality of the motor holding brake.  
                             - check the feedback signal (p1222).

---

**207934**            **<location>Drive: S120 Combi motor holding brake configuration**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE (OFF1, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY (POWER ON)  
**Cause:**                A connected motor holding brake has been detected with an S120 Combi. However, this brake has not been assigned  
                             to just one Combi feed drive and, therefore, brake control is not configured (correctly). It is also not permitted to assign  
                             the brake to the spindle.  
                             Fault value (r0949, decimal interpretation):  
                             0: No motor holding brake is assigned (p1215 = 0 or 3 on all S120 Combi feed drives).  
                             1: More than one motor holding brake has been assigned (p1215 = 1 or 2 on more than one S120 Combi feed drive)  
                             - or there is more than one DRIVE-CLiQ motor with motor holding brake.  
                             2: Brake was accidentally assigned to the spindle (p1215 = 1); this is not permitted.  
                             3: An attempt was made to enable the function "Safe brake control" (SBC, p9602 = p9802 = 1) for the spindle. This is  
                             not permitted.  
**Remedy:**               Check whether the motor holding brake has been assigned to one S120 Combi feed drive exclusively (p1215 = 1 or  
                             2) and not the spindle.  
                             The fault will only be withdrawn once the motor holding brake has been assigned to just one of the S120 Combi feed  
                             drives and not the spindle (p1215 = 1 or 2 for this one drive). From this point, the motor holding brake will be controlled  
                             by this drive.  
                             See also: p1215 (Motor holding brake configuration)

---

<b>207935</b>	<b>&lt;location&gt;Drv: Motor holding brake detected</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE (OFF1, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A motor holding brake was detected where the brake control has not been configured (p1215 = 0). Fault value (r0949, decimal interpretation): 0: The brake control configuration was set to "motor holding brake the same as sequence control" (p1215 = 1) (only when commissioning for the first time). 1: The brake control configuration was left at "No motor holding brake available" (p1215 = 0).
<b>Remedy:</b>	For fault value = 0: - No remedy required. For fault value = 1: - If required change the motor holding brake configuration (p1215 = 1, 2). - If this fault value unexpectedly occurs, then the motor connections should be checked in order to rule out that they have been interchanged. See also: p1215 (Motor holding brake configuration)

---

<b>207937</b>	<b>&lt;location&gt;Drive: Speed deviation between motor model and external speed</b>
<b>Message value:</b>	-
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2 (NONE, OFF1, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The absolute value of the speed difference from the two actual values (r2169, r1443) exceeds the tolerance threshold (p3236) for longer than permitted (p3238). Possible causes: - the interconnection or scaling of the external encoder signal is incorrect (p1440, p2000). - speed encoder for external encoder signal faulty. - encoder signal's polarity or gain incorrect. - smoothing time constant for model speed for monitoring too high (p2157). - smoothing time constant or threshold values for monitoring too low (p3236, p3238). See also: p2149 (Monitoring configuration)
<b>Remedy:</b>	- check that the external speed matches the motor speed (p1440, r1443). - check the polarity of the external speed (r1443). - check the interconnection of the connector input and the scaling of the signal (p1440, p2000).

---

<b>207940</b>	<b>&lt;location&gt;Sync-line-drive: Synchronization error</b>
<b>Message value:</b>	-
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	After synchronization has been completed, the phase difference (r3808) is greater than the threshold value, phase synchronism (p3813). OFF1 or OFF3 response, while the closed-loop phase control is active (r3819.6 = 1) or synchronism reached (r3819.2 = 1). Enable signal withdrawn (p3802 = 0), while the closed-loop phase control was active (r3819.6 = 1).
<b>Remedy:</b>	If required increase the threshold value phase synchronism (p3813) for synchronizing the line supply to the drive. Before OFF1 or OFF3, complete synchronizing (r03819.0 = 0). Before withdrawing the enable signal (p3802 = 0), reach synchronism (r3819.2 = 1). See also: p3813 (Sync-line-drive phase synchronism threshold value)

**207941 <location>Sync-line-drive: Target frequency not permissible**

**Message value:** Parameter: %1  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The target frequency is outside the permissible value range.  
 Alarm value (r2124, interpret decimal):  
 1084: Target frequency greater than the positive speed limit,  $f_{sync} > f_{max}$  (r1084).  
 1087: Target frequency less than the negative speed limit,  $f_{sync} < f_{min}$  (r1087).  
**Remedy:** Fulfill the conditions for the target frequency for line-drive synchronization.  
 See also: r1084, r1087

---

**207942 <location>Sync-line-drive: Setpoint frequency is completely different than the target frequency**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** There is a considerable difference between the setpoint frequency and the target frequency ( $f_{set} \ll f_{target}$ ). The deviation that can be tolerated is set in p3806.  
**Remedy:** The alarm automatically disappears after the difference that can be tolerated between the setpoint and target frequencies (p3806) is reached.  
 See also: p3806 (Sync-line-drive frequency difference threshold value)

---

**207943 <location>Sync-line-drive: Synchronization not permitted**

**Message value:** Parameter: %1  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Synchronization is not permitted.  
 Alarm value (r2124, interpret decimal):  
 1300: The control mode (p1300) has not been set to encoderless closed-loop speed control or U/f characteristic.  
 1910: Motor data identification activated.  
 1960: Speed controller optimization activated.  
 1990: Encoder adjustment activated.  
 3801: Voltage Sensing Module (VSM) not found.  
 3845: Friction characteristic record activated.  
**Remedy:** Fulfill the conditions for the line-drive synchronization.  
 Re alarm value = 1300:  
 Set the control mode (p1300) to encoderless closed-loop speed control (p1300 = 20) or U/f characteristic (p1300 = 0 ... 19).  
 Re alarm value = 1910:  
 Exit the motor data identification routine (p1910).  
 Re alarm value = 1960:  
 Exist the speed controller optimization routine (p1960).  
 Re alarm value = 1990:  
 Exit the encoder adjustment (p1990).

Re alarm value = 3801:

Connect the Voltage Sensing Module (VSM), assign it to the synchronizing drive (see p9910, p0151) and enter the drive object number of the synchronizing drive in p3801. When connecting the VSM to a neighboring drive object, ensure that the same current controller clock cycle p0115[0] exists as the one in the synchronizing drive.

Re alarm value = 3845:

Exit the friction characteristic record (p3845).

**207950****<location>Drive: Incorrect motor parameter**

**Message value:** Parameter: %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** - the motor parameters were incorrectly entered while commissioning (e.g. p0300 = 0, no motor)  
- The braking resistor (p6811) has still not been parameterized - commissioning cannot be completed.  
Fault value (r0949, decimal interpretation):

Parameter number involved.

The following motor parameters can be incorrect for fault value 307:

p0304, p0305, p0307, p0308, p0309

See also: p0300, p0301, p0304, p0305, p0307, p0310, p0311, p0314, p0315, p0316, p0320, p0322, p0323

**Remedy:** Compare the motor data with the rating plate data and if required, correct.

See also: p0300, p0301, p0304, p0305, p0307, p0310, p0311, p0314, p0316, p0320, p0322, p0323

**207955****<location>Drive: Motor has been changed**

**Message value:** Parameter: %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The code number of the actual motor with DRIVE-CLiQ does not match the saved number.

Fault value (r0949, decimal interpretation):

Number of the incorrect parameter.

See also: p0301 (Motor code number selection), r0302 (Motor code number of motor with DRIVE-CLiQ)

**Remedy:** Connect the original motor, power up the Control Unit again (POWER ON) and exit quick commissioning with p0010 = 0.

Or set p0300 = 10000 (load the parameters from the motor with DRIVE-CLiQ) and re-commission.

Quick commissioning (p0010 = 1) is automatically exited with p3900 > 0.

If quick commissioning was exited with p0010 = 0, then an automatic controller calculation (p0340 = 1) is not carried out.

**207956****<location>Drive: Motor code does not match the list (catalog) motor**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** The motor code of the connected motor with DRIVE-CLiQ does not match the possible list motor types (see selection in p0300).

The connected motor with DRIVE-CLiQ might not be supported by this firmware version.

Fault value (r0949, decimal interpretation):

Motor code of the connected motor with DRIVE-CLiQ.

Note: The first three digits of the motor code generally correspond to the list motor type.

**Remedy:** Use a motor with DRIVE-CLiQ and the matching motor code.

**207960**                    **<location>Drive: Incorrect friction characteristic**

**Message value:**        Parameter: %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The friction characteristic is incorrect.  
 Alarm value (r2124, interpret decimal):  
 1538:  
 The friction torque is greater than the maximum from the upper effective torque limit (p1538) and zero. This is the reason that the output of the friction characteristic (r3841) is limited to this value.  
 1539:  
 The friction torque is less than the minimum from the lower effective torque limit (p1539) and zero. This is the reason that the output of the friction characteristic (r3841) is limited to this value.  
 3820 ... 3829:  
 Incorrect parameter number. The speeds entered in the parameters for the friction characteristic do not correspond to the following condition:  
 $0.0 < p3820 < p3821 < \dots < p3829 \leq p0322$  or  $p1082$ , if  $p0322 = 0$   
 Therefore the output of the friction characteristic (r3841) is set to zero.  
 3830 ... 3839:  
 Incorrect parameter number. The torques entered in the parameters for the friction characteristic do not correspond to the following condition:  
 $0 \leq p3830, p3831 \dots p3839 \leq p0333$   
 Therefore the output of the friction characteristic (r3841) is set to zero.  
 See also: r3840 (Friction characteristic, status word)

**Remedy:**                Fulfill the conditions for the friction characteristic.  
 Re alarm value = 1538:  
 Check the upper effective torque limit (e.g. in the field weakening range).  
 Re alarm value = 1539:  
 Check the lower effective torque limit (e.g. in the field weakening range).  
 Re alarm value = 3820 ... 3839:  
 Fulfill the conditions to set the parameters of the friction characteristic.  
 If the motor data (e.g. the maximum speed p0322) are changed during commissioning (p0010 = 1, 3), then the technological limits and threshold values, dependent on this, must be re-calculated by selecting p0340= 5).

---

**207961**                    **<location>Drive: Friction characteristic record activated**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The automatic friction characteristic record is activated.  
 The friction characteristic is recorded at the next power-on command.

**Remedy:**                Not necessary.  
 The alarm disappears automatically after the friction characteristic record has been successfully completed or the record is de-activated (p3845 = 0).

---

**207963**                    **<location>Drive: Friction characteristic record interrupted**

**Message value:**        Parameter: %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF1

**Acknowledge:**        IMMEDIATELY



<b>Cause:</b>	<p>The conditions to record the friction characteristic are not fulfilled.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>0046: Missing enable signals (r0046).</p> <p>1082: The highest speed value to be approached (p3829) is greater than the maximum speed (p1082).</p> <p>1084: The highest speed value to be approached (p3829) is greater than the maximum speed (r1084, p1083, p1085).</p> <p>1087: The highest speed value to be approached (p3829) is greater than the maximum speed (r1087, p1086, p1088).</p> <p>1110: Friction characteristic record, negative direction selected (p3845) and negative direction inhibited (p1110).</p> <p>1111: Friction characteristic record, positive direction selected (p3845) and positive direction inhibited (p1111).</p> <p>1198: Friction characteristic record selected (p3845 &gt; 0) and negative (p1110) and positive directions (p1111) inhibited (r1198).</p> <p>1300: The control mode (p1300) has not been set to closed-loop speed control.</p> <p>1755: For encoderless closed-loop control (p1300 = 20), the lowest speed value to be approached (p3820) is less than or equal to the changeover speed, open-loop controlled operation (p1755).</p> <p>1910: Motor data identification activated.</p> <p>1960: Speed controller optimization activated.</p> <p>3820 ... 3829: Speed (p382x) cannot be approached.</p> <p>3840: Friction characteristic incorrect.</p> <p>3845: Friction characteristic record de-selected.</p>
<b>Remedy:</b>	<p>Fulfill the conditions to record the friction characteristic.</p> <p>Re fault value = 0046:</p> <ul style="list-style-type: none"> <li>- establish missing enable signals.</li> </ul> <p>Re fault value = 1082, 1084, 1087:</p> <ul style="list-style-type: none"> <li>- Select the highest speed value to be approached (p3829) less than or equal to the maximum speed (p1082, r1084, r1087).</li> <li>- Re-calculate the speed points along the friction characteristic (p0340 = 5).</li> </ul> <p>For fault value = 1110:</p> <ul style="list-style-type: none"> <li>- Select the friction characteristic record, positive direction (p3845).</li> </ul> <p>For fault value = 1111:</p> <ul style="list-style-type: none"> <li>- Select the friction characteristic record, negative direction (p3845).</li> </ul> <p>For fault value = 1198:</p> <ul style="list-style-type: none"> <li>- Enable the permitted direction (p1110, p1111, r1198).</li> </ul> <p>For fault value = 1300:</p> <ul style="list-style-type: none"> <li>- Set the control mode (p1300) on the closed-loop speed control (p1300 = 20, 21).</li> </ul> <p>For fault value = 1755:</p> <ul style="list-style-type: none"> <li>- For encoderless closed-loop speed control (p1300 = 20) select the lowest speed value to be approached (p3820) greater than the changeover speed of open-loop controlled operation (p1755).</li> <li>- Re-calculate the speed points along the friction characteristic (p0340 = 5).</li> </ul> <p>For fault value = 1910:</p> <ul style="list-style-type: none"> <li>- Exit the motor data identification routine (p1910).</li> </ul> <p>For fault value = 1960:</p> <ul style="list-style-type: none"> <li>- Exit the speed controller optimization routine (p1960).</li> </ul> <p>Re fault value 3820 ... 3829:</p> <ul style="list-style-type: none"> <li>- check the load at speed p382x.</li> <li>- check the speed signal (r0063) for oscillation at speed p382x. Check the settings of the speed controller if applicable.</li> </ul> <p>For fault value = 3840:</p> <ul style="list-style-type: none"> <li>- Make the friction characteristic error-free (p3820 ... p3829, p3830 ... p3839, p3840).</li> </ul> <p>For fault value = 3845:</p> <ul style="list-style-type: none"> <li>- Activate the friction characteristic record (p3845).</li> </ul>

---

## 207965 <location>Drive: Save required

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>The angular commutation offset (p0431) was re-defined and has still not been saved.</p> <p>In order to permanently accept the new value, it must be saved in a non-volatile fashion (p0971, p0977).</p> <p>See also: p0431 (Angular commutation offset), p1990 (Encoder adjustment, determine angular commutation offset)</p>

**Remedy:** Not necessary.  
 This alarm automatically disappears after the data has been saved.  
 See also: p0971 (Save drive object parameters), p0977 (Save all parameters)

**207966 <location>Drive: Check the commutation angle**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The speed actual value was inverted and the associated angular commutation offset is not equal to zero and is therefore possibly incorrect.  
**Remedy:** Angular commutation offset after the actual value inversion or determine it again (p1990=1).

**207967 <location>Drive: Automatic encoder adjustment incorrect**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred during the automatic encoder adjustment or the pole position identification.  
 Only for internal Siemens troubleshooting.  
**Remedy:** Carry out a POWER ON.

**207968 <location>Drive: Lq-Ld measurement incorrect**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred during the Lq-Ld measurement.  
 Fault value (r0949, decimal interpretation):  
 10: Stage 1: The ratio between the measured current and zero current is too low.  
 12: Stage 1: The maximum current was exceeded.  
 15: Second harmonic too low.  
 16: Drive converter too small for the measuring technique.  
 17: Abort due to pulse inhibit.  
**Remedy:** For fault value = 10:  
 Check whether the motor is correctly connected.  
 Replace the power unit involved.  
 De-activate technique (p1909).  
 For fault value = 12:  
 Check whether motor data have been correctly entered.  
 De-activate technique (p1909).  
 For fault value = 16:  
 De-activate technique (p1909).  
 For fault value = 17:  
 Repeat technique.

<b>207969</b>	<b>&lt;location&gt;Drive: Incorrect pole position identification</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>A fault has occurred during the pole position identification routine.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>1: Current controller limited</p> <p>2: Motor shaft locked.</p> <p>4: Encoder speed signal not plausible.</p> <p>10: Stage 1: The ratio between the measured current and zero current is too low.</p> <p>11: Stage 2: The ratio between the measured current and zero current is too low.</p> <p>12: Stage 1: The maximum current was exceeded.</p> <p>13: Stage 2: The maximum current was exceeded.</p> <p>14: Current difference to determine the +d axis too low.</p> <p>15: Second harmonic too low.</p> <p>16: Drive converter too small for the measuring technique.</p> <p>17: Abort due to pulse inhibit.</p> <p>18: First harmonic too low.</p> <p>20: Pole position identification requested with the motor shaft rotating and activated flying restart function.</p>
<b>Remedy:</b>	<p>For fault value = 1:</p> <p>Check whether the motor is correctly connected.</p> <p>Check whether motor data have been correctly entered.</p> <p>Replace the Motor Module involved.</p> <p>For fault value = 2:</p> <p>Open the motor holding brake (p1215 = 2) and bring the motor into a no-load condition.</p> <p>For fault value = 4:</p> <p>Check whether the encoder pulse number (p0408) and gearbox factor (p0432, p0433) are correct.</p> <p>Check whether the motor pole pair number is correct (p0314).</p> <p>For fault value = 10:</p> <p>When selecting p1980 = 4: Increase the value for p0325.</p> <p>When selecting p1980 = 1: Increase the value for p0329.</p> <p>Check whether the motor is correctly connected.</p> <p>Replace the Motor Module involved.</p> <p>For fault value = 11:</p> <p>Increase the value for p0329.</p> <p>Check whether the motor is correctly connected.</p> <p>Replace the Motor Module involved.</p> <p>For fault value = 12:</p> <p>When selecting p1980 = 4: Reduce the value for p0325.</p> <p>When selecting p1980 = 1: Reduce the value for p0329.</p> <p>Check whether motor data have been correctly entered.</p> <p>For fault value = 13:</p> <p>Reduce the value for p0329.</p> <p>Check whether motor data have been correctly entered.</p> <p>For fault value = 14:</p> <p>Increase the value for p0329.</p> <p>For fault value = 15:</p> <p>Increase the value for p0325.</p> <p>Motor not sufficiently anisotropic, change the technique (p1980 = 1 or 10).</p> <p>For fault value = 16:</p> <p>De-activate technique (p1982).</p> <p>For fault value = 17:</p> <p>Repeat technique.</p> <p>For fault value = 18:</p> <p>Increase the value for p0329.</p> <p>Saturation not sufficient, change the technique (p1980 = 10).</p> <p>For fault value = 20:</p> <p>Before carrying out a pole position identification routine ensure that the motor shaft is absolutely stationary (zero speed).</p>

**207970 <location>Drive: Automatic encoder adjustment incorrect**

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF2 (NONE)

**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred during the automatic encoder adjustment.  
 Fault value (r0949, decimal):  
 1: Current controller limited  
 2: Motor shaft locked.  
 4: Encoder speed signal not plausible.  
 10: Stage 1: The ratio between the measured current and zero current is too low.  
 11: Stage 2: The ratio between the measured current and zero current is too low.  
 12: Stage 1: The maximum current was exceeded.  
 13: Stage 2: The maximum current was exceeded.  
 14: Current difference to determine the +d axis too low.  
 15: Second harmonic too low.  
 16: Drive converter too small for the measuring technique.  
 17: Abort due to pulse inhibit.

**Remedy:** For fault value = 1:  
 Check whether the motor is correctly connected.  
 Check whether motor data have been correctly entered.  
 Replace the power unit involved.  
 For fault value = 2:  
 Open the motor holding brake (p1215 = 2) and bring the motor into a no-load condition.  
 For fault value = 4:  
 Check whether the speed actual value inversion is correct (p0410.0).  
 Check whether the motor is correctly connected.  
 Check whether the encoder pulse number (p0408) and gearbox factor (p0432, p0433) are correct.  
 Check whether the motor pole pair number is correct (p0314).  
 For fault value = 10:  
 Increase the value for p0325.  
 Check whether the motor is correctly connected.  
 Replace the power unit involved.  
 For fault value = 11:  
 Increase the value for p0329.  
 Check whether the motor is correctly connected.  
 Replace the power unit involved.  
 For fault value = 12:  
 Reduce the value for p0325.  
 Check whether motor data have been correctly entered.  
 For fault value = 13:  
 Reduce the value for p0329.  
 Check whether motor data have been correctly entered.  
 For fault value = 14:  
 Increase the value for p0329.  
 For fault value = 15:  
 Increase the value for p0325.  
 For fault value = 16:  
 De-activate technique (p1982).  
 For fault value = 17:  
 Repeat technique.

---

**207971**            **<location>Drive: Angular commutation offset determination activated**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The automatic determination of the angular commutation offset (encoder adjustment) is activated (p1990 = 1).  
The automatic determination is carried out at the next power-on command.  
For SERVO and fault F07414 present, the following applies:  
The determination of the angular commutation offset is automatically activated (p1990 = 1), if a pole position identification technique is set in p1980.  
See also: p1990 (Encoder adjustment, determine angular commutation offset)

**Remedy:**                Not necessary.  
The alarm automatically disappears after determination or for the setting p1990 = 0.

---

**207971**            **<location>Drive: Angular commutation offset determination activated**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The automatic determination of the angular commutation offset (encoder adjustment) is activated (p1990 = 1).  
The automatic determination is carried out at the next power-on command.  
See also: p1990 (Encoder adjustment, determine angular commutation offset)

**Remedy:**                Not necessary.  
The alarm automatically disappears after determination or for the setting p1990 = 0.

---

**207980**            **<location>Drive: Rotating measurement activated**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The rotating measurement is activated. For the rotating measurement, the motor can accelerate up to the maximum speed and with maximum torque. Only the parameterized current limit (p0640) and the maximum speed (p1082) are effective. The behavior of the motor can be influenced using the direction inhibit (p1959.14, p1959.15) and the ramp-up/ramp-down time (p1958).  
The rotating measurement is carried out at the next power-on command.  
See also: p1960

**Remedy:**                Not necessary.  
The alarm automatically disappears after the rotating measurement has been successfully completed or for the setting p1960 = 0.  
Note:  
If a POWER ON or a warm restart is performed with motor data identification selected, the motor data identification request will be lost. If motor data identification is required, it will need to be selected again manually following ramp-up.

---

**207980**            **<location>Drive: Rotating measurement activated**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:** The rotating measurement (automatic speed controller optimization) is activated.  
 The rotating measurement is carried out at the next power-on command.  
 See also: p1960

**Remedy:** Not necessary.  
 The alarm disappears automatically after the speed controller optimization has been successfully completed or for the setting p1900 = 0.

**207981 <location>Drive: Enable signals for the rotating measurement missing**

**Message value:** -

**Drive object:** VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The rotating measurement cannot be started due to missing enable signals.

**Remedy:** - acknowledge faults that are present.  
 - establish missing enable signals.  
 See also: r0002, r0046

**207982 <location>Drive: Rotating measurement encoder test**

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF1 (NONE, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred during the encoder test.  
 Fault value (r0949, decimal interpretation):  
 1: The speed did not reach a steady-state condition.  
 2: The speed setpoint was not able to be approached as the minimum limiting is active.  
 3: The speed setpoint was not able to be approached as the suppression (skip) bandwidth is active.  
 4: The speed setpoint was not able to be approached as the maximum limiting is active.  
 5: The encoder does not supply a signal.  
 6: Incorrect polarity.  
 7: Incorrect pulse number.  
 8: Noise in the encoder signal or speed controller unstable.  
 9: Voltage Sensing Module (VSM) incorrectly connected.

**Remedy:** For fault value = 1:  
 - check the motor parameters.  
 - carry out a motor data identification routine (p1910).  
 - if required, reduce the dynamic factor (p1967 < 25 %).  
 For fault value = 2:  
 - adapt the speed setpoint (p1965) or adapt the minimum limit (p1080).  
 For fault value = 3:  
 - adapt the speed setpoint (p1965) or suppression (skip) bandwidths (p1091 ... p1094, p1101).  
 For fault value = 4:  
 - adapt the speed setpoint (p1965) or maximum limit (p1082, p1083 and p1086).  
 For fault value = 5:  
 - check the encoder connection. If required, replace the encoder.  
 For fault value = 6:  
 - check the connection assignment of the encoder cable. Adapt the polarity (p0410).  
 For fault value = 7:  
 - adapt the pulse number (p0408).

For fault value = 8:

- check the encoder connection and encoder cable. It is possible that there is a problem associated with the ground connection.
- reduce the dynamic response of the speed controller (p1460, p1462 and p1470, p1472).

For fault value = 9:

- check the connections of the Voltage Sensing Module (VSM).

Note:

The encoder test can be switched out (disabled) using p1959.0.

See also: p1959

## 207983

### <location>Drive: Rotating measurement saturation characteristic

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF1 (NONE, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:**

A fault has occurred while determining the saturation characteristic.

Fault value (r0949, decimal interpretation):

- 1: The speed did not reach a steady-state condition.
- 2: The rotor flux did not reach a steady-state condition.
- 3: The adaptation circuit did not reach a steady-state condition.
- 4: The adaptation circuit was not enabled.
- 5: Field weakening active.
- 6: The speed setpoint was not able to be approached as the minimum limiting is active.
- 7: The speed setpoint was not able to be approached as the suppression (skip) bandwidth is active.
- 8: The speed setpoint was not able to be approached as the maximum limiting is active.
- 9: Several values of the determined saturation characteristic are not plausible.
- 10: Saturation characteristic could not be sensibly determined because load torque too high.

**Remedy:**

For fault value = 1:

- the total drive moment of inertia is far higher than that of the motor (p0341, p0342).

De-select rotating measurement (p1960), enter the moment of inertia p0342, re-calculate the speed controller p0340 = 4 and repeat the measurement.

Re fault value = 1 ... 2:

- increase the measuring speed (p1961) and repeat the measurement.

Re fault value = 1 ... 4:

- check the motor parameters (rating plate data). After the change: Calculate p0340 = 3.
- check the moment of inertia (p0341, p0342). After the change: Calculate p0340 = 3.
- carry out a motor data identification routine (p1910).
- if required, reduce the dynamic factor (p1967 < 25 %).

For fault value = 5:

- the speed setpoint (p1961) is too high. Reduce the speed.

For fault value = 6:

- adapt the speed setpoint (p1961) or minimum limiting (p1080).

For fault value = 7:

- adapt the speed setpoint (p1961) or suppression (skip) bandwidths (p1091 ... p1094, p1101).

For fault value = 8:

- adapt the speed setpoint (p1961) or maximum limit (p1082, p1083 and p1086).

Re fault value = 9, 10:

- the measurement was carried out at an operating point where the load torque is too high. Select a more suitable operating point, either by changing the speed setpoint (p1961) or by reducing the load torque. The load torque may not be varied while making measurements.

Note:

The saturation characteristic identification routine can be disabled using p1959.1.

See also: p1959

**207984 <location>Drive: Speed controller optimization, moment of inertia**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF1 (NONE, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred while identifying the moment of inertia.  
 Fault value (r0949, decimal interpretation):  
 1: The speed did not reach a steady-state condition.  
 2: The speed setpoint was not able to be approached as the minimum limiting is active.  
 3: The speed setpoint was not able to be approached as the suppression (skip) bandwidth is active.  
 4: The speed setpoint was not able to be approached as the maximum limiting is active.  
 5: It is not possible to increase the speed by 10% as the minimum limiting is active.  
 6: It is not possible to increase the speed by 10% as the suppression (skip) bandwidth is active.  
 7: It is not possible to increase the speed by 10% as the maximum limiting is active.  
 8: The torque difference after the speed setpoint step is too low in order to be able to still reliably identify the moment of inertia.  
 9: Too few data to be able to reliably identify the moment of inertia.  
 10: After the setpoint step, the speed either changed too little or in the incorrect direction.  
 11: The identified moment of inertia is not plausible.  
**Remedy:** For fault value = 1:  
 - check the motor parameters (rating plate data). After the change: Calculate p0340 = 3.  
 - check the moment of inertia (p0341, p0342). After the change: Calculate p0340 = 3.  
 - carry out a motor data identification routine (p1910).  
 - if required, reduce the dynamic factor (p1967 < 25 %).  
 Re fault value = 2, 5:  
 - adapt the speed setpoint (p1965) or adapt the minimum limit (p1080).  
 Re fault value = 3, 6:  
 - adapt the speed setpoint (p1965) or suppression (skip) bandwidths (p1091 ... p1094, p1101).  
 Re fault value = 4, 7:  
 - adapt the speed setpoint (p1965) or maximum limit (p1082, p1083 and p1086).  
 For fault value = 8:  
 - the total drive moment of inertia is far higher than that of the motor (refer to p0341, p0342). De-select rotating measurement (p1960), enter the moment of inertia p0342, re-calculate the speed controller p0340 = 4 and repeat the measurement.  
 For fault value = 9:  
 - check the moment of inertia (p0341, p0342). After the change, re-calculate (p0340 = 3 or 4).  
 For fault value = 10:  
 - check the moment of inertia (p0341, p0342). After the change: Calculate p0340 = 3.  
 Note:  
 The moment of inertia identification routine can be disabled using p1959.2.  
 See also: p1959

---

**207985 <location>Drive: Speed controller optimization (oscillation test)**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF1 (NONE, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred during the vibration test.  
 Fault value (r0949, decimal interpretation):  
 1: The speed did not reach a steady-state condition.  
 2: The speed setpoint was not able to be approached as the minimum limiting is active.  
 3: The speed setpoint was not able to be approached as the suppression (skip) bandwidth is active.  
 4: The speed setpoint was not able to be approached as the maximum limiting is active.  
 5: Torque limits too low for a torque step.  
 6: No suitable speed controller setting was found.



**Remedy:**

- For fault value = 1:
  - check the motor parameters (rating plate data). After the change: Calculate p0340 = 3.
  - check the moment of inertia (p0341, p0342). After the change: Calculate p0340 = 3.
  - carry out a motor data identification routine (p1910).
  - if required, reduce the dynamic factor (p1967 < 25 %).
- For fault value = 2:
  - adapt the speed setpoint (p1965) or adapt the minimum limit (p1080).
- For fault value = 3:
  - adapt the speed setpoint (p1965) or suppression (skip) bandwidths (p1091 ... p1094, p1101).
- For fault value = 4:
  - adapt the speed setpoint (p1965) or maximum limit (p1082, p1083 and p1086).
- For fault value = 5:
  - increase the torque limits (e.g. p1520, p1521).
- For fault value = 6:
  - reduce the dynamic factor (p1967).
  - disable the vibration test (p1959.4 = 0) and repeat the rotating measurement.

See also: p1959

---

**207986**                    **<location>Drive: Rotating measurement ramp-function generator**

**Message value:**        %1  
**Drive object:**         VECTOR  
**Reaction:**              OFF1 (NONE, OFF2)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                During the rotating measurements, problems with the ramp-function generator occurred.  
                               Fault value (r0949, decimal interpretation):  
                               1: The positive and negative directions are inhibited.  
**Remedy:**                For fault value = 1:  
                               Enable the direction (p1110 or p1111).

---

**207987**                    **<location>Drive: Rotating measurement, no encoder available**

**Message value:**        %1  
**Drive object:**         VECTOR  
**Reaction:**              NONE  
**Acknowledge:**        NONE  
**Cause:**                No encoder available. The rotating measurement was carried out without encoder.  
**Remedy:**                Connect encoder or select p1960 = 1, 3.

---

**207988**                    **<location>Drive: Rotating measurement, no configuration selected**

**Message value:**        -  
**Drive object:**         VECTOR  
**Reaction:**              OFF2 (NONE, OFF1)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                When configuring the rotating measurement (p1959), no function was selected.  
**Remedy:**                Select at least one function for automatic optimization of the speed controller (p1959).  
                               See also: p1959

**207989** <location>Drive: Rotating measurement leakage inductance (q-axis)

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF1 (NONE, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** An error has occurred while measuring the dynamic leakage inductance.  
 Fault value (r0949, decimal interpretation):  
 1: The speed did not reach a steady-state condition.  
 2: The speed setpoint was not able to be approached as the minimum limiting is active.  
 3: The speed setpoint was not able to be approached as the suppression (skip) bandwidth is active.  
 4: The speed setpoint was not able to be approached as the maximum limiting is active.  
 5: The 100% flux setpoint was not reached.  
 6: No Lq measurement possible because field weakening is active.  
 7: Speed actual value exceeds the maximum speed p1082 or 75% of the rated motor speed.  
 8: Speed actual value is below 2 % of the rated motor speed.

**Remedy:** For fault value = 1:  
 - check the motor parameters.  
 - carry out a motor data identification routine (p1910).  
 - if required, reduce the dynamic factor (p1967 < 25 %).  
 For fault value = 2:  
 - adapt the speed setpoint (p1965) or adapt the minimum limit (p1080).  
 For fault value = 3:  
 - adapt the speed setpoint (p1965) or suppression (skip) bandwidths (p1091 ... p1094, p1101).  
 For fault value = 4:  
 - adapt the speed setpoint (p1965) or maximum limit (p1082, p1083 and p1086).  
 For fault value = 5:  
 - flux setpoint p1570 = 100 % and current setpoint p1610 = 0 % kept during the Lq measurement.  
 For fault value = 6:  
 - reduce the regenerative load so that the drive does not reach field weakening when accelerating.  
 - reduce p1965 so that the q leakage inductance is recorded at lower speeds.  
 For fault value = 7:  
 - increase p1082 if this is technically permissible.  
 - reduce p1965 so that the q leakage inductance is recorded at lower speeds.  
 For fault value = 8:  
 - reduce the load when motoring so that the drive is not braked.  
 - increase p1965 so that the measurement may be taken at higher speeds.  
 Note:  
 The measurement of the q leakage inductance can be disabled using p1959.5. If only p1959.5 is set, then only this measurement is carried out if p1960 is set to 1, 2 and the drive is powered up.  
 See also: p1959

---

**207990** <location>Drive: Incorrect motor data identification

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2 (NONE, OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred during the identification routine.  
 Fault value (r0949, decimal interpretation):  
 1: Current limit value reached.  
 2: Identified stator resistance lies outside the expected range 0.1 ... 100% of Zn.  
 3: Identified rotor resistance lies outside the expected range 0.1 ... 100% of Zn.  
 4: Identified stator reactance lies outside the expected range 50 ... 500% of Zn.  
 5: Identified magnetizing reactance lies outside the expected range 50 ... 500% of Zn.

- 6: Identified rotor time constant lies outside the expected range 10 ms ... 5 s.  
 7: Identified total leakage reactance lies outside the expected range 4 ... 50% of Zn.  
 8: Identified stator leakage reactance lies outside the expected range 2 ... 50% of Zn.  
 9: Identified rotor leakage reactance lies outside the expected range 2 ... 50% of Zn.  
 10: Data set changeover during motor data identification.  
 11: Motor shaft rotates.  
 20: Identified threshold voltage of the semiconductor devices lies outside the expected range 0 ... 10 V.  
 30: Current controller in voltage limiting.  
 40: At least one identification contains errors. The identified parameters are not saved to prevent inconsistencies.  
 50: With the selected current controller sampling rate, the pulse frequency cannot be implemented.
- Note:  
 Percentage values are referred to the rated motor impedance:  
 $Z_n = V_{mot,nom} / \sqrt{3} / I_{mot,nom}$
- 101: Voltage amplitude even at 30% maximum current amplitude is too low to measure the inductance.  
 102, 104: Voltage limiting while measuring the inductance.  
 103: Maximum frequency exceeded during the rotating inductance measurement.  
 110: Motor not finely synchronized before the rotating measurement.  
 111: The zero mark is not received within 2 revolutions.  
 112: Fine synchronization is not realized within 8 seconds after the zero mark has been passed.  
 113: The power, torque or current limit is zero.  
 115: U/f control is active.  
 120: Error when evaluating the magnetizing inductance.  
 125: Cable resistance greater than the total resistance.  
 126: Series inductance greater than the total leakage inductance.  
 127: Identified leakage inductance negative.  
 128: Identified stator resistance negative.  
 129: Identified rotor resistance negative.  
 130: Drive data set changeover during the motor data identification routine.  
 140: The setpoint channel inhibits both directions.  
 160: Accelerating when determining kT, moment of inertia or reluctance torque too short or the accelerating time is too long.  
 173: Internal problem.  
 180: Identification speed (maximum speed, rated speed, 0.9 x p0348) less than p1755.  
 190: Speed setpoint not equal to zero.  
 191: An actual speed of zero is not reached.  
 192: Speed setpoint not reached.  
 193: Inadmissible motion of the motor when identifying the voltage emulation error.  
 194: Supplementary torque (r1515) not equal to zero.  
 195: Closed-loop torque control active.  
 200, 201: Not possible to identify the voltage emulation error characteristic of the drive converter (p1952, p1953).

**Remedy:**

- For fault value = 0:  
 - check whether the motor is correctly connected. Observe configuration (star-delta).
- Re fault value = 1 ... 40:  
 - check whether motor data have been correctly entered in p0300, p0304 ... p0311.  
 - is there an appropriate relationship between the motor power rating and that of the Motor Module? The ratio of the Motor Module to the rated motor current should not be less than 0.5 and not be greater than 4.  
 - check configuration (star-delta).
- For fault value = 2:  
 - for parallel circuits, check the motor winding system in p7003. If, for power units connected in parallel, a motor is specified with a single-winding system (p7003 = 0), although a multi-winding system is being used, then a large proportion of the stator resistance is interpreted as feeder cable resistance and entered in p0352.
- Re fault value = 4, 7:  
 - check whether inductances are correctly entered in p0233 and p0353.  
 - check whether motor has been correctly connected (star-delta).
- For fault value = 50:  
 - reduce the current controller sampling rate.
- For fault value = 101:  
 - increase current limit (p0640) or torque limit (p1520, p1521).  
 - check current controller gain (p1715).  
 - reduce current controller sampling time (p0115).
- It may be impossible to completely identify the L characteristic, as required current amplitude is too high.  
 - suppress meas. (p1909, p1959).

Re fault value = 102, 104:

- reduce current limit (p0640).
- check current controller P gain.
- suppress meas. (p1909, p1959).

For fault value = 103:

- increase external moment of inertia (if possible).
- reduce current controller sampling time (p0115).
- suppress meas. (p1909, p1959).

For fault value = 110:

- before rotating measurement, traverse motor over zero mark.

For fault value = 111:

- it is possible that encoder does not have zero mark. Correct setting in p0404.15.
- encoder pulse number was incorrectly entered. Correct setting in p0408.
- if zero mark signal is defective, replace encoder.

For fault value = 112:

- upgrade encoder software.

For fault value = 113:

- check the limits (p0640, p1520, p1521, p1530, p1531), correct the zero values.

For fault value = 115:

- de-select U/f control (p1317 = 0).

For fault value = 120:

- check current controller P gain (p1715) and if required, reduce.
- increase the pulse frequency (p1800).

For fault value = 125:

- reduce cable resistance (p0352).

For fault value = 126:

- reduce series inductance (p0353).

Re fault = 127, 128, 129:

- it is possible that current controller is oscillating. Reduce p1715 before next measurement.

For fault value = 130:

- do not initiate a drive data set changeover during motor ident. routine.

For fault value = 140:

- before the measurement, enable at least one direction (p1110 = 0 or p1111 = 0 or p1959.14 = 1 or p1959.15 = 1).

For fault value = 160:

- extend accelerating time when determining kT, moment of inertia and reluctance torque, e.g. by increasing max. speed (p1082), increasing moment of inertia or reducing max. current (p0640).
- in encoderless operation with load moment of inertia, parameterize the load moment of inertia (p1498).
- reduce the ramp-up time (p1958).
- increase speed controller P-gain (p1460).
- suppress meas. (p1959).

For fault value = 173:

-

For fault value = 180:

- increase max. speed (p1082).
- reduce p1755.
- suppress meas. (p1909, p1959).

For fault value = 190:

- set speed setpoint to zero.

For fault value = 191:

- do not start motor data ident. routine while motor is still rotating.

For fault value = 192:

- check closed-loop speed control (motor rotor may be locked or closed-loop speed control is not functioning).
- for p1215 = 1, 3 (brake the same as the sequence control) check the control sense (p0410.0).
- ensure that enable signals are present during measurement.
- remove any pulling loads from motor.
- increase max. current (p0640).
- reduce max. speed (p1082).
- suppress meas. (p1959).

For fault value = 193:

- the motor has moved through more than 5 ° electrical (r0093). Lock motor rotor at one of these pole position angles (r0093): 90 °, 210 ° or 330 ° (+/-5 °) and then start identification.

For fault value = 194:

- switch out all supplementary torques (e.g. CI: p1511).

- for hanging/suspended axes: Lock motor rotor at one of these pole position angles (r0093): 90 °, 210 ° or 330 ° (+/- 1 °) and then start identification.
- For fault value = 195:
  - de-select closed-loop torque control (p1300 = 21 or 20, or set the signal source in p1501 to a 0 signal).
- Re fault value = 200, 201:
  - set pulse frequency to 0.5 x current controller frequency (e.g. 4 kHz for a current controller clock cycle of 125 us).
  - reduce cable length between Motor Module and motor.
  - read-out measured values (r1950, r1951) and therefore determine suitable values for p1952, p1953 according to your own estimation.

---

## 207990 <location>Drive: Incorrect motor data identification

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF2 (NONE, OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:**

A fault has occurred during the identification routine.

Fault value (r0949, decimal interpretation):

1: Current limit value reached.

2: Identified stator resistance lies outside the expected range 0.1 ... 100% of Zn.

3: Identified rotor resistance lies outside the expected range 0.1 ... 100% of Zn.

Separately excited synchronous motors: damping resistance outside 1.0 ... 15 % of Zn.

4: Identified stator reactance lies outside the expected range 50 ... 900 % of Zn.

Separately excited synchronous motors: stator reactance outside 20 ... 500 % of Zn.

5: Identified magnetizing reactance lies outside the expected range 50 ... 900 % of Zn.

Separately excited synchronous motors: magnetizing reactance outside 20 ... 500 % of Zn.

6: Identified rotor time constant lies outside the expected range 10 ms ... 5 s.

Separately excited synchronous motors: damping time constant outside 5 ms ... 1 s.

7: Identified total leakage reactance lies outside the expected range 4 ... 100 % of Zn.

8: Identified stator leakage reactance lies outside the expected range 2 ... 50% of Zn.

Separately excited synchronous motors: stator leakage reactance outside 2 ... 40 % of Zn.

9: Identified rotor leakage reactance lies outside the expected range 2 ... 50% of Zn.

Separately excited synchronous motors: damping leakage reactance outside 1.5 ... 20 % of Zn.

10: Motor has been incorrectly connected.

11: Motor shaft rotates.

20: Identified threshold voltage of the semiconductor devices lies outside the expected range 0 ... 10 V.

30: Current controller in voltage limiting.

40: At least one identification contains errors. The identified parameters are not saved to prevent inconsistencies.

Note:

Percentage values are referred to the rated motor impedance:

$Z_n = V_{mot,nom} / \sqrt{3} / I_{mot,nom}$

**Remedy:**

For fault value = 0:

- check whether the motor is correctly connected. Observe configuration (star-delta).

Re fault value = 1 ... 40:

- check whether motor data have been correctly entered in p0300, p0304 ... p0311.

- is there an appropriate relationship between the motor power rating and that of the Motor Module? The ratio of the Motor Module to the rated motor current should not be less than 0.5 and not be greater than 4.

- check configuration (star-delta).

Also for fault value = 11:

- de-activate vibration monitoring (p1909 bit 7 = 1).

For fault value = 2:

- for parallel circuits, check the motor winding system in p7003. If, for power units connected in parallel, a motor is specified with a single-winding system (p7003 = 0), although a multi-winding system is being used, then a large proportion of the stator resistance is interpreted as feeder cable resistance and entered in p0352.

Re fault value = 4, 7:

- check whether inductances are correctly entered in p0233 and p0353.

- check whether motor has been correctly connected (star-delta).

---

**207991 <location>Drive: Motor data identification activated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The motor data ident. routine is activated.  
The motor data identification routine is carried out at the next power-on command.  
See also: p1910, p1960  
**Remedy:** Not necessary.  
The alarm automatically disappears after the motor data identification routine has been successfully completed or for the setting p1910 = 0 or p1960 = 0.  
If a POWER ON or a warm restart is performed with motor data identification selected, the motor data identification request will be lost. If motor data identification is required, it will need to be selected again manually following ramp-up.

---

**207991 <location>Drive: Motor data identification activated**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The motor data ident. routine is activated.  
The motor data identification routine is carried out at the next power-on command.  
If rotating measurement is selected (see p1900, p1960), it will not be possible to save the parameter assignment. Once motor data identification has been completed or de-activated, the option to save the parameter assignment will be made available again.  
See also: p1910  
**Remedy:** Not necessary.  
The alarm automatically disappears after the motor data identification routine has been successfully completed or for the setting p1900 = 0.

---

**207993 <location>Drive: Incorrect direction of rotation of the field or encoder actual value inversion**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2 (NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Either the direction of the rotating field or the encoder actual value has an incorrect sign. The motor data identification automatically changed the actual value inversion (p0410) in order to correct the control sense. This can result in a direction of rotation change.  
Note:  
To acknowledge this fault, the correctness of the direction of rotation must first be acknowledged with p1910 = -2.  
**Remedy:** Check the direction of rotation (also for the position controller, if one is being used).  
If the direction of rotation is correct, the following applies:  
No additional measures are required (except set p1910 = -2 and acknowledge fault).  
If the direction of rotation is incorrect, the following applies:  
To change the direction of rotation, two phases must be interchanged and the motor identification routine must be repeated.

---

**207994 <location>Drive: motor data identification not performed**

**Message value:** -

**Drive object:** VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Motor data identification has not yet been performed with the actual data set.  
The alarm is only initiated when changing the data set (see r0051) in the following cases:  
- vector control is parameterized in the data set that has been newly selected (p1300 >= 20).  
- a motor data identification run has still not been performed in the newly selected data set (see r3925).

**Remedy:** - Perform motor data identification (see p1900).  
- Return data set.  
- Parameterize U/f control (p1300 < 20).

---

**207995 <location>Drive: Pole position identification not successful**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The pole position identification routine was unsuccessful.  
Fault value (r0949, decimal interpretation):  
1: No current is established.  
2: The starting current is not zero.  
3: The selected max. distance was exceeded (p1981).  
4x: The measuring signal does not permit a clear evaluation.  
5: The max. current was exceeded during the measurement.  
6: The current measurement must be re-calibrated.  
7x: The Sensor Module does not support the pole position identification routine.  
8: The pole position identification routine current required is greater than the max. current.  
9: The set pole position identification routine current is zero.  
10: Data set changeover during the pole position identification.  
11: The encoder adjustment to determine the commutation angle (p1990 = 1) and the encoder without zero mark is not finely synchronized or does not have any valid data.  
100: Motion-based pole position identification, 1st and 2nd measurement different. Motor locked or current (p1993) too low.  
101: Motion-based position position identification, insufficient motion, motor locked or current (p1993) too low.  
102: Motion-based pole position identification, brake is being used and is closed. The motion-based position position identification in conjunction with the brake is not permitted.  
103: Motion-based pole position identification without encoder.  
104: Motion-based pole position identification, speed actual value not zero after stabilizing time.  
200: Elasticity-based pole position identification, internal error in the arctan calculation ( 0/0 ).  
201: Elasticity-based pole position identification, too few measuring points that can be evaluated.  
202: Elasticity-based pole position identification, outliers in the measurement series.  
203: Elasticity-based pole position identification, maximum rotation without current.  
204: Elasticity-based pole position identification, no positive edge found.  
205: Elasticity-based pole position identification, the result of the Fourier transformation differs by more than 480 ° electrical / p3093 from the rough estimate.  
206: Elasticity-based pole position identification, plausibility test unsuccessful.  
207: Elasticity-based pole position identification, no negative measured value found.  
It is possible that all measured values are identical. The expected deflection was not able to be reached, either because the expectation is too high or not enough current was able to be established.  
208: Elasticity-based pole position identification, measuring current is 0.  
209: Elasticity-based pole position identification, the selected max. distance was exceeded (p3095).  
210: Elasticity-based pole position identification without encoder.

250 ... 260:

Elasticity-based pole position identification, more than 3 attempts have been made and fault value 200 ... 210 output.

Example:

Fault value= 253 --> more than 3 attempts have been made and fault value 203 output.

**Remedy:**

For fault value = 1:

- check the motor connection and DC link voltage.
- for the following parameters, set practical values that are not zero (p0325, p0329).

Re fault value = 1, 2:

- in the case of a large computing time load (e.g., 6 drives with Safety Integrated), set the computing dead time of the current controller to late transfers (p0117 = 3).

For fault value = 3:

- increase the max. distance (p1981).
- reduce the currents for the pole position identification routine (p0325, p0329).
- stop the motor in order to carry out the pole position identification routine.

For fault value = 5:

- reduce the currents for the pole position identification routine (p0325, p0329).

For fault value = 6:

- re-calibrate the Motor Module.

For fault value = 8:

- reduce the currents for the pole position identification routine (p0329, p0325, p1993).
- the power unit cannot provide the necessary pole position identification routine current (p0209 < p0329, p0325, p1993), replace the power unit with a power unit with a higher max. current.

For fault value = 9:

- enter a value not equal to zero in the pole position identification routine current (p0329, p0325, p1993).

For fault value = 10:

- do not initiate a data set changeover during the pole position identification.

For fault value = 11:

- for incremental encoders without commutation with zero mark (p0404.15 = 0), it does not make sense to adjust the encoder to determine the commutation angle (p1990 = 1). In this case, the function should be de-selected (p1990 = 0) or, for an encoder with suitable zero mark, commutation with zero mark should be selected (p0404.15 = 1).
- for absolute encoders, only adjust the encoder to determine the commutation angle (p1990 = 1) if the encoder supplies commutation information and is finely synchronized (p1992.8 = 1 and p1992.10 = 1). The encoder is possibly parked, de-activated (p0145), not ready for operation or signals a fault condition.
- de-select the encoder adjustment to determine the commutation angle (set p1990 to 0).

Re fault value = 40 ... 49:

- increase the currents for the pole position identification routine (p0325, p0329).
- stop the motor in order to carry out the pole position identification routine.
- select another technique for pole position identification routine (p1980).
- use another motor, absolute encoder or Hall sensors.

Re fault value = 70 ... 79:

- upgrade the software in the Sensor Module.

Re fault value = 100, 101:

- check and ensure that the motor is free to move.
- increase the current for motion-based pole position identification (p1993).

For fault value = 102:

- if the motor is to be operated with a brake: Select a different technique to identify the pole position (p1980).
- if the motor can be operated without a brake: Open the brake (p1215 = 2).

For fault value = 103:

- the motion-based pole position identification can only be carried out using an encoder. Connect an encoder or select another technique for pole position identification routine (p1980).

For fault value = 104:

- pole position identification, increase the smoothing time, motion-based (p1997).
- pole position identification, increase the rise time, motion-based (p1994).
- pole position identification, check the gain, motion-based (p1995).
- pole position identification, check the integral time, motion-based (p1996).
- for motor encoders with track A/B sq-wave (p0404.3 = 1) and flank time measurement (p0430.20 = 0), disable the integral time (p1996 = 0).



- For fault value = 200:  
 - check parameter setting (p3090 ... p3096).
- For fault value = 201:  
 - check parameter setting (p3090 ... p3096).  
 - reduce p3094.
- For fault value = 202:  
 - check parameter setting (p3090 ... p3096).  
 - fault has occurred during the identification. Repeat the measurement.  
 - check the brake or brake control.
- For fault value = 203:  
 - check the brake or brake control.  
 - check the measuring current (p3096).  
 - increase p3094.
- For fault value = 204:  
 - check parameter setting (p3090 ... p3096).
- For fault value = 205:  
 - check parameter setting (p3090 ... p3096).
- For fault value = 206:  
 - check parameter setting (p3090 ... p3096).  
 - fault has occurred during the identification. Repeat the measurement.  
 - check the brake or brake control.
- For fault value = 207:  
 - reduce the expected deflection (p3094).  
 - increase the measuring current (p3096).
- For fault value = 208:  
 - set the measuring current (p3096).
- For fault value = 209:  
 - check parameter setting p3095.  
 - check the brake or brake control.
- For fault value = 210:  
 - the elasticity-based pole position identification can only be carried out using an encoder. Connect an encoder or select another technique for pole position identification routine (p1980).
- Re fault value = 250 ... 260:  
 - check parameter setting (p3090 ... p3096, p1980).

---

## 207996 <location>Drive: Pole position identification routine not carried out

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK
<b>Reaction:</b>	ENCODER (OFF2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>In operation, the operating mode that requires a pole position identification was changed over, which is not possible in this state.</p> <ul style="list-style-type: none"> <li>- the drive was changed over, flying, from encoderless operation to operation with encoder without having previously carried out a pole position identification for the encoder. p1404 is then at a value between zero and the max. speed and the pulses in the speed range above p1404 were enabled without a pole position ident. routine having been previously carried out in operation with encoder.</li> <li>- in operation, an EDS changeover was made to an encoder where it is necessary to carry out a pole position identification. However, this has still not been carried out (p1982 = 1 or 2 and p1992.7 = 0).</li> </ul>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- for a flying changeover between operation with and without encoder with pole position identification after POWER ON or commissioning (p0010 not equal to zero) enable the pulses once at zero speed. This means that the pole position identification routine is carried out and the result is available for operation.</li> <li>- carry out the EDS changeover with the pulses inhibited, or, before the changeover, carry out a pole position identification using this data set.</li> </ul>

---

**207998**                    **<location>Drive: Motor data identification active on another drive**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The motor data identification is activated on the drive object specified in the fault value and interlocks the other drive objects so they cannot be powered up.  
 Fault value (r0949, decimal interpretation):  
 Drive object with the active motor data identification.  
 See also: p1910, p1960

**Remedy:**                - wait for the complete execution of the motor data identification of the drive object designated in the fault value.  
 - de-select the motor data identification for the drive object designated in the fault value (p1910 = 0 or p1960 = 0).

---

**207999**                    **<location>Drive: Motor data identification cannot be activated**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                Closed-loop control is enabled on a SERVO drive object type. To select motor data identification, pulses must be suppressed for all SERVO drive objects.  
 Fault value (r0949, decimal interpretation):  
 Drive object with enabled closed-loop control.

**Remedy:**                Withdraw the pulse enable on all drives and re-activate the motor data identification.

---

**208000**                    **<location>TB: +/-15 V power supply faulted**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             Infeed: NONE (OFF1, OFF2)  
 Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
 Vector: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                Terminal Board 30 detects an incorrect internal power supply voltage.  
 Fault value (r0949, decimal interpretation):  
 0: Error when testing the monitoring circuit.  
 1: Fault in normal operation.

**Remedy:**                - replace Terminal Board 30.  
 - replace Control Unit.

---

**208010**                    **<location>TB: Analog-digital converter**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             Infeed: NONE (OFF1, OFF2)  
 Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
 Vector: OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                The analog/digital converter on Terminal Board 30 has not supplied any converted data.

---

**Remedy:**

- check the power supply.
- replace Terminal Board 30.

### 208500 <location>COMM BOARD: Monitoring time configuration expired

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**  
 Infeed: OFF1 (OFF2)  
 Servo: OFF1 (OFF2, OFF3)  
 Vector: OFF1 (OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The monitoring time for the configuration has expired.  
 Fault value (r0949, decimal interpretation):  
 0: The transfer time of the send configuration data has been exceeded.  
 1: The transfer time of the receive configuration data has been exceeded.

**Remedy:** Check communication line.

### 208501 <location>COMM BOARD: Setpoint timeout

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**  
 Infeed: OFF1 (OFF2)  
 Servo: OFF3 (IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)  
 Vector: OFF3 (IASC/DCBRAKE, NONE, OFF1, OFF2, STOP1, STOP2)

**Acknowledge:** IMMEDIATELY

**Cause:** The reception of setpoints from the COMM BOARD has been interrupted.  
 - bus connection interrupted.  
 - controller switched off.  
 - controller set into the STOP state.  
 - COMM BOARD defective.  
 See also: p8840 (COMM BOARD monitoring time)

**Remedy:**  
 - Restore the bus connection and set the controller to RUN.  
 - check the set monitoring time if the error persists.  
 See also: p8840 (COMM BOARD monitoring time)

### 208502 <location>COMM BOARD: Monitoring time sign-of-life expired

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**  
 Infeed: OFF1 (OFF2)  
 Servo: OFF1 (OFF2, OFF3)  
 Vector: OFF1 (OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The monitoring time for the sign-of-life counter has expired.  
 The connection to the COMM BOARD was interrupted.

**Remedy:**  
 - check communications link.  
 - check COMM BOARD.

**208504**            **<location>COMM BOARD: Internal cyclic data transfer error**

**Message value:**    %1

**Drive object:**     A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**            NONE

**Acknowledge:**      NONE

**Cause:**              The cyclic actual and/or setpoint values were not transferred within the specified times.  
Alarm value (r2124, interpret decimal):  
Only for internal Siemens troubleshooting.

**Remedy:**             Check the parameterizing telegram (Ti, To, Tdp, etc.).

---

**208510**            **<location>COMM BOARD: Send configuration data invalid**

**Message value:**    %1

**Drive object:**     A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**            Infeed: OFF1 (OFF2)  
Servo: OFF1 (OFF2, OFF3)  
Vector: OFF1 (OFF2, OFF3)

**Acknowledge:**      IMMEDIATELY

**Cause:**              COMM BOARD did not accept the send-configuration data.  
Fault value (r0949, decimal interpretation):  
Return value of the send-configuration data check.

**Remedy:**             Check the send configuration data.

---

**208511**            **<location>COMM BOARD: Receive configuration data invalid**

**Message value:**    %1

**Drive object:**     A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**            NONE

**Acknowledge:**      NONE

**Cause:**              The drive unit did not accept the receive configuration data.  
Alarm value (r2124, interpret decimal):  
Return value of the receive configuration data check.  
1: Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978.  
2: Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051 for PZD IF1, and in r8850/p8851 for PZD IF2.  
3: Uneven number of bytes for input or output.  
4: Setting data for synchronization not accepted. For more information, see A01902.  
5: Cyclic operation not active.  
17: CBE20 Shared Device: Configuration of the F-CPU has been changed.  
223: Illegal clock synchronization for the PZD interface set in p8815[0].  
501: PROFIsafe parameter error (e.g. F\_dest).

**Remedy:**             Check the receive configuration data.  
Re alarm value = 1:  
Check the list of the drive objects with process data exchange (p0978). With p0978[x] = 0, all of the following drive objects in the list are excluded from the process data exchange.

Re alarm value = 2:  
 Check the number of data words for output and input to a drive object.  
 Re alarm value = 17:  
 CBE20 Shared Device: Unplug/plug A-CPU.  
 Re alarm value = 501:  
 Check the set PROFIsafe address (p9610).

---

<b>208520</b>	<b>&lt;location&gt;COMM BOARD: Non-cyclic channel error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The memory or the buffer status of the non-cyclic channel has an error. Alarm value (r2124, interpret decimal): 0: Error in the buffer status. 1: Error in the memory.
<b>Remedy:</b>	Check communication line.

---

<b>208526</b>	<b>&lt;location&gt;COMM BOARD: No cyclic connection</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	There is no cyclic connection to the control.
<b>Remedy:</b>	Establish the cyclic connection and activate the control with cyclic operation. For PROFINET, check the parameters "Name of Station" and "IP of Station" (r61000, r61001). If a CBE20 is inserted and PROFIBUS is to communicate via PZD Interface1, then this must be parameterized using the STARTER commissioning tool or directly with p8839.

---

<b>208530</b>	<b>&lt;location&gt;COMM BOARD: Message channel error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The memory or the buffer status of the message channel has an error. Alarm value (r2124, interpret decimal): 0: Error in the buffer status. 1: Error in the memory.
<b>Remedy:</b>	Check communication line.

**208550 <location>PZD Interface Hardware assignment error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The assignment of the hardware to the PZD interface has been incorrectly parameterized.  
 Alarm value (r2124, interpret decimal):  
 1: Only one of the two indices is not equal to 99 (automatic).  
 2: Both PZD interfaces are assigned to the same hardware.  
 3: Assigned COMM BOARD missing.  
 4: CBC10 is assigned to interface 1.  
 See also: p8839 (PZD interface hardware assignment)  
**Remedy:** Check the parameterization and if required, correct (p8839).

---

**208560 <location>IE: Syntax error in configuration file**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A syntax error has been detected in the ASCII configuration file for the Industrial Ethernet interface (X127). The saved configuration file has not been loaded.  
 Note:  
 IE: Industrial Ethernet  
**Remedy:** - Check the interface configuration (p8900 and following), correct if necessary, and activate (p8905 = 1).  
 - Save the parameters for interface configuration (e.g. p8905 = 2)  
 or  
 - Reconfigure the station via the "Edit Ethernet node" screen form (e.g. with STARTER commissioning software).  
 See also: p8905 (IE Interface configuration)

---

**208561 <location>IE: Consistency error affecting adjustable parameters**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A consistency error was detected when activating the configuration (p8905 = 1) for the Industrial Ethernet interface (X127). The currently set configuration has not been activated.  
 Possible causes:  
 - IP address, subnet mask or default gateway is not correct  
 - IP address or station name used twice in the network  
 - station name contains invalid characters, etc.  
 Note:  
 IE: Industrial Ethernet  
 See also: p8900 (IE Name of Station), p8901 (IE IP Address of Station), p8902 (IE Default Gateway of Station), p8903 (IE Subnet Mask of Station)

**Remedy:**

- Check the required interface configuration (p8900 and following), correct if necessary, and activate (p8905 = 1).
- or
- Reconfigure the station via the "Edit Ethernet node" screen form (e.g. with STARTER commissioning software).

See also: p8905 (IE Interface configuration)

### 208562 <location>PN: Syntax error in configuration file

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A syntax error has been detected in the ASCII configuration file for the onboard PROFINET interface. The saved configuration file has not been loaded.

**Remedy:**

- Check the interface configuration (p8920 and following), correct if necessary, and activate (p8925 = 1).
- Save the parameters for interface configuration (e.g. p8925 = 2).
- or
- Reconfigure the station via the "Edit Ethernet node" screen form (e.g. with STARTER commissioning software).

See also: p8925 (PN interface configuration)

### 208563 <location>PN: Consistency error affecting adjustable parameters

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A consistency error was detected when activating the configuration (p8925 = 1) for the onboard PROFINET interface. The currently set configuration has not been activated.  
Possible causes:

- IP address, subnet mask or default gateway is not correct
- IP address or station name used twice in the network
- station name contains invalid characters, etc.

See also: p8920 (PN Name of Station), p8921 (PN IP address of station), p8922 (PN Default Gateway of Station), p8923 (PN Subnet Mask of Station)

**Remedy:**

- Check the required interface configuration (p8940 and following), correct if necessary, and activate (p8945 = 1).
- or
- Reconfigure the station via the "Edit Ethernet node" screen form (e.g. with STARTER commissioning software).

See also: p8925 (PN interface configuration)

### 208564 <location>CBE20: Syntax error in configuration file

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A syntax error has been detected in the ASCII configuration file for the Communication Board Ethernet 20 (CBE20). The saved configuration file has not been loaded.

**Remedy:** - Check the CBE20 configuration (p8940 and following), correct if necessary, and activate (p8945 = 1).  
 Note:  
 The configuration is not applied until the next POWER ON!  
 - reconfigure the CBE20 (e.g. using the STARTER commissioning software)  
 See also: p8945 (CBE20 interface configuration)

**208565 <location>CBE20: Consistency error affecting adjustable parameters**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A consistency error was detected when activating the configuration (p8945 = 1) for the Communication Board Ethernet 20 (CBE20).  
 The currently set configuration has not been activated.  
 Possible causes:  
 - IP address, subnet mask or default gateway is not correct  
 - IP address or station name used twice in the network  
 - station name contains invalid characters, etc.  
 See also: p8940 (CBE20 Name of Station), p8941 (CBE20 IP Address of Station), p8942 (CBE20 Default Gateway of Station), p8943 (CBE20 Subnet Mask of Station), p8944 (CBE20 DHCP Mode)  
**Remedy:** Check the required interface configuration (p8940 and following), correct if necessary, and activate (p8945 = 1).  
 See also: p8945 (CBE20 interface configuration)

**208700 <location>CAN: Communications error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** Infeed: NONE (OFF1, OFF2)  
 Servo: OFF3 (NONE, OFF1, OFF2)  
 Vector: OFF3 (NONE, OFF1, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A CAN communications error has occurred.  
 Fault value (r0949, decimal interpretation):  
 1: The error counter for the send telegrams has exceeded the BUS OFF value 255. The bus disables the CAN controller.  
 - bus cable short circuit.  
 - incorrect baud rate.  
 - incorrect bit timing.  
 2: The master no longer interrogated the CAN node status longer than for its "life time". The "life time" is obtained from the "guard time" (p8604[0]) multiplied by the "life time factor" (p8604[1]).  
 - bus cable interrupted.  
 - bus cable not connected.  
 - incorrect baud rate.  
 - incorrect bit timing.  
 - master fault.  
 Note:  
 The fault response can be set as required using p8641.  
 See also: p8604 (CAN node guarding), p8641 (CAN Abort Connection Option Code)



**Remedy:**

- check the bus cable
- check the baud rate (p8622).
- check the bit timing (p8623).
- check the master.

The CAN controller must be manually restarted with p8608 = 1 after the cause of the fault has been resolved!  
See also: p8608 (CAN Clear Bus Off Error), p8622 (CAN bit rate), p8623 (CAN Bit Timing selection)

## 208701 <location>CAN: NMT state change

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** Infeed: OFF2  
Servo: OFF3  
Vector: OFF3

**Acknowledge:** IMMEDIATELY

**Cause:** A CANopen NMT state transition from "operational" to "pre-operational" or after "stopped".  
Fault value (r0949, decimal interpretation):  
1: CANopen NMT state transition from "operational" to "pre-operational".  
2: CANopen NMT state transition from "operational" to "stopped".  
Note:  
In the NMT state "pre-operational", process data cannot be transferred and in the NMT state "stopped", no process data and no service data can be transferred.

**Remedy:** Not necessary.  
Acknowledge the fault and continue operation.

## 208702 <location>CAN: RPDO Timeout

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Servo: OFF3 (NONE, OFF1, OFF2)  
Vector: OFF3 (NONE, OFF1, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** The monitoring time of the CANopen RPDO telegram has expired because the bus connection was either interrupted or the CANopen Master was switched-off.  
See also: p8699 (CAN: RPDO monitoring time)

**Remedy:**

- check the bus cable
- check the master.
- If required, increase the monitoring time (p8699).

## 208703 <location>CAN: Maximum number of drive objects exceeded

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Servo: OFF3 (NONE, OFF1, OFF2)  
Vector: OFF3 (NONE, OFF1, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** The maximum number of 8 drive objects with the "CAN" function module was exceeded.  
**Note:**  
 In the CANopen standard only a maximum of 8 drive objects are defined for each CANopen slave.

**Remedy:**

- New commissioning of maximum 8 drive objects with the "CAN" function module in the topology.
- For the drive objects, if required, deselect the "CAN" function module (r0108.29).

**208751 <location>CAN: Telegram loss**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The CAN controller has lost a receive message (telegram).

**Remedy:** Reduce the cycle times of the receive messages.

**208752 <location>CAN: Error counter for error passive exceeded**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The error counter for the send or receive telegrams has exceeded the value 127.

**Remedy:**

- check the bus cable
- set a higher baud rate (p8622).
- check the bit timing and if required optimize (p8623).

See also: p8622 (CAN bit rate), p8623 (CAN Bit Timing selection)

**208753 <location>CAN: Message buffer overflow**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A message buffer overflow.  
 Alarm value (r2124, interpret decimal):

- 1: Non-cyclic send buffer (SDO response buffer) overflow.
- 2: Non-cyclic receive buffer (SDO receive buffer) overflow.
- 3: Cyclic send buffer (PDO send buffer) overflow.

**Remedy:**

- check the bus cable.
- set a higher baud rate (p8622).
- check the bit timing and if required optimize (p8623).

Re alarm value = 2:

- reduce the cycle times of the SDO receive messages.
- SDO request from master only after SDO feedback for previous SDO request.

See also: p8622 (CAN bit rate), p8623 (CAN Bit Timing selection)

---

**208754 <location>CAN: Incorrect communications mode**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** In the "operational" mode, an attempt was made to change parameters p8700 ... p8737.

**Remedy:** Change to the "pre-operational" or "stopped" mode.

---

**208755 <location>CAN: Obj cannot be mapped**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The CANopen object is not provided for the Process Data Object (PDO) Mapping.

**Remedy:** Use a CANopen object intended for the PDO mapping or enter 0.  
The following objects can be mapped in the Receive Process Data Object (RPDO) or Transmit Process Data Object (TPDO):  
- RPDO: 6040 hex, 6060 hex, 60FF hex, 6071 hex; 5800 hex - 580F hex; 5820 hex - 5827 hex  
- TPDO: 6041 hex, 6061 hex, 6063 hex, 6069 hex, 606B hex, 606C hex, 6074 hex; 5810 hex - 581F hex; 5830 hex - 5837 hex  
Only sub-index 0 of the specified objects can be mapped.  
Note:  
As long as A08755 is present, the COB-ID cannot be set to valid.

---

**208756 <location>CAN: Number of mapped bytes exceeded**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The number of bytes of the mapped objects exceeds the telegram size for net data. A max. of 8 bytes is permissible.

**Remedy:** Map fewer objects or objects with a smaller data type.  
See also: p8710, p8711, p8712, p8713, p8714, p8715, p8716, p8717, p8730, p8731, p8732, p8733, p8734, p8735, p8736, p8737

---

**208757 <location>CAN: Set COB-ID invalid**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** For online operation, the appropriate COB-ID must be set invalid before mapping.  
 Example:  
 Mapping for RPDO 1 should be changed (p8710[0]).  
 --> set p8700[0] = C00006E0 hex (invalid COB-ID)  
 --> set p8710[0] as required.  
 --> p8700[0] enter a valid COB-ID

**Remedy:** Set the COB-ID to invalid.

---

**208758 <location>CAN: Number of PDO channels too low**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The number of PDO channels in p8740 has either been set to 0 or too low.  
 See also: p8740 (CAN channel distribution)  
**Remedy:** The number of channels set in p8740 must be greater than or equal to the number of PDOs.  
 There are 2 possibilities:  
 Increase the number of channels in p8740 and confirm the selection using p8741.  
 Reduce the number of PDOs by setting the COB-ID to invalid.  
 See also: p8740 (CAN channel distribution), p8741 (CAN PDO configuration acknowledgement)

---

**208759 <location>CAN: PDO COB-ID already available**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An existing PDO COB-ID was allocated.  
**Remedy:** Select another PDO COB-ID.

---

**213000 <location>License not adequate**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** - for the drive unit, the options that require a license are being used but the licenses are not sufficient.  
 - an error occurred when checking the existing licenses.  
 Alarm value (r2124, interpret decimal):  
 0:  
 The existing license is not sufficient.  
 1:  
 An adequate license was not able to be determined as the memory card with the required licensing data was withdrawn in operation.

2:  
An adequate license was not able to be determined as there is no licensing data available on the memory card.

3:  
An adequate license was not able to be determined as there is a checksum error in the license key.

4:  
An internal error occurred when checking the license.

**Remedy:**

Re alarm value = 0:

Additional licenses are required and these must be activated (p9920, p9921).

Re alarm value = 1:

With the system powered down, re-insert the memory card that matches the system.

Re alarm value = 2:

Enter and activate the license key (p9920, p9921).

Re alarm value = 3:

Compare the license key (p9920) entered with the license key on the certificate of license.

Re-enter the license key and activate (p9920, p9921).

Re alarm value = 4:

- carry out a POWER ON.

- upgrade firmware to later version.

- contact the Hotline.

**213001 <location>Error in license checksum**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** When checking the checksum of the license key, an error was detected.

**Remedy:** Compare the license key (p9920) entered with the license key on the certificate of license.  
Re-enter the license key and activate (p9920, p9921).

**213009 <location>Licensing OA application not licensed**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1

**Acknowledge:** IMMEDIATELY

**Cause:** At least one OA application which is under license does not have a license.

Note:

Refer to r4955 and p4955 for information about the installed OA applications.

**Remedy:** - enter and activate the license key for OA applications under license (p9920, p9921).  
- if necessary, de-activate unlicensed OA applications (p4956).  
See also: p9920 (Licensing, enter license key), p9921 (Licensing, activate license key)

**213010**                    **<location>Licensing function module not licensed**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, CU\_S\_CU310DP, CU\_S\_CU310PN, CU\_S\_CU320\_DP, CU\_S\_CU320\_PN, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**              OFF1

**Acknowledge:**        IMMEDIATELY

**Cause:**                At least one function module which is under license does not have a license.  
 Fault value (r0949, interpret hexadecimal):  
 Bit x = 1: The corresponding function module does not have a license.  
 Note:  
 Refer to p0108 or r0108 for the assignment between the bit number and function module.

**Remedy:**              - enter and activate the license key for function modules under license (p9920, p9921).  
 - if necessary, de-activate unlicensed function modules (p0108, r0108).  
 See also: p9920 (Licensing, enter license key), p9921 (Licensing, activate license key)

---

**213020**                    **<location>Licensing not sufficient in the control**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_I\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**              OFF1

**Acknowledge:**        IMMEDIATELY

**Cause:**                For the drive unit, the options that require a license are being used but the licenses are not sufficient.

**Remedy:**              - enter and activate the license key for options that require a license.  
 - if necessary, de-activate unlicensed options.

---

**230001**                    **<location>Power unit: Overcurrent**

**Message value:**        Fault cause: %1 bin

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                The power unit has detected an overcurrent condition.  
 - closed-loop control is incorrectly parameterized.  
 - motor has a short-circuit or fault to ground (frame).  
 - U/f operation: Up ramp set too low.  
 - U/f operation: Rated motor current is significantly greater than that of the Motor Module.  
 - infeed: High discharge and post-charging currents for voltage dip.  
 - infeed: High post-charging currents for overload when motoring and DC link voltage dip.  
 - infeed: Short-circuit currents at power-up due to the missing line reactor.  
 - power cables are not correctly connected.  
 - power cables exceed the maximum permissible length.  
 - power unit defective.  
 - line phase interrupted.  
 Additional causes for a parallel switching device (r0108.15 = 1):  
 - a power unit has tripped (powered down) due to a ground fault.  
 - the closed-loop circulating current control is either too slow or has been set too fast.

Fault value (r0949, interpret bitwise binary):

Bit 0: Phase U.

Bit 1: Phase V.

Bit 2: Phase W.

Bit 3: Overcurrent in the DC link.

Note:

Fault value = 0 means that the phase with overcurrent is not recognized (e.g. for blocksize device).

**Remedy:**

- check the motor data - if required, carry out commissioning.
  - check the motor circuit configuration (star-delta)
  - U/f operation: Increase up ramp.
  - U/f operation: Check the assignment of the rated currents of the motor and Motor Module.
  - infeed: Check the line supply quality.
  - infeed: Reduce the motor load.
  - infeed: Correct connection of the line reactor.
  - check the power cable connections.
  - check the power cables for short-circuit or ground fault.
  - check the length of the power cables.
  - replace power unit.
  - check the line supply phases.
- For a parallel switching device (r0108.15 = 1) the following additionally applies:
- check the ground fault monitoring thresholds (p0287).
  - check the setting of the closed-loop circulating current control (p7036, p7037).

**230002 <location>Power unit: DC link voltage, overvoltage**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The power unit has detected overvoltage in the DC link.

- motor regenerates too much energy.
- device connection voltage too high.
- when operating with a Voltage Sensing Module (VSM), the phase assignment L1, L2, L3 at the VSM differs from the phase assignment at the power unit.
- line phase interrupted.

Fault value (r0949, decimal interpretation):

DC link voltage at the time of trip [0.1 V].

**Remedy:**

- increase the ramp-down time
  - activate the DC link voltage controller
  - use a brake resistor or Active Line Module
  - increase the current limit of the infeed or use a larger module (for the Active Line Module)
  - check the device supply voltage
  - check and correct the phase assignment at the VSM and at the power unit
  - check the line supply phases.
- See also: p0210 (Drive unit line supply voltage), p1240 (Vdc controller or Vdc monitoring configuration)

**230002 <location>Power unit: DC link voltage, overvoltage**

**Message value:** %1

**Drive object:** VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The power unit has detected overvoltage in the DC link.

- motor regenerates too much energy.
- device connection voltage too high.
- when operating with a Voltage Sensing Module (VSM), the phase assignment L1, L2, L3 at the VSM differs from the phase assignment at the power unit.
- line phase interrupted.

Fault value (r0949, decimal interpretation):  
DC link voltage at the time of trip [0.1 V].

**Remedy:**

- increase the ramp-down time
- activate the DC link voltage controller
- use a brake resistor or Active Line Module
- increase the current limit of the infeed or use a larger module (for the Active Line Module)
- check the device supply voltage
- check and correct the phase assignment at the VSM and at the power unit
- check the line supply phases.
- set the rounding times (p1130, p1136). This is particularly recommended in U/f operation to relieve the DC link voltage controller with rapid ramp-down times of the ramp-function generator.

See also: p0210 (Drive unit line supply voltage), p1240 (Vdc controller or Vdc monitoring configuration)

**230003**                    **<location>Power unit: DC link voltage, undervoltage**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The power unit has detected an undervoltage condition in the DC link.

- line supply failure
- line supply voltage below the permissible value.
- line supply infeed failed or interrupted.
- line phase interrupted.

**Note:**  
The monitoring threshold for undervoltage in the DC link is indicated in r0296.

**Remedy:**

- check the line supply voltage
- check the line supply infeed and observe the fault messages relating to it (if there are any)
- check the line supply phases.
- check the line supply voltage setting (p0210).
- booksize units: check the setting of p0278.

**Note:**  
The ready signal for the infeed (r0863) must be interconnected to the associated drive inputs (p0864).  
See also: p0210 (Drive unit line supply voltage)

**230004**                    **<location>Power unit: Overtemperature heat sink AC inverter**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** The temperature of the power unit heat sink has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.
- pulse frequency too high.

Fault value (r0949):  
Temperature [1 bit = 0.01 °C].



**Remedy:**

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.
- check the motor load.
- reduce the pulse frequency if this is higher than the rated pulse frequency.

**Notice:**  
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.  
See also: p1800 (Pulse frequency setpoint)

### 230005 <location>Power unit: Overload I2t

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The power unit was overloaded (r0036 = 100 %).  
 - the permissible rated power unit current was exceeded for an inadmissibly long time.  
 - the permissible load duty cycle was not maintained.  
 Fault value (r0949, decimal interpretation):  
 I2t [100 % = 16384].

**Remedy:**

- reduce the continuous load.
- adapt the load duty cycle.
- check the motor and power unit rated currents.

See also: r0036 (Power unit overload I2t), r0206 (Rated power unit power), p0307 (Rated motor power)

### 230005 <location>Power unit: Overload I2t

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The power unit was overloaded (r0036 = 100 %).  
 - the permissible rated power unit current was exceeded for an inadmissibly long time.  
 - the permissible load duty cycle was not maintained.  
 Fault value (r0949, decimal interpretation):  
 I2t [100 % = 16384].

**Remedy:**

- reduce the continuous load.
- adapt the load duty cycle.
- check the motor and power unit rated currents.
- increase p0294

See also: r0036 (Power unit overload I2t), r0206 (Rated power unit power), p0307 (Rated motor power)

### 230006 <location>Power unit: Thyristor Control Board

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** The Thyristor Control Board (TCB) of the Basic Line Module signals a fault.

- there is no line supply voltage.
- the line contactor is not closed.
- the line supply voltage is too low.
- line supply frequency outside the permissible range (45 ... 66 Hz).
- there is a DC link short-circuit.
- there is a DC link short-circuit (during the pre-charging phase).
- voltage supply for the Thyristor Control Board outside the nominal range (5 ... 18 V) and line voltage >30 V.
- there is an internal fault in the Thyristor Control Board.

**Remedy:** The faults must be saved in the Thyristor Control Board and must be acknowledged. To do this, the supply voltage of the Thyristor Control Board must be switched out for at least 10 s!

- check the line supply voltage
- check or energize the line contactor.
- check the monitoring time and, if required, increase (p0857).
- if required, observe additional power unit messages/signals.
- check the DC link regarding short-circuit or ground fault.
- evaluate diagnostic LEDs for the Thyristor Control Board.

**230008 <location>Power unit: Sign-of-life error cyclic data**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** Infeed: NONE (OFF1, OFF2)  
 Servo: NONE (OFF1, OFF2, OFF3)  
 Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** The power unit has detected that the cyclic setpoint telegrams of the Control Unit have not been updated on time. The number of consecutive sign-of-life errors has exceeded the fault threshold (p7789).

**Remedy:**

- check the electrical cabinet design and cable routing for EMC compliance
- for projects with the VECTOR drive object, check whether p0117 = 6 has been set on the Control Unit.
- increase the fault threshold (p7789).

See also: p0117 (Current controller computing dead time mode)

**230010 <location>Power unit: Sign-of-life error cyclic data**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A DRIVE-CLiQ communication error has occurred between the Control Unit and the power unit involved. The cyclic setpoint telegrams of the Control Unit were not received on time by the power unit for at least one clock cycle.

**Remedy:** Check the electrical cabinet design and cable routing for EMC compliance.

**230011 <location>Power unit: Line phase failure in main circuit**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2 (OFF1)

**Acknowledge:** IMMEDIATELY

**Cause:** A line phase failure was detected at the power unit.  
- the fuse of a phase of a main circuit has ruptured.  
- the DC link voltage ripple has exceeded the permissible limit value.  
**Note:**  
The cause may also be a phase failure in the motor feeder cable.

**Remedy:**  
- check the main circuit fuses.  
- check the motor feeder cables.

---

**230012 <location>Power unit: Temperature sensor heat sink wire breakage**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The connection to a heat sink temperature sensor in the power unit is interrupted.  
Fault value (r0949, interpret hexadecimal):  
Bit 0: Module slot (electronics slot)  
Bit 1: Air intake  
Bit 2: Inverter 1  
Bit 3: Inverter 2  
Bit 4: Inverter 3  
Bit 5: Inverter 4  
Bit 6: Inverter 5  
Bit 7: Inverter 6  
Bit 8: Rectifier 1  
Bit 9: Rectifier 2

**Remedy:** Contact the manufacturer.

---

**230013 <location>Power unit: Temperature sensor heat sink short-circuit**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The heat sink temperature sensor in the power unit is short-circuited.  
Fault value (r0949, interpret hexadecimal):  
Bit 0: Module slot (electronics slot)  
Bit 1: Air intake  
Bit 2: Inverter 1  
Bit 3: Inverter 2  
Bit 4: Inverter 3  
Bit 5: Inverter 4  
Bit 6: Inverter 5  
Bit 7: Inverter 6  
Bit 8: Rectifier 1  
Bit 9: Rectifier 2

**Remedy:** Contact the manufacturer.

---

**230015**                    **<location>Power unit: Phase failure motor cable**

**Message value:**        -

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**              OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A phase failure in the motor feeder cable was detected.  
 The signal can also be output in the following case:  
 - the motor is correctly connected, however the closed-speed control is instable and therefore an oscillating torque is generated.

**Note:**  
 Chassis power units do not feature phase failure monitoring.

**Remedy:**              - check the motor feeder cables.  
 - check the speed controller settings.

---

**230015**                    **<location>Power unit: Phase failure motor cable**

**Message value:**        -

**Drive object:**         VECTOR

**Reaction:**              OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A phase failure in the motor feeder cable was detected.  
 The signal can also be output in the following cases:  
 - The motor is correctly connected, but the drive has stalled in V/f control. In this case, a current of 0 A is possibly measured in one phase due to asymmetry of the currents.  
 - the motor is correctly connected, however the closed-speed control is instable and therefore an oscillating torque is generated.

**Note:**  
 Chassis power units do not feature phase failure monitoring.

**Remedy:**              - check the motor feeder cables.  
 - increase the ramp-up or ramp-down time (p1120) if the drive has stalled in V/f control.  
 - check the speed controller settings.

---

**230016**                    **<location>Power unit: Load supply switched out**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              NONE

**Acknowledge:**        NONE

**Cause:**                The DC link voltage is too low.  
 Alarm value (r2124, interpret decimal):  
 DC link voltage at the time of trip [0.1 V].

**Remedy:**              - switch on load supply.  
 - check the line supply if necessary.

---

**230017**                    **<location>Power unit: Hardware current limit has responded too often**

**Message value:**        Fault cause: %1 bin

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

<b>Cause:</b>	<p>The hardware current limitation in the relevant phase (see A30031, A30032, A30033) has responded too often. The number of times the limit has been exceeded depends on the design and type of power unit.</p> <p>For infeed units, the following applies:</p> <ul style="list-style-type: none"> <li>- closed-loop control is incorrectly parameterized.</li> <li>- load on the infeed is too high.</li> <li>- Voltage Sensing Module incorrectly connected.</li> <li>- line reactor missing or the incorrect type.</li> <li>- power unit defective.</li> </ul> <p>The following applies to Motor Modules:</p> <ul style="list-style-type: none"> <li>- closed-loop control is incorrectly parameterized.</li> <li>- fault in the motor or in the power cables.</li> <li>- the power cables exceed the maximum permissible length.</li> <li>- motor load too high</li> <li>- power unit defective.</li> </ul> <p>Fault value (r0949, interpret binary):</p> <p>Bit 0: Phase U          Bit 1: Phase V          Bit 2: Phase W</p>
<b>Remedy:</b>	<p>For infeed units, the following applies:</p> <ul style="list-style-type: none"> <li>- check the controller settings and reset and identify the controller if necessary (p0340 = 2, p3410 = 5)</li> <li>- reduce the load and increase the DC-link capacitance or use a higher-rating infeed if necessary</li> <li>- check the connection of the optional Voltage Sensing Module</li> <li>- check the connection and technical data of the line reactor</li> <li>- check the power cables for short-circuit or ground fault.</li> <li>- replace power unit.</li> </ul> <p>The following applies to Motor Modules:</p> <ul style="list-style-type: none"> <li>- check the motor data and if required, recalculate the controller parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).</li> <li>- check the motor circuit configuration (star-delta).</li> <li>- check the motor load.</li> <li>- check the power cable connections.</li> <li>- check the power cables for short-circuit or ground fault.</li> <li>- check the length of the power cables.</li> <li>- replace power unit.</li> </ul>

---

<b>230020</b>	<b>&lt;location&gt;Power unit: Configuration not supported</b>
<b>Message value:</b>	fault cause: %1, additional information: %2
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>A configuration is requested that is not supported by the power unit.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>yyyyxxxx hex: xxxx = fault cause, yyyy = additional information (siemensintern)</p> <p>xxxx = 0: Autonomous operation is requested but is not supported.</p> <p>xxxx = 1: The requested DRIVE-CLiQ timing is not permissible.</p> <p>xxxx = 2: A PM260 has been detected with PS-ASIC version 2. This combination is not supported.</p> <p>xxxx = 3: Initialization was not able to be successfully completed. It is possible that the Control Unit was withdrawn from the power module before or during power-up.</p> <p>xxxx = 4: The combination of power unit and Control Unit or Control Unit Adapter is not supported.</p> <p>xxxx = 5: The higher current controller dynamic performance is not supported.</p>
<b>Remedy:</b>	<p>Re fault cause = 0:          If required, deactivate an active internal voltage protection (p1231).</p> <p>Re fault cause = 1:          Update the Control Unit firmware or change the DRIVE-CLiQ topology.</p> <p>Re fault cause = 2:          Replace the power unit with a PM260 with PS-ASIC version 3 (or higher).</p>

Re fault cause = 3, 4:  
 Insert a Control Unit or Control Unit Adapter (CUAxx) on an appropriate Power Module and perform a POWER ON for the Control Unit or the Control Units Adapter.  
 Re fault cause = 5:  
 - use a booksize format power unit.  
 - for a Double Motor Module operate the two drive controls with the same current controller sampling time (p0115[0]). Otherwise, the higher current controller dynamics can only be activated on the drive with the longer sampling time.  
 - If required, de-select the higher current controller dynamic performance (p1810.11 = 0). After deselecting the computing dead time, recalculate the controller gains (p0340 = 4). If required, optimize the speed controller.  
 See also: p0115, p1231, p1810

---

**230021**                    **<location>Power unit: Ground fault**

**Message value:**        %1

**Drive object:**            A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**                OFF2

**Acknowledge:**            IMMEDIATELY

**Cause:**                    Power unit has detected a ground fault.  
 - ground fault in the power cables.  
 - winding fault or ground fault at the motor.  
 - CT defective.  
 Additional cause for CU310/CUA31:  
 - when the brake is applied, this causes the hardware DC current monitoring to respond.  
 Additional cause for parallel switching devices (r0108.15 = 1):  
 - the closed-loop circulating current control is either too slow or has been set too fast.  
 Fault value (r0949, decimal interpretation):  
 Absolute value, total current amplitude [20479 = r0209 x 1.4142].  
 Note:  
 For power units, a ground fault is also emulated in r3113.5.

**Remedy:**                    - check the power cable connections.  
 - check the motor.  
 - check the CT.  
 The following applies additionally for CU310/CUA31:  
 - check the cables and contacts of the brake connection (a wire is possibly broken).  
 For parallel switching devices (r0108.15 = 1) the following additionally applies:  
 - check the ground fault monitoring thresholds (p0287).  
 - check the setting of the closed-loop circulating current control (p7036, p7037).  
 See also: p0287 (Ground fault monitoring thresholds)

---

**230022**                    **<location>Power unit: Monitoring U\_ce**

**Message value:**        Fault cause: %1 bin

**Drive object:**            A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**                OFF2

**Acknowledge:**            POWER ON

**Cause:**                    In the power unit, the monitoring of the collector-emitter voltage (U\_ce) of the semiconductor has responded.  
 Possible causes:  
 - fiber-optic cable interrupted.  
 - power supply of the IGBT gating module missing.  
 - short-circuit at the power unit output.  
 - defective semiconductor in the power unit.  
 Fault value (r0949, interpret binary):  
 Bit 0: Short-circuit in phase U  
 Bit 1: Short circuit in phase V

Bit 2: Short-circuit in phase W  
 Bit 3: Light transmitter enable defective  
 Bit 4: U<sub>ce</sub> group fault signal interrupted  
 See also: r0949 (Fault value)

- Remedy:**
- check the fiber-optic cable and if required, replace.
  - check the power supply of the IGBT gating module (24 V).
  - check the power cable connections.
  - select the defective semiconductor and replace.

## 230024 <location>Power unit: Overtemperature thermal model

- Message value:** -
- Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK
- Reaction:** OFF2
- Acknowledge:** IMMEDIATELY
- Cause:** The temperature difference between the heat sink and chip has exceeded the permissible limit value.
- the permissible load duty cycle was not maintained.
  - insufficient cooling, fan failure.
  - overload.
  - ambient temperature too high.
  - pulse frequency too high.
- See also: r0037
- Remedy:**
- adapt the load duty cycle.
  - check whether the fan is running.
  - check the fan elements.
  - check whether the ambient temperature is in the permissible range.
  - check the motor load.
  - reduce the pulse frequency if this is higher than the rated pulse frequency.

## 230024 <location>Power unit: Overtemperature thermal model

- Message value:** -
- Drive object:** VECTOR
- Reaction:** OFF2
- Acknowledge:** IMMEDIATELY
- Cause:** The temperature difference between the heat sink and chip has exceeded the permissible limit value.
- the permissible load duty cycle was not maintained.
  - insufficient cooling, fan failure.
  - overload.
  - ambient temperature too high.
  - pulse frequency too high.
- See also: r0037
- Remedy:**
- adapt the load duty cycle.
  - check whether the fan is running.
  - check the fan elements.
  - check whether the ambient temperature is in the permissible range.
  - check the motor load.
  - reduce the pulse frequency if this is higher than the rated pulse frequency.
  - if DC braking is active: reduce braking current (p1232).

**230025 <location>Power unit: Chip overtemperature**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** Chip temperature of the semiconductor has exceeded the permissible limit value.  
 - the permissible load duty cycle was not maintained.  
 - insufficient cooling, fan failure.  
 - overload.  
 - ambient temperature too high.  
 - pulse frequency too high.  
 Fault value (r0949):  
 Temperature difference between the heat sink and chip [1 Bit = 0.01 °C].  
**Remedy:**  
 - adapt the load duty cycle.  
 - check whether the fan is running.  
 - check the fan elements.  
 - check whether the ambient temperature is in the permissible range.  
 - check the motor load.  
 - reduce the pulse frequency if this is higher than the rated pulse frequency.  
 Notice:  
 This fault can only be acknowledged after this alarm threshold for alarm A05001 has been undershot.  
 See also: r0037

**230027 <location>Power unit: Precharging DC link time monitoring**

**Message value:** Enable signals: %1, Status: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The power unit DC link was not able to be pre-charged within the expected time.  
 1) There is no line supply voltage connected.  
 2) The line contactor/line side switch has not been closed.  
 3) The line supply voltage is too low.  
 4) Line supply voltage incorrectly set (p0210).  
 5) The pre-charging resistors are overheated as there were too many pre-charging operations per time unit.  
 6) The pre-charging resistors are overheated as the DC link capacitance is too high.  
 7) The pre-charging resistors are overheated because when there is no "ready for operation" (r0863.0) of the infeed unit, power is taken from the DC link.  
 8) The pre-charging resistors are overheated as the line contactor was closed during the DC link fast discharge through the Braking Module.  
 9) The DC link has either a ground fault or a short-circuit.  
 10) The pre-charging circuit is possibly defective (only for chassis units).  
 11) Infeed is defective and/or fuse has ruptured in the Motor Module (only Booksize units).  
 Fault value (r0949, interpret binary):  
 yyyyxxxx hex:  
 yyyy = power unit state  
 0: Fault status (wait for OFF and fault acknowledgement).  
 1: Restart inhibit (wait for OFF).  
 2: Overvoltage condition detected -> change into the fault state.  
 3: Undervoltage condition detected -> change into the fault state.  
 4: Wait for bypass contactor to open -> change into the fault state.  
 5: Wait for bypass contactor to open -> change into restart inhibit.  
 6: Commissioning.  
 7: Ready for pre-charging.



8: Pre-charging started, DC link voltage less than the minimum switch-on voltage.  
 9: Pre-charging, DC link voltage end of pre-charging still not detected.  
 10: Wait for the end of the de-bounce time of the main contactor after pre-charging has been completed.  
 11: Pre-charging completed, ready for pulse enable.  
 12: It was detected that the STO terminal was energized at the power unit.  
 xxxx = Missing internal enable signals, power unit (inverted bit-coded, FFFF hex -> all internal enable signals available)  
 Bit 0: Power supply of the IGBT gating shut down.  
 Bit 1: Ground fault detected.  
 Bit 2: Peak current intervention.  
 Bit 3: I<sub>2t</sub> exceeded.  
 Bit 4: Thermal model overtemperature calculated.  
 Bit 5: (heat sink, gating module, power unit) overtemperature measured.  
 Bit 6: Reserved.  
 Bit 7: Overvoltage detected.  
 Bit 8: Power unit has completed pre-charging, ready for pulse enable.  
 Bit 9: STO terminal missing.  
 Bit 10: Overcurrent detected.  
 Bit 11: Armature short-circuit active.  
 Bit 12: DRIVE-CLiQ fault active.  
 Bit 13: Vce fault detected, transistor de-saturated due to overcurrent/short-circuit.  
 Bit 14: Undervoltage detected.  
 See also: p0210 (Drive unit line supply voltage)

**Remedy:**

In general:  
 - check the line supply voltage at the input terminals.  
 - check the line supply voltage setting (p0210).  
 For booksize drive units, the following applies:  
 - wait (approx. 8 minutes) until the pre-charging resistors have cooled down. For this purpose, preferably disconnect the infeed unit from the line supply.  
 Re 5):  
 - carefully observe the permissible pre-charging frequency (refer to the appropriate Equipment Manual).  
 Re 6):  
 - check the total capacitance of the DC link and reduce in accordance with the maximum permissible DC-link capacitance if necessary (refer to the appropriate Equipment Manual)  
 Re 7):  
 - interconnect the ready-for-operation signal from the infeed unit (r0863.0) in the enable logic of the drives connected to this DC link  
 Re 8):  
 - check the connections of the external line contactor. The line contactor must be open during DC-link fast discharge.  
 Re 9):  
 - check the DC link for ground faults or short circuits.  
 Re 11):  
 - Check the DC link voltage of the infeed (r0070) and Motor Modules (r0070).  
 If the DC link voltage generated by the infeed (or external) is not displayed for the Motor Modules (r0070), then a fuse has ruptured in the Motor Module.  
 See also: p0210 (Drive unit line supply voltage)

**230031****<location>Power unit: Hardware current limiting, phase U**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Hardware current limit for phase U responded. The pulsing in this phase is inhibited for one pulse period.  
 - closed-loop control is incorrectly parameterized.  
 - fault in the motor or in the power cables.

- the power cables exceed the maximum permissible length.
- motor load too high
- power unit defective.

Note:

Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.

**Remedy:**

- check the motor data and if required, recalculate the controller parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).
- check the motor circuit configuration (star-delta)
- check the motor load.
- check the power cable connections.
- check the power cables for short-circuit or ground fault.
- check the length of the power cables.

---

**230032** <location>Power unit: Hardware current limiting, phase V

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Hardware current limit for phase V responded. The pulsing in this phase is inhibited for one pulse period.

- closed-loop control is incorrectly parameterized.
- fault in the motor or in the power cables.
- the power cables exceed the maximum permissible length.
- motor load too high
- power unit defective.

Note:

Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.

**Remedy:**

- Check the motor data and if required, recalculate the controller parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).
- check the motor circuit configuration (star-delta)
- check the motor load.
- check the power cable connections.
- check the power cables for short-circuit or ground fault.
- check the length of the power cables.

---

**230033** <location>Power unit: Hardware current limiting, phase W

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Hardware current limit for phase W responded. The pulsing in this phase is inhibited for one pulse period.

- closed-loop control is incorrectly parameterized.
- fault in the motor or in the power cables.
- the power cables exceed the maximum permissible length.
- motor load too high
- power unit defective.

Note:

Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.

**Remedy:**

- check the motor data and if required, recalculate the controller parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).
- check the motor circuit configuration (star-delta)
- check the motor load.
- check the power cable connections.
- check the power cables for short-circuit or ground fault.
- check the length of the power cables.

### 230034 <location>Power unit: Internal overtemperature

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The alarm threshold for internal overtemperature has been reached.  
 If the temperature inside the unit continues to increase, fault F30036 may be triggered.

- ambient temperature might be too high.
- insufficient cooling, fan failure.

Fault value (r0949, interpret binary):  
 Bit 0 = 1: Control electronics range.  
 Bit 1 = 1: Power electronics range.

**Remedy:**

- check the ambient temperature.
- check the fan for the inside of the unit.

### 230035 <location>Power unit: Air intake overtemperature

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The air intake in the power unit has exceeded the permissible temperature limit.  
 For air-cooled power units, the temperature limit is at 55 °C.

- ambient temperature too high.
- insufficient cooling, fan failure.

Fault value (r0949, decimal interpretation):  
 Temperature [0.01 °C].

**Remedy:**

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.

Notice:  
 This fault can only be acknowledged after this alarm threshold for alarm A05002 has been undershot.

### 230036 <location>Power unit: Internal overtemperature

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** For chassis power units, the following applies:  
 The temperature inside the drive converter has exceeded the permissible temperature limit.  
 - insufficient cooling, fan failure.  
 - overload.  
 - ambient temperature too high.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Overtemperature in the control electronics range.  
 Bit 1 = 1: Overtemperature in the power electronics range.

**Remedy:**  
 - check whether the fan is running.  
 - check the fan elements.  
 - check whether the ambient temperature is in the permissible range.

**Notice:**  
 This fault can only be acknowledged once the permissible temperature limit minus 5 K has been fallen below.

**230037**                    **<location>Power unit: Rectifier overtemperature**

**Message value:**        %1

**Drive object:**            A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**                OFF2

**Acknowledge:**            IMMEDIATELY

**Cause:**                    The temperature in the rectifier of the power unit has exceeded the permissible temperature limit.  
 - insufficient cooling, fan failure.  
 - overload.  
 - ambient temperature too high.  
 - line supply phase failure.  
 Fault value (r0949, decimal interpretation):  
 Temperature [0.01 °C].

**Remedy:**  
 - check whether the fan is running.  
 - check the fan elements.  
 - check whether the ambient temperature is in the permissible range.  
 - check the motor load.  
 - check the line supply phases.

**Notice:**  
 This fault can only be acknowledged after this alarm threshold for alarm A05004 has been undershot.

**230038**                    **<location>Power unit: Capacitor fan monitoring**

**Message value:**        %1

**Drive object:**            B\_INF, BIC\_SINUMERIK

**Reaction:**                NONE

**Acknowledge:**            NONE

**Cause:**                    The capacitor fan signals a fault.

**Remedy:**                  Replace the capacitor fan in the power unit.

**230039**                    **<location>Power unit: Failure capacitor fan**

**Message value:**        %1

**Drive object:**            B\_INF, BIC\_SINUMERIK

**Reaction:**                OFF1

**Acknowledge:**            IMMEDIATELY

**Cause:**                    The capacitor fan has failed.

**Remedy:**                  Replace the capacitor fan in the power unit.

---

**230040 <location>Power unit: Undervolt 24 V**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** Failure of the 24 V power supply for the power unit.  
- The undervoltage threshold was undershot for longer than 3 ms.  
Fault value (r0949, decimal interpretation):  
24 V voltage [0.1 V].  
**Remedy:**  
- check the 24 V DC power supply of the power unit.  
- carry out a POWER ON (power off/on) for the component.

---

**230041 <location>Power unit: Undervoltage 24 V alarm**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** 24 V power supply fault for the power unit.  
- the 16 V threshold was undershot..  
Alarm value (r2124, interpret decimal):  
24 V voltage [0.1 V].  
**Remedy:**  
- check the 24 V DC power supply of the power unit.  
- carry out a POWER ON (power off/on) for the component.

---

**230042 <location>Power unit: Fan operating time reached or exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The maximum operating time of the fan in the power unit is set in p0252.  
This message indicates the following:  
Fault value (r0949, decimal interpretation):  
0: The maximum fan operating time is 500 hours.  
1: The maximum fan operating time has been exceeded.  
**Remedy:** Replace the fan in the power unit and reset the operating hours counter to 0 (p0251 = 0).  
See also: p0251 (Operating hours counter power unit fan), p0252 (Maximum operating time power unit fan)

---

**230043 <location>Power unit: Overvolt 24 V**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** POWER ON

**Cause:** The following applies for CU31x:  
 Overvoltage of the 24 V power supply for the power unit.  
 - the 31.5 V threshold was exceeded for more than 3 ms.  
 Fault value (r0949, decimal interpretation):  
 24 V voltage [0.1 V].

**Remedy:** Check the 24 V DC power supply of the power unit.

**230044 <location>Power unit: Overvoltage 24 V alarm**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The following applies for CU31x:  
 24 V power supply fault for the power unit.  
 - the 32.0 V threshold was exceeded.  
 Alarm value (r2124, interpret decimal):  
 24 V voltage [0.1 V].

**Remedy:** Check the 24 V DC power supply of the power unit.

**230045 <location>Power unit: Supply undervoltage**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** Power supply fault in the power unit.  
 - The voltage monitor signals an undervoltage fault on the module.  
 The following applies for CU31x:  
 - the voltage monitoring on the DAC board signals an undervoltage fault on the module.

**Remedy:** - check the 24 V DC voltage supply to power unit.  
 - carry out a POWER ON (power off/on) for the component.  
 - replace the module if necessary.

**230046 <location>Power unit: Undervoltage, alarm**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Before the last restart, a problem occurred at the power unit power supply.  
 - the voltage monitor in the internal FPGA of the PSA signals an undervoltage fault on the module.  
 Fault value (r0949):  
 Register value of the voltage fault register.

**Remedy:** - check the 24 V DC voltage supply to power unit.  
 - carry out a POWER ON (power off/on) for the component.  
 - replace the module if necessary.

---

<b>230047</b>	<b>&lt;location&gt;Cooling system: Cooling medium flow rate too low</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The flowrate of the cooling system has fallen below the fault threshold.
<b>Remedy:</b>	- Check the feedback signals and parameter assignment (p0260 ... p0267). - Check the coolant feed.

---

<b>230048</b>	<b>&lt;location&gt;Power unit: External fan faulty</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The feedback signal from the external fan indicates a fault. - fan faulty, blocked. - feedback signal inaccurate.
<b>Remedy:</b>	- check the external fan and replace if necessary. - if you are using an external fan with feedback, check its wiring (X12.2 or X13.2). Note: If you are using an external fan without feedback, check that the feedback terminal wiring on the power unit is connected to ground and make this connection if necessary (X12.1/2 or X13.1/2).

---

<b>230049</b>	<b>&lt;location&gt;Power unit: Internal fan faulty</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The internal fan has failed.
<b>Remedy:</b>	Check the internal fan and replace if necessary.

---

<b>230050</b>	<b>&lt;location&gt;Power unit: 24 V supply overvoltage</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	The voltage monitor signals an overvoltage fault on the module.
<b>Remedy:</b>	- check the 24 V power supply. - replace the module if necessary.

---

**230052 <location>EEPROM data error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** POWER ON  
**Cause:** EEPROM data error of the power unit module.  
 Fault value (r0949, interpret hexadecimal):  
 0: The EEPROM data read in from the power unit module is inconsistent.  
 1: EEPROM data is not compatible to the firmware of the power unit application.  
 Additional values:  
 Only for internal Siemens troubleshooting.  
**Remedy:** For fault value = 0:  
 Replace the power unit module or update the EEPROM data.  
 For fault value = 1:  
 The following applies for CU31x and CUA31:  
 Update the firmware \SIEMENS\SINAMICS\CODE\SAC\cu31xi.ufw (cua31.ufw)

---

**230053 <location>FPGA data faulty**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** POWER ON  
**Cause:** The FPGA data of the power unit are faulty.  
**Remedy:** Replace the power unit or update the FPGA data.

---

**230054 <location>Power unit: Undervoltage when opening the brake**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When the brake is being opened, it is detected that the power supply voltage is less than 24 V - 10% = 21.6V.  
 Alarm value (r2124, interpret decimal):  
 Supply voltage fault [0.1 V].  
 Example:  
 Alarm value = 212 --> voltage = 21.2 V  
**Remedy:** Check the 24V power supply for stability and value.

---

**230055 <location>Power unit: Braking chopper overcurrent**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** An overcurrent condition has occurred in the braking chopper.



**Remedy:**

- check whether the braking resistor has a short circuit.
- for an external braking resistor, check whether the resistor may have been dimensioned too small.

Note:  
The braking chopper is only enabled again at pulse enable after the fault has been acknowledged.

### 230057 <location>Power unit: Line asymmetry

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Frequencies have been detected on the DC link voltage that would suggest line asymmetry or failure of a line phase. It is also possible that a motor phase has failed.  
 Fault F30011 is output if the alarm is present and at the latest after 5 minutes.  
 Alarm value (r2124, interpret decimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- check the line phase connection.
- check the motor feeder cable connections.

If there is no phase failure of the line or motor, then line asymmetry is involved.

- reduce the power in order to avoid fault F30011.

### 230059 <location>Power unit: Internal fan faulty

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The internal power unit fan has failed and is possibly defective.  
**Remedy:** Check the internal fan and replace if necessary.

### 230060 <location>Pre-charge contactor state monitoring

**Message value:** Fault cause: %1 bin  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** At the end of the monitoring time (p0255[0]), the actual state of the pre-charge contactor does not match the desired state.  
 Bit 0: Monitoring time exceeded.  
 Bit 1: Contactor opened during operation.  
 Bit 2: Contactor closed in OFF state.

**Remedy:**

- check the monitoring time setting (p0255[0]).
- check the contactor wiring and activation.
- replace the contactor.

---

**230061 <location>Bypass contactor monitoring**

**Message value:** Fault cause: %1 bin  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (NONE, OFF1)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** At the end of the monitoring time (p0255[1]), the actual state of the bypass contactor does not match the desired state.  
 Fault value (r0949, interpret bitwise binary):  
 Bit 0: Monitoring time exceeded.  
 Bit 1: Contactor opened during operation.  
 Bit 2: Contactor closed in OFF state.  
**Remedy:** - check the monitoring time setting (p0255[1]).  
 - check the contactor wiring and activation.  
 - replace the contactor.

---

**230070 <location>Cycle requested by the power unit module not supported**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A cycle is requested that is not supported by the power unit.  
 Fault value (r0949, interpret hexadecimal):  
 0: The current control cycle is not supported.  
 1: The DRIVE-CLiQ cycle is not supported.  
 2: Internal timing problem (clearance between RX and TX instants too low).  
 3: Internal timing problem (TX instant too early).  
**Remedy:** The power unit only supports the following cycles:  
 62.5 µs, 125 µs, 250 µs and 500 µs  
 For fault value = 0:  
 Set a permitted current control cycle.  
 For fault value = 1:  
 Set a permitted DRIVE-CLiQ cycle.  
 Re fault value = 2, 3:  
 Contact the manufacturer (you may have an incompatible firmware version).

---

**230071 <location>No new actual values received from the power unit module**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The number of actual value telegrams from the power unit module that have failed has exceeded the permissible number.  
**Remedy:** Check the interface (adjustment and locking) to the power unit module.

---

<b>230072</b>	<b>&lt;location&gt;Setpoints are no longer being transferred to the power unit</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The following applies for CU31x and CUA31: More than one setpoint telegram was not able to be transferred to the power unit module.
<b>Remedy:</b>	The following applies for CU31x and CUA31: Check the interface (adjustment and locking) to the power unit module.

---

<b>230073</b>	<b>&lt;location&gt;Actual value/setpoint preprocessing no longer synchronous</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	Communication with the power unit module is no longer in synchronism with the current control cycle.
<b>Remedy:</b>	Wait until synchronization is re-established.

---

<b>230074</b>	<b>&lt;location&gt;Communication error between the Control Unit and Power Module</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Communications between the Control Unit (CU) and Power Module (PM) via the interface no longer possible. The CU may have been withdrawn or is incorrectly inserted. Fault value (r0949, interpret hexadecimal): 0 hex: The Control Unit was withdrawn from the Power Module during operation. 1 hex: The Control Unit was withdrawn from the Power Module during operation, although the encoderless safe motion monitoring functions are enabled. This is not supported. After re-inserting the Control Unit in operation, communications to the Power Module no longer possible. 20A hex: The Control Unit was inserted on a Power Module, which has another code number. 20B hex: The Control Unit was inserted on a Power Module, which although it has the same code number, has a different serial number. 601 hex: The Control Unit was inserted on a Power Module, whose power/performance class (chassis unit) is not supported.
<b>Remedy:</b>	Reinsert the Control Unit (CU) or the Control Unit adapter (CUAxx) onto the original Power Module and continue operation. If required, carry out a POWER ON for the CU and/or the CUA.

**230080 <location>Power unit: Current increasing too quickly**

**Message value:** Fault cause: %1 bin  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The power unit has detected an excessive rate of rise in the overvoltage range.  
 - closed-loop control is incorrectly parameterized.  
 - motor has a short-circuit or fault to ground (frame).  
 - U/f operation: Up ramp set too low.  
 - U/f operation: rated current of motor much greater than that of power unit.  
 - infeed: High discharge and post-charging currents for voltage dip.  
 - infeed: High post-charging currents for overload when motoring and DC link voltage dip.  
 - infeed: Short-circuit currents at power-up due to the missing line reactor.  
 - power cables are not correctly connected.  
 - power cables exceed the maximum permissible length.  
 - power unit defective.  
 Additional causes for a parallel switching device (r0108.15 = 1):  
 - a power unit has tripped (powered down) due to a ground fault.  
 - the closed-loop circulating current control is either too slow or has been set too fast.  
 Fault value (r0949, interpret bitwise binary):  
 Bit 0: Phase U.  
 Bit 1: Phase V.  
 Bit 2: Phase W.  
**Remedy:**  
 - check the motor data - if required, carry out commissioning.  
 - check the motor circuit configuration (star-delta)  
 - U/f operation: Increase up ramp.  
 - U/f operation: Check assignment of rated currents of motor and power unit.  
 - infeed: Check the line supply quality.  
 - infeed: Reduce the motor load.  
 - infeed: Correct connection of the line reactor.  
 - check the power cable connections.  
 - check the power cables for short-circuit or ground fault.  
 - check the length of the power cables.  
 - replace power unit.  
 For a parallel switching device (r0108.15 = 1) the following additionally applies:  
 - check the ground fault monitoring thresholds (p0287).  
 - check the setting of the closed-loop circulating current control (p7036, p7037).

**230081 <location>Power unit: Switching operations too frequent**

**Message value:** Fault cause: %1 bin  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The power unit has executed too many switching operations for current limitation.  
 - closed-loop control is incorrectly parameterized.  
 - motor has a short-circuit or fault to ground (frame).  
 - U/f operation: Up ramp set too low.  
 - U/f operation: rated current of motor much greater than that of power unit.  
 - infeed: High discharge and post-charging currents for voltage dip.  
 - infeed: High post-charging currents for overload when motoring and DC link voltage dip.  
 - infeed: Short-circuit currents at power-up due to the missing line reactor.  
 - power cables are not correctly connected.  
 - power cables exceed the maximum permissible length.  
 - power unit defective.

Additional causes for a parallel switching device (r0108.15 = 1):  
 - a power unit has tripped (powered down) due to a ground fault.  
 - the closed-loop circulating current control is either too slow or has been set too fast.  
 Fault value (r0949, interpret bitwise binary):

Bit 0: Phase U.

Bit 1: Phase V.

Bit 2: Phase W.

**Remedy:**

- check the motor data - if required, carry out commissioning.
- check the motor circuit configuration (star-delta)
- U/f operation: Increase up ramp.
- U/f operation: Check assignment of rated currents of motor and power unit.
- infeed: Check the line supply quality.
- infeed: Reduce the motor load.
- infeed: Correct connection of the line reactor.
- check the power cable connections.
- check the power cables for short-circuit or ground fault.
- check the length of the power cables.
- replace power unit.

For a parallel switching device (r0108.15 = 1) the following additionally applies:

- check the ground fault monitoring thresholds (p0287).
- check the setting of the closed-loop circulating current control (p7036, p7037).

### 230105 <location>PU: Actual value sensing fault

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** At least one incorrect actual value channel was detected on the Power Stack Adapter (PSA).  
The incorrect actual value channels are displayed in the following diagnostic parameters.

**Remedy:** Evaluate the diagnostic parameters.  
If the actual value channel is incorrect, check the components and if required, replace.

### 230314 <location>Power unit: 24 V power supply overloaded by PM

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The 24 V power supply through the Power Module (PM) is overloaded.  
An external 24 V power supply via X124 on the Control Unit is not connected.

**Remedy:** Connect an external 24 V power supply via X124 at the Control Unit.

### 230315 <location>Power unit: 24 V power supply overloaded by PM

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The 24 V power supply through the Power Module (PM) is overloaded.  
An external 24 V power supply via X124 on the Control Unit is not connected.

**Remedy:** Connect an external 24 V power supply via X124 at the Control Unit.

---

**230502**                    **<location>Power unit: DC link overvoltage**

**Message value:**        %1  
**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**             NONE  
**Acknowledge:**        NONE  
**Cause:**                The power unit has detected overvoltage in the DC link on a pulse inhibit.  
                              - device connection voltage too high.  
                              - line reactor incorrectly dimensioned.  
                              Fault value (r0949, decimal interpretation):  
                              DC link voltage [1 bit = 100 mV].  
                              See also: r0070 (Actual DC link voltage)  
**Remedy:**               - check the device supply voltage (p0210).  
                              - check the dimensioning of the line reactor.  
                              See also: p0210 (Drive unit line supply voltage)

---

**230600**                    **<location>SI MM: STOP A initiated**

**Message value:**        %1  
**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**             OFF2  
**Acknowledge:**        IMMEDIATELY (POWER ON)  
**Cause:**                The "Safety Integrated" function integrated in the drive in the Motor Module (MM) has detected a fault and initiated STOP A (pulse suppression via the safety shutdown path of the Motor Module).  
                              - forced checking procedure of the safety shutdown path of the Motor Module unsuccessful.  
                              - subsequent response to fault F30611 (defect in a monitoring channel).  
                              Fault value (r0949, decimal interpretation):  
                              0: Stop request from the Control Unit.  
                              1005: Pulses suppressed although STO not selected and there is no internal STOP A present.  
                              1010: Pulses enabled although STO is selected or an internal STOP A is present.  
                              1020: Internal software error in the "Internal voltage protection" function. The "internal voltage protection" function is withdrawn. A STOP A that cannot be acknowledged is initiated.  
                              9999: Subsequent response to fault F30611.  
**Remedy:**               - select Safe Torque Off and de-select again.  
                              - replace the Motor Module involved.  
                              For fault value = 1020:  
                              - carry out a POWER ON (power off/on) for all components.  
                              - upgrade the Motor Module software.  
                              - replace the Motor Module.  
                              For fault value = 9999:  
                              - carry out diagnostics for fault F30611.  
                              Note:  
                              CU: Control Unit  
                              MM: Motor Module  
                              SI: Safety Integrated  
                              STO: Safe Torque Off / SH: Safe standstill

<b>230611</b>	<b>&lt;location&gt;SI MM: Defect in a monitoring channel</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (OFF1, OFF2, OFF3) Vector: NONE (OFF1, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>The "Safety Integrated" function integrated in the drive in the Motor Module (MM) has detected a fault in the crosswise data comparison between the Control Unit (CU) and MM and initiated a STOP F.</p> <p>As a result of this fault, after the parameterized transition has expired (p9858), fault F30600 is output (SI MM: STOP A initiated).</p> <p>Fault value (r0949, decimal interpretation):</p> <p>0: Stop request from the Control Unit.</p> <p>1 ... 999:</p> <p>Number of the cross-checked data that resulted in this fault. This number is also displayed in r9895.</p> <p>1: SI monitoring clock cycle (r9780, r9880).</p> <p>2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.</p> <p>3: SI SGE changeover tolerance time (p9650, p9850).</p> <p>4: SI transition period STOP F to STOP A (p9658, p9858).</p> <p>5: SI enable Safe Brake Control (p9602, p9802).</p> <p>6: SI Motion enable, safety-relevant functions (p9501, internal value).</p> <p>7: SI pulse suppression delay time for Safe Stop 1 (p9652, p9852).</p> <p>8: SI PROFIsafe address (p9610, p9810).</p> <p>9: SI debounce time for STO/SBC/SS1 (MM) (p9651, p9851).</p> <p>10: SI delay time for pulse suppression for ESR (p9697, p9897).</p> <p>11: SI Safe Brake Adapter mode, BICO interconnection (p9621, p9821).</p> <p>12: SI Safe Brake Adapter relay ON time (p9622[0], p9822[0]).</p> <p>13: SI Safe Brake Adapter relay OFF time (p9622[1], p9822[1]).</p> <p>1000: Watchdog timer has expired. Within the time of approx. 5 x p9850 too many switching operations have occurred at the safety-related inputs of the Control Unit, or STO (also as subsequent response) was initiated too frequently via PROFIsafe/TM54F.</p> <p>1001, 1002: Initialization error, change timer / check timer.</p> <p>1950: Module temperature outside the permissible temperature range.</p> <p>1951: Module temperature not plausible.</p> <p>2000: Status of the STO selection on the Control Unit and Motor Module are different.</p> <p>2001: Feedback signal for safe pulse suppression on the Control Unit and Motor Module are different.</p> <p>2002: Status of the delay timer SS1 on the Control Unit and Motor Module are different.</p> <p>6000 ... 6999:</p> <p>Error in the PROFIsafe control.</p> <p>For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.</p> <p>The significance of the individual message values is described in safety message C01711 of the Control Unit.</p>
<b>Remedy:</b>	<p>Re fault value = 1 ... 5 and 7 ... 999:</p> <ul style="list-style-type: none"> <li>- check the cross-checked data that resulted in a STOP F.</li> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- upgrade the Motor Module software.</li> <li>- upgrade the Control Unit software.</li> </ul> <p>For fault value = 6:</p> <ul style="list-style-type: none"> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- upgrade the Motor Module software.</li> <li>- upgrade the Control Unit software.</li> </ul> <p>For fault value = 1000:</p> <ul style="list-style-type: none"> <li>- check the wiring of the safety-relevant inputs (SGE) on the Control Unit (contact problems).</li> <li>- PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller. - check the wiring of the failsafe inputs at the TM54F (contact problems).</li> </ul> <p>Re fault value = 1001, 1002:</p> <ul style="list-style-type: none"> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- upgrade the Motor Module software.</li> <li>- upgrade the Control Unit software.</li> </ul>

Re fault value = 2000, 2001, 2002:

- check the tolerance time SGE changeover and if required, increase the value (p9650/p9850, p9652/p9852).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).
- check the cause of the STO selection in r9772. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions.
- replace the Motor Module involved.

Re fault value = 6000 ... 6999:

Refer to the description of the message values in safety message C01711.

Note:

CU: Control Unit

MM: Motor Module

SGE: Safety-relevant input

SI: Safety Integrated

SMM: Safe Motion Monitoring

SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)

STO: Safe Torque Off / SH: Safe standstill

ESR: Extended Stop and Retract

---

**230620**                    **<location>SI MM: Safe Torque Off active**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The "Safe Torque Off" function was selected on the Motor Module (MM) via the input terminal and is active.

Note:

This message does not result in a safety stop response.

**Remedy:** Not necessary.

Note:

MM: Motor Module

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

---

**230621**                    **<location>SI MM: Safe Stop 1 active**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The "Safe Stop 1" function (SS1) was selected on the Motor Module (MM) and is active.

Note:

This message does not result in a safety stop response.

**Remedy:** Not necessary.

Note:

MM: Motor Module

SI: Safety Integrated

SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)



**230625 <location>SI MM: Sign-of-life error in safety data**

<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>The "Safety Integrated" function integrated in the drive on the Motor Module (MM) has detected an error in the sign-of-life of the safety data between the Control Unit (CU) and MM and initiated a STOP A.</p> <ul style="list-style-type: none"> <li>- there is either a DRIVE-CLiQ communication error or communication has failed.</li> <li>- a time slice overflow of the safety software has occurred.</li> </ul> <p>Fault value (r0949, decimal interpretation): Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- select Safe Torque Off and de-select again.</li> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.</li> <li>- de-select all drive functions that are not absolutely necessary.</li> <li>- reduce the number of drives.</li> <li>- check the electrical cabinet design and cable routing for EMC compliance</li> </ul> <p>Note: CU: Control Unit MM: Motor Module SI: Safety Integrated</p>

**230630 <location>SI MM: Brake control error**

<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>The "Safety Integrated" function integrated in the drive on the Motor Module (MM) has detected a brake control error and initiated a STOP A.</p> <p>Fault value (r0949, decimal interpretation):</p> <p>10: Fault in "open holding brake" operation.</p> <ul style="list-style-type: none"> <li>- Parameter p1278 incorrectly set.</li> <li>- No brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).</li> <li>- Ground fault in brake cable.</li> </ul> <p>30: Fault in "close holding brake" operation.</p> <ul style="list-style-type: none"> <li>- No brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).</li> <li>- Short-circuit in brake winding.</li> </ul> <p>40: Fault in "brake closed" state.</p> <p>60, 70: Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control).</p> <p>81: SafeBrakeAdapter: Fault in "brake closed" state. 82: SafeBrakeAdapter: Fault in "open brake" state. 83: SafeBrakeAdapter: Fault in "close brake" state.</p>

84,85:

SafeBrakeAdapter: Fault in the brake control circuit of the Control Unit or communication fault between Control Unit and Motor Module (brake control).

Note:

The following causes may apply to fault values:

- motor cable is not shielded correctly.
- defect in control circuit of the Motor Module.

**Remedy:**

- check parameter p1278 (for SBC, only p1278 = 0 is permissible).
- select Safe Torque Off and de-select again.
- check the motor holding brake connection.
- check the function of the motor holding brake.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).
- replace the Motor Module involved.

Operation with Safe Brake Module or Safe Brake Adapter:

- check the Safe Brake Module or Safe Brake Adapter connection.
- Replace the Safe Brake Module or Safe Brake Adapter.

Note:

MM: Motor Module

SBC: Safe Brake Control

SI: Safety Integrated

**230640**

**<location>SI MM: Fault in the shutdown path of the second channel**

**Message value:**

%1

**Drive object:**

A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:**

NONE

**Acknowledge:**

NONE

**Cause:**

The Motor Module has detected a communication error with the higher-level control or the TM54F to transfer the safety-relevant information or there is a communication error between motor modules connected in parallel.

Note:

This fault results in a STOP A that can be acknowledged.

Fault value (r0949, decimal interpretation):

Only for internal Siemens troubleshooting.

**Remedy:**

For the higher-level control, the following applies:

- check the PROFIsafe address in the higher-level control and Motor Modules and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (power off/on) for all components.

For TM54F, carry out the following steps:

- start the copy function for the node identifier (p9700 = 1D hex).
- acknowledge hardware CRC (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (power off/on) for all components.

For a parallel connection:

- check the PROFIsafe address in the Control Unit and Motor Module and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (power off/on) for all components.

The following generally applies:

- upgrade the Motor Module software.

Note:

MM: Motor Module

SI: Safety Integrated

See also: p9810 (SI PROFIsafe address (Motor Module))

**230649 <location>SI MM: Internal software error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** An internal error in the Safety Integrated software on the Motor Module has occurred.  
**Note:**  
This fault results in a STOP A that cannot be acknowledged.  
Fault value (r0949, interpret hexadecimal):  
Only for internal Siemens troubleshooting.  
**Remedy:**  
- carry out a POWER ON (power off/on) for all components.  
- re-commission the Safety Integrated function and carry out a POWER ON.  
- upgrade the Motor Module software.  
- contact the Hotline.  
- replace the Motor Module.  
**Note:**  
MM: Motor Module  
SI: Safety Integrated

**230650 <location>SI MM: Acceptance test required**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The "Safety Integrated" function on the Motor Module requires an acceptance test.  
**Note:**  
This fault results in a STOP A that can be acknowledged.  
Fault value (r0949, decimal interpretation):  
130: Safety parameters for the Motor Module not available.  
**Note:**  
This fault value is always output when Safety Integrated is commissioned for the first time.  
1000: Reference and actual checksum in the Motor Module are not identical (booting).  
- at least one checksum-checked piece of data is defective.  
2000: Reference and actual checksum on the Motor Module are not identical (commissioning mode).  
- reference checksum incorrectly entered into the Motor Module (p9899 not equal to r9898).  
2003: Acceptance test is required as a safety parameter has been changed.  
2005: The safety logbook has identified that the safety checksums have changed. An acceptance test is required.  
3003: Acceptance test is required as a hardware-related safety parameter has been changed.  
9999: Subsequent response of another safety-related fault that occurred when booting that requires an acceptance test.  
**Remedy:**  
For fault value = 130:  
- carry out safety commissioning routine.  
For fault value = 1000:  
- again carry out safety commissioning routine.  
- replace the memory card or Control Unit.  
For fault value = 2000:  
- check the safety parameters in the Motor Module and adapt the reference checksum (p9899).  
Re fault value = 2003, 2005:  
- Carry out an acceptance test and generate an acceptance report.  
The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:  
SINAMICS S120 Function Manual Safety Integrated

For fault value = 3003:

- carry out the function checks for the modified hardware and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

For fault value = 9999:

- carry out diagnostics for the other safety-related fault that is present.

Note:

MM: Motor Module

SI: Safety Integrated

See also: p9799 (SI reference checksum SI parameters (Control Unit)), p9899 (SI reference checksum SI parameters (Motor Module))

---

**230651 <location>SI MM: Synchronization with Control Unit unsuccessful**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The "Safety Integrated" function integrated in the drive is requesting synchronization of the safety time slices on the Control Unit and Motor Module. This synchronization routine was unsuccessful.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, decimal interpretation):

Only for internal Siemens troubleshooting.

**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

Note:

MM: Motor Module

SI: Safety Integrated

---

**230652 <location>SI MM: Illegal monitoring clock cycle**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The Safety Integrated monitoring clock cycle cannot be maintained due to the communication conditions requested in the system.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, decimal interpretation):

Only for internal Siemens troubleshooting.

**Remedy:**

- if fault 1652 simultaneously occurs, apply the remedy/countermeasure described there.
- upgrade the Motor Module software.

Note:

MM: Motor Module

SI: Safety Integrated

---

<b>230655</b>	<b>&lt;location&gt;SI MM: Align monitoring functions</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>An error has occurred when aligning the Safety Integrated monitoring functions on the Control Unit (CU) and Motor Module (MM). Control Unit and Motor Module were not able to determine a common set of supported SI monitoring functions.</p> <ul style="list-style-type: none"> <li>- there is either a DRIVE-CLiQ communication error or communication has failed.</li> <li>- Safety Integrated software releases on the Control Unit and Motor Module are not compatible with one another.</li> </ul> <p>Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- carry out a POWER ON (power off/on) for all components.</li> <li>- upgrade the Motor Module software.</li> <li>- upgrade the Control Unit software.</li> <li>- check the electrical cabinet design and cable routing for EMC compliance</li> </ul> <p>Note: CU: Control Unit MM: Motor Module SI: Safety Integrated</p>

---

<b>230656</b>	<b>&lt;location&gt;SI MM: Motor Module parameter error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	<p>When accessing the Safety Integrated parameters for the Motor Module (MM) in the non-volatile memory, an error has occurred.</p> <p>Note: This fault results in a STOP A that can be acknowledged. Fault value (r0949, decimal interpretation): 129: - safety parameters for the Motor Module corrupted. - drive with enabled safety functions was possibly copied offline using the commissioning software and the project downloaded. 131: Internal software error on the Control Unit. 255: Internal Motor Module software error.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- re-commission the safety functions.</li> <li>- upgrade the Control Unit software.</li> <li>- upgrade the Motor Module software.</li> <li>- replace the memory card or Control Unit.</li> </ul> <p>For fault value = 129:</p> <ul style="list-style-type: none"> <li>- activate the safety commissioning mode (p0010 = 95).</li> <li>- adapt the PROFIsafe address (p9610).</li> <li>- start the copy function for SI parameters (p9700 = D0 hex).</li> <li>- acknowledge data change (p9701 = DC hex).</li> <li>- exit the safety commissioning mode (p0010 = 0).</li> <li>- save all parameters (p0977 = 1 or "copy RAM to ROM").</li> <li>- carry out a POWER ON (power off/on) for all components.</li> </ul> <p>Note: MM: Motor Module SI: Safety Integrated</p>

**230659 <location>SI MM: Write request for parameter rejected**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The write request for one or several Safety Integrated parameters on the Motor Module (MM) was rejected.  
 Note:  
 This fault does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 10: An attempt was made to enable the STO function although this cannot be supported.  
 11: An attempt was made to enable the SBC function although this cannot be supported.  
 13: An attempt was made to enable the SS1 function although this cannot be supported.  
 14: An attempt was made to enable the safe motion monitoring function with the higher-level control, although this cannot be supported.  
 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.  
 16: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on the CU and MM is different.  
 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.  
 19: For ESR, an attempt was made to enable the delay for pulse suppression, although this cannot be supported.  
 See also: r9771 (SI common functions (Control Unit)), r9871 (SI common functions (Motor Module))

**Remedy:** Re fault value = 10, 11, 13, 14, 15, 16, 18, 19:  
 - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.  
 - use a Motor Module that supports the required function.  
 - upgrade the Motor Module software.  
 - upgrade the Control Unit software.  
 Note:  
 CU: Control Unit  
 ESR: Extended Stop and Retract  
 MM: Motor Module  
 SBC: Safe Brake Control  
 SI: Safety Integrated  
 SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)  
 STO: Safe Torque Off / SH: Safe standstill

---

**230662 <location>Error in internal communications**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF2

**Acknowledge:** POWER ON

**Cause:** A module-internal communication error has occurred.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:** - carry out a POWER ON (power off/on).  
 - upgrade firmware to later version.  
 - contact the Hotline.

---

**230664**      **<location>Error while booting**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, ENCODER, ENCSINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TB30, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** An error has occurred during booting.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.  
**Remedy:** - carry out a POWER ON (power off/on).  
 - upgrade firmware to later version.  
 - contact the Hotline.

---

**230665**      **<location>SI MM: System is defective**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A system defect was detected before the last boot or in the actual one. The system might have been rebooted (reset).  
 Fault value (r0949, interpret hexadecimal):  
 200000 hex, 400000 hex:  
 - Fault in the actual booting/operation.  
 2 hex:  
 - parameters p9500 and p9300 are not the same (if Safety message C30711 is displayed at the same time).  
 Additional values:  
 - defect before the last time that the system booted.  
**Remedy:** - carry out a POWER ON (power off/on).  
 - upgrade firmware to later version.  
 - contact the Hotline.  
 For fault value = 2:  
 - check parameters p9500 and p9300 to see if they are the same (if Safety message C30711 is displayed at the same time).  
 Re fault value = 400000 hex:  
 - ensure that the Control Unit is connected to the Power Module.

---

**230666**      **<location>SI Motion MM: Steady-state (static) 1 signal at the F-DI for safety-relevant acknowledgement**

**Message value:** -  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A logical 1 signal is present at the F-DI configured in p10106 for more than 10 seconds.  
 If, at the F-DI no acknowledgment was performed for safe acknowledgement, then a steady-state logical and 0 signal must be present. This avoids unintentional safety-relevant acknowledgement (or the "Internal Event Acknowledge" signal) if a wire breaks or one of the two digital inputs bounces.  
**Remedy:** Set the fail-safe digital input (F-DI) to a logical 0 signal (p10106).  
 Note:  
 F-DI: Failsafe Digital Input

**230672 <location>SI CU: Control Unit software incompatible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The existing Control Unit software does not support the safe drive-based motion monitoring function.  
**Note:**  
 This fault results in a STOP A that cannot be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.  
**Remedy:**  
 - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module (F01655, F30655) and if required, carry out diagnostics for the faults involved.  
 - use a Control Unit that supports the safe motion monitoring function.  
 - upgrade the Control Unit software.  
**Note:**  
 SI: Safety Integrated

---

**230680 <location>SI Motion MM: Checksum error safety monitoring functions**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The actual checksum calculated by the Motor Module and entered in r9398 over the safety-relevant parameters does not match the reference checksum saved in p9399 at the last machine acceptance.  
 Safety-relevant parameters have been changed or a fault is present.  
**Note:**  
 This fault results in a STOP A that can be acknowledged.  
 Fault value (r0949, decimal interpretation):  
 0: Checksum error for SI parameters for motion monitoring.  
 1: Checksum error for SI parameters for component assignment.  
**Remedy:**  
 - check the safety-relevant parameters and if required, correct.  
 - set the reference checksum to the actual checksum.  
 - perform a POWER ON if safety parameters requiring a POWER ON have been modified.  
 - carry out an acceptance test.

---

**230681 <location>SI Motion MM: Incorrect parameter value**

**Message value:** Parameter: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The parameter cannot be parameterized with this value.  
**Note:**  
 This message does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Parameter number with the incorrect value.  
**Remedy:**  
 Correct the parameter value.  
 If the encoder parameters (p9526/p9326) have different values, start the copy function for SI parameters on the drive (p9700 = 57 hex).  
 Also check p9316.0 for fault value 9317.



---

<b>230682</b>	<b>&lt;location&gt;SI Motion MM: Monitoring function not supported</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The monitoring function enabled in p9301, p9501, p9601 or p9801 is not supported in this firmware version. Note: This message does not result in a safety stop response. Fault value (r0949, decimal interpretation): 1: Monitoring function SLP not supported (p9301.1). 2: Monitoring function SCA not supported (p9301.7 and p9301.8 ... 15). 3: Monitoring function SLS override not supported (p9301.5). 4: Monitoring function external ESR activation not supported (p9301.4). 5: Monitoring function F-DI in PROFIsafe not supported (p9301.30). 6: Enable actual value synchronization not supported (p9301.3). 9: Monitoring function not supported, enable bit reserved (p9301.2, p9301.17 ... 29, p9301.31, if required p9301.6). 12: This Control Unit does not support NcSI. 24: Monitoring function SDI not supported. 26: hysteresis and filtering for SSM monitoring function without an encoder not supported (p9301.16). 30: The firmware version of the Motor Module is older than the version of the Control Unit.
<b>Remedy:</b>	- de-select the monitoring function involved (p9301, p9301, p9303, p9601, p9801). - Upgrade the Motor Module firmware. Note: ESR: Extended Stop and Retract SCA: Safe Cam / SN: Safe software cam SDI: Safe Direction (safe motion direction) SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches SLS: Safely-Limited Speed / SG: Safely reduced speed See also: p9301, p9501, p9503, p9601, p9801, r9871

---

<b>230683</b>	<b>&lt;location&gt;SI Motion MM: SOS/SLS enable missing</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The safety-relevant basic function "SOS/SLS" is not enabled in p9301 although other safety-relevant monitoring functions are enabled. Note: This message does not result in a safety stop response.
<b>Remedy:</b>	Enable the function "SOS/SLS" (p9301.0). Note: SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed SOS: Safe Operating Stop / SBH: Safe operating stop See also: p9301 (SI Motion enable safety functions (Motor Module))

---

<b>230685</b>	<b>&lt;location&gt;SI Motion MM: Safely-Limited Speed limit value too high</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)

**Cause:** The limit value for the function "Safely-Limited Speed" (SLS) is greater than the speed that corresponds to an encoder limit frequency of 500 kHz.  
**Note:**  
 This message does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Maximum permissible speed.

**Remedy:** Correct the limit values for SLS and carry out a POWER ON.  
**Note:**  
 SI: Safety Integrated  
 SLS: Safely-Limited Speed / SG: Safely reduced speed  
 See also: p9331 (SI Motion SLS limit values (Motor Module))

**230688 <location>SI Motion MM: Actual value synchronization not permissible**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:**  
 - It is not permissible to enable actual value synchronization for a 1-encoder system.  
 - It is not permissible to simultaneously enable actual value synchronization and a monitoring function with absolute reference (SCA/SLP).  
**Note:**  
 This fault results in a STOP A that cannot be acknowledged.

**Remedy:**  
 - Either select the "actual value synchronization" function or parameterize a 2-encoder system.  
 - Either de-select the function "actual value synchronization" or the monitoring functions with absolute reference (SCA/SLP) and carry out a POWER ON.  
**Note:**  
 SCA: Safe Cam / SN: Safe software cam  
 SI: Safety Integrated  
 SLP: Safely-Limited Position / SE: Safe software limit switches  
 See also: p9501 (SI Motion enable safety functions (Control Unit)), p9526 (SI Motion encoder assignment second channel)

**230692 <location>SI Motion MM: Incorrect parameter value encoderless**

**Message value:** Parameter: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:**  
 The parameter cannot be parameterized with this value if encoderless motion monitoring functions have been parameterized in p9306.  
**Note:**  
 This message does not result in a safety stop response.  
 Fault value (r0949, decimal interpretation):  
 Parameter number with the incorrect value.  
 See also: p9301 (SI Motion enable safety functions (Motor Module))

**Remedy:** Correct the parameter value or de-select encoderless motion monitoring functions.  
 See also: p9301 (SI Motion enable safety functions (Motor Module)), p9501 (SI Motion enable safety functions (Control Unit))

---

**230693 <location>SI MM: Safety parameter settings changed, warm restart/POWER ON required**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Safety parameters have been changed; these will only take effect following a warm restart or POWER ON.  
Alarm value (r2124, interpret decimal):  
Parameter number of the safety parameter which has changed, necessitating a warm restart or POWER ON.  
**Remedy:** - carry out a warm restart (p0009 = 30, p0976 = 2, 3).  
- carry out a POWER ON (power off/on) for all components.  
Note:  
Before performing an acceptance test, a POWER ON must be carried out for all components.

---

**230700 <location>SI Motion MM: STOP A initiated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The drive is stopped via a STOP A (pulses are suppressed via the safety shutdown path of the Control Unit).  
Possible causes:  
- stop request from the Control Unit.  
- pulses not suppressed after a parameterized time (p9357) after test stop selection.  
- subsequent response to the message C30706 "SI Motion MM: SAM/SBR limit exceeded".  
- subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".  
- subsequent response to the message C30701 "SI Motion MM: STOP B initiated".  
**Remedy:** - remove the cause to the fault on the Control Unit.  
- check the value in p9357, if required, increase the value.  
- check the shutdown path of the Control Unit (check DRIVE-CLiQ communication).  
- carry out a diagnostics routine for message C30706.  
- carry out a diagnostics routine for message C30714.  
- carry out a diagnostics routine for message C30701.  
- replace the Motor Module/Power Module  
- replace Control Unit.  
This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
Note:  
SAM: Safe Acceleration Monitor (safe acceleration monitoring)  
SBR: Safe Brake Ramp (safe brake ramp monitoring)  
SI: Safety Integrated

---

**230701 <location>SI Motion MM: STOP B initiated**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF3  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP B (braking along the OFF3 ramp).  
 As a result of this fault, after the time parameterized in p9356 has expired or after the speed threshold parameterized in p9360 has been fallen below, message C30700 "SI Motion MM: STOP A initiated" is output.  
 Possible causes:  
 - stop request from the Control Unit.  
 - subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".  
 - subsequent response to the message C30711 "SI Motion MM: Defect in a monitoring channel".  
 - subsequent response to the message C30707 "SI Motion MM: tolerance for safe operating stop exceeded".

**Remedy:**  
 - remove the cause to the fault on the Control Unit.  
 - carry out a diagnostics routine for message C30714.  
 - carry out a diagnostics routine for message C30711.  
 - carry out a diagnostics routine for message C30707.  
 This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
 Note:  
 SI: Safety Integrated

---

**230706 <location>SI Motion MM: SAM/SBR limit exceeded**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** Motion monitoring functions with encoder (p9306 = 0) or encoderless with set acceleration monitoring (p9306 = 3):  
 SAM - safe acceleration monitoring. After initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance.  
 Motion monitoring functions encoderless with set brake ramp monitoring (p9306 = 1):  
 SBR - Safe brake ramp monitoring. After initiating STOP B (SS1) or SLS changeover to the lower speed stage, the speed has exceeded the selected tolerance.  
 - via F-DI or PROFIsafe.  
 The drive is shut down by the message C30700 "SI Motion MM: STOP A initiated".

**Remedy:** Check the braking behavior and, if necessary, adapt the tolerance for the "SAM" function or modify the parameter settings for the "SBR" function.  
 This message can be acknowledged without a POWER ON as follows:  
 - motion monitoring functions integrated in the drive: via Terminal Module 54F (TM54F) or PROFIsafe  
 Note:  
 SAM: Safe Acceleration Monitor (safe acceleration monitoring)  
 SBR: Safe Brake Ramp (safe ramp monitoring)  
 SI: Safety Integrated  
 See also: p9348, p9381, p9382, p9383, p9548

---

**230707 <location>SI Motion MM: Tolerance for safe operating stop exceeded**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The actual position has distanced itself further from the target position than the standstill tolerance.  
 The drive is shut down by the message C30701 "SI Motion MM: STOP B initiated".

**Remedy:**  
 - check whether safety faults are present and if required carry out the appropriate diagnostic routines for the particular faults.  
 - check whether the standstill tolerance matches the accuracy and control dynamic performance of the axis.  
 This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
 Note:  
 SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop  
 See also: p9530 (SI Motion standstill tolerance (Control Unit))

---

**230708 <location>SI Motion MM: STOP C initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** STOP2

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP C (braking along the OFF3 ramp).  
 "Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
 Possible causes:  
 - stop request from the higher-level control.  
 - subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".  
 See also: p9552 (SI Motion transition time STOP C to SOS (SBH) (Control Unit))

**Remedy:** - remove the cause of the fault at the control.  
 - carry out a diagnostics routine for message C30714.  
 This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
 Note:  
 SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop

---

**230709 <location>SI Motion MM: STOP D initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP D (braking along the path).  
 "Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
 Possible causes:  
 - stop request from the Control Unit.  
 - subsequent response to the message C30714 "SI Motion: Safely limited speed exceeded".  
 See also: p9353 (SI Motion transition time STOP D to SOS (Motor Module)), p9553 (SI Motion transition time STOP D to SOS (SBH) (Control Unit))

**Remedy:** - remove the cause of the fault at the control.  
 - carry out a diagnostics routine for message C30714.  
 This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
 Note:  
 SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop

---

**230710 <location>SI Motion MM: STOP E initiated**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive is stopped via a STOP E (retraction motion).  
 "Safe Operating Stop" (SOS) is activated after the parameterized timer has expired.  
 Possible causes:  
 - stop request from the higher-level control.  
 - subsequent response to the message C30714 "SI Motion: Safely limited speed exceeded".  
 See also: p9354 (SI Motion transition time STOP E to SOS (Motor Module)), p9554 (SI Motion transition time STOP E to SOS (SBH) (Control Unit))

**Remedy:**

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C30714.

This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.

Note:

SI: Safety Integrated  
 SOS: Safe Operating Stop / SBH: Safe operating stop

---

**230711**                    **<location>SI Motion MM: Defect in a monitoring channel**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                When cross-checking and comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.

If at least one monitoring function is active, then after the parameterized timer has expired, the message C30701 "SI Motion: STOP B initiated" is output. The message is output with message value 1031 when the Sensor Module hardware is replaced.

The following message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:

- differently parameterized cycle times (p9500/p9300, p9511/p9311).
- differently parameterized axis types (p9502/p9302).
- excessively fast cycle times (p9500/p9300, p9511/p9311).
- incorrect synchronization.

Message value (r9749, interpret decimal):

0 ... 999: Number of the cross-checked data that resulted in this message. Refer to safety message C01711 for a description of the individual data.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.

1001: Initialization error of watchdog timer.

1005: Pulses already suppressed for test stop selection.

1011: Acceptance test status between the monitoring channels differ.

1012: Plausibility violation of the actual value from the encoder.

1020: Cyc. communication failure between the monit. cycles.

1021: Cyc. communication failure between the monit. channel and Sensor Module.

1023: Error in the effectiveness test in the DRIVE-CLiQ encoder

1030: Encoder fault detected from another monitoring channel.

1031: Data transfer error between the monitoring channel and the Sensor Module (p9526/p9326).

1040: Pulses suppressed with active encoderless monitoring functions.

1041: Current absolute value too low (encoderless)

1042: Current/voltage plausibility error

1043: Too many acceleration phases

1044: Actual current values plausibility error.

5000 ... 5140:

PROFIsafe message values.

For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

6000 ... 6166:

PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).

For these fault values, the failsafe control signals (failsafe values) are transferred to the safety functions.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion, diagnostics STOP F)

**Remedy:**

Re message value = 1030:

- check the encoder connection.
- if required, replace the encoder.

Re message value = 1031:

When replacing a Sensor Module, carry out the following steps:

- start the copy function for the node identifier on the drive (p9700 = 1D hex).
- acknowledge the hardware CRC on the drive (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (power off/on) for all components.

The following always applies:

- check the encoder connection.
- if required, replace the encoder.

Re message value = 1040:

- de-select encoderless monitoring functions, select and de-select STO.
- if monitoring function is active, issue "SLS" pulse enable within 5 s of de-selecting STO.

Re other message values:

- The significance of the individual message values is described in safety message C01711 of the Control Unit.

Note:

This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

---

## 230712 <location>SI Motion MM: Defect in F-IO processing

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:**

When cross checking and comparing the two monitoring channels, the drive detected a difference between parameters or results of the F-IO processing and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.  
The safety message C30711 with message value 0 is also displayed due to initiation of STOP F.  
If at least one monitoring function is active, the safety message C30701 "SI Motion: STOP B initiated" is output after the parameterized timer has expired.  
Message value (r9749, interpret decimal):  
Number of the cross-checked data that resulted in this message.  
Refer to the description of the message values in safety message C01712.

**Remedy:**

- check parameterization in the parameters involved and correct if required.
- ensure equality by copying the SI data to the second channel and then carry out an acceptance test.
- check monitoring clock cycle for equality (p9500, p9300).

Note:

This message can be acknowledged via F-DI or PROFIsafe.  
See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

---

## 230714 <location>SI Motion MM: Safely-Limited Speed exceeded

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The drive had moved faster than that specified by the velocity limit value (p9331). The drive is stopped as a result of the configured stop response (p9363).  
 Message value (r9749, interpret decimal):  
 100: SLS1 exceeded.  
 200: SLS2 exceeded.  
 300: SLS3 exceeded.  
 400: SLS4 exceeded.  
 1000: Encoder limit frequency exceeded.

**Remedy:** - check the traversing/motion program in the control.  
 - check the limits for "SLS" function and if required, adapt (p9331).  
 Note:  
 This message can only be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.  
 SI: Safety Integrated  
 SLS: Safely-Limited Speed / SG: Safely reduced speed  
 See also: p9331 (SI Motion SLS limit values (Motor Module)), p9363 (SI Motion SLS stop response (Motor Module))

**230716 <location>SI Motion MM: Tolerance for safe motion direction exceeded**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The tolerance for the "safe motion direction" function was exceeded. The drive is stopped as a result of the configured stop response (p9366).  
 Message value (r9749, interpret decimal):  
 0: Tolerance for the "safe motion direction positive" function exceeded.  
 1: Tolerance for the "safe motion direction positive negative" function exceeded.

**Remedy:** - check the traversing/motion program in the control.  
 - check the tolerance for "SDI" function and if required, adapt (p9364).  
 This message can be acknowledged as follows:  
 Via F-DI or PROFIsafe  
 Note:  
 SDI: Safe Direction (safe motion direction)  
 SI: Safety Integrated  
 See also: p9364 (SI Motion SDI tolerance (Motor Module)), p9365 (SI Motion SDI delay time (Motor Module)), p9366 (SI Motion SDI stop response (Motor Module))

**230770 <location>SI Motion MM: Discrepancy error affecting the fail-safe inputs/outputs**

**Message value:** %1  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The fail-safe digital inputs/digital outputs (F-DI/F-DO) show a different state longer than that parameterized in p10002 / p10102.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex  
 xxxx: Discrepancy error for fail-safe digital inputs (F-DI).  
 Bit 0: Discrepancy error for F-DI 0  
 Bit 1: Discrepancy error for F-DI 1  
 ...  
 yyyy: Discrepancy error for fail-safe digital outputs (F-DO).  
 Bit 0: Discrepancy error for F-DO 0  
 ...  
 Note:  
 If several discrepancy errors occur consecutively, then this fault is only signaled for the first error that occurs.



**Remedy:** - check the wiring of the F-DI (contact problems).  
**Note:**  
 This message can be acknowledged via F-DI or PROFIsafe.  
 Discrepancy errors of an F-DI can only be completely acknowledged if safe acknowledgement was carried out once the cause of the error was resolved (p10006 or acknowledgment via PROFIsafe). As long as safety acknowledgement was not carried out, the corresponding F-DI stays in the safe state internally.  
 For cyclic switching operations at the F-DI, it may be necessary to adapt the discrepancy time to the switching frequency.  
 If the period of a cyclic switching pulse has the order of magnitude of double the value of p10002, then the following formulas must be checked.  
 $p10002 < (tp / 2) - td$  (discrepancy time must be less than half the period minus the actual discrepancy time)  
 $p10002 \geq p9500$  (discrepancy time must be no less than P9500)  
 $p10002 > td$  (discrepancy time must be greater than the switch discrepancy time which may actually apply)  
 $td$  = possible actual discrepancy time (in ms) that can occur with a switching operation. This must correspond to at least 1 SI sampling cycle (see p9500).  
 $tp$  = period for a switching operation in ms.  
 When debounce p10017 is active, the discrepancy time is directly specified by the debounce time.  
 If the period of a cyclic switching pulse has the order of magnitude of twice the debounce time, then the following formulas should be checked.  
 $p10002 < p10017 + 1 \text{ ms} - td$   
 $p10002 > td$   
 $p10002 \geq p9500$   
**Example:**  
 For a 12 ms SI sampling cycle and a switching frequency of 110 ms ( $p10017 = 0$ ), the maximum discrepancy time which can be set is as follows:  
 $p10002 \leq (110/2 \text{ ms}) - 12 \text{ ms} = 43 \text{ ms}$   
 Rounded-off,  $p10002 \leq 36 \text{ ms}$  is obtained (since the discrepancy time can only be accepted as a whole SI sampling cycle, the value will need to be rounded up or down to a whole SI sampling time value if the result is not an exact multiple of an SI sampling cycle).  
**Note:**  
 F-DI: Failsafe Digital Input  
 F-DO: Failsafe Digital Output

---

### 230772 <location>SI Motion MM: Test stop failsafe inputs/outputs active

**Message value:** -  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The test stop for the fail-safe digital inputs (F-DI) and/or fail-safe digital outputs (F-DO) is presently being performed.  
**Note:**  
 F-DI: Failsafe Digital Input  
 F-DO: Failsafe Digital Output  
**Remedy:** The alarm disappears automatically after successfully ending or canceling (when a fault condition occurs) the test stop.

---

### 230773 <location>SI Motion MM: Test stop fault Motor Module

**Message value:** %1  
**Drive object:** SERVO  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** A fault has occurred on the MM side during the test stop for the fail-safe outputs.  
 Fault value (r0949, interpret hexadecimal):  
 RRRVWXYZ hex:  
 R: Reserved.  
 V: Actual state of the DO channel concerned (see X) on the CU (corresponds to the states read back from the hardware, bit 0 = DO 0, bit 1 = DO 1, etc.).  
 W: Required state of the DO channel concerned (see X, bit 0 = DO 0, bit 1 = DO 1, etc.).  
 X: DO channels involved, which indicate an error (bit 0 = DO 0, bit 1 = DO 1, etc.).  
 Y: Reason for the test stop fault.  
 Z: State of the test stop in which the fault has occurred.  
 Y: Reason for the test stop fault  
 Y = 1: MM side in incorrect test stop state (internal fault).  
 Y = 2: Expected states of the DOs were not fulfilled (CU305: readback via DI 22 / CU240 readback DI 2).  
 Y = 3: Incorrect timer state on CU side (internal fault)  
 Y = 4: Expected states of the diag DOs were not fulfilled (CU305: internal readback on MM channel).  
 Y = 5: Expected states of the second diag DOs were not fulfilled (CU305: internal readback on CU channel).  
 X and V indicate the DI or Diag-DO state dependent upon the reason for the fault (2, 4 or 5).  
 In the event of multiple test stop faults, the first one that occurred is shown.  
 Z: Test stop state and associated test actions  
 Z = 0 ... 3: Synchronization phase of test stop between CU and Motor Module no switching operations  
 Z = 4: DO + OFF and DO - OFF  
 Z = 5: Check to see if states are as expected  
 Z = 6: DO + ON and DO - ON  
 Z = 7: Check to see if states are as expected  
 Z = 8: DO + OFF and DO - ON  
 Z = 9: Check to see if states are as expected  
 Z = 10: DO + ON and DO - OFF  
 Z = 11: Check to see if states are as expected  
 Z = 12: DO + OFF and DO - OFF  
 Z = 13: Check to see if states are as expected  
 Z = 14: End of test stop  
 Diag expected states in table format:  
 Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4  
 5: 0/-/-/1  
 7: 0/-/-/0  
 9: 0/-/-/0  
 11: 1/-/-/1  
 13: 0/-/-/1  
 Second diag expected states in table format:  
 Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4  
 5: -/-/-/1  
 7: -/-/-/0  
 9: -/-/-/1  
 11: -/-/-/0  
 13: -/-/-/1  
 DI expected states in table format:  
 Test stop state: Expectation Mode 1 / Mode 2 / Mode 3 / Mode 4  
 5: -/1/1/-  
 7: -/0/0/-  
 9: -/0/1/-  
 11: -/0/1/-  
 13: -/1/1/-  
 Example:  
 Fault F01773 (CU) is signaled with fault value = 0001\_0127 and fault F30773 (MM) is signaled with fault value 0000\_0127.  
 This means that in state 7 (Z = 7) the state of the external readback signal was not set correctly (Y = 2) after DO-0 (X = 1) was switched to ON/ON.  
 Fault value 0001\_0127 indicates that 0 was expected (W = 0) and 1 (V = 1) was read back from the hardware.  
 Fault value 0000\_0127 on the MM indicates that the states were as expected.  
 In the case of fault F30773, W and V are always identical; a value of 0 always means that 0 was expected at the readback input but was not present on the other channel (CU).

**Remedy:** Check the wiring of the F-DOs and restart the test stop.  
**Note:**  
 The fault is withdrawn if the test stop is successfully completed.  
 In the event of multiple test stop faults, the first one that occurred is shown.  
 Once the test stop has been restarted the next queued test stop fault will be signaled (if there is one).

**230798 <location>SI Motion MM: Test stop running**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The test stop is active.  
**Remedy:** Not necessary.  
 The message is withdrawn when the test stop is finished.  
**Note:**  
 SI: Safety Integrated

**230799 <location>SI Motion MM: Acceptance test mode active**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The acceptance test mode is active. The POWER ON signals of the safety-relevant motion monitoring functions can be acknowledged during the acceptance test using the acknowledgement functions of the higher-level control.  
**Remedy:** Not necessary.  
 The message is withdrawn when exiting the acceptance test mode.  
**Note:**  
 SI: Safety Integrated

**230800 <location>Power unit: Group signal**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** NONE  
**Cause:** The power unit has detected at least one fault.  
**Remedy:** Evaluate the other messages that are presently available.

**230801 <location>Power unit DRIVE-CLiQ: Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned.  
The computing time load might be too high.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**

- check the electrical cabinet design and cable routing for EMC compliance
- remove DRIVE-CLiQ components that are not required.
- de-select functions that are not required.
- if required, increase the sampling times (p0112, p0115).
- replace the component involved.

---

**230802 <location>Power unit: Time slice overflow**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A time slice overflow has occurred.  
**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

---

**230804 <location>Power unit: CRC**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** CRC error actuator  
**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

---

**230805 <location>Power unit: EPROM checksum error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** Internal parameter data is corrupted.  
Fault value (r0949, interpret hexadecimal):  
01: EEPROM access error.  
02: Too many blocks in the EEPROM.  
**Remedy:** Replace the module.

---

**230809 <location>Power unit: Switching information not valid**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** For 3P gating unit:  
The last switching status word in the setpoint telegram is identified by the end ID. Such an end ID was not found.

**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

---

**230810 <location>Power unit: Watchdog timer**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** When booting it was detected that the cause of the previous reset was an SAC watchdog timer overflow.

**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

---

**230820 <location>Power unit DRIVE-CLiQ: Telegram error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause

xx = 01 hex:  
CRC error.

xx = 02 hex:  
Telegram is shorter than specified in the length byte or in the receive list.

xx = 03 hex:  
Telegram is longer than specified in the length byte or in the receive list.

xx = 04 hex:  
The length of the receive telegram does not match the receive list.

xx = 05 hex:  
The type of the receive telegram does not match the receive list.

xx = 06 hex:  
The address of the component in the telegram and in the receive list do not match.

xx = 07 hex:  
A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

xx = 08 hex:  
No SYNC telegram is expected - but the received telegram is one.

xx = 09 hex:  
The error bit in the receive telegram is set.

xx = 10 hex:  
The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**230835**                    **<location>Power unit DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**            OFF2  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. The nodes do not send and receive in synchronism.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 21 hex:  
The cyclic telegram has not been received.  
xx = 22 hex:  
Timeout in the telegram receive list.  
xx = 40 hex:  
Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**230836**                    **<location>Power unit DRIVE-CLiQ: Send error for DRIVE-CLiQ data**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**            OFF2  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. Data were not able to be sent.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 41 hex:  
Telegram type does not match send list.

**Remedy:**                Carry out a POWER ON.

---

**230837**                    **<location>Power unit DRIVE-CLiQ: Component fault**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:**            OFF2  
**Acknowledge:**        IMMEDIATELY

---

<b>Cause:</b>	<p>Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.          Fault value (r0949, interpret hexadecimal):          yyxx hex: yy = component number, xx = fault cause          xx = 20 hex:          Error in the telegram header.          xx = 23 hex:          Receive error: The telegram buffer memory contains an error.          xx = 42 hex:          Send error: The telegram buffer memory contains an error.          xx = 43 hex:          Send error: The telegram buffer memory contains an error.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).</li> <li>- check the electrical cabinet design and cable routing for EMC compliance</li> <li>- if required, use another DRIVE-CLiQ socket (p9904).</li> <li>- replace the component involved.</li> </ul>

---

### 230845 <location>Power unit DRIVE-CLiQ: Cyclic data transfer error

<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned.          Fault value (r0949, interpret hexadecimal):          yyxx hex: yy = component number, xx = fault cause          xx = 0B hex:          Synchronization error during alternating cyclic data transfer.</p>
<b>Remedy:</b>	<p>Carry out a POWER ON (power off/on).          See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)</p>

---

### 230850 <location>Power unit: Internal software error

<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	<p>Infeed: OFF1 (NONE, OFF2)          Servo: OFF1 (NONE, OFF2, OFF3)          Vector: OFF1 (NONE, OFF2, OFF3)</p>
<b>Acknowledge:</b>	POWER ON
<b>Cause:</b>	<p>An internal software error has occurred in the power unit.          Fault value (r0949, decimal interpretation):          Only for internal Siemens troubleshooting.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- replace power unit.</li> <li>- if required, upgrade the firmware in the power unit.</li> <li>- contact the Hotline.</li> </ul>

---

**230851 <location>Power unit DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (NONE, OFF1, OFF3)  
 Vector: OFF2 (NONE, OFF1, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved.  
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex = 10 dec:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:** Upgrade the firmware of the component involved.

---

**230853 <location>Power unit: Sign-of-life error cyclic data**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The power unit has detected that the cyclic setpoint telegrams of the Control Unit have not been updated on time. At least two sign-of-life errors have occurred within the window set in p7788.  
**Remedy:** - check the electrical cabinet design and cable routing for EMC compliance  
 - reduce the size of the window (p7788) for monitoring.

---

**230860 <location>Power unit DRIVE-CLiQ (CU): Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 CRC error and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 02 hex = 02 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 13 hex = 19 dec:  
 The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 03 hex = 03 dec:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 14 hex = 20 dec:  
 The length of the receive telegram does not match the receive list and the receive telegram is too early.



xx = 04 hex = 04 dec:  
The length of the receive telegram does not match the receive list.

xx = 15 hex = 21 dec:  
The type of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 05 hex = 05 dec:  
The type of the receive telegram does not match the receive list.

xx = 16 hex = 22 dec:  
The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.

xx = 06 hex = 06 dec:  
The address of the power unit in the telegram and in the receive list do not match.

xx = 19 hex = 25 dec:  
The error bit in the receive telegram is set and the receive telegram is too early.

xx = 09 hex = 09 dec:  
The error bit in the receive telegram is set.

xx = 10 hex = 16 dec:  
The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 230885 <location>CU DRIVE-CLiQ (CU): Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved. The nodes do not send and receive in synchronism.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause

xx = 1A hex = 26 dec:  
Sign-of-life bit in the receive telegram not set and the receive telegram is too early.

xx = 21 hex = 33 dec:  
The cyclic telegram has not been received.

xx = 22 hex = 34 dec:  
Timeout in the telegram receive list.

xx = 40 hex = 64 dec:  
Timeout in the telegram send list.

xx = 62 hex = 98 dec:  
Error at the transition to cyclic operation.

**Remedy:**

- check the power supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 230886 <location>PU DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

**230887**                    **<location>Power unit DRIVE-CLiQ (CU): Component fault**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** Fault detected on the DRIVE-CLiQ component (power unit) involved. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex:  
 Response received too late during runtime measurement.  
 xx = 61 hex:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**230895**                    **<location>PU DRIVE-CLiQ (CU): Alternating cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
 Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

<b>230896</b>	<b>&lt;location&gt;Power unit DRIVE-CLiQ (CU): Inconsistent component properties</b>
<b>Message value:</b>	Component number: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2) Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The properties of the DRIVE-CLiQ component (power unit), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, decimal interpretation): Component number.
<b>Remedy:</b>	- carry out a POWER ON. - when a component is replaced, the same component type and if possible the same firmware version should be used. - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

---

<b>230899</b>	<b>&lt;location&gt;Power unit: Unknown fault</b>
<b>Message value:</b>	New message: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2) Vector: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	A fault occurred on the power unit that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Fault value (r0949, decimal interpretation): Fault number. Note: If required, the significance of this new fault can be read about in a more recent description of the Control Unit.
<b>Remedy:</b>	- replace the firmware on the power unit by an older firmware version (r0128). - upgrade the firmware on the Control Unit (r0018).

---

<b>230903</b>	<b>&lt;location&gt;Power unit: I2C bus error occurred</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2) Vector: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Communications error with an EEPROM or A/D converter. Fault value (r0949, interpret hexadecimal): 80000000 hex: - internal software error. 00000001 hex ... 0000FFFF hex: - module fault.

**Remedy:** Re fault value = 80000000 hex:  
 - upgrade firmware to later version.  
 Re fault value = 00000001 hex ... 0000FFFF hex:  
 - replace the module.

**230907 <location>Power unit: FPGA configuration unsuccessful**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** During initialization within the power unit, an internal software error has occurred.  
**Remedy:** - if required, upgrade the firmware in the power unit.  
 - replace power unit.  
 - contact the Hotline.

**230920 <location>Power unit: Temperature sensor fault**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
 Alarm value (r2124, interpret decimal):  
 1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm, PT100: R > 375 Ohm).  
 2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT100: R < 30 Ohm).  
**Remedy:** - make sure that the sensor is connected correctly.  
 - replace the sensor.

**230999 <location>Power unit: Unknown alarm**

**Message value:** New message: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An alarm occurred on the power unit that cannot be interpreted by the Control Unit firmware.  
 This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Alarm number.  
 Note:  
 If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.  
**Remedy:** - replace the firmware on the power unit by an older firmware version (r0128).  
 - upgrade the firmware on the Control Unit (r0018).

---

**231100 <location>Encoder 1: Zero mark distance error**

<b>Message value:</b>	%1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The measured zero mark distance does not correspond to the parameterized zero mark distance.</p> <p>For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.</p> <p>The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).            Fault value (r0949, decimal interpretation):            Last measured zero mark distance in increments (4 increments = 1 encoder pulse).            The sign designates the direction of motion when detecting the zero mark distance.            See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the encoder cables are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>. check the encoder type (encoder with equidistant zero marks).</li> <li>- adapt the parameter for the distance between zero marks (p0424, p0425).</li> <li>- if message output above speed threshold, reduce filter time if necessary (p0438).</li> <li>- replace the encoder or encoder cable</li> </ul>

---

**231101 <location>Encoder 1: Zero mark failed**

<b>Message value:</b>	%1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The 1.5 x parameterized zero mark distance was exceeded.</p> <p>The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).            Fault value (r0949, decimal interpretation):            Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).            See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the encoder cables are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>. check the encoder type (encoder with equidistant zero marks).</li> <li>- adapt the parameter for the clearance between zero marks (p0425).</li> <li>- if message output above speed threshold, reduce filter time if necessary (p0438).</li> <li>- when p0437.1 is active, check p4686.</li> <li>- replace the encoder or encoder cable</li> </ul>

---

**231103 <location>Encoder 1: Amplitude error, track R**

<b>Message value:</b>	R track: %1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	PULSE INHIBIT

- Cause:** The amplitude of the reference track signal (track R) does not lie within the tolerance bandwidth for encoder 1. The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign)  
 The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV.  
 The response threshold for the differential signal level of the encoder is < -1600 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note:  
 The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module.  
 The fault value can only be represented between -32767 ... 32767 dec (-770 ... 770 mV).  
 The signal level is not evaluated unless the following conditions are satisfied:  
 - Sensor Module properties available (r0459.31 = 1).  
 - Monitoring active (p0437.31 = 1).  
 See also: p0491 (Motor encoder fault response ENCODER)
- Remedy:**
- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range
  - check that the encoder cables and shielding are routed in compliance with EMC.
  - check the plug connections and contacts of the encoder cable.
  - check whether the zero mark is connected and the signal cables RP and RN have been connected correctly
  - replace the encoder cable.
  - if the coding disk is soiled or the lighting aged, replace the encoder.

---

**231110 <location>Encoder 1: Serial communications error**

- Message value:** Fault cause: %1 bin
- Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** ENCODER (IASC/DCBRAKE, NONE)
- Acknowledge:** PULSE INHIBIT
- Cause:** Serial communication protocol transfer error between the encoder and evaluation module.  
 Fault value (r0949, interpret binary):  
 Bit 0: Alarm bit in the position protocol.  
 Bit 1: Incorrect quiescent level on the data line.  
 Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).  
 Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.  
 Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.  
 Bit 5: Internal error in the serial driver: An illegal mode command was requested.  
 Bit 6: Timeout when cyclically reading.  
 Bit 8: Protocol is too long (e.g. > 64 bits).  
 Bit 9: Receive buffer overflow.  
 Bit 10: Frame error when reading twice.  
 Bit 11: Parity error.  
 Bit 12: Data line signal level error during the monoflop time.  
 Bit 13: Data line incorrect.
- Remedy:**
- Re fault value, bit 0 = 1:  
 - Enc defect F31111 may provide additional details.
- Re fault value, bit 1 = 1:  
 - Incorrect encoder type / replace the encoder or encoder cable.
- Re fault value, bit 2 = 1:  
 - Incorrect encoder type / replace the encoder or encoder cable.
- Re fault value, bit 3 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable.
- Re fault value, bit 4 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.
- Re fault value, bit 5 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.

- Re fault value, bit 6 = 1:  
 - Update Sensor Module firmware.
- Re fault value, bit 8 = 1:  
 - Check parameterization (p0429.2).
- Re fault value, bit 9 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.
- Re fault value, bit 10 = 1:  
 - Check parameterization (p0429.2, p0449).
- Re fault value, bit 11 = 1:  
 - Check parameterization (p0436).
- Re fault value, bit 12 = 1:  
 - Check parameterization (p0429.6).
- Re fault value, bit 13 = 1:  
 - Check data line.

**231111****<location>Encoder 1: Absolute encoder EnDat, internal fault/error**

<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The EnDat encoder fault word supplies fault bits that have been set.          Fault value (r0949, interpret binary):          Bit 0: Lighting system failed.          Bit 1: Signal amplitude too low.          Bit 2: Position value incorrect.          Bit 3: Encoder power supply overvoltage condition.          Bit 4: Encoder power supply undervoltage condition.          Bit 5: Encoder power supply overcurrent condition.          Bit 6: The battery must be changed.          See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<p>Re fault value, bit 0 = 1:          Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.</p> <p>Re fault value, bit 1 = 1:          Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.</p> <p>Re fault value, bit 2 = 1:          Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.</p> <p>Re fault value, bit 3 = 1:          5 V power supply voltage fault.          When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.          When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor.</p> <p>Re fault value, bit 4 = 1:          5 V power supply voltage fault.          When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.          When using a motor with DRIVE-CLiQ: Replace the motor.</p> <p>Re fault value, bit 5 = 1:          Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.</p> <p>Re fault value, bit 6 = 1:          The battery must be changed (only for encoders with battery back-up).</p>

**231112 <location>Encoder 1: Error bit set in the serial protocol**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder sends a set error bit via the serial protocol.  
 Fault value (r0949, interpret binary):  
 Bit 0: Fault bit in the position protocol.  
**Remedy:** For fault value, bit 0 = 1:  
 In the case of an EnDat encoder, F31111 may provide further details.

---

**231115 <location>Encoder 1: Amplitude error track A or B (A<sup>2</sup> + B<sup>2</sup>)**

**Message value:** A track: %1, B-track: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude (root of A<sup>2</sup> + B<sup>2</sup>) for encoder 1 exceeds the permissible tolerance.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response thresholds are < 1070 mV and > 3582 mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**  
 - check that the encoder cables and shielding are routed in compliance with EMC.  
 - check the plug connections  
 - replace the encoder or encoder cable  
 - check the Sensor Module (e.g. contacts).  
 The following applies to measuring systems without their own bearing system:  
 - adjust the scanning head and check the bearing system of the measuring wheel.  
 The following applies for measuring systems with their own bearing system:  
 - ensure that the encoder housing is not subject to any axial force.

---

**231116 <location>Encoder 1: Amplitude error monitoring track A + B**

**Message value:** A track: %1, B-track: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The amplitude of the rectified encoder signals A and B and the amplitude from the roots of A<sup>2</sup> + B<sup>2</sup> for encoder 1 are not within the tolerance bandwidth.  
 Fault value (r0949, interpret hexadecimal):



yyyyxxxx hex:

yyyy = Signal level, track B (16 bits with sign).

xxxx = Signal level, track A (16 bits with sign).

The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).

The response thresholds are < 176 mV (observe the frequency response of the encoder) and > 955 mV.

A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.

Note:

The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check that the encoder cables and shielding are routed in compliance with EMC.
  - check the plug connections
  - replace the encoder or encoder cable
  - check the Sensor Module (e.g. contacts).

### 231117 <location>Encoder 1: Inversion error signals A/B/R

**Message value:** Fault cause: %1 bin

**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:** IMMEDIATELY

**Cause:** For a square-wave encoder (bipolar, double ended) signals A\*, B\* and R\* are not inverted with respect to signals A, B and R.

Fault value (r0949, interpret binary):

Bits 0 ... 15: Only for internal Siemens troubleshooting.

Bit 16: Error track A.

Bit 17: Error track B.

Bit 18: Error track R.

Note:

For SMC30 (order no.. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), CUA32, and CU310, the following applies:

A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.

See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- Check the encoder/cable.
  - Does the encoder supply signals and the associated inverted signals?

Note:

For SMC30 (order no. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), the following applies:

- check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520).

For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30) or X23 (CUA32, CU310):

- pin 10 (reference signal R) <--> pin 7 (encoder power supply, ground)

- pin 11 (reference signal R inverted) <--> pin 4 (encoder power supply)

### 231118 <location>Encoder 1: Speed difference outside the tolerance range

**Message value:** %1

**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:** PULSE INHIBIT

**Cause:** For an HTL/TTL encoder, the speed difference has exceeded the value in p0492 over several sampling cycles. The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time. Encoder 1 is used as motor encoder and can be effective has fault response to change over to encoderless operation. Fault value (r0949, decimal interpretation): Only for internal Siemens troubleshooting. See also: p0491, p0492

**Remedy:**

- check the tachometer feeder cable for interruptions.
- check the grounding of the tachometer shielding.
- if required, increase the maximum speed difference per sampling cycle (p0492).

**231120 <location>Encoder 1: Power supply voltage fault**

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** A power supply fault was detected for encoder 1.  
 Fault value (r0949, interpret binary):  
 Bit 0: Undervoltage condition on the sense line.  
 Bit 1: Overcurrent condition for the encoder power supply.  
 Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative.  
 Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive.  
**Note:**  
 If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

Re fault value, bit 0 = 1:

- correct encoder cable connected?
- check the plug connections of the encoder cable.
- SMC30: Check the parameterization (p0404.22).

Re fault value, bit 1 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

Re fault value, bit 2 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

Re fault value, bit 3 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

**231121 <location>Encoder 1: Coarse position error**

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** For the actual value sensing, an error was detected on the module.  
 As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

**231122 <location>Encoder 1: Internal power supply voltage faulty**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER  
**Acknowledge:** IMMEDIATELY

**Cause:** Fault in internal reference voltage of ASICs for encoder 1.  
 Fault value (r0949, decimal interpretation):  
 1: Reference voltage error.  
 2: Internal undervoltage.  
 3: Internal overvoltage.

**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

### 231123 <location>Encoder 1: Signal level A/B unipolar outside tolerance

**Message value:** Fault cause: %1 bin

**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:** PULSE INHIBIT

**Cause:** The unipolar level (AP/AN or BP/BN) for encoder 1 is outside the permissible tolerance.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Either AP or AN outside the tolerance.  
 Bit 16 = 1: Either BP or BN outside the tolerance.  
 The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.  
 The response thresholds are < 1700 mV and > 3300 mV.  
 Note:  
 The signal level is not evaluated unless the following conditions are satisfied:  
 - Sensor Module properties available (r0459.31 = 1).  
 - Monitoring active (p0437.31 = 1).  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- make sure that the encoder cables and shielding are installed in an EMC-compliant manner.
- check the plug connections and contacts of the encoder cable.
- check the short-circuit of a signal cable with mass or the operating voltage.
- replace the encoder cable.

### 231125 <location>Encoder 1: Amplitude error track A or B overcontrolled

**Message value:** A track: %1, B-track: %2

**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:** PULSE INHIBIT

**Cause:** The amplitude of track A or B for encoder 1 exceeds the permissible tolerance band.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold is > 750 mV. This fault also occurs if the A/D converter is overcontrolled.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is > 3582 mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable

**231126**                    **<location>Encoder 1: Amplitude AB too high**

**Message value:**        Amplitude: %1, Angle: %2  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The amplitude (root of  $A^2 + B^2$  or  $|A| + |B|$ ) for encoder 1 exceeds the permissible tolerance.  
                             Fault value (r0949, interpret hexadecimal):  
                             yyyxxxx hex:  
                             yyyy = Angle  
                             xxxx = Amplitude, i.e. root from  $A^2 + B^2$  (16 bits without sign)  
                             The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV  $-25/+20$  %).  
                             The response threshold for  $(|A| + |B|)$  is  $> 1120$  mV or the root of  $(A^2 + B^2) > 955$  mV.  
                             A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec.  
                             The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  
                             Note:  
                             The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.  
                             See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**                - check that the encoder cables and shielding are routed in compliance with EMC.  
                                   - replace the encoder or encoder cable

**231129**                    **<location>Encoder 1: Position difference, hall sensor/track C/D and A/B too large**

**Message value:**        %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The error for track C/D is greater than  $\pm 15^\circ$  mechanical or  $\pm 60^\circ$  electrical or the error for the Hall signals is greater than  $\pm 60^\circ$  electrical.  
                             One period of track C/D corresponds to  $360^\circ$  mechanical.  
                             One period of the Hall signal corresponds to  $360^\circ$  electrical.  
                             The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
                             After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A31429.  
                             Fault value (r0949, decimal interpretation):  
                             For track C/D, the following applies:  
                             Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to  $1^\circ$ ).  
                             For Hall signals, the following applies:  
                             Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to  $1^\circ$ ).  
                             See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**                - track C or D not connected.  
                                   - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.  
                                   - check that the encoder cables are routed in compliance with EMC.  
                                   - check the adjustment of the Hall sensor.

**231130**                    **<location>Encoder 1: Zero mark and position error from the coarse synchronization**

**Message value:**        Angular deviation, electrical: %1, angle, mechanical: %2  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:**        PULSE INHIBIT

<b>Cause:</b>	<p>After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out.</p> <p>When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of +/-18 ° mechanical.</p> <p>When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of +/-60 ° electrical.</p> <p>Fault value (r0949, interpret hexadecimal):          yyyyxxxx hex          yyyy: Determined mechanical zero mark position (can only be used for track C/D).          xxxx: Deviation of the zero mark from the expected position as electrical angle.          Scaling: 32768 dec = 180 °          See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check p0431 and, if necessary, correct (trigger via p1990 = 1 if necessary).</li> <li>- check that the encoder cables are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>- if the Hall sensor is used as an equivalent for track C/D, check the connection.</li> <li>- Check the connection of track C or D.</li> <li>- replace the encoder or encoder cable</li> </ul>

### 231131 <location>Encoder 1: Deviation, position incremental/absolute too large

<b>Message value:</b>	%1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>Absolute encoder:          When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected.          Limit value for the deviation:          - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 &gt; 2 quadrants, EQN 1325 &gt; 50 quadrants).          - other encoders: 15 pulses = 60 quadrants.</p> <p>Incremental encoder:          When the zero pulse is passed, a deviation in the incremental position was detected.          For equidistant zero marks, the following applies:          - The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.          For distance-coded zero marks, the following applies:          - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.          Fault value (r0949, decimal interpretation):          Deviation in quadrants (1 pulse = 4 quadrants).          See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the encoder cables are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>- replace the encoder or encoder cable</li> <li>- check whether the coding disk is dirty or there are strong ambient magnetic fields.</li> <li>- adapt the parameter for the clearance between zero marks (p0425).</li> <li>- if message output above speed threshold, reduce filter time if necessary (p0438).</li> </ul>

### 231135 <location>Encoder 1: Fault when determining the position

<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	PULSE INHIBIT

**Cause:** The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.  
 Fault value (r0949, interpret binary):  
 Bit 0: F1 (safety status display)  
 Bit 1: F2 (safety status display)  
 Bit 2: Lighting (reserved)  
 Bit 3: Signal amplitude (reserved)  
 Bit 4: Position value (reserved)  
 Bit 5: Overvoltage (reserved)  
 Bit 6: Undervoltage (reserved)  
 Bit 7: Overcurrent (reserved)  
 Bit 8: Battery (reserved)  
 Bit 16: Lighting (--> F3x135, x = 1, 2, 3)  
 Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3)  
 Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3)  
 Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3)  
 Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3)  
 Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3)  
 Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3)  
 Bit 23: Singleturn position 2 (safety status display)  
 Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3)  
 Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3)  
 Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3)  
 Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3)  
 Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3)  
 Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3)  
 Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3)  
 Bit 31: Multiturn battery (reserved)

**Remedy:** Replace DRIVE-CLiQ encoder.

---

**231136** <location>**Encoder 1: Error when determining multiturn information**

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT

**Cause:** The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.  
 Fault value (r0949, interpret binary):  
 Bit 0: F1 (safety status display)  
 Bit 1: F2 (safety status display)  
 Bit 2: Lighting (reserved)  
 Bit 3: Signal amplitude (reserved)  
 Bit 4: Position value (reserved)  
 Bit 5: Overvoltage (reserved)  
 Bit 6: Undervoltage (reserved)  
 Bit 7: Overcurrent (reserved)  
 Bit 8: Battery (reserved)  
 Bit 16: Lighting (--> F3x135, x = 1, 2, 3)  
 Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3)  
 Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3)  
 Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3)  
 Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3)  
 Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3)

Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3)  
 Bit 23: Singleturn position 2 (safety status display)  
 Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3)  
 Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3)  
 Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3)  
 Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3)  
 Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3)  
 Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3)  
 Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3)  
 Bit 31: Multiturn battery (reserved)

**Remedy:** Replace DRIVE-CLiQ encoder.

### 231137 <location>Encoder 1: Internal fault when determining the position

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal Siemens troubleshooting.  
**Remedy:** Replace encoder.

### 231138 <location>Encoder 1: Internal error when determining multiturn information

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal SIEMENS troubleshooting.  
**Remedy:** Replace encoder.

### 231150 <location>Encoder 1: Initialization error

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** Encoder functionality selected in p0404 is not operating correctly.  
 Fault value (r0949, interpret hexadecimal):  
 Encoder malfunction.  
 The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).  
 See also: p0404 (Encoder configuration effective), p0491 (Motor encoder fault response ENCODER)  
**Remedy:**

- Check that p0404 is correctly set.
- check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.
- if relevant, note additional fault messages that describe the fault in detail.

---

**231151**                    **<location>Encoder 1: Encoder speed for initialization AB too high**

**Message value:**        %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The encoder speed is too high during while initializing the sensor.  
**Remedy:**              Reduce the speed of the encoder accordingly during initialization.  
                            If necessary, de-activate monitoring (p0437.29).  
                            See also: p0437 (Sensor Module configuration extended)

---

**231160**                    **<location>Encoder 1: Analog sensor channel A failed**

**Message value:**        %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The input voltage of the analog sensor is outside the permissible limits.  
                            Fault value (r0949, decimal interpretation):  
                            1: Input voltage outside detectable measuring range.  
                            2: Input voltage outside the measuring range set in (p4673).  
                            3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:**              For fault value = 1:  
                            - check the output voltage of the analog sensor.  
                            For fault value = 2:  
                            - check the voltage setting for each encoder period (p4673).  
                            For fault value = 3:  
                            - check the range limit setting and increase it if necessary (p4676).

---

**231161**                    **<location>Encoder 1: Analog sensor channel B failed**

**Message value:**        %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The input voltage of the analog sensor is outside the permissible limits.  
                            Fault value (r0949, decimal interpretation):  
                            1: Input voltage outside detectable measuring range.  
                            2: Input voltage outside the measuring range set in (p4675).  
                            3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:**              For fault value = 1:  
                            - check the output voltage of the analog sensor.  
                            For fault value = 2:  
                            - check the voltage setting for each encoder period (p4675).  
                            For fault value = 3:  
                            - check the range limit setting and increase it if necessary (p4676).



---

**231163 <location>Encoder 1: Analog sensor position value exceeds limit value**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
 Fault value (r0949, decimal interpretation):  
 1: Position value from the LVDT sensor.  
 2: Position value from the encoder characteristic.  
**Remedy:** For fault value = 1:  
 - Check the LVDT ratio (p4678).  
 - check the reference signal connection at track B.  
 For fault value = 2:  
 - check the coefficients of the characteristic (p4663 ... p4666).

---

**231400 <location>Encoder 1: Alarm threshold zero mark distance error**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance.  
 For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - check the encoder type (encoder with equidistant zero marks).  
 - adapt the parameter for the distance between zero marks (p0424, p0425).  
 - replace the encoder or encoder cable

---

**231401 <location>Encoder 1: Alarm threshold zero mark failed**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The 1.5 x parameterized zero mark distance was exceeded.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - check the encoder type (encoder with equidistant zero marks).  
 - adapt the parameter for the clearance between zero marks (p0425).  
 - replace the encoder or encoder cable

---

**231405 <location>Encoder 1: Temperature in the encoder evaluation inadmissible**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The encoder evaluation for a motor with DRIVE-CLiQ has detected an inadmissible temperature.  
 The fault threshold is 125 ° C.  
 Alarm value (r2124, interpret decimal):  
 Measured board/module temperature in 0.1 °C.  
**Remedy:** Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

---

**231407 <location>Encoder 1: Function limit reached**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder has reached one of its function limits. A service is recommended.  
 Alarm value (r2124, interpret decimal):  
 1 : Incremental signals  
 3 : Absolute track  
 4 : Code connection  
**Remedy:** Perform service. Replace the encoder if necessary.  
 Note:  
 The current functional reserve of an encoder can be displayed via r4651.  
 See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

---

**231410 <location>Encoder 1: Serial communications**

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Serial communication protocol transfer error between the encoder and evaluation module.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Alarm bit in the position protocol.  
 Bit 1: Incorrect quiescent level on the data line.  
 Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).  
 Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.  
 Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.  
 Bit 5: Internal error in the serial driver: An illegal mode command was requested.  
 Bit 6: Timeout when cyclically reading.  
 Bit 8: Protocol is too long (e.g. > 64 bits).  
 Bit 9: Receive buffer overflow.  
 Bit 10: Frame error when reading twice.  
 Bit 11: Parity error.  
 Bit 12: Data line signal level error during the monoflop time.  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - replace the encoder.

---

**231411 <location>Encoder 1: EnDat encoder signals alarms**

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The error word of the EnDat encoder has alarm bits that have been set.  
Alarm value (r2124, binary interpretation):  
Bit 0: Frequency exceeded (speed too high).  
Bit 1: Temperature exceeded.  
Bit 2: Control reserve, lighting system exceeded.  
Bit 3: Battery discharged.  
Bit 4: Reference point passed.  
See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** Replace encoder.

---

**231412 <location>Encoder 1: Error bit set in the serial protocol**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder sends a set error bit via the serial protocol.  
Alarm value (r2124, binary interpretation):  
Bit 0: Fault bit in the position protocol.  
Bit 1: Alarm bit in the position protocol.  
**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder.

---

**231414 <location>Encoder 1: Amplitude error track C or D (C<sup>2</sup> + D<sup>2</sup>)**

**Message value:** C track: %1, D track: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The amplitude (C<sup>2</sup> + D<sup>2</sup>) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.  
Alarm value (r2124, interpret hexadecimal):  
yyyyxxxx hex:  
yyyy = Signal level, track D (16 bits with sign).  
xxxx = Signal level, track C (16 bits with sign).  
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.  
A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
Note:  
If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.  
**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check the Sensor Module (e.g. contacts).
- check the Hall sensor box

---

**231415 <location>Encoder 1: Amplitude alarm track A or B (A<sup>2</sup> + B<sup>2</sup>)**

**Message value:** Amplitude: %1, Angle: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The amplitude (root of A<sup>2</sup> + B<sup>2</sup>) for encoder 1 exceeds the permissible tolerance.  
 Alarm value (r2124, interpret hexadecimal):  
 yyyxxxx hex:  
 yyyy = Angle  
 xxxx = Amplitude, i.e. root from A<sup>2</sup> + B<sup>2</sup> (16 bits without sign)  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold is < 300 mV (observe the frequency response of the encoder).  
 A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec.  
 The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1414 mV (1.0 Vrms).  
 A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**

- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range.
- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check the Sensor Module (e.g. contacts).
- if the coding disk is soiled or the lighting aged, replace the encoder.

**231418 <location>Encoder 1: Speed difference per sampling rate exceeded**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** For an HTL/TTL encoder, the speed difference between two sampling cycles has exceeded the value in p0492.  
 The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.  
 Alarm value (r2124, interpret decimal):  
 Only for internal Siemens troubleshooting.  
 See also: p0492  
**Remedy:**

- check the tachometer feeder cable for interruptions.
- check the grounding of the tachometer shielding.
- if required, increase the setting of p0492.

**231419 <location>Encoder 1: Track A or B outside tolerance**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

<b>Cause:</b>	<p>The amplitude/phase/offset correction for track A or B is at the limit.  Amplitude error correction: Amplitude B / Amplitude A = 0.78 ... 1.27  Phase: &lt;84 degrees or &gt;96 degrees  SMC20: Offset correction: +/-140 mV  SMC10: Offset correction: +/-650 mV  Alarm value (r2124, interpret hexadecimal):  xxxx1: Minimum of the offset correction, track B  xxxx2: Maximum of the offset correction, track B  xxx1x: Minimum of the offset correction, track A  xxx2x: Maximum of the offset correction, track A  xx1xx: Minimum of the amplitude correction, track B/A  xx2xx: Maximum of the amplitude correction, track B/A  x1xxx: Minimum of the phase error correction  x2xxx: Maximum of the phase error correction  1xxxx: Minimum of the cubic correction  2xxxx: Maximum of the cubic correction  See also: p0491 (Motor encoder fault response ENCODER)</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders).</li> <li>- check the plug connections (also the transition resistance).</li> <li>- check the encoder signals.</li> <li>- replace the encoder or encoder cable</li> </ul>

### 231421 <location>Encoder 1: Coarse position error

<b>Message value:</b>	%1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>For the actual value sensing, an error was detected. As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.  Alarm value (r2124, interpret decimal):  3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.</p>
<b>Remedy:</b>	<p>Re alarm value = 3:  - For a standard encoder with cable, contact the manufacturer where relevant.  - correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A* and B with B*) or, for a programmable encoder, check the zero offset of the position.</p>

### 231422 <location>Encoder 1: Pulses per revolution square-wave encoder outside tolerance bandwidth

<b>Message value:</b>	%1
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>The measured zero mark distance does not correspond to the parameterized zero mark distance.  This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684.  The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder).  Alarm value (r2124, interpret decimal):  accumulated differential pulses in encoder pulses.  See also: p0491 (Motor encoder fault response ENCODER)</p>

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
  - check the plug connections
  - check the encoder type (encoder with equidistant zero marks).
  - adapt the parameter for the distance between zero marks (p0424, p0425).
  - replace the encoder or encoder cable

---

**231429**                    **<location>Encoder 1: Position difference, hall sensor/track C/D and A/B too large**

- Message value:**    %1
- Drive object:**    ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:**        NONE
- Acknowledge:**    NONE
- Cause:**            The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical.  
One period of track C/D corresponds to 360 ° mechanical.  
One period of the Hall signal corresponds to 360 ° electrical.  
The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
Alarm value (r2124, interpret decimal):  
For track C/D, the following applies:  
Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °).  
For Hall signals, the following applies:  
Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).  
See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- track C or D not connected.
  - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.
  - check that the encoder cables are routed in compliance with EMC.
  - check the adjustment of the Hall sensor.

---

**231431**                    **<location>Encoder 1: Deviation, position incremental/absolute too large**

- Message value:**    %1
- Drive object:**    ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:**        NONE
- Acknowledge:**    NONE
- Cause:**            When the zero pulse is passed, a deviation in the incremental position was detected.  
For equidistant zero marks, the following applies:  
- The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.  
For distance-coded zero marks, the following applies:  
- the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.  
Alarm value (r2124, interpret decimal):  
Deviation in quadrants (1 pulse = 4 quadrants).  
See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
  - check the plug connections
  - replace the encoder or encoder cable
  - Clean coding disk or remove strong magnetic fields.

---

**231432**                    **<location>Encoder 1: Rotor position adaptation corrects deviation**

**Message value:**        %1

**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                For track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected.  
Alarm value (r2124, interpret decimal):  
Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse).  
The sign designates the direction of motion when detecting the zero mark distance.

**Remedy:**                - check that the encoder cables are routed in compliance with EMC.  
- check the plug connections  
- replace the encoder or encoder cable  
- check encoder limit frequency.  
- adapt the parameter for the distance between zero marks (p0424, p0425).

---

**231442**                    **<location>Encoder 1: Battery voltage pre-alarm**

**Message value:**        -

**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                When switched-off, the encoder uses a battery to back up the multiturn information. The battery voltage is no longer sufficient to check the multiturn information.

**Remedy:**                Replace battery.

---

**231443**                    **<location>Encoder 1: Unipolar CD signal level outside specification**

**Message value:**        Fault cause: %1 bin

**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                The unipolar level (CP/CN or DP/DN) for encoder 1 is outside the permissible tolerance.  
Alarm value (r2124, binary interpretation):  
Bit 0 = 1: Either CP or CN outside the tolerance.  
Bit 16 = 1: Either DP or DN outside the tolerance.  
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.  
The response thresholds are < 1700 mV and > 3300 mV.  
Note:  
The signal level is not evaluated unless the following conditions are satisfied:  
- Sensor Module properties available (r0459.31 = 1).  
- Monitoring active (p0437.31 = 1).  
See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**                - check that the encoder cables and shielding are routed in compliance with EMC.  
- check the plug connections and contacts of the encoder cable.  
- are the C/D tracks connected correctly (have the signal lines CP and CN or DP and DN been interchanged)?  
- replace the encoder cable.

---

---

**231460 <location>Encoder 1: Analog sensor channel A failed**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Alarm value (r2124, interpret decimal):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside measuring range set in p4673.  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:** Re alarm value = 1:  
- check the output voltage of the analog sensor.  
Re alarm value = 2:  
- check the voltage setting for each encoder period (p4673).  
Re alarm value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**231461 <location>Encoder 1: Analog sensor channel B failed**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Alarm value (r2124, interpret decimal):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4675).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:** Re alarm value = 1:  
- check the output voltage of the analog sensor.  
Re alarm value = 2:  
- check the voltage setting for each encoder period (p4675).  
Re alarm value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**231462 <location>Encoder 1: Analog sensor, no channel active**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Channel A and B are not activated for the analog sensor.  
**Remedy:** - activate channel A and/or channel B (p4670).  
- check the encoder configuration (p0404.17).  
See also: p4670 (Analog sensor configuration)



---

**231463 <location>Encoder 1: Analog sensor position value exceeds limit value**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
Alarm value (r2124, interpret decimal):  
1: Position value from the LVDT sensor.  
2: Position value from the encoder characteristic.  
**Remedy:** Re alarm value = 1:  
- Check the LVDT ratio (p4678).  
- check the reference signal connection at track B.  
Re alarm value = 2:  
- check the coefficients of the characteristic (p4663 ... p4666).

---

**231470 <location>Encoder 1: Soiling detected**

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of the alternative encoder system interface on the Sensor Module Cabinet 30 (SMC30), encoder soiling is signaled via a 0 signal at terminal X521.7.  
**Remedy:** - check the plug connections  
- replace the encoder or encoder cable

---

**231500 <location>Encoder 1: Position tracking traversing range exceeded**

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions.  
For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421.  
For p0411.3 = 1, the maximum traversing range for the configured linear axis is pre-set (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).  
**Remedy:** The fault should be resolved as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and the absolute encoder adjusted.

---

**231501 <location>Encoder 1: Position tracking encoder position outside tolerance window**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY

**Cause:** When powered down, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder.  
Fault value (r0949, decimal interpretation):  
Deviation (difference) to the last encoder position in increments of the absolute value.  
The sign designates the traversing direction.  
Note:  
The deviation (difference) found is also displayed in r0477.  
See also: p0413 (Measuring gear, position tracking tolerance window), r0477 (Measuring gear, position difference)

**Remedy:** Reset the position tracking as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).  
See also: p0010, p2507

---

**231502**                    **<location>Encoder 1: Encoder with measuring gear, without valid signals**

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The encoder with measuring gear no longer provides any valid signals.  
**Remedy:** It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.

---

**231503**                    **<location>Encoder 1: Position tracking cannot be reset**

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The position tracking for the measuring gear cannot be reset.  
**Remedy:** The fault should be resolved as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and the absolute encoder adjusted.

---

**231700**                    **<location>Encoder 1: Effectivity test does not supply the expected value**

**Message value:** Fault cause: %1 bin  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
Fault value (r0949, interpret binary):  
Bit x = 1: Effectivity test x unsuccessful.  
**Remedy:** Replace encoder.

---

**231800** <location>Encoder 1: Group signal

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** NONE  
**Cause:** The motor encoder has detected at least one fault.  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** Evaluate the other messages that are presently available.

---

**231801** <location>Encoder 1 DRIVE-CLiQ: Sign-of-life missing

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex:  
 The sign-of-life bit in the receive telegram is not set.  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** - check the electrical cabinet design and cable routing for EMC compliance  
 - replace the component involved.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**231802** <location>Encoder 1: Time slice overflow

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A time slice overflow has occurred in encoder 1.  
 Fault value (r0949, decimal interpretation):  
 9: Time slice overflow of the fast (current controller clock cycle) time slice.  
 10: Time slice overflow of the average time slice.  
 12: Time slice overflow of the slow time slice.  
 999: Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** Reduce the current controller frequency.

---

**231804** <location>Encoder 1: Checksum error

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY

**Cause:** A checksum error has occurred when reading-out the program memory on the Sensor Module.  
 Fault value (r0949, interpret hexadecimal):  
 yyyxxxx hex  
 yyyy: Memory area involved.  
 xxxx: Difference between the checksum at POWER ON and the actual checksum.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
 - replace the Sensor Module.

**231805** <location>Encoder 1: EPROM checksum error

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Internal parameter data is corrupted.  
 Fault value (r0949, interpret hexadecimal):  
 01: EEPROM access error.  
 02: Too many blocks in the EEPROM.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:** Replace the module.

**231806** <location>Encoder 1: Initialization error

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder was not successfully initialized.  
 Fault value (r0949, interpret hexadecimal):  
 Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4).  
 Bit 2: Mid-voltage matching for track A unsuccessful.  
 Bit 3: Mid-voltage matching for track B unsuccessful.  
 Bit 4: Mid-voltage matching for acceleration input unsuccessful.  
 Bit 5: Mid-voltage matching for track safety A unsuccessful.  
 Bit 6: Mid-voltage matching for track safety B unsuccessful.  
 Bit 7: Mid-voltage matching for track C unsuccessful.  
 Bit 8: Mid-voltage matching for track D unsuccessful.  
 Bit 9: Mid-voltage matching for track R unsuccessful.  
 Bit 10: The difference in mid-voltages between A and B is too great (> 0.5 V)  
 Bit 11: The difference in mid-voltages between C and D is too great (> 0.5 V)  
 Bit 12: The difference in mid-voltages between safety A and safety B is too great (> 0.5 V)  
 Bit 13: The difference in mid-voltages between A and safety B is too great (> 0.5 V)  
 Bit 14: The difference in mid-voltages between B and safety A is too great (> 0.5 V)  
 Bit 15: The standard deviation of the calculated mid-voltages is too great (> 0.3 V)  
 Bit 16: Internal fault - fault reading a register (CAFE)  
 Bit 17: Internal fault - fault writing a register (CAFE)  
 Bit 18: Internal fault: No mid-voltage matching available  
 Bit 19: Internal error - ADC access error.  
 Bit 20: Internal error - no zero crossover found.  
 Note:  
 Bit 0, 1: Up to 6SL3055-0AA00-5\*A0  
 Bits 2 ... 20: 6SL3055-0AA00-5\*A1 and higher  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:** Acknowledge the fault.  
 If the fault cannot be acknowledged:  
 Bits 2 ... 9: Check encoder power supply.  
 Bits 2 ... 14: Check the corresponding cable.  
 Bit 15 with no other bits: Check track R, check settings in p0404.

### 231811 <location>Encoder 1: Encoder serial number changed

**Message value:** -  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The serial number of the motor encoder of a synchronous motor has changed. The change was only checked for encoders with serial number (e.g. EnDat encoders) and build-in motors (e.g. p0300 = 401) or third-party motors (p0300 = 2).  
 Cause 1:  
 - The encoder was replaced.  
 Cause 2:  
 - A third-party, built-in or linear motor was re-commissioned.  
 Cause 3:  
 - The motor with integrated and adjusted encoder was replaced.  
 Cause 4:  
 - The firmware was updated to a version that checks the encoder serial number.  
**Note:**  
 With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2).  
 When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1).  
 Proceed as follows to hide serial number monitoring:  
 - set the following serial numbers for the corresponding Encoder Data Set: p0441= FF, p0442 = 0, p0442 = 0, p0444 = 0, p0445 = 0.  
 - parameterize F07414 as message type N (p2100, p2101).  
 See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:** Re causes 1, 2:  
 Carry out an automatic adjustment using the pole position identification routine. Acknowledge the fault. Initiate the pole position identification routine with p1990 = 1. Then check that the pole position identification routine is correctly executed.  
 SERVO:  
 If a pole position identification technique is selected in p1980, and if p0301 does not contain a motor type with an encoder adjusted in the factory, then p1990 is automatically activated.  
 or  
 Set the adjustment via p0431. In this case, the new serial number is automatically accepted.  
 or  
 Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.  
 Re causes 3, 4:  
 Accept the new serial number with p0440 = 1.

### 231812 <location>Encoder 1: Requested cycle or RX-/TX timing not supported

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** A cycle requested from the Control Unit or RX/TX timing is not supported.  
 Fault value (r0949, decimal interpretation):  
 0: Application cycle is not supported.  
 1: DRIVE-CLiQ cycle is not supported.  
 2: Distance between RX and TX instants in time too low.  
 3: TX instant in time too early.

**Remedy:** POWER ON all components (switch the power off and then back on again).

**231813**                    **<location>Encoder 1: Hardware logic unit failed**

**Message value:**        Fault cause: %1 bin

**Drive object:**         ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:**         PULSE INHIBIT

**Cause:**                 The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Bit 0: ALU watchdog has responded.  
 Bit 1: ALU has detected a sign-of-life error.

**Remedy:**                Replace encoder.

**231820**                    **<location>Encoder 1 DRIVE-CLiQ: Telegram error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              ENCODER (IASC/DCBRAKE, NONE)

**Acknowledge:**         IMMEDIATELY

**Cause:**                 A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 01 hex:  
 CRC error.  
 xx = 02 hex:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 03 hex:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 04 hex:  
 The length of the receive telegram does not match the receive list.  
 xx = 05 hex:  
 The type of the receive telegram does not match the receive list.  
 xx = 06 hex:  
 The address of the component in the telegram and in the receive list do not match.  
 xx = 07 hex:  
 A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
 xx = 08 hex:  
 No SYNC telegram is expected - but the received telegram is one.  
 xx = 09 hex:  
 The error bit in the receive telegram is set.  
 xx = 10 hex:  
 The receive telegram is too early.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**                - carry out a POWER ON.  
 - check the electrical cabinet design and cable routing for EMC compliance  
 - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

<b>231835</b>	<b>&lt;location&gt;Encoder 1 DRIVE-CLiQ: Cyclic data transfer error</b>
<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 21 hex: The cyclic telegram has not been received. xx = 22 hex: Timeout in the telegram receive list. xx = 40 hex: Timeout in the telegram send list. See also: p0491 (Motor encoder fault response ENCODER)
<b>Remedy:</b>	- carry out a POWER ON. - replace the component involved. See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

<b>231836</b>	<b>&lt;location&gt;Encoder 1 DRIVE-CLiQ: Send error for DRIVE-CLiQ data</b>
<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 41 hex: Telegram type does not match send list. See also: p0491 (Motor encoder fault response ENCODER)
<b>Remedy:</b>	Carry out a POWER ON.

---

<b>231837</b>	<b>&lt;location&gt;Encoder 1 DRIVE-CLiQ: Component fault</b>
<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 20 hex: Error in the telegram header. xx = 23 hex: Receive error: The telegram buffer memory contains an error. xx = 42 hex: Send error: The telegram buffer memory contains an error. xx = 43 hex: Send error: The telegram buffer memory contains an error. See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

---

**231845**                    **<location>Encoder 1 DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
                               Fault value (r0949, interpret hexadecimal):  
                               yyxx hex: yy = component number, xx = fault cause  
                               xx = 0B hex:  
                               Synchronization error during alternating cyclic data transfer.  
                               See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**                Carry out a POWER ON.  
                               See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**231850**                    **<location>Encoder 1: Encoder evaluation, internal software error**

**Message value:**        %1  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        POWER ON  
**Cause:**                An internal software error has occurred in the Sensor Module of encoder 1.  
                               Fault value (r0949, decimal interpretation):  
                               1: Background time slice is blocked.  
                               2: Checksum over the code memory is not OK.  
                               10000: OEM memory of the EnDat encoder contains data that cannot be interpreted.  
                               11000 ... 11499: Descriptive data from EEPROM incorrect.  
                               11500 ... 11899: Calibration data from EEPROM incorrect.  
                               11900 ... 11999: Configuration data from EEPROM incorrect.  
                               16000: DRIVE-CLiQ encoder initialization application error.  
                               16001: DRIVE-CLiQ encoder initialization ALU error.  
                               16002: DRIVE-CLiQ encoder HISI / SISI initialization error.  
                               16003: DRIVE-CLiQ encoder safety initialization error.  
                               16004: DRIVE-CLiQ encoder internal system error.  
                               See also: p0491 (Motor encoder fault response ENCODER)  
**Remedy:**                - replace the Sensor Module.  
                               - if required, upgrade the firmware in the Sensor Module.  
                               - contact the Hotline.

---

**231851**                    **<location>Encoder 1 DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:**        IMMEDIATELY



<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 0A hex = 10 dec: The sign-of-life bit in the receive telegram is not set.
<b>Remedy:</b>	Upgrade the firmware of the component involved.

### 231860 <location>Encoder 1 DRIVE-CLiQ (CU): Telegram error

<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	ENCODER, ENCSINUMERIK, SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	ENCODER (IASC/DCBRAKE, NONE)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 11 hex = 17 dec: CRC error and the receive telegram is too early. xx = 01 hex = 01 dec: Checksum error (CRC error). xx = 12 hex = 18 dec: The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. xx = 02 hex = 02 dec: Telegram is shorter than specified in the length byte or in the receive list. xx = 13 hex = 19 dec: The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. xx = 03 hex = 03 dec: Telegram is longer than specified in the length byte or in the receive list. xx = 14 hex = 20 dec: The length of the receive telegram does not match the receive list and the receive telegram is too early. xx = 04 hex = 04 dec: The length of the receive telegram does not match the receive list. xx = 15 hex = 21 dec: The type of the receive telegram does not match the receive list and the receive telegram is too early. xx = 05 hex = 05 dec: The type of the receive telegram does not match the receive list. xx = 16 hex = 22 dec: The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. xx = 06 hex = 06 dec: The address of the power unit in the telegram and in the receive list do not match. xx = 19 hex = 25 dec: The error bit in the receive telegram is set and the receive telegram is too early. xx = 09 hex = 09 dec: The error bit in the receive telegram is set. xx = 10 hex = 16 dec: The receive telegram is too early.
<b>Remedy:</b>	- carry out a POWER ON. - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**231885 <location>Encoder 1 DRIVE-CLiQ (CU): Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 1A hex = 26 dec:  
 Sign-of-life bit in the receive telegram not set and the receive telegram is too early.  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.  
 xx = 62 hex = 98 dec:  
 Error at the transition to cyclic operation.  
**Remedy:** - check the power supply voltage of the component involved.  
 - carry out a POWER ON.  
 - replace the component involved.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**231886 <location>Encoder 1 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.  
**Remedy:** - carry out a POWER ON.  
 - check whether the firmware version of the encoder (r0148) matches the firmware version of Control Unit (r0018).

**231887 <location>Encoder 1 DRIVE-CLiQ (CU): Component fault**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 1). Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.

xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex:  
 Response received too late during runtime measurement.  
 xx = 61 hex:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

### 231895 <location>Encoder 1 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.  
**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 231896 <location>Encoder 1 DRIVE-CLiQ (CU): Inconsistent component properties

**Message value:** Component number: %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The properties of the DRIVE-CLiQ component (Sensor Module for encoder 1), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.  
 Fault value (r0949, decimal interpretation):  
 Component number.  
**Remedy:**

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

### 231899 <location>Encoder 1: Unknown fault

**Message value:** New message: %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** A fault occurred on the Sensor Module for encoder 1 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Fault number.  
 Note:  
 If required, the significance of this new fault can be read about in a more recent description of the Control Unit.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

**231902 <location>Encoder 1: SPI-BUS error occurred**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when operating the internal SPI bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact the Hotline.

**231903 <location>Encoder 1: I2C-BUS error occurred**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when operating the internal I2C bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact the Hotline.

**231905 <location>Encoder 1: Parameterization error**

**Message value:** Parameter: %1, supplementary information: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A parameter of encoder 1 was detected as being incorrect.  
 It is possible that the parameterized encoder type does not match the connected encoder.  
 The parameter involved can be determined as follows:  
 - determine the parameter number using the fault value (r0949).  
 - determine the parameter index (p0187).  
 Fault value (r0949, decimal interpretation):  
 yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter  
 yyyy = 0:  
 No information available.  
 yyyy = 1:  
 The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <-> -A/B (p0405.2 = 1).

yyyy = 2:

A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please start a new encoder identification.

yyyy = 3:

A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please select a listed encoder in p0400 with a code number < 10000.

yyyy = 4:

This component does not support SSI encoders (p0404.9 = 1) without track A/B.

yyyy = 5:

For SQW encoder, value in p4686 greater than in p0425.

yyyy = 6:

DRIVE-CLiQ encoder cannot be used with this firmware version.

yyyy = 7:

For the SQW encoder, the Xact1 correction (p0437.2) is only permitted with equidistant zero marks.

yyyy = 8:

The motor pole pair width is not supported by the linear scale being used.

See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.
- re parameter number = 314:
- check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ((r0313 \* p0433) / p0432 <= 1000).

### 231915 <location>Encoder 1: Configuration error

**Message value:** %1

**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The configuration for encoder 1 is incorrect.  
Alarm value (r2124, interpret decimal):  
1: Re-parameterization between fault/alarm is not permissible.  
419: When the fine resolution Gx\_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.

**Remedy:** Re alarm value = 1:  
No re-parameterization between fault/alarm.  
Re alarm value = 419:  
Reduce the fine resolution (p0419).

### 231916 <location>Encoder 1: Parameterization fault

**Message value:** Parameter: %1, supplementary information: %2

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:** IMMEDIATELY

**Cause:** A parameter of encoder 1 was detected as being incorrect.  
It is possible that the parameterized encoder type does not match the connected encoder.  
The parameter involved can be determined as follows:  
- determine the parameter number using the fault value (r0949).  
- determine the parameter index (p0187).  
Fault value (r0949, decimal interpretation):  
Parameter number.  
Note:  
This fault is only output for encoders where r0404.10 = 1 or r0404.11 = 1. It corresponds to A31905 with encoders where r0404.10 = 0 and r0404.11 = 0.  
See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.

**231916 <location>Encoder 1: Parameterization fault**

**Message value:** Parameter: %1, supplementary information: %2  
**Drive object:** ENCODER, ENCSINUMERIK  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A parameter of encoder 1 was detected as being incorrect.  
 In the case of the ENCODER drive object, the selected encoder type (rotary/linear) might not match the function module setting (r0108.12).  
 The parameter involved can be determined as follows:  
 - determine the parameter number using the fault value (r0949).  
 - determine the parameter index (p0187).  
 Fault value (r0949, decimal interpretation):  
 Parameter number.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.
- if a linear encoder has been selected in parameter p0400/p0404, the "linear encoder" function module has to be activated (r0108.12 = 1)
- if a rotary encoder has been selected in parameter p0400/p0404, the "linear encoder" function module should not be activated (r0108.12 = 0)

**231920 <location>Encoder 1: Temperature sensor fault**

**Message value:** Fault cause: %1, channel number: %2  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
 Alarm value (r2124, interpret decimal):  
 yyxx hex: yy: channel number, xx = fault cause  
 xx = 1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
 xx = 2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).  
 xx = Additional values:  
 Only for internal Siemens troubleshooting.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- check that the encoder cable is the correct type and is correctly connected.
- check the temperature sensor selection in p0600 to p0603.
- replace the Sensor Module (hardware defect or incorrect calibration data).

**231940 <location>Sensor 1: Spindle clamping state error**

**Message value:** %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The spindle clamping state is incorrect.  
 Fault value (r0949, decimal interpretation):  
 Signal level from sensor S1.  
 Note:  
 A signal level of 500 mV corresponds to the numerical value 500 dec.

**Remedy:**

- Check the clamped tool.
- Check the tolerance and if required, adapt (p5040).
- Check the thresholds and if required, adapt (p5041).
- Check analog sensor S1 and connections.

See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

### 231999 <location>Encoder 1: Unknown alarm

**Message value:** New message: %1  
**Drive object:** ENCODER, ENCSINUMERIK, SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** A alarm has occurred on the Sensor Module for encoder 1 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Alarm number.  
 Note:  
 If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.  
 See also: p0491 (Motor encoder fault response ENCODER)

**Remedy:**

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

### 232100 <location>Encoder 2: Zero mark distance error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT

**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance.  
 For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Fault value (r0949, decimal interpretation):  
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- if message output above speed threshold, reduce filter time if necessary (p0438).
- replace the encoder or encoder cable

**232101 <location>Encoder 2: Zero mark failed**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The 1.5 x parameterized zero mark distance was exceeded.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Fault value (r0949, decimal interpretation):  
 Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).  
**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the clearance between zero marks (p0425).
- if message output above speed threshold, reduce filter time if necessary (p0438).
- when p0437.1 is active, check p4686.
- replace the encoder or encoder cable

**232103 <location>Encoder 2: Amplitude error, track R**

**Message value:** R track: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The amplitude of the reference track signal (track R) does not lie within the tolerance bandwidth for encoder 2.  
 The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign)  
 The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV.  
 The response threshold for the differential signal level of the encoder is < -1600 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
**Note:**  
 The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module.  
 The fault value can only be represented between -32767 ... 32767 dec (-770 ... 770 mV).  
 The signal level is not evaluated unless the following conditions are satisfied:  
 - Sensor Module properties available (r0459.31 = 1).  
 - Monitoring active (p0437.31 = 1).  
**Remedy:**

- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range
- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections and contacts of the encoder cable.
- check whether the zero mark is connected and the signal cables RP and RN have been connected correctly
- replace the encoder cable.
- if the coding disk is soiled or the lighting aged, replace the encoder.

**232110 <location>Encoder 2: Serial communications error**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT



<b>Cause:</b>	<p>Serial communication protocol transfer error between the encoder and evaluation module.</p> <p>Fault value (r0949, interpret binary):</p> <p>Bit 0: Alarm bit in the position protocol.</p> <p>Bit 1: Incorrect quiescent level on the data line.</p> <p>Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).</p> <p>Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.</p> <p>Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.</p> <p>Bit 5: Internal error in the serial driver: An illegal mode command was requested.</p> <p>Bit 6: Timeout when cyclically reading.</p> <p>Bit 8: Protocol is too long (e.g. &gt; 64 bits).</p> <p>Bit 9: Receive buffer overflow.</p> <p>Bit 10: Frame error when reading twice.</p> <p>Bit 11: Parity error.</p> <p>Bit 12: Data line signal level error during the monoflop time.</p> <p>Bit 13: Data line incorrect.</p>
<b>Remedy:</b>	<p>Re fault value, bit 0 = 1:</p> <ul style="list-style-type: none"> <li>- Enc defect F31111 may provide additional details.</li> </ul> <p>Re fault value, bit 1 = 1:</p> <ul style="list-style-type: none"> <li>- Incorrect encoder type / replace the encoder or encoder cable.</li> </ul> <p>Re fault value, bit 2 = 1:</p> <ul style="list-style-type: none"> <li>- Incorrect encoder type / replace the encoder or encoder cable.</li> </ul> <p>Re fault value, bit 3 = 1:</p> <ul style="list-style-type: none"> <li>- EMC / connect the cable shield, replace the encoder or encoder cable.</li> </ul> <p>Re fault value, bit 4 = 1:</p> <ul style="list-style-type: none"> <li>- EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.</li> </ul> <p>Re fault value, bit 5 = 1:</p> <ul style="list-style-type: none"> <li>- EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.</li> </ul> <p>Re fault value, bit 6 = 1:</p> <ul style="list-style-type: none"> <li>- Update Sensor Module firmware.</li> </ul> <p>Re fault value, bit 8 = 1:</p> <ul style="list-style-type: none"> <li>- Check parameterization (p0429.2).</li> </ul> <p>Re fault value, bit 9 = 1:</p> <ul style="list-style-type: none"> <li>- EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.</li> </ul> <p>Re fault value, bit 10 = 1:</p> <ul style="list-style-type: none"> <li>- Check parameterization (p0429.2, p0449).</li> </ul> <p>Re fault value, bit 11 = 1:</p> <ul style="list-style-type: none"> <li>- Check parameterization (p0436).</li> </ul> <p>Re fault value, bit 12 = 1:</p> <ul style="list-style-type: none"> <li>- Check parameterization (p0429.6).</li> </ul> <p>Re fault value, bit 13 = 1:</p> <ul style="list-style-type: none"> <li>- Check data line.</li> </ul>

---

## 232111 <location>Encoder 2: Absolute encoder EnDat, internal fault/error

<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The EnDat encoder fault word supplies fault bits that have been set.</p> <p>Fault value (r0949, interpret binary):</p> <p>Bit 0: Lighting system failed.</p> <p>Bit 1: Signal amplitude too low.</p> <p>Bit 2: Position value incorrect.</p> <p>Bit 3: Encoder power supply overvoltage condition.</p> <p>Bit 4: Encoder power supply undervoltage condition.</p> <p>Bit 5: Encoder power supply overcurrent condition.</p> <p>Bit 6: The battery must be changed.</p>

**Remedy:**

Re fault value, bit 0 = 1:  
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

Re fault value, bit 1 = 1:  
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

Re fault value, bit 2 = 1:  
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

Re fault value, bit 3 = 1:  
5 V power supply voltage fault.  
When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.  
When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor.

Re fault value, bit 4 = 1:  
5 V power supply voltage fault.  
When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.  
When using a motor with DRIVE-CLiQ: Replace the motor.

Re fault value, bit 5 = 1:  
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

Re fault value, bit 6 = 1:  
The battery must be changed (only for encoders with battery back-up).

**232112 <location>Encoder 2: Error bit set in the serial protocol**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder sends a set error bit via the serial protocol.  
 Fault value (r0949, interpret binary):  
 Bit 0: Fault bit in the position protocol.

**Remedy:** For fault value, bit 0 = 1:  
 In the case of an EnDat encoder, F31111 may provide further details.

**232115 <location>Encoder 2: Amplitude error track A or B (A^2 + B^2)**

**Message value:** A track: %1, B-track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude (root of A^2 + B^2) for encoder 2 exceeds the permissible tolerance.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response thresholds are < 1070 mV and > 3582 mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

- Remedy:**
- check that the encoder cables and shielding are routed in compliance with EMC.
  - check the plug connections
  - replace the encoder or encoder cable
  - check the Sensor Module (e.g. contacts).
- The following applies to measuring systems without their own bearing system:
- adjust the scanning head and check the bearing system of the measuring wheel.
- The following applies for measuring systems with their own bearing system:
- ensure that the encoder housing is not subject to any axial force.

### 232116 <location>Encoder 2: Amplitude error monitoring track A + B

- Message value:** Amplitude: %1, Angle: %2
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
- Acknowledge:** IMMEDIATELY
- Cause:** The amplitude of the rectified encoder signals A and B and the amplitude from the roots of  $A^2 + B^2$  for encoder 2 are not within the tolerance bandwidth.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response thresholds are < 176 mV (observe the frequency response of the encoder) and > 955 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.
- Remedy:**
- check that the encoder cables and shielding are routed in compliance with EMC.
  - check the plug connections
  - replace the encoder or encoder cable
  - check the Sensor Module (e.g. contacts).

### 232117 <location>Encoder 2: Inversion error signals A/B/R

- Message value:** Fault cause: %1 bin
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
- Acknowledge:** IMMEDIATELY
- Cause:** For a square-wave encoder (bipolar, double ended) signals A\*, B\* and R\* are not inverted with respect to signals A, B and R.  
 Fault value (r0949, interpret binary):  
 Bits 0 ... 15: Only for internal Siemens troubleshooting.  
 Bit 16: Error track A.  
 Bit 17: Error track B.  
 Bit 18: Error track R.  
 Note:  
 For SMC30 (order no.. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), CUA32, and CU310, the following applies:  
 A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.
- Remedy:**
- Check the encoder/cable.
  - Does the encoder supply signals and the associated inverted signals?

Note:

For SMC30 (order no. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), the following applies:

- check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520).

For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30) or X23 (CUA32, CU310):

- pin 10 (reference signal R) <--> pin 7 (encoder power supply, ground)
- pin 11 (reference signal R inverted) <--> pin 4 (encoder power supply)

**232118 <location>Encoder 2: Speed difference outside the tolerance range**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:** PULSE INHIBIT

**Cause:** For an HTL/TTL encoder, the speed difference has exceeded the value in p0492 over several sampling cycles. The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time. Fault value (r0949, decimal interpretation): Only for internal Siemens troubleshooting. See also: p0492

**Remedy:**

- check the tachometer feeder cable for interruptions.
- check the grounding of the tachometer shielding.
- if required, increase the maximum speed difference per sampling cycle (p0492).

**232120 <location>Encoder 2: Power supply voltage fault**

**Message value:** Fault cause: %1 bin

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:** PULSE INHIBIT

**Cause:** A power supply fault was detected for encoder 2. Fault value (r0949, interpret binary):  
 Bit 0: Undervoltage condition on the sense line.  
 Bit 1: Overcurrent condition for the encoder power supply.  
 Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative.  
 Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive.

Note:

If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed.

**Remedy:**

Re fault value, bit 0 = 1:

- correct encoder cable connected?
- check the plug connections of the encoder cable.
- SMC30: Check the parameterization (p0404.22).

Re fault value, bit 1 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

Re fault value, bit 2 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

Re fault value, bit 3 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable

---

**232121 <location>Encoder 2: Coarse position error**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** For the actual value sensing, an error was detected on the module.  
As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.  
**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

---

**232122 <location>Encoder 2: Internal power supply voltage faulty**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault in internal reference voltage of ASICs for encoder 2.  
Fault value (r0949, decimal interpretation):  
1: Reference voltage error.  
2: Internal undervoltage.  
3: Internal overvoltage.  
**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

---

**232123 <location>Encoder 2: Signal level A/B unipolar outside tolerance**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The unipolar level (AP/AN or BP/BN) for encoder 2 is outside the permissible tolerance.  
Fault value (r0949, interpret binary):  
Bit 0 = 1: Either AP or AN outside the tolerance.  
Bit 16 = 1: Either BP or BN outside the tolerance.  
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.  
The response thresholds are < 1700 mV and > 3300 mV.  
Note:  
The signal level is not evaluated unless the following conditions are satisfied:  
- Sensor Module properties available (r0459.31 = 1).  
- Monitoring active (p0437.31 = 1).  
**Remedy:**  
- make sure that the encoder cables and shielding are installed in an EMC-compliant manner.  
- check the plug connections and contacts of the encoder cable.  
- check the short-circuit of a signal cable with mass or the operating voltage.  
- replace the encoder cable.

---

**232125 <location>Encoder 2: Amplitude error track A or B overcontrolled**

**Message value:** A track: %1, B-track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT

**Cause:** The amplitude of track A or B for encoder 2 exceeds the permissible tolerance band.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold is > 750 mV. This fault also occurs if the A/D converter is overcontrolled.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is > 3582 mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable

**232126 <location>Encoder 2: Amplitude AB too high**

**Message value:** Amplitude: %1, Angle: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude (root of A<sup>2</sup> + B<sup>2</sup> or |A| + |B|) for encoder 2 exceeds the permissible tolerance.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Angle  
 xxxx = Amplitude, i.e. root from A<sup>2</sup> + B<sup>2</sup> (16 bits without sign)  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold for (|A| + |B|) is > 1120 mV or the root of (A<sup>2</sup> + B<sup>2</sup>) > 955 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec.  
 The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable

**232129 <location>Encoder 2: Position difference, hall sensor/track C/D and A/B too large**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical.  
 One period of track C/D corresponds to 360 ° mechanical.  
 One period of the Hall signal corresponds to 360 ° electrical.  
 The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
 After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A32429.

Fault value (r0949, decimal interpretation):  
 For track C/D, the following applies:  
 Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °).  
 For Hall signals, the following applies:  
 Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).

**Remedy:**

- track C or D not connected.
- correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.
- check that the encoder cables are routed in compliance with EMC.
- check the adjustment of the Hall sensor.

### 232130 <location>Encoder 2: Zero mark and position error from the coarse synchronization

**Message value:** Angular deviation, electrical: %1, angle, mechanical: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out.  
 When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of +/-18 ° mechanical.  
 When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of +/-60 ° electrical.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex  
 yyyy: Determined mechanical zero mark position (can only be used for track C/D).  
 xxxx: Deviation of the zero mark from the expected position as electrical angle.  
 Scaling: 32768 dec = 180 °

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- if the Hall sensor is used as an equivalent for track C/D, check the connection.
- Check the connection of track C or D.
- replace the encoder or encoder cable

### 232131 <location>Encoder 2: Deviation, position incremental/absolute too large

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** Absolute encoder:  
 When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected.  
 Limit value for the deviation:  
 - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 > 2 quadrants, EQN 1325 > 50 quadrants).  
 - other encoders: 15 pulses = 60 quadrants.  
 Incremental encoder:  
 When the zero pulse is passed, a deviation in the incremental position was detected.  
 For equidistant zero marks, the following applies:  
 - The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.  
 For distance-coded zero marks, the following applies:  
 - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.  
 Fault value (r0949, decimal interpretation):  
 Deviation in quadrants (1 pulse = 4 quadrants).

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
  - check the plug connections
  - replace the encoder or encoder cable
  - check whether the coding disk is dirty or there are strong ambient magnetic fields.
  - adapt the parameter for the clearance between zero marks (p0425).
  - if message output above speed threshold, reduce filter time if necessary (p0438).

**232135**                    **<location>Encoder 2: Fault when determining the position**

**Message value:**        Fault cause: %1 bin

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:**        PULSE INHIBIT

**Cause:**                The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.  
 Fault value (r0949, interpret binary):  
 Bit 0: F1 (safety status display)  
 Bit 1: F2 (safety status display)  
 Bit 2: Lighting (reserved)  
 Bit 3: Signal amplitude (reserved)  
 Bit 4: Position value (reserved)  
 Bit 5: Overvoltage (reserved)  
 Bit 6: Undervoltage (reserved)  
 Bit 7: Overcurrent (reserved)  
 Bit 8: Battery (reserved)  
 Bit 16: Lighting (--> F3x135, x = 1, 2, 3)  
 Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3)  
 Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3)  
 Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3)  
 Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3)  
 Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3)  
 Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3)  
 Bit 23: Singleturn position 2 (safety status display)  
 Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3)  
 Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3)  
 Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3)  
 Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3)  
 Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3)  
 Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3)  
 Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3)  
 Bit 31: Multiturn battery (reserved)

**Remedy:**                Replace DRIVE-CLiQ encoder.

**232136**                    **<location>Encoder 2: Error when determining multiturn information**

**Message value:**        Fault cause: %1 bin

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:**        PULSE INHIBIT

**Cause:**                The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.  
 Fault value (r0949, interpret binary):  
 Bit 0: F1 (safety status display)  
 Bit 1: F2 (safety status display)  
 Bit 2: Lighting (reserved)



Bit 3: Signal amplitude (reserved)  
 Bit 4: Position value (reserved)  
 Bit 5: Overvoltage (reserved)  
 Bit 6: Undervoltage (reserved)  
 Bit 7: Overcurrent (reserved)  
 Bit 8: Battery (reserved)  
 Bit 16: Lighting (--> F3x135, x = 1, 2, 3)  
 Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3)  
 Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3)  
 Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3)  
 Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3)  
 Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3)  
 Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3)  
 Bit 23: Singleturn position 2 (safety status display)  
 Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3)  
 Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3)  
 Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3)  
 Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3)  
 Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3)  
 Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3)  
 Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3)  
 Bit 31: Multiturn battery (reserved)

**Remedy:** Replace DRIVE-CLiQ encoder.

### **232137 <location>Encoder 2: Internal fault when determining the position**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal Siemens troubleshooting.  
**Remedy:** Replace encoder.

### **232138 <location>Encoder 2: Internal error when determining multiturn information**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal SIEMENS troubleshooting.  
**Remedy:** Replace encoder.

### **232150 <location>Encoder 2: Initialization error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT

**Cause:** Encoder functionality selected in p0404 is not operating correctly.  
Fault value (r0949, interpret hexadecimal):  
Encoder malfunction.  
The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).

**Remedy:**

- Check that p0404 is correctly set.
- check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.
- if relevant, note additional fault messages that describe the fault in detail.

---

**232151 <location>Encoder 2: Encoder speed for initialization AB too high**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder speed is too high during while initializing the sensor.  
**Remedy:** Reduce the speed of the encoder accordingly during initialization.  
If necessary, de-activate monitoring (p0437.29).  
See also: p0437 (Sensor Module configuration extended)

---

**232160 <location>Encoder 2: Analog sensor channel A failed**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Fault value (r0949, decimal interpretation):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4673).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:**  
For fault value = 1:  
- check the output voltage of the analog sensor.  
For fault value = 2:  
- check the voltage setting for each encoder period (p4673).  
For fault value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**232161 <location>Encoder 2: Analog sensor channel B failed**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Fault value (r0949, decimal interpretation):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4675).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).

**Remedy:** For fault value = 1:  
 - check the output voltage of the analog sensor.  
 For fault value = 2:  
 - check the voltage setting for each encoder period (p4675).  
 For fault value = 3:  
 - check the range limit setting and increase it if necessary (p4676).

### 232163 <location>Encoder 2: Analog sensor position value exceeds limit value

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
 Fault value (r0949, decimal interpretation):  
 1: Position value from the LVDT sensor.  
 2: Position value from the encoder characteristic.  
**Remedy:** For fault value = 1:  
 - Check the LVDT ratio (p4678).  
 - check the reference signal connection at track B.  
 For fault value = 2:  
 - check the coefficients of the characteristic (p4663 ... p4666).

### 232400 <location>Encoder 2: Alarm threshold zero mark distance error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance.  
 For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - check the encoder type (encoder with equidistant zero marks).  
 - adapt the parameter for the distance between zero marks (p0424, p0425).  
 - replace the encoder or encoder cable

### 232401 <location>Encoder 2: Alarm threshold zero mark failed

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The 1.5 x parameterized zero mark distance was exceeded.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- . check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the clearance between zero marks (p0425).
- replace the encoder or encoder cable

**232405 <location>Encoder 2: Temperature in the encoder evaluation inadmissible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The encoder evaluation for a motor with DRIVE-CLiQ has detected an inadmissible temperature.  
 The fault threshold is 125 °C.  
 Alarm value (r2124, interpret decimal):  
 Measured board/module temperature in 0.1 °C.

**Remedy:** Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

**232407 <location>Encoder 2: Function limit reached**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder has reached one of its function limits. A service is recommended.  
 Alarm value (r2124, interpret decimal):  
 1 : Incremental signals  
 3 : Absolute track  
 4 : Code connection

**Remedy:** Perform service. Replace the encoder if necessary.  
 Note:  
 The current functional reserve of an encoder can be displayed via r4651.  
 See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

**232410 <location>Encoder 2: Serial communications**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Serial communication protocol transfer error between the encoder and evaluation module.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Alarm bit in the position protocol.  
 Bit 1: Incorrect quiescent level on the data line.  
 Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).

Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.  
 Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.  
 Bit 5: Internal error in the serial driver: An illegal mode command was requested.  
 Bit 6: Timeout when cyclically reading.  
 Bit 8: Protocol is too long (e.g. > 64 bits).  
 Bit 9: Receive buffer overflow.  
 Bit 10: Frame error when reading twice.  
 Bit 11: Parity error.  
 Bit 12: Data line signal level error during the monoflop time.

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder.

### 232411 <location>Encoder 2: EnDat encoder signals alarms

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The error word of the EnDat encoder has alarm bits that have been set.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Frequency exceeded (speed too high).  
 Bit 1: Temperature exceeded.  
 Bit 2: Control reserve, lighting system exceeded.  
 Bit 3: Battery discharged.  
 Bit 4: Reference point passed.

**Remedy:** Replace encoder.

### 232412 <location>Encoder 2: Error bit set in the serial protocol

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder sends a set error bit via the serial protocol.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Fault bit in the position protocol.  
 Bit 1: Alarm bit in the position protocol.

**Remedy:**

- carry out a POWER ON (power off/on) for all components.
- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder.

### 232414 <location>Encoder 2: Amplitude error track C or D (C<sup>2</sup> + D<sup>2</sup>)

**Message value:** C track: %1, D track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The amplitude ( $C^2 + D^2$ ) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.  
 Alarm value (r2124, interpret hexadecimal):  
 yyyxxxx hex:  
 yyyy = Signal level, track D (16 bits with sign).  
 xxxx = Signal level, track C (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note:  
 If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check the Sensor Module (e.g. contacts).
- check the Hall sensor box

**232415** <location>Encoder 2: Amplitude alarm track A or B ( $A^2 + B^2$ )

**Message value:** Amplitude: %1, Angle: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The amplitude (root of  $A^2 + B^2$ ) for encoder 2 exceeds the permissible tolerance.  
 Alarm value (r2124, interpret hexadecimal):  
 yyyxxxx hex:  
 yyyy = Angle  
 xxxx = Amplitude, i.e. root from  $A^2 + B^2$  (16 bits without sign)  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold is < 300 mV (observe the frequency response of the encoder).  
 A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec.  
 The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1414 mV (1.0 Vrms).  
 A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

**Remedy:**

- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range.
- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check the Sensor Module (e.g. contacts).
- if the coding disk is soiled or the lighting aged, replace the encoder.

**232418** <location>Encoder 2: Speed difference per sampling rate exceeded

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** For an HTL/TTL encoder, the speed difference between two sampling cycles has exceeded the value in p0492.  
 The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.  
 Alarm value (r2124, interpret decimal):  
 Only for internal Siemens troubleshooting.  
 See also: p0492

**Remedy:**

- check the tachometer feeder cable for interruptions.
- check the grounding of the tachometer shielding.
- if required, increase the setting of p0492.

### 232419 <location>Encoder 2: Track A or B outside tolerance

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The amplitude/phase/offset correction for track A or B is at the limit.  
 Amplitude error correction: Amplitude B / Amplitude A = 0.78 ... 1.27  
 Phase: <84 degrees or >96 degrees  
 SMC20: Offset correction: +/-140 mV  
 SMC10: Offset correction: +/-650 mV  
 Alarm value (r2124, interpret hexadecimal):  
 xxxx1: Minimum of the offset correction, track B  
 xxxx2: Maximum of the offset correction, track B  
 xxx1x: Minimum of the offset correction, track A  
 xxx2x: Maximum of the offset correction, track A  
 xx1xx: Minimum of the amplitude correction, track B/A  
 xx2xx: Maximum of the amplitude correction, track B/A  
 x1xxx: Minimum of the phase error correction  
 x2xxx: Maximum of the phase error correction  
 1xxxx: Minimum of the cubic correction  
 2xxxx: Maximum of the cubic correction

**Remedy:**

- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders).
- check the plug connections (also the transition resistance).
- check the encoder signals.
- replace the encoder or encoder cable

### 232421 <location>Encoder 2: Coarse position error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** For the actual value sensing, an error was detected. As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.  
 Alarm value (r2124, interpret decimal):  
 3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.

**Remedy:** Re alarm value = 3:  
 - For a standard encoder with cable, contact the manufacturer where relevant.  
 - correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A\* and B with B\*) or, for a programmable encoder, check the zero offset of the position.

**232422**                    **<location>Encoder 2: Pulses per revolution square-wave encoder outside tolerance bandwidth**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The measured zero mark distance does not correspond to the parameterized zero mark distance.  
                              This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684.  
                              The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder).  
                              Alarm value (r2124, interpret decimal):  
                              accumulated differential pulses in encoder pulses.  
**Remedy:**                - check that the encoder cables are routed in compliance with EMC.  
                              - check the plug connections  
                              . check the encoder type (encoder with equidistant zero marks).  
                              - adapt the parameter for the distance between zero marks (p0424, p0425).  
                              - replace the encoder or encoder cable

**232429**                    **<location>Encoder 2: Position difference, hall sensor/track C/D and A/B too large**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical.  
                              One period of track C/D corresponds to 360 ° mechanical.  
                              One period of the Hall signal corresponds to 360 ° electrical.  
                              The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
                              Alarm value (r2124, interpret decimal):  
                              For track C/D, the following applies:  
                              Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °).  
                              For Hall signals, the following applies:  
                              Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).  
**Remedy:**                - track C or D not connected.  
                              - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.  
                              - check that the encoder cables are routed in compliance with EMC.  
                              - check the adjustment of the Hall sensor.

**232431**                    **<location>Encoder 2: Deviation, position incremental/absolute too large**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                When the zero pulse is passed, a deviation in the incremental position was detected.  
                              For equidistant zero marks, the following applies:  
                              - The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.



For distance-coded zero marks, the following applies:

- the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.

Alarm value (r2124, interpret decimal):

Deviation in quadrants (1 pulse = 4 quadrants).

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- Clean coding disk or remove strong magnetic fields.

### 232432 <location>Encoder 2: Rotor position adaptation corrects deviation

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** For track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected.

Alarm value (r2124, interpret decimal):

Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse).

The sign designates the direction of motion when detecting the zero mark distance.

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check encoder limit frequency.
- adapt the parameter for the distance between zero marks (p0424, p0425).

### 232442 <location>Encoder 2: Battery voltage pre-alarm

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** When switched-off, the encoder uses a battery to back up the multiturn information. The battery voltage is no longer sufficient to check the multiturn information.

**Remedy:** Replace battery.

### 232443 <location>Encoder 2: Unipolar CD signal level outside specification

**Message value:** Fault cause: %1 bin

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The unipolar level (CP/CN or DP/DN) for encoder 2 is outside the permissible tolerance.

Alarm value (r2124, binary interpretation):

Bit 0 = 1: Either CP or CN outside the tolerance.

Bit 16 = 1: Either DP or DN outside the tolerance.

The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.

The response thresholds are < 1700 mV and > 3300 mV.

Note:

The signal level is not evaluated unless the following conditions are satisfied:

- Sensor Module properties available (r0459.31 = 1).

- Monitoring active (p0437.31 = 1).

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections and contacts of the encoder cable.
- are the C/D tracks connected correctly (have the signal lines CP and CN or DP and DN been interchanged)?
- replace the encoder cable.

---

**232460**                    **<location>Encoder 2: Analog sensor channel A failed**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The input voltage of the analog sensor is outside the permissible limits.  
Alarm value (r2124, interpret decimal):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside measuring range set in p4673.  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:**                Re alarm value = 1:  
- check the output voltage of the analog sensor.  
Re alarm value = 2:  
- check the voltage setting for each encoder period (p4673).  
Re alarm value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**232461**                    **<location>Encoder 2: Analog sensor channel B failed**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The input voltage of the analog sensor is outside the permissible limits.  
Alarm value (r2124, interpret decimal):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4675).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:**                Re alarm value = 1:  
- check the output voltage of the analog sensor.  
Re alarm value = 2:  
- check the voltage setting for each encoder period (p4675).  
Re alarm value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**232462**                    **<location>Encoder 2: Analog sensor, no channel active**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                Channel A and B are not activated for the analog sensor.  
**Remedy:**                - activate channel A and/or channel B (p4670).  
- check the encoder configuration (p0404.17).  
See also: p4670 (Analog sensor configuration)

---

**232463 <location>Encoder 2: Analog sensor position value exceeds limit value**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
Alarm value (r2124, interpret decimal):  
1: Position value from the LVDT sensor.  
2: Position value from the encoder characteristic.  
**Remedy:** Re alarm value = 1:  
- Check the LVDT ratio (p4678).  
- check the reference signal connection at track B.  
Re alarm value = 2:  
- check the coefficients of the characteristic (p4663 ... p4666).

---

**232470 <location>Encoder 2: Soiling detected**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of the alternative encoder system interface on the Sensor Module Cabinet 30 (SMC30), encoder soiling is signaled via a 0 signal at terminal X521.7.  
**Remedy:** - check the plug connections  
- replace the encoder or encoder cable

---

**232500 <location>Encoder 2: Position tracking traversing range exceeded**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions.  
For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421.  
For p0411.3 = 1, the maximum traversing range for the configured linear axis is pre-set (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).  
**Remedy:** The fault should be resolved as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and the absolute encoder adjusted.

---

**232501 <location>Encoder 2: Position tracking encoder position outside tolerance window**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY

**Cause:** When powered down, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder.  
Fault value (r0949, decimal interpretation):  
Deviation (difference) to the last encoder position in increments of the absolute value.  
The sign designates the traversing direction.  
Note:  
The deviation (difference) found is also displayed in r0477.  
See also: p0413 (Measuring gear, position tracking tolerance window), r0477 (Measuring gear, position difference)

**Remedy:** Reset the position tracking as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).  
See also: p0010, p2507

---

**232502**                    **<location>Encoder 2: Encoder with measuring gear, without valid signals**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The encoder with measuring gear no longer provides any valid signals.  
**Remedy:** It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.

---

**232503**                    **<location>Encoder 2: Position tracking cannot be reset**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The position tracking for the measuring gear cannot be reset.  
**Remedy:** The fault should be resolved as follows:  
- select encoder commissioning (p0010 = 4).  
- reset the position tracking as follows (p0411.2 = 1).  
- de-select encoder commissioning (p0010 = 0).  
The fault should then be acknowledged and the absolute encoder adjusted.

---

**232700**                    **<location>Encoder 2: Effectivity test does not supply the expected value**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
Fault value (r0949, interpret binary):  
Bit x = 1: Effectivity test x unsuccessful.  
**Remedy:** Replace encoder.

---

**232800 <location>Encoder 2: Group signal**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** NONE  
**Cause:** The motor encoder has detected at least one fault.  
**Remedy:** Evaluates other actual messages.

---

**232801 <location>Encoder 2 DRIVE-CLiQ: Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:** - check the electrical cabinet design and cable routing for EMC compliance  
 - replace the component involved.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**232802 <location>Encoder 2: Time slice overflow**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A time slice overflow has occurred in encoder 2.  
 Fault value (r0949, decimal interpretation):  
 9: Time slice overflow of the fast (current controller clock cycle) time slice.  
 10: Time slice overflow of the average time slice.  
 12: Time slice overflow of the slow time slice.  
 999: Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).  
**Remedy:** Reduce the current controller frequency.

---

**232804 <location>Encoder 2: Checksum error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A checksum error has occurred when reading-out the program memory on the Sensor Module.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex  
 yyyy: Memory area involved.  
 xxxx: Difference between the checksum at POWER ON and the actual checksum.  
**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
 - replace the Sensor Module.

**232805**                    **<location>Encoder 2: EPROM checksum error**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                Internal parameter data is corrupted.  
                             Fault value (r0949, interpret hexadecimal):  
                             01: EEPROM access error.  
                             02: Too many blocks in the EEPROM.  
**Remedy:**              Replace the module.

---

**232806**                    **<location>Encoder 2: Initialization error**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:**        PULSE INHIBIT  
**Cause:**                The encoder was not successfully initialized.  
                             Fault value (r0949, interpret hexadecimal):  
                             Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4).  
                             Bit 2: Mid-voltage matching for track A unsuccessful.  
                             Bit 3: Mid-voltage matching for track B unsuccessful.  
                             Bit 4: Mid-voltage matching for acceleration input unsuccessful.  
                             Bit 5: Mid-voltage matching for track safety A unsuccessful.  
                             Bit 6: Mid-voltage matching for track safety B unsuccessful.  
                             Bit 7: Mid-voltage matching for track C unsuccessful.  
                             Bit 8: Mid-voltage matching for track D unsuccessful.  
                             Bit 9: Mid-voltage matching for track R unsuccessful.  
                             Bit 10: The difference in mid-voltages between A and B is too great (> 0.5 V)  
                             Bit 11: The difference in mid-voltages between C and D is too great (> 0.5 V)  
                             Bit 12: The difference in mid-voltages between safety A and safety B is too great (> 0.5 V)  
                             Bit 13: The difference in mid-voltages between A and safety B is too great (> 0.5 V)  
                             Bit 14: The difference in mid-voltages between B and safety A is too great (> 0.5 V)  
                             Bit 15: The standard deviation of the calculated mid-voltages is too great (> 0.3 V)  
                             Bit 16: Internal fault - fault reading a register (CAFE)  
                             Bit 17: Internal fault - fault writing a register (CAFE)  
                             Bit 18: Internal fault: No mid-voltage matching available  
                             Bit 19: Internal error - ADC access error.  
                             Bit 20: Internal error - no zero crossover found.  
                             Note:  
                             Bit 0, 1: Up to 6SL3055-0AA00-5\*A0  
                             Bits 2 ... 20: 6SL3055-0AA00-5\*A1 and higher  
**Remedy:**              Acknowledge the fault.  
                             If the fault cannot be acknowledged:  
                             Bits 2 ... 9: Check encoder power supply.  
                             Bits 2 ... 14: Check the corresponding cable.  
                             Bit 15 with no other bits: Check track R, check settings in p0404.

---

<b>232811</b>	<b>&lt;location&gt;Encoder 2: Encoder serial number changed</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The encoder serial number has changed. The change is only checked for encoders with serial number (e.g. EnDat encoders). - The encoder was replaced. Note: With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2). When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1). Proceed as follows to hide serial number monitoring: - set the following serial numbers for the corresponding Encoder Data Set: p0441= FF, p0442 = 0, p0442 = 0, p0444 = 0, p0445 = 0.
<b>Remedy:</b>	Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.

---

<b>232812</b>	<b>&lt;location&gt;Encoder 2: Requested cycle or RX-/TX timing not supported</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A cycle requested from the Control Unit or RX/TX timing is not supported. Fault value (r0949, decimal interpretation): 0: Application cycle is not supported. 1: DRIVE-CLiQ cycle is not supported. 2: Distance between RX and TX instants in time too low. 3: TX instant in time too early.
<b>Remedy:</b>	POWER ON all components (switch the power off and then back on again).

---

<b>232813</b>	<b>&lt;location&gt;Encoder 2: Hardware logic unit failed</b>
<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	The DRIVE-CLiQ encoder fault word supplies fault bits that have been set. Fault value (r0949, interpret binary): Bit 0: ALU watchdog has responded. Bit 1: ALU has detected a sign-of-life error.
<b>Remedy:</b>	Replace encoder.

---

<b>232820</b>	<b>&lt;location&gt;Encoder 2 DRIVE-CLiQ: Telegram error</b>
<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 01 hex:  
 CRC error.  
 xx = 02 hex:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 03 hex:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 04 hex:  
 The length of the receive telegram does not match the receive list.  
 xx = 05 hex:  
 The type of the receive telegram does not match the receive list.  
 xx = 06 hex:  
 The address of the component in the telegram and in the receive list do not match.  
 xx = 07 hex:  
 A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
 xx = 08 hex:  
 No SYNC telegram is expected - but the received telegram is one.  
 xx = 09 hex:  
 The error bit in the receive telegram is set.  
 xx = 10 hex:  
 The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**232835**                    **<location>Encoder 2 DRIVE-CLiQ: Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 21 hex:  
 The cyclic telegram has not been received.  
 xx = 22 hex:  
 Timeout in the telegram receive list.  
 xx = 40 hex:  
 Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**232836**                    **<location>Encoder 2 DRIVE-CLiQ: Send error for DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY



**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

### 232837 <location>Encoder 2 DRIVE-CLiQ: Component fault

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

### 232845 <location>Encoder 2 DRIVE-CLiQ: Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

### 232850 <location>Encoder 2: Encoder evaluation, internal software error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** POWER ON

**Cause:** An internal software error has occurred in the Sensor Module of encoder 2.  
 Fault value (r0949, decimal interpretation):  
 1: Background time slice is blocked.  
 2: Checksum over the code memory is not OK.  
 10000: OEM memory of the EnDat encoder contains data that cannot be interpreted.  
 11000 ... 11499: Descriptive data from EEPROM incorrect.  
 11500 ... 11899: Calibration data from EEPROM incorrect.  
 11900 ... 11999: Configuration data from EEPROM incorrect.  
 16000: DRIVE-CLiQ encoder initialization application error.  
 16001: DRIVE-CLiQ encoder initialization ALU error.  
 16002: DRIVE-CLiQ encoder HISI / SISI initialization error.  
 16003: DRIVE-CLiQ encoder safety initialization error.  
 16004: DRIVE-CLiQ encoder internal system error.

**Remedy:**

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact the Hotline.

**232851 <location>Encoder 2 DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex = 10 dec:  
 The sign-of-life bit in the receive telegram is not set.

**Remedy:** Upgrade the firmware of the component involved.

**232860 <location>Encoder 2 DRIVE-CLiQ (CU): Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 CRC error and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 02 hex = 02 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 13 hex = 19 dec:  
 The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 03 hex = 03 dec:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 14 hex = 20 dec:  
 The length of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 04 hex = 04 dec:  
The length of the receive telegram does not match the receive list.

xx = 15 hex = 21 dec:  
The type of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 05 hex = 05 dec:  
The type of the receive telegram does not match the receive list.

xx = 16 hex = 22 dec:  
The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.

xx = 06 hex = 06 dec:  
The address of the power unit in the telegram and in the receive list do not match.

xx = 19 hex = 25 dec:  
The error bit in the receive telegram is set and the receive telegram is too early.

xx = 09 hex = 09 dec:  
The error bit in the receive telegram is set.

xx = 10 hex = 16 dec:  
The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 232885 <location>Encoder 2 DRIVE-CLiQ (CU): Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. The nodes do not send and receive in synchronism.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 1A hex = 26 dec:  
Sign-of-life bit in the receive telegram not set and the receive telegram is too early.

xx = 21 hex = 33 dec:  
The cyclic telegram has not been received.

xx = 22 hex = 34 dec:  
Timeout in the telegram receive list.

xx = 40 hex = 64 dec:  
Timeout in the telegram send list.

xx = 62 hex = 98 dec:  
Error at the transition to cyclic operation.

**Remedy:**

- check the power supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 232886 <location>Encoder 2 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

**232887** <location>Encoder 2 DRIVE-CLiQ (CU): Component fault

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 2). Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex:  
 Response received too late during runtime measurement.  
 xx = 61 hex:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**232895** <location>Encoder 2 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

**232896**                    **<location>Encoder 2 DRIVE-CLiQ (CU): Inconsistent component properties**

**Message value:**        Component number: %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The properties of the DRIVE-CLiQ component (Sensor Module for encoder 2), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.  
 Fault value (r0949, decimal interpretation):  
 Component number.

**Remedy:**                - carry out a POWER ON.  
 - when a component is replaced, the same component type and if possible the same firmware version should be used.  
 - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

---

**232899**                    **<location>Encoder 2: Unknown fault**

**Message value:**        New message: %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                A fault occurred on the Sensor Module for encoder 2 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Fault number.  
 Note:  
 If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

**Remedy:**                - replace the firmware on the Sensor Module by an older firmware version (r0148).  
 - upgrade the firmware on the Control Unit (r0018).

---

**232902**                    **<location>Encoder 2: SPI-BUS error occurred**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                Error when operating the internal SPI bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**                - replace the Sensor Module.  
 - if required, upgrade the firmware in the Sensor Module.  
 - contact the Hotline.

---

**232903**                    **<location>Encoder 2: I2C-BUS error occurred**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

---

**Cause:** Error when operating the internal I2C bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:** - replace the Sensor Module.  
 - if required, upgrade the firmware in the Sensor Module.  
 - contact the Hotline.

**232905** <location>Encoder 2: Parameterization error

**Message value:** Parameter: %1, supplementary information: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A parameter of encoder 2 was detected as being incorrect.  
 It is possible that the parameterized encoder type does not match the connected encoder.  
 The parameter involved can be determined as follows:  
 - determine the parameter number using the fault value (r0949).  
 - determine the parameter index (p0187).  
 Fault value (r0949, decimal interpretation):  
 yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter  
 yyyy = 0:  
 No information available.  
 yyyy = 1:  
 The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <-> -A/B (p0405.2 = 1).  
 yyyy = 2:  
 A code number for an identified encoder has been entered into p0400, however, no identification was carried out.  
 Please start a new encoder identification.  
 yyyy = 3:  
 A code number for an identified encoder has been entered into p0400, however, no identification was carried out.  
 Please select a listed encoder in p0400 with a code number < 10000.  
 yyyy = 4:  
 This component does not support SSI encoders (p0404.9 = 1) without track A/B.  
 yyyy = 5:  
 For SQW encoder, value in p4686 greater than in p0425.  
 yyyy = 6:  
 DRIVE-CLiQ encoder cannot be used with this firmware version.  
 yyyy = 7:  
 For the SQW encoder, the Xact1 correction (p0437.2) is only permitted with equidistant zero marks.  
 yyyy = 8:  
 The motor pole pair width is not supported by the linear scale being used.

**Remedy:** - check whether the connected encoder type matches the encoder that has been parameterized.  
 - correct the parameter specified by the fault value (r0949) and p0187.  
 - re parameter number = 314:  
 - check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ((r0313 \* p0433) / p0432 <= 1000).

**232915** <location>Encoder 2: Configuration error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The configuration for encoder 2 is incorrect.  
 Alarm value (r2124, interpret decimal):  
 1: Re-parameterization between fault/alarm is not permissible.  
 419: When the fine resolution Gx\_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.

**Remedy:** Re alarm value = 1:  
No re-parameterization between fault/alarm.  
Re alarm value = 419:  
Reduce the fine resolution (p0419).

### 232916 <location>Encoder 2: Parameterization fault

**Message value:** Parameter: %1, supplementary information: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A parameter of encoder 2 was detected as being incorrect.  
It is possible that the parameterized encoder type does not match the connected encoder.  
The parameter involved can be determined as follows:  
- determine the parameter number using the fault value (r0949).  
- determine the parameter index (p0187).  
Fault value (r0949, decimal interpretation):  
Parameter number.  
**Note:**  
This fault is only output for encoders where r0404.10 = 1 or r0404.11 = 1. It corresponds to A32905 with encoders where r0404.10 = 0 and r0404.11 = 0.  
**Remedy:** - check whether the connected encoder type matches the encoder that has been parameterized.  
- correct the parameter specified by the fault value (r0949) and p0187.

### 232920 <location>Encoder 2: Temperature sensor fault

**Message value:** Fault cause: %1, channel number: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
yyxx hex: yy: channel number, xx = fault cause  
xx = 1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
xx = 2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).  
xx = Additional values:  
Only for internal Siemens troubleshooting.  
**Remedy:** - check that the encoder cable is the correct type and is correctly connected.  
- check the temperature sensor selection in p0600 to p0603.  
- replace the Sensor Module (hardware defect or incorrect calibration data).

### 232940 <location>Sensor 2: Spindle clamping state error

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The spindle clamping state is incorrect.  
Fault value (r0949, decimal interpretation):  
Signal level from sensor S1.  
**Note:**  
A signal level of 500 mV corresponds to the numerical value 500 dec.

**Remedy:**

- Check the clamped tool.
- Check the tolerance and if required, adapt (p5040).
- Check the thresholds and if required, adapt (p5041).
- Check analog sensor S1 and connections.

See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

---

**232999 <location>Encoder 2: Unknown alarm**

**Message value:** New message: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A alarm has occurred on the Sensor Module for encoder 2 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Alarm number.  
 Note:  
 If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.  
**Remedy:**

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

---

**233100 <location>Encoder 3: Zero mark distance error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance. For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Fault value (r0949, decimal interpretation):  
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.  
**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- if message output above speed threshold, reduce filter time if necessary (p0438).
- replace the encoder or encoder cable

---

**233101 <location>Encoder 3: Zero mark failed**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The 1.5 x parameterized zero mark distance was exceeded.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Fault value (r0949, decimal interpretation):  
 Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).



- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
  - check the plug connections
  - check the encoder type (encoder with equidistant zero marks).
  - adapt the parameter for the clearance between zero marks (p0425).
  - if message output above speed threshold, reduce filter time if necessary (p0438).
  - when p0437.1 is active, check p4686.
  - replace the encoder or encoder cable

### 233103 <location>Encoder 3: Amplitude error, track R

- Message value:** R track: %1
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
- Acknowledge:** IMMEDIATELY
- Cause:** The amplitude of the reference track signal (track R) does not lie within the tolerance bandwidth for encoder 3. The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot.
- Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign)  
 The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV.  
 The response threshold for the differential signal level of the encoder is < -1600 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
- Note:  
 The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module.  
 The fault value can only be represented between -32767 ... 32767 dec (-770 ... 770 mV).  
 The signal level is not evaluated unless the following conditions are satisfied:
- Sensor Module properties available (r0459.31 = 1).
  - Monitoring active (p0437.31 = 1).
- Remedy:**
- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range
  - check that the encoder cables and shielding are routed in compliance with EMC.
  - check the plug connections and contacts of the encoder cable.
  - check whether the zero mark is connected and the signal cables RP and RN have been connected correctly
  - replace the encoder cable.
  - if the coding disk is soiled or the lighting aged, replace the encoder.

### 233110 <location>Encoder 3: Serial communications error

- Message value:** Fault cause: %1 bin
- Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR
- Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
- Acknowledge:** PULSE INHIBIT
- Cause:** Serial communication protocol transfer error between the encoder and evaluation module.
- Fault value (r0949, interpret binary):
- Bit 0: Alarm bit in the position protocol.
  - Bit 1: Incorrect quiescent level on the data line.
  - Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).
  - Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.
  - Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.
  - Bit 5: Internal error in the serial driver: An illegal mode command was requested.
  - Bit 6: Timeout when cyclically reading.
  - Bit 8: Protocol is too long (e.g. > 64 bits).
  - Bit 9: Receive buffer overflow.

Bit 10: Frame error when reading twice.  
 Bit 11: Parity error.  
 Bit 12: Data line signal level error during the monoflop time.  
 Bit 13: Data line incorrect.

**Remedy:**

Re fault value, bit 0 = 1:  
 - Enc defect F31111 may provide additional details.  
 Re fault value, bit 1 = 1:  
 - Incorrect encoder type / replace the encoder or encoder cable.  
 Re fault value, bit 2 = 1:  
 - Incorrect encoder type / replace the encoder or encoder cable.  
 Re fault value, bit 3 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable.  
 Re fault value, bit 4 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.  
 Re fault value, bit 5 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.  
 Re fault value, bit 6 = 1:  
 - Update Sensor Module firmware.  
 Re fault value, bit 8 = 1:  
 - Check parameterization (p0429.2).  
 Re fault value, bit 9 = 1:  
 - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module.  
 Re fault value, bit 10 = 1:  
 - Check parameterization (p0429.2, p0449).  
 Re fault value, bit 11 = 1:  
 - Check parameterization (p0436).  
 Re fault value, bit 12 = 1:  
 - Check parameterization (p0429.6).  
 Re fault value, bit 13 = 1:  
 - Check data line.

---

**233111**

**<location>Encoder 3: Absolute encoder EnDat, internal fault/error**

**Message value:**

Fault cause: %1 bin

**Drive object:**

SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**

OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:**

PULSE INHIBIT

**Cause:**

The EnDat encoder fault word supplies fault bits that have been set.

Fault value (r0949, interpret binary):

Bit 0: Lighting system failed.  
 Bit 1: Signal amplitude too low.  
 Bit 2: Position value incorrect.  
 Bit 3: Encoder power supply overvoltage condition.  
 Bit 4: Encoder power supply undervoltage condition.  
 Bit 5: Encoder power supply overcurrent condition.  
 Bit 6: The battery must be changed.

**Remedy:**

Re fault value, bit 0 = 1:  
 Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.  
 Re fault value, bit 1 = 1:  
 Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.  
 Re fault value, bit 2 = 1:  
 Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.  
 Re fault value, bit 3 = 1:  
 5 V power supply voltage fault.  
 When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.  
 When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor.

Re fault value, bit 4 = 1:  
 5 V power supply voltage fault.  
 When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.  
 When using a motor with DRIVE-CLiQ: Replace the motor.  
 Re fault value, bit 5 = 1:  
 Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.  
 Re fault value, bit 6 = 1:  
 The battery must be changed (only for encoders with battery back-up).

---

### 233112 <location>Encoder 3: Error bit set in the serial protocol

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder sends a set error bit via the serial protocol.  
 Fault value (r0949, interpret binary):  
 Bit 0: Fault bit in the position protocol.  
**Remedy:** For fault value, bit 0 = 1:  
 In the case of an EnDat encoder, F31111 may provide further details.

---

### 233115 <location>Encoder 3: Amplitude error track A or B ( $A^2 + B^2$ )

**Message value:** A track: %1, B-track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude (root of  $A^2 + B^2$ ) for encoder 3 exceeds the permissible tolerance.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV  $-25/+20$  %).  
 The response thresholds are  $< 230$  mV (observe the frequency response of the encoder) and  $> 750$  mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note for sensors modules for resolvers (e. g. SMC10):  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response thresholds are  $< 1070$  mV and  $> 3582$  mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
 Note:  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.  
**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check the Sensor Module (e.g. contacts).

 The following applies to measuring systems without their own bearing system:
 

- adjust the scanning head and check the bearing system of the measuring wheel.

 The following applies for measuring systems with their own bearing system:
 

- ensure that the encoder housing is not subject to any axial force.

---

<b>233116</b>	<b>&lt;location&gt;Encoder 3: Amplitude error monitoring track A + B</b>
<b>Message value:</b>	Amplitude: %1, Angle: %2
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The amplitude of the rectified encoder signals A and B and the amplitude from the roots of <math>A^2 + B^2</math> for encoder 3 are not within the tolerance bandwidth.</p> <p>Fault value (r0949, interpret hexadecimal):          yyyyxxxx hex:          yyyy = Signal level, track B (16 bits with sign).          xxxx = Signal level, track A (16 bits with sign).</p> <p>The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).          The response thresholds are &lt; 176 mV (observe the frequency response of the encoder) and &gt; 955 mV.          A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.</p> <p>Note:          The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check that the encoder cables and shielding are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>- replace the encoder or encoder cable</li> <li>- check the Sensor Module (e.g. contacts).</li> </ul>

---

<b>233117</b>	<b>&lt;location&gt;Encoder 3: Inversion error signals A/B/R</b>
<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>For a square-wave encoder (bipolar, double ended) signals A*, B* and R* are not inverted with respect to signals A, B and R.</p> <p>Fault value (r0949, interpret binary):          Bits 0 ... 15: Only for internal Siemens troubleshooting.          Bit 16: Error track A.          Bit 17: Error track B.          Bit 18: Error track R.</p> <p>Note:          For SMC30 (order no.. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), CUA32, and CU310, the following applies:          A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- Check the encoder/cable.</li> <li>- Does the encoder supply signals and the associated inverted signals?</li> </ul> <p>Note:          For SMC30 (order no. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1 only), the following applies:          - check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520).          For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30) or X23 (CUA32, CU310):</p> <ul style="list-style-type: none"> <li>- pin 10 (reference signal R) &lt;--&gt; pin 7 (encoder power supply, ground)</li> <li>- pin 11 (reference signal R inverted) &lt;--&gt; pin 4 (encoder power supply)</li> </ul>

---

<b>233118</b>	<b>&lt;location&gt;Encoder 3: Speed difference outside the tolerance range</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	For an HTL/TTL encoder, the speed difference has exceeded the value in p0492 over several sampling cycles. The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time. Fault value (r0949, decimal interpretation): Only for internal Siemens troubleshooting. See also: p0492
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the tachometer feeder cable for interruptions.</li> <li>- check the grounding of the tachometer shielding.</li> <li>- if required, increase the maximum speed difference per sampling cycle (p0492).</li> </ul>

---

<b>233120</b>	<b>&lt;location&gt;Encoder 3: Power supply voltage fault</b>
<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>A power supply fault was detected for encoder 3.</p> <p>Fault value (r0949, interpret binary):</p> <p>Bit 0: Undervoltage condition on the sense line.</p> <p>Bit 1: Overcurrent condition for the encoder power supply.</p> <p>Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative.</p> <p>Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive.</p> <p>Note:</p> <p>If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed.</p>
<b>Remedy:</b>	<p>Re fault value, bit 0 = 1:</p> <ul style="list-style-type: none"> <li>- correct encoder cable connected?</li> <li>- check the plug connections of the encoder cable.</li> <li>- SMC30: Check the parameterization (p0404.22).</li> </ul> <p>Re fault value, bit 1 = 1:</p> <ul style="list-style-type: none"> <li>- correct encoder cable connected?</li> <li>- replace the encoder or encoder cable</li> </ul> <p>Re fault value, bit 2 = 1:</p> <ul style="list-style-type: none"> <li>- correct encoder cable connected?</li> <li>- replace the encoder or encoder cable</li> </ul> <p>Re fault value, bit 3 = 1:</p> <ul style="list-style-type: none"> <li>- correct encoder cable connected?</li> <li>- replace the encoder or encoder cable</li> </ul>

---

<b>233121</b>	<b>&lt;location&gt;Encoder 3: Coarse position error</b>
<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	For the actual value sensing, an error was detected on the module. As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.
<b>Remedy:</b>	Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

---

**233122 <location>Encoder 3: Internal power supply voltage faulty**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault in internal reference voltage of ASICs for encoder 3.  
 Fault value (r0949, decimal interpretation):  
 1: Reference voltage error.  
 2: Internal undervoltage.  
 3: Internal overvoltage.  
**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

---

**233123 <location>Encoder 3: Signal level A/B unipolar outside tolerance**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The unipolar level (AP/AN or BP/BN) for encoder 3 is outside the permissible tolerance.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Either AP or AN outside the tolerance.  
 Bit 16 = 1: Either BP or BN outside the tolerance.  
 The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.  
 The response thresholds are < 1700 mV and > 3300 mV.  
**Note:**  
 The signal level is not evaluated unless the following conditions are satisfied:  
 - Sensor Module properties available (r0459.31 = 1).  
 - Monitoring active (p0437.31 = 1).  
**Remedy:**  
 - make sure that the encoder cables and shielding are installed in an EMC-compliant manner.  
 - check the plug connections and contacts of the encoder cable.  
 - check the short-circuit of a signal cable with mass or the operating voltage.  
 - replace the encoder cable.

---

**233125 <location>Encoder 3: Amplitude error track A or B overcontrolled**

**Message value:** A track: %1, B-track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude of track A or B for encoder 3 exceeds the permissible tolerance band.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Signal level, track B (16 bits with sign).  
 xxxx = Signal level, track A (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response threshold is > 750 mV. This fault also occurs if the A/D converter is overcontrolled.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
**Note for sensors modules for resolvers (e. g. SMC10):**  
 The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is > 3582 mV.  
 A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.  
**Note:**  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable

### 233126 <location>Encoder 3: Amplitude AB too high

**Message value:** Amplitude: %1, Angle: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The amplitude (root of  $A^2 + B^2$  or  $|A| + |B|$ ) for encoder 3 exceeds the permissible tolerance.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex:  
 yyyy = Angle  
 xxxx = Amplitude, i.e. root from  $A^2 + B^2$  (16 bits without sign)  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV  $-25/+20$  %).  
 The response threshold for  $(|A| + |B|)$  is  $> 1120$  mV or the root of  $(A^2 + B^2) > 955$  mV.  
 A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec.  
 The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  
**Note:**  
 The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable

### 233129 <location>Encoder 3: Position difference, hall sensor/track C/D and A/B too large

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The error for track C/D is greater than  $\pm 15^\circ$  mechanical or  $\pm 60^\circ$  electrical or the error for the Hall signals is greater than  $\pm 60^\circ$  electrical.  
 One period of track C/D corresponds to  $360^\circ$  mechanical.  
 One period of the Hall signal corresponds to  $360^\circ$  electrical.  
 The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
 After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A33429.  
 Fault value (r0949, decimal interpretation):  
 For track C/D, the following applies:  
 Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to  $1^\circ$ ).  
 For Hall signals, the following applies:  
 Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to  $1^\circ$ ).

**Remedy:**

- track C or D not connected.
- correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.
- check that the encoder cables are routed in compliance with EMC.
- check the adjustment of the Hall sensor.

**233130**                    **<location>Encoder 3: Zero mark and position error from the coarse synchronization**

**Message value:**        Angular deviation, electrical: %1, angle, mechanical: %2

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:**         PULSE INHIBIT

**Cause:**                 After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out.  
 When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of +/-18 ° mechanical.  
 When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of +/-60 ° electrical.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex  
 yyyy: Determined mechanical zero mark position (can only be used for track C/D).  
 xxxx: Deviation of the zero mark from the expected position as electrical angle.  
 Scaling: 32768 dec = 180 °

**Remedy:**                - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - if the Hall sensor is used as an equivalent for track C/D, check the connection.  
 - Check the connection of track C or D.  
 - replace the encoder or encoder cable

**233131**                    **<location>Encoder 3: Deviation, position incremental/absolute too large**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**              OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:**         PULSE INHIBIT

**Cause:**                 Absolute encoder:  
 When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected.  
 Limit value for the deviation:  
 - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 > 2 quadrants, EQN 1325 > 50 quadrants).  
 - other encoders: 15 pulses = 60 quadrants.  
 Incremental encoder:  
 When the zero pulse is passed, a deviation in the incremental position was detected.  
 For equidistant zero marks, the following applies:  
 - The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.  
 For distance-coded zero marks, the following applies:  
 - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.  
 Fault value (r0949, decimal interpretation):  
 Deviation in quadrants (1 pulse = 4 quadrants).

**Remedy:**                - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - replace the encoder or encoder cable  
 - check whether the coding disk is dirty or there are strong ambient magnetic fields.  
 - adapt the parameter for the clearance between zero marks (p0425).  
 - if message output above speed threshold, reduce filter time if necessary (p0438).



**233135 <location>Encoder 3: Fault when determining the position**

<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.</p> <p>Fault value (r0949, interpret binary):</p> <ul style="list-style-type: none"> <li>Bit 0: F1 (safety status display)</li> <li>Bit 1: F2 (safety status display)</li> <li>Bit 2: Lighting (reserved)</li> <li>Bit 3: Signal amplitude (reserved)</li> <li>Bit 4: Position value (reserved)</li> <li>Bit 5: Overvoltage (reserved)</li> <li>Bit 6: Undervoltage (reserved)</li> <li>Bit 7: Overcurrent (reserved)</li> <li>Bit 8: Battery (reserved)</li> <li>Bit 16: Lighting (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 17: Signal amplitude (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 18: Singleturn position 1 (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 19: Overvoltage (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 20: Undervoltage (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 21: Overcurrent (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 22: Temperature exceeded (--&gt; F3x405, x = 1, 2, 3)</li> <li>Bit 23: Singleturn position 2 (safety status display)</li> <li>Bit 24: Singleturn system (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 25: Singleturn power down (--&gt; F3x135, x = 1, 2, 3)</li> <li>Bit 26: Multiturn position 1 (--&gt; F3x136, x = 1, 2, 3)</li> <li>Bit 27: Multiturn position 2 (--&gt; F3x136, x = 1, 2, 3)</li> <li>Bit 28: Multiturn system (--&gt; F3x136, x = 1, 2, 3)</li> <li>Bit 29: Multiturn power down (--&gt; F3x136, x = 1, 2, 3)</li> <li>Bit 30: Multiturn overflow/underflow (--&gt; F3x136, x = 1, 2, 3)</li> <li>Bit 31: Multiturn battery (reserved)</li> </ul>
<b>Remedy:</b>	Replace DRIVE-CLiQ encoder.

**233136 <location>Encoder 3: Error when determining multiturn information**

<b>Message value:</b>	Fault cause: %1 bin
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The DRIVE-CLiQ encoder supplies status information via bits in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value.</p> <p>Fault value (r0949, interpret binary):</p> <ul style="list-style-type: none"> <li>Bit 0: F1 (safety status display)</li> <li>Bit 1: F2 (safety status display)</li> <li>Bit 2: Lighting (reserved)</li> <li>Bit 3: Signal amplitude (reserved)</li> <li>Bit 4: Position value (reserved)</li> <li>Bit 5: Overvoltage (reserved)</li> <li>Bit 6: Undervoltage (reserved)</li> <li>Bit 7: Overcurrent (reserved)</li> <li>Bit 8: Battery (reserved)</li> </ul>

- Bit 16: Lighting (--> F3x135, x = 1, 2, 3)
- Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3)
- Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3)
- Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3)
- Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3)
- Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3)
- Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3)
- Bit 23: Singleturn position 2 (safety status display)
- Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3)
- Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3)
- Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3)
- Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3)
- Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3)
- Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3)
- Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3)
- Bit 31: Multiturn battery (reserved)

**Remedy:** Replace DRIVE-CLiQ encoder.

**233137 <location>Encoder 3: Internal fault when determining the position**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal Siemens troubleshooting.  
**Remedy:** Replace encoder.

**233138 <location>Encoder 3: Internal error when determining multiturn information**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Only for internal SIEMENS troubleshooting.  
**Remedy:** Replace encoder.

**233150 <location>Encoder 3: Initialization error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** Encoder functionality selected in p0404 is not operating correctly.  
 Fault value (r0949, interpret hexadecimal):  
 Encoder malfunction.  
 The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).  
**Remedy:**  
 - Check that p0404 is correctly set.  
 - check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.  
 - if relevant, note additional fault messages that describe the fault in detail.

---

**233151** <location>Encoder 3: Encoder speed for initialization AB too high

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The encoder speed is too high during while initializing the sensor.  
**Remedy:** Reduce the speed of the encoder accordingly during initialization.  
If necessary, de-activate monitoring (p0437.29).  
See also: p0437 (Sensor Module configuration extended)

---

**233160** <location>Encoder 3: Analog sensor channel A failed

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Fault value (r0949, decimal interpretation):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4673).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:** For fault value = 1:  
- check the output voltage of the analog sensor.  
For fault value = 2:  
- check the voltage setting for each encoder period (p4673).  
For fault value = 3:  
- check the range limit setting and increase it if necessary (p4676).

---

**233161** <location>Encoder 3: Analog sensor channel B failed

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
Fault value (r0949, decimal interpretation):  
1: Input voltage outside detectable measuring range.  
2: Input voltage outside the measuring range set in (p4675).  
3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:** For fault value = 1:  
- check the output voltage of the analog sensor.  
For fault value = 2:  
- check the voltage setting for each encoder period (p4675).  
For fault value = 3:  
- check the range limit setting and increase it if necessary (p4676).

**233163 <location>Encoder 3: Analog sensor position value exceeds limit value**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
 Fault value (r0949, decimal interpretation):  
 1: Position value from the LVDT sensor.  
 2: Position value from the encoder characteristic.  
**Remedy:** For fault value = 1:  
 - Check the LVDT ratio (p4678).  
 - check the reference signal connection at track B.  
 For fault value = 2:  
 - check the coefficients of the characteristic (p4663 ... p4666).

---

**233400 <location>Encoder 3: Alarm threshold zero mark distance error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance.  
 For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 . check the encoder type (encoder with equidistant zero marks).  
 - adapt the parameter for the distance between zero marks (p0424, p0425).  
 - replace the encoder or encoder cable

---

**233401 <location>Encoder 3: Alarm threshold zero mark failed**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The 1.5 x parameterized zero mark distance was exceeded.  
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).  
 Alarm value (r2124, interpret decimal):  
 Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).  
**Remedy:**  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 . check the encoder type (encoder with equidistant zero marks).  
 - adapt the parameter for the clearance between zero marks (p0425).  
 - replace the encoder or encoder cable

---

**233405 <location>Encoder 3: Temperature in the encoder evaluation inadmissible**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** ENCODER (IASC/DCBRAKE, NONE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The encoder evaluation for a motor with DRIVE-CLiQ has detected an inadmissible temperature.  
The fault threshold is 125 °C.  
Alarm value (r2124, interpret decimal):  
Measured board/module temperature in 0.1 °C.  
**Remedy:** Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

---

**233407 <location>Encoder 3: Function limit reached**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder has reached one of its function limits. A service is recommended.  
Alarm value (r2124, interpret decimal):  
1 : Incremental signals  
3 : Absolute track  
4 : Code connection  
**Remedy:** Perform service. Replace the encoder if necessary.  
Note:  
The current functional reserve of an encoder can be displayed via r4651.  
See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

---

**233410 <location>Encoder 3: Serial communications**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Serial communication protocol transfer error between the encoder and evaluation module.  
Alarm value (r2124, binary interpretation):  
Bit 0: Alarm bit in the position protocol.  
Bit 1: Incorrect quiescent level on the data line.  
Bit 2: Encoder does not respond (does not supply a start bit within 50 ms).  
Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data.  
Bit 4: Encoder acknowledgement error: The encoder incorrectly understood the task (request) or cannot execute it.  
Bit 5: Internal error in the serial driver: An illegal mode command was requested.  
Bit 6: Timeout when cyclically reading.  
Bit 8: Protocol is too long (e.g. > 64 bits).  
Bit 9: Receive buffer overflow.  
Bit 10: Frame error when reading twice.  
Bit 11: Parity error.  
Bit 12: Data line signal level error during the monoflop time.  
**Remedy:** - check that the encoder cables are routed in compliance with EMC.  
- check the plug connections  
- replace the encoder.

**233411 <location>Encoder 3: EnDat encoder signals alarms**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The error word of the EnDat encoder has alarm bits that have been set.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Frequency exceeded (speed too high).  
 Bit 1: Temperature exceeded.  
 Bit 2: Control reserve, lighting system exceeded.  
 Bit 3: Battery discharged.  
 Bit 4: Reference point passed.  
**Remedy:** Replace encoder.

---

**233412 <location>Encoder 3: Error bit set in the serial protocol**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The encoder sends a set error bit via the serial protocol.  
 Alarm value (r2124, binary interpretation):  
 Bit 0: Fault bit in the position protocol.  
 Bit 1: Alarm bit in the position protocol.  
**Remedy:** - carry out a POWER ON (power off/on) for all components.  
 - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - replace the encoder.

---

**233414 <location>Encoder 3: Amplitude error track C or D (C<sup>2</sup> + D<sup>2</sup>)**

**Message value:** C track: %1, D track: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The amplitude (C<sup>2</sup> + D<sup>2</sup>) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.  
 Alarm value (r2124, interpret hexadecimal):  
 yyyyxxx hex:  
 yyyy = Signal level, track D (16 bits with sign).  
 xxxx = Signal level, track C (16 bits with sign).  
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).  
 The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.  
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.  
 Note:  
 If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.  
**Remedy:** - check that the encoder cables are routed in compliance with EMC.  
 - check the plug connections  
 - replace the encoder or encoder cable  
 - check the Sensor Module (e.g. contacts).  
 - check the Hall sensor box

---

<b>233415</b>	<b>&lt;location&gt;Encoder 3: Amplitude alarm track A or B (<math>A^2 + B^2</math>)</b>
<b>Message value:</b>	Amplitude: %1, Angle: %2
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>The amplitude (root of <math>A^2 + B^2</math>) for encoder 3 exceeds the permissible tolerance.  Alarm value (r2124, interpret hexadecimal):  yyyyxxxx hex:  yyyy = Angle  xxxx = Amplitude, i.e. root from <math>A^2 + B^2</math> (16 bits without sign)  The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV <math>-25/+20</math> %).  The response threshold is &lt; 300 mV (observe the frequency response of the encoder).  A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec.  The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is at the negative zero crossover of track B.  Note for sensors modules for resolvers (e. g. SMC10):  The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is &lt; 1414 mV (1.0 Vrms).  A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec.  Note:  The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range.</li> <li>- check that the encoder cables and shielding are routed in compliance with EMC.</li> <li>- check the plug connections</li> <li>- replace the encoder or encoder cable</li> <li>- check the Sensor Module (e.g. contacts).</li> <li>- if the coding disk is soiled or the lighting aged, replace the encoder.</li> </ul>

---

<b>233418</b>	<b>&lt;location&gt;Encoder 3: Speed difference per sampling rate exceeded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	<p>For an HTL/TTL encoder, the speed difference between two sampling cycles has exceeded the value in p0492.  The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.  Alarm value (r2124, interpret decimal):  Only for internal Siemens troubleshooting.  See also: p0492</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- check the tachometer feeder cable for interruptions.</li> <li>- check the grounding of the tachometer shielding.</li> <li>- if required, increase the setting of p0492.</li> </ul>

---

<b>233419</b>	<b>&lt;location&gt;Encoder 3: Track A or B outside tolerance</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE

**Cause:** The amplitude/phase/offset correction for track A or B is at the limit.  
 Amplitude error correction: Amplitude B / Amplitude A = 0.78 ... 1.27  
 Phase: <84 degrees or >96 degrees  
 SMC20: Offset correction: +/-140 mV  
 SMC10: Offset correction: +/-650 mV  
 Alarm value (r2124, interpret hexadecimal):  
 xxx1: Minimum of the offset correction, track B  
 xxx2: Maximum of the offset correction, track B  
 xxx1x: Minimum of the offset correction, track A  
 xxx2x: Maximum of the offset correction, track A  
 xx1xx: Minimum of the amplitude correction, track B/A  
 xx2xx: Maximum of the amplitude correction, track B/A  
 x1xxx: Minimum of the phase error correction  
 x2xxx: Maximum of the phase error correction  
 1xxxx: Minimum of the cubic correction  
 2xxxx: Maximum of the cubic correction

**Remedy:**

- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders).
- check the plug connections (also the transition resistance).
- check the encoder signals.
- replace the encoder or encoder cable

**233421 <location>Encoder 3: Coarse position error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** For the actual value sensing, an error was detected. As a result of this error, it must be assumed that the actual value sensing supplies an incorrect coarse position.  
 Alarm value (r2124, interpret decimal):  
 3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.

**Remedy:** Re alarm value = 3:

- For a standard encoder with cable, contact the manufacturer where relevant.
- correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A\* and B with B\*) or, for a programmable encoder, check the zero offset of the position.

**233422 <location>Encoder 3: Pulses per revolution square-wave encoder outside tolerance bandwidth**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The measured zero mark distance does not correspond to the parameterized zero mark distance.  
 This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684.  
 The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder).  
 Alarm value (r2124, interpret decimal):  
 accumulated differential pulses in encoder pulses.



**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- replace the encoder or encoder cable

### 233429 <location>Encoder 3: Position difference, hall sensor/track C/D and A/B too large

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical.  
 One period of track C/D corresponds to 360 ° mechanical.  
 One period of the Hall signal corresponds to 360 ° electrical.  
 The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.  
 Alarm value (r2124, interpret decimal):  
 For track C/D, the following applies:  
 Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °).  
 For Hall signals, the following applies:  
 Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).

**Remedy:**

- track C or D not connected.
- correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.
- check that the encoder cables are routed in compliance with EMC.
- check the adjustment of the Hall sensor.

### 233431 <location>Encoder 3: Deviation, position incremental/absolute too large

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When the zero pulse is passed, a deviation in the incremental position was detected.  
 For equidistant zero marks, the following applies:  
 - The first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.  
 For distance-coded zero marks, the following applies:  
 - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.  
 Alarm value (r2124, interpret decimal):  
 Deviation in quadrants (1 pulse = 4 quadrants).

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- Clean coding disk or remove strong magnetic fields.

### 233432 <location>Encoder 3: Rotor position adaptation corrects deviation

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** For track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected.  
 Alarm value (r2124, interpret decimal):  
 Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse).  
 The sign designates the direction of motion when detecting the zero mark distance.

**Remedy:**

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections
- replace the encoder or encoder cable
- check encoder limit frequency.
- adapt the parameter for the distance between zero marks (p0424, p0425).

**233442 <location>Encoder 3: Battery voltage pre-alarm**

**Message value:** -

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** When switched-off, the encoder uses a battery to back up the multiturn information. The battery voltage is no longer sufficient to check the multiturn information.

**Remedy:** Replace battery.

**233443 <location>Encoder 3: Unipolar CD signal level outside specification**

**Message value:** Fault cause: %1 bin

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The unipolar level (CP/CN or DP/DN) for encoder 3 is outside the permissible tolerance.  
 Alarm value (r2124, binary interpretation):  
 Bit 0 = 1: Either CP or CN outside the tolerance.  
 Bit 16 = 1: Either DP or DN outside the tolerance.  
 The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.  
 The response thresholds are < 1700 mV and > 3300 mV.  
 Note:  
 The signal level is not evaluated unless the following conditions are satisfied:  
 - Sensor Module properties available (r0459.31 = 1).  
 - Monitoring active (p0437.31 = 1).

**Remedy:**

- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections and contacts of the encoder cable.
- are the C/D tracks connected correctly (have the signal lines CP and CN or DP and DN been interchanged)?
- replace the encoder cable.

**233460 <location>Encoder 3: Analog sensor channel A failed**

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
 Alarm value (r2124, interpret decimal):  
 1: Input voltage outside detectable measuring range.  
 2: Input voltage outside measuring range set in p4673.  
 3: The absolute value of the input voltage has exceeded the range limit (p4676).

**Remedy:** Re alarm value = 1:  
 - check the output voltage of the analog sensor.  
 Re alarm value = 2:  
 - check the voltage setting for each encoder period (p4673).  
 Re alarm value = 3:  
 - check the range limit setting and increase it if necessary (p4676).

### 233461 <location>Encoder 3: Analog sensor channel B failed

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The input voltage of the analog sensor is outside the permissible limits.  
 Alarm value (r2124, interpret decimal):  
 1: Input voltage outside detectable measuring range.  
 2: Input voltage outside the measuring range set in (p4675).  
 3: The absolute value of the input voltage has exceeded the range limit (p4676).  
**Remedy:** Re alarm value = 1:  
 - check the output voltage of the analog sensor.  
 Re alarm value = 2:  
 - check the voltage setting for each encoder period (p4675).  
 Re alarm value = 3:  
 - check the range limit setting and increase it if necessary (p4676).

### 233462 <location>Encoder 3: Analog sensor, no channel active

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Channel A and B are not activated for the analog sensor.  
**Remedy:** - activate channel A and/or channel B (p4670).  
 - check the encoder configuration (p0404.17).  
 See also: p4670 (Analog sensor configuration)

### 233463 <location>Encoder 3: Analog sensor position value exceeds limit value

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The position value has exceeded the permissible range of -0.5 ... +0.5.  
 Alarm value (r2124, interpret decimal):  
 1: Position value from the LVDT sensor.  
 2: Position value from the encoder characteristic.  
**Remedy:** Re alarm value = 1:  
 - Check the LVDT ratio (p4678).  
 - check the reference signal connection at track B.  
 Re alarm value = 2:  
 - check the coefficients of the characteristic (p4663 ... p4666).

---

**233470**                    **<location>Encoder 3: Soiling detected**

**Message value:**            -  
**Drive object:**            SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**                NONE  
**Acknowledge:**            NONE  
**Cause:**                    In the case of the alternative encoder system interface on the Sensor Module Cabinet 30 (SMC30), encoder soiling is signaled via a 0 signal at terminal X521.7.  
**Remedy:**                    - check the plug connections  
                                   - replace the encoder or encoder cable

---

**233500**                    **<location>Encoder 3: Position tracking traversing range exceeded**

**Message value:**            -  
**Drive object:**            SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**                OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:**            IMMEDIATELY  
**Cause:**                    For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions. For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421. For p0411.3 = 1, the maximum traversing range for the configured linear axis is pre-set (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).  
**Remedy:**                    The fault should be resolved as follows:  
                                   - select encoder commissioning (p0010 = 4).  
                                   - reset the position tracking as follows (p0411.2 = 1).  
                                   - de-select encoder commissioning (p0010 = 0).  
                                   The fault should then be acknowledged and the absolute encoder adjusted.

---

**233501**                    **<location>Encoder 3: Position tracking encoder position outside tolerance window**

**Message value:**            %1  
**Drive object:**            SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**                OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:**            IMMEDIATELY  
**Cause:**                    When powered down, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder. Fault value (r0949, decimal interpretation): Deviation (difference) to the last encoder position in increments of the absolute value. The sign designates the traversing direction.  
**Note:**  
                                   The deviation (difference) found is also displayed in r0477.  
                                   See also: p0413 (Measuring gear, position tracking tolerance window), r0477 (Measuring gear, position difference)  
**Remedy:**                    Reset the position tracking as follows:  
                                   - select encoder commissioning (p0010 = 4).  
                                   - reset the position tracking as follows (p0411.2 = 1).  
                                   - de-select encoder commissioning (p0010 = 0).  
                                   The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).  
                                   See also: p0010, p2507

---

**233502**            **<location>Encoder 3: Encoder with measuring gear, without valid signals**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The encoder with measuring gear no longer provides any valid signals.

**Remedy:**              It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.

---

**233503**            **<location>Encoder 3: Position tracking cannot be reset**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (NONE, OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:**                The position tracking for the measuring gear cannot be reset.

**Remedy:**              The fault should be resolved as follows:

- select encoder commissioning (p0010 = 4).
- reset the position tracking as follows (p0411.2 = 1).
- de-select encoder commissioning (p0010 = 0).

The fault should then be acknowledged and the absolute encoder adjusted.

---

**233700**            **<location>Encoder 3: Effectivity test does not supply the expected value**

**Message value:**        Fault cause: %1 bin

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
Fault value (r0949, interpret binary):  
Bit x = 1: Effectivity test x unsuccessful.

**Remedy:**              Replace encoder.

---

**233800**            **<location>Encoder 3: Group signal**

**Message value:**        -

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:**        NONE

**Cause:**                The motor encoder has detected at least one fault.

**Remedy:**              Evaluate the other messages that are presently available.

---

**233801**            **<location>Encoder 3 DRIVE-CLiQ: Sign-of-life missing**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:**            OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

---

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex:  
 The sign-of-life bit in the receive telegram is not set.

**Remedy:** - check the electrical cabinet design and cable routing for EMC compliance  
 - replace the component involved.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**233802 <location>Encoder 3: Time slice overflow**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A time slice overflow has occurred in encoder 3.  
 Fault value (r0949, decimal interpretation):  
 9: Time slice overflow of the fast (current controller clock cycle) time slice.  
 10: Time slice overflow of the average time slice.  
 12: Time slice overflow of the slow time slice.  
 999: Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).

**Remedy:** Reduce the current controller frequency.

**233804 <location>Encoder 3: Checksum error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A checksum error has occurred when reading-out the program memory on the Sensor Module.  
 Fault value (r0949, interpret hexadecimal):  
 yyyyxxxx hex  
 yyyy: Memory area involved.  
 xxxx: Difference between the checksum at POWER ON and the actual checksum.

**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
 - replace the Sensor Module.

**233805 <location>Encoder 3: EPROM checksum error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Internal parameter data is corrupted.  
 Fault value (r0949, interpret hexadecimal):  
 01: EEPROM access error.  
 02: Too many blocks in the EEPROM.

**Remedy:** Replace the module.

**233806 <location>Encoder 3: Initialization error**

<b>Message value:</b>	%1
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	PULSE INHIBIT
<b>Cause:</b>	<p>The encoder was not successfully initialized.</p> <p>Fault value (r0949, interpret hexadecimal):</p> <p>Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4).</p> <p>Bit 2: Mid-voltage matching for track A unsuccessful.</p> <p>Bit 3: Mid-voltage matching for track B unsuccessful.</p> <p>Bit 4: Mid-voltage matching for acceleration input unsuccessful.</p> <p>Bit 5: Mid-voltage matching for track safety A unsuccessful.</p> <p>Bit 6: Mid-voltage matching for track safety B unsuccessful.</p> <p>Bit 7: Mid-voltage matching for track C unsuccessful.</p> <p>Bit 8: Mid-voltage matching for track D unsuccessful.</p> <p>Bit 9: Mid-voltage matching for track R unsuccessful.</p> <p>Bit 10: The difference in mid-voltages between A and B is too great (&gt; 0.5 V)</p> <p>Bit 11: The difference in mid-voltages between C and D is too great (&gt; 0.5 V)</p> <p>Bit 12: The difference in mid-voltages between safety A and safety B is too great (&gt; 0.5 V)</p> <p>Bit 13: The difference in mid-voltages between A and safety B is too great (&gt; 0.5 V)</p> <p>Bit 14: The difference in mid-voltages between B and safety A is too great (&gt; 0.5 V)</p> <p>Bit 15: The standard deviation of the calculated mid-voltages is too great (&gt; 0.3 V)</p> <p>Bit 16: Internal fault - fault reading a register (CAFE)</p> <p>Bit 17: Internal fault - fault writing a register (CAFE)</p> <p>Bit 18: Internal fault: No mid-voltage matching available</p> <p>Bit 19: Internal error - ADC access error.</p> <p>Bit 20: Internal error - no zero crossover found.</p> <p>Note:</p> <p>Bit 0, 1: Up to 6SL3055-0AA00-5*A0</p> <p>Bits 2 ... 20: 6SL3055-0AA00-5*A1 and higher</p>
<b>Remedy:</b>	<p>Acknowledge the fault.</p> <p>If the fault cannot be acknowledged:</p> <p>Bits 2 ... 9: Check encoder power supply.</p> <p>Bits 2 ... 14: Check the corresponding cable.</p> <p>Bit 15 with no other bits: Check track R, check settings in p0404.</p>

**233811 <location>Encoder 3: Encoder serial number changed**

<b>Message value:</b>	-
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>The encoder serial number has changed. The change is only checked for encoders with serial number (e.g. EnDat encoders).</p> <p>- The encoder was replaced.</p> <p>Note:</p> <p>With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2).</p> <p>When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1).</p> <p>Proceed as follows to hide serial number monitoring:</p> <p>- set the following serial numbers for the corresponding Encoder Data Set: p0441= FF, p0442 = 0, p0442 = 0, p0444 = 0, p0445 = 0.</p>
<b>Remedy:</b>	Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.

---

**233812 <location>Encoder 3: Requested cycle or RX-/TX timing not supported**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A cycle requested from the Control Unit or RX/TX timing is not supported.  
 Fault value (r0949, decimal interpretation):  
 0: Application cycle is not supported.  
 1: DRIVE-CLiQ cycle is not supported.  
 2: Distance between RX and TX instants in time too low.  
 3: TX instant in time too early.  
**Remedy:** POWER ON all components (switch the power off and then back on again).

---

**233813 <location>Encoder 3: Hardware logic unit failed**

**Message value:** Fault cause: %1 bin  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** PULSE INHIBIT  
**Cause:** The DRIVE-CLiQ encoder fault word supplies fault bits that have been set.  
 Fault value (r0949, interpret binary):  
 Bit 0: ALU watchdog has responded.  
 Bit 1: ALU has detected a sign-of-life error.  
**Remedy:** Replace encoder.

---

**233820 <location>Encoder 3 DRIVE-CLiQ: Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 01 hex:  
 CRC error.  
 xx = 02 hex:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 03 hex:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 04 hex:  
 The length of the receive telegram does not match the receive list.  
 xx = 05 hex:  
 The type of the receive telegram does not match the receive list.  
 xx = 06 hex:  
 The address of the component in the telegram and in the receive list do not match.  
 xx = 07 hex:  
 A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
 xx = 08 hex:  
 No SYNC telegram is expected - but the received telegram is one.  
 xx = 09 hex:  
 The error bit in the receive telegram is set.  
 xx = 10 hex:  
 The receive telegram is too early.



**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

### 233835 <location>Encoder 3 DRIVE-CLiQ: Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 21 hex:  
 The cyclic telegram has not been received.  
 xx = 22 hex:  
 Timeout in the telegram receive list.  
 xx = 40 hex:  
 Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

### 233836 <location>Encoder 3 DRIVE-CLiQ: Send error for DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

### 233837 <location>Encoder 3 DRIVE-CLiQ: Component fault

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.

xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**233845**                    **<location>Encoder 3 DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.  
                               Fault value (r0949, interpret hexadecimal):  
                               yyxx hex: yy = component number, xx = fault cause  
                               xx = 0B hex:  
                               Synchronization error during alternating cyclic data transfer.  
**Remedy:**                Carry out a POWER ON.  
                               See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**233850**                    **<location>Encoder 3: Encoder evaluation, internal software error**

**Message value:**        %1  
**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:**        POWER ON  
**Cause:**                An internal software error has occurred in the Sensor Module of encoder 3.  
                               Fault value (r0949, decimal interpretation):  
                               1: Background time slice is blocked.  
                               2: Checksum over the code memory is not OK.  
                               10000: OEM memory of the EnDat encoder contains data that cannot be interpreted.  
                               11000 ... 11499: Descriptive data from EEPROM incorrect.  
                               11500 ... 11899: Calibration data from EEPROM incorrect.  
                               11900 ... 11999: Configuration data from EEPROM incorrect.  
                               16000: DRIVE-CLiQ encoder initialization application error.  
                               16001: DRIVE-CLiQ encoder initialization ALU error.  
                               16002: DRIVE-CLiQ encoder HISI / SISI initialization error.  
                               16003: DRIVE-CLiQ encoder safety initialization error.  
                               16004: DRIVE-CLiQ encoder internal system error.  
**Remedy:**                - replace the Sensor Module.  
                               - if required, upgrade the firmware in the Sensor Module.  
                               - contact the Hotline.

**233851**                    **<location>Encoder 3 DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**         SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**             OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:**        IMMEDIATELY

---

<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 0A hex = 10 dec: The sign-of-life bit in the receive telegram is not set.
<b>Remedy:</b>	Upgrade the firmware of the component involved.

---

### 233860 <location>Encoder 3 DRIVE-CLiQ (CU): Telegram error

<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	SERVO, SERVO_SINUMERIK, VECTOR
<b>Reaction:</b>	OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 11 hex = 17 dec: CRC error and the receive telegram is too early. xx = 01 hex = 01 dec: Checksum error (CRC error). xx = 12 hex = 18 dec: The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. xx = 02 hex = 02 dec: Telegram is shorter than specified in the length byte or in the receive list. xx = 13 hex = 19 dec: The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. xx = 03 hex = 03 dec: Telegram is longer than specified in the length byte or in the receive list. xx = 14 hex = 20 dec: The length of the receive telegram does not match the receive list and the receive telegram is too early. xx = 04 hex = 04 dec: The length of the receive telegram does not match the receive list. xx = 15 hex = 21 dec: The type of the receive telegram does not match the receive list and the receive telegram is too early. xx = 05 hex = 05 dec: The type of the receive telegram does not match the receive list. xx = 16 hex = 22 dec: The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. xx = 06 hex = 06 dec: The address of the power unit in the telegram and in the receive list do not match. xx = 19 hex = 25 dec: The error bit in the receive telegram is set and the receive telegram is too early. xx = 09 hex = 09 dec: The error bit in the receive telegram is set. xx = 10 hex = 16 dec: The receive telegram is too early.
<b>Remedy:</b>	- carry out a POWER ON. - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

**233885 <location>Encoder 3 DRIVE-CLiQ (CU): Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 1A hex = 26 dec:  
 Sign-of-life bit in the receive telegram not set and the receive telegram is too early.  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.  
 xx = 62 hex = 98 dec:  
 Error at the transition to cyclic operation.  
**Remedy:** - check the power supply voltage of the component involved.  
 - carry out a POWER ON.  
 - replace the component involved.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

**233886 <location>Encoder 3 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.  
**Remedy:** Carry out a POWER ON.

---

**233887 <location>Encoder 3 DRIVE-CLiQ (CU): Component fault**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 3). Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.

xx = 42 hex:  
Send error: The telegram buffer memory contains an error.  
xx = 43 hex:  
Send error: The telegram buffer memory contains an error.  
xx = 60 hex:  
Response received too late during runtime measurement.  
xx = 61 hex:  
Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

### 233895 <location>Encoder 3 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.  
**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 233896 <location>Encoder 3 DRIVE-CLiQ (CU): Inconsistent component properties

**Message value:** Component number: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The properties of the DRIVE-CLiQ component (Sensor Module for encoder 3), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.  
 Fault value (r0949, decimal interpretation):  
 Component number.  
**Remedy:**

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

### 233899 <location>Encoder 3: Unknown fault

**Message value:** New message: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** A fault occurred on the Sensor Module for encoder 3 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Fault number.  
 Note:  
 If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

**Remedy:**

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

**233902 <location>Encoder 3: SPI-BUS error occurred**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when operating the internal SPI bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact the Hotline.

**233903 <location>Encoder 3: I2C-BUS error occurred**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error when operating the internal I2C bus.  
 Fault value (r0949, interpret hexadecimal):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact the Hotline.

**233905 <location>Encoder 3: Parameterization error**

**Message value:** Parameter: %1, supplementary information: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A parameter of encoder 3 was detected as being incorrect.  
 It is possible that the parameterized encoder type does not match the connected encoder.  
 The parameter involved can be determined as follows:  
 - determine the parameter number using the fault value (r0949).  
 - determine the parameter index (p0187).  
 Fault value (r0949, decimal interpretation):  
 yyyyxxx dec: yyyy = supplementary information, xxxx = parameter  
 yyyy = 0:  
 No information available.  
 yyyy = 1:  
 The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <> -A/B (p0405.2 = 1).

yyyy = 2:

A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please start a new encoder identification.

yyyy = 3:

A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please select a listed encoder in p0400 with a code number < 10000.

yyyy = 4:

This component does not support SSI encoders (p0404.9 = 1) without track A/B.

yyyy = 5:

For SQW encoder, value in p4686 greater than in p0425.

yyyy = 6:

DRIVE-CLiQ encoder cannot be used with this firmware version.

yyyy = 7:

For the SQW encoder, the Xact1 correction (p0437.2) is only permitted with equidistant zero marks.

yyyy = 8:

The motor pole pair width is not supported by the linear scale being used.

**Remedy:**

- check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.
- re parameter number = 314:
- check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ( $(r0313 * p0433) / p0432 \leq 1000$ ).

### 233915 <location>Encoder 3: Configuration error

**Message value:** %1

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The configuration for encoder 3 is incorrect.

Alarm value (r2124, interpret decimal):

1: Re-parameterization between fault/alarm is not permissible.

419: When the fine resolution Gx\_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.

**Remedy:**

- Re alarm value = 1:  
No re-parameterization between fault/alarm.
- Re alarm value = 419:  
Reduce the fine resolution (p0419).

### 233916 <location>Encoder 3: Parameterization fault

**Message value:** Parameter: %1, supplementary information: %2

**Drive object:** SERVO, SERVO\_SINUMERIK, VECTOR

**Reaction:** OFF1 (IASC/DCBRAKE, NONE, OFF2, OFF3, STOP1, STOP2)

**Acknowledge:** IMMEDIATELY

**Cause:** A parameter of encoder 3 was detected as being incorrect.

It is possible that the parameterized encoder type does not match the connected encoder.

The parameter involved can be determined as follows:

- determine the parameter number using the fault value (r0949).

- determine the parameter index (p0187).

Fault value (r0949, decimal interpretation):

Parameter number.

Note:

This fault is only output for encoders where  $r0404.10 = 1$  or  $r0404.11 = 1$ . It corresponds to A33905 with encoders where  $r0404.10 = 0$  and  $r0404.11 = 0$ .

**Remedy:**

- check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.

---

**233920**                    **<location>Encoder 3: Temperature sensor fault**

**Message value:**      Fault cause: %1, channel number: %2  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                When evaluating the temperature sensor, an error occurred.  
                           Alarm value (r2124, interpret decimal):  
                           yyxx hex: yy: channel number, xx = fault cause  
                           xx = 1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
                           xx = 2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).  
                           xx = Additional values:  
                           Only for internal Siemens troubleshooting.  
**Remedy:**                - check that the encoder cable is the correct type and is correctly connected.  
                           - check the temperature sensor selection in p0600 to p0603.  
                           - replace the Sensor Module (hardware defect or incorrect calibration data).

---

**233940**                    **<location>Sensor 3: Spindle clamping state error**

**Message value:**      %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                The spindle clamping state is incorrect.  
                           Fault value (r0949, decimal interpretation):  
                           Signal level from sensor S1.  
                           Note:  
                           A signal level of 500 mV corresponds to the numerical value 500 dec.  
**Remedy:**                - Check the clamped tool.  
                           - Check the tolerance and if required, adapt (p5040).  
                           - Check the thresholds and if required, adapt (p5041).  
                           - Check analog sensor S1 and connections.  
                           See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

---

**233999**                    **<location>Encoder 3: Unknown alarm**

**Message value:**      New message: %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK, VECTOR  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**                A alarm has occurred on the Sensor Module for encoder 3 that cannot be interpreted by the Control Unit firmware.  
                           This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
                           Alarm value (r2124, interpret decimal):  
                           Alarm number.  
                           Note:  
                           If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.  
**Remedy:**                - replace the firmware on the Sensor Module by an older firmware version (r0148).  
                           - upgrade the firmware on the Control Unit (r0018).



---

**234207**                    **<location>VSM: Temperature fault threshold exceeded**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            Infeed: OFF2 (NONE, OFF1)  
Vector: NONE

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                The temperature (r3666) measured using the Voltage Sensing Module (VSM) has exceeded the threshold value (p3668).  
Note:  
This fault can only be initiated if the temperature evaluation was activated (p3665 = 2 for a KTY sensor or p3665 = 1 for a PTC sensor).  
Fault value (r0949, decimal interpretation):  
yyxxxx dec:  
yy: Component number of the component which detected the fault.

**Remedy:**              - check the fan.  
- reduce the power.

---

**234211**                    **<location>VSM: Temperature alarm threshold exceeded**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                The temperature (r3666) measured using the Voltage Sensing Module (VSM) has exceeded the threshold value (p3667).  
Alarm value (r2124, interpret decimal):  
The hundred-thousands and ten-thousands position specifies the component number of the VSM which detected the fault.

**Remedy:**              - check the fan.  
- reduce the power.

---

**234800**                    **<location>VSM: Group signal**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:**        NONE

**Cause:**                The Voltage Sensing Module (VSM) has detected at least one fault.

**Remedy:**              Evaluates other actual messages.

---

**234801**                    **<location>VSM DRIVE-CLiQ: Sign-of-life missing**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:**        IMMEDIATELY

**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module (VSM).  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**

- check the DRIVE-CLiQ connection.
- replace the Voltage Sensing Module (VSM).

---

**234801 <location>VSM DRIVE-CLiQ: Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module (VSM).  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**

- check the DRIVE-CLiQ connection.
- replace the Terminal Module.

---

**234802 <location>VSM: Time slice overflow**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** A time slice overflow has occurred on the Voltage Sensing Module.

**Remedy:** Replace the Voltage Sensing Module.

---

**234803 <location>VSM: Memory test**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)

**Acknowledge:** IMMEDIATELY

**Cause:** An error has occurred during the memory test on the Voltage Sensing Module.

**Remedy:**

- check whether the permissible ambient temperature for the Voltage Sensing Module is being maintained.
- replace the Voltage Sensing Module.

---

**234804 <location>VSM: CRC**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A checksum error has occurred when reading-out the program memory on the Voltage Sensing Module (VSM).  
**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
- replace the Voltage Sensing Module.

---

**234805 <location>VSM: EPROM checksum error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Internal parameter data is corrupted.  
Fault value (r0949, interpret hexadecimal):  
01: EEPROM access error.  
02: Too many blocks in the EEPROM.  
**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
- replace the Voltage Sensing Module (VSM).

---

**234806 <location>VSM: Initialization**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2, OFF3)  
**Acknowledge:** IMMEDIATELY  
**Cause:** For the Voltage Sensing Module (VSM), a fault has occurred while initializing.  
**Remedy:** Replace the Voltage Sensing Module.

---

**234807 <location>VSM: Sequence control time monitoring**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Error, timeout in the sequence control on the Voltage Sensing Module (VSM).  
**Remedy:** Replace the Voltage Sensing Module.

**234820**                    **<location>VSM DRIVE-CLiQ: Telegram error**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:**            Infeed: OFF2 (NONE, OFF1)  
                               Vector: NONE (OFF1, OFF2)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module involved.  
                               Fault value (r0949, interpret hexadecimal):  
                               yyxx hex: yy = component number, xx = fault cause  
                               xx = 01 hex:  
                               CRC error.  
                               xx = 02 hex:  
                               Telegram is shorter than specified in the length byte or in the receive list.  
                               xx = 03 hex:  
                               Telegram is longer than specified in the length byte or in the receive list.  
                               xx = 04 hex:  
                               The length of the receive telegram does not match the receive list.  
                               xx = 05 hex:  
                               The type of the receive telegram does not match the receive list.  
                               xx = 06 hex:  
                               The address of the component in the telegram and in the receive list do not match.  
                               xx = 07 hex:  
                               A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
                               xx = 08 hex:  
                               No SYNC telegram is expected - but the received telegram is one.  
                               xx = 09 hex:  
                               The error bit in the receive telegram is set.  
                               xx = 10 hex:  
                               The receive telegram is too early.  
**Remedy:**                - carry out a POWER ON.  
                               - check the electrical cabinet design and cable routing for EMC compliance  
                               - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
                               See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**234835**                    **<location>VSM DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2  
**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:**            Infeed: OFF2 (NONE, OFF1)  
                               Vector: NONE (OFF1, OFF2)  
**Acknowledge:**        IMMEDIATELY  
**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module involved. The nodes do not send and receive in synchronism.  
                               Fault value (r0949, interpret hexadecimal):  
                               yyxx hex: yy = component number, xx = fault cause  
                               xx = 21 hex:  
                               The cyclic telegram has not been received.  
                               xx = 22 hex:  
                               Timeout in the telegram receive list.  
                               xx = 40 hex:  
                               Timeout in the telegram send list.  
**Remedy:**                - carry out a POWER ON.  
                               - replace the component involved.

---

**234836**                    **<location>VSM DRIVE-CLiQ: Send error for DRIVE-CLiQ data**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module. Data were not able to be sent.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 41 hex:  
Telegram type does not match send list.

**Remedy:**              Carry out a POWER ON.

---

**234837**                    **<location>VSM DRIVE-CLiQ: Component fault**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 20 hex:  
Error in the telegram header.  
xx = 23 hex:  
Receive error: The telegram buffer memory contains an error.  
xx = 42 hex:  
Send error: The telegram buffer memory contains an error.  
xx = 43 hex:  
Send error: The telegram buffer memory contains an error.

**Remedy:**              - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
- check the electrical cabinet design and cable routing for EMC compliance  
- if required, use another DRIVE-CLiQ socket (p9904).  
- replace the component involved.

---

**234845**                    **<location>VSM DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
Vector: NONE (OFF1, OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module (VSM).  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0B hex:  
Synchronization error during alternating cyclic data transfer.

**Remedy:**              Carry out a POWER ON.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**234850 <location>VSM: Internal software error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Vector: OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** POWER ON  
**Cause:** An internal software error in the Voltage Sensing Module (VSM) has occurred.  
 Fault value (r0949, decimal interpretation):  
 1: Background time slice is blocked.  
 2: Checksum over the code memory is not OK.  
**Remedy:**  
 - replace the Voltage Sensing Module (VSM).  
 - if required, upgrade the firmware in the Voltage Sensing Module.  
 - contact the Hotline.

---

**234851 <location>VSM DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: NONE (OFF1, OFF2)  
 Vector: NONE (OFF1, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.  
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex = 10 dec:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:** Upgrade the firmware of the component involved.

---

**234860 <location>VSM DRIVE-CLiQ (CU): Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
 Servo: NONE (OFF1, OFF2)  
 Vector: NONE (OFF1, OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 CRC error and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.

xx = 02 hex = 02 dec:  
Telegram is shorter than specified in the length byte or in the receive list.

xx = 13 hex = 19 dec:  
The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.

xx = 03 hex = 03 dec:  
Telegram is longer than specified in the length byte or in the receive list.

xx = 14 hex = 20 dec:  
The length of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 04 hex = 04 dec:  
The length of the receive telegram does not match the receive list.

xx = 15 hex = 21 dec:  
The type of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 05 hex = 05 dec:  
The type of the receive telegram does not match the receive list.

xx = 16 hex = 22 dec:  
The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.

xx = 06 hex = 06 dec:  
The address of the power unit in the telegram and in the receive list do not match.

xx = 19 hex = 25 dec:  
The error bit in the receive telegram is set and the receive telegram is too early.

xx = 09 hex = 09 dec:  
The error bit in the receive telegram is set.

xx = 10 hex = 16 dec:  
The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**234885****<location>VSM DRIVE-CLiQ (CU): Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Servo: NONE (OFF1, OFF2)  
Vector: NONE (OFF1, OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.  
The nodes do not send and receive in synchronism.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 1A hex = 26 dec:  
Sign-of-life bit in the receive telegram not set and the receive telegram is too early.  
xx = 21 hex = 33 dec:  
The cyclic telegram has not been received.  
xx = 22 hex = 34 dec:  
Timeout in the telegram receive list.  
xx = 40 hex = 64 dec:  
Timeout in the telegram send list.  
xx = 62 hex = 98 dec:  
Error at the transition to cyclic operation.

**Remedy:**

- check the power supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**234886**                    **<location>VSM DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
                              Servo: NONE (OFF1, OFF2)  
                              Vector: NONE (OFF1, OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.  
                              Data were not able to be sent.  
                              Fault value (r0949, interpret hexadecimal):  
                              yyxx hex: yy = component number, xx = fault cause  
                              xx = 41 hex:  
                              Telegram type does not match send list.

**Remedy:**              Carry out a POWER ON.

---

**234887**                    **<location>VSM DRIVE-CLiQ (CU): Component fault**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
                              Servo: NONE (OFF1, OFF2)  
                              Vector: NONE (OFF1, OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                Fault detected on the DRIVE-CLiQ component (Voltage Sensing Module) involved. Faulty hardware cannot be excluded.  
                              Fault value (r0949, interpret hexadecimal):  
                              yyxx hex: yy = component number, xx = fault cause  
                              xx = 20 hex:  
                              Error in the telegram header.  
                              xx = 23 hex:  
                              Receive error: The telegram buffer memory contains an error.  
                              xx = 42 hex:  
                              Send error: The telegram buffer memory contains an error.  
                              xx = 43 hex:  
                              Send error: The telegram buffer memory contains an error.  
                              xx = 60 hex:  
                              Response received too late during runtime measurement.  
                              xx = 61 hex:  
                              Time taken to exchange characteristic data too long.

**Remedy:**              - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
                              - check the electrical cabinet design and cable routing for EMC compliance  
                              - if required, use another DRIVE-CLiQ socket (p9904).  
                              - replace the component involved.



---

<b>234895</b>	<b>&lt;location&gt;VSM DRIVE-CLiQ (CU): Alternating cyclic data transfer error</b>
<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: NONE (OFF1, OFF2) Vector: NONE (OFF1, OFF2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = fault cause xx = 0B hex: Synchronization error during alternating cyclic data transfer.
<b>Remedy:</b>	Carry out a POWER ON. See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

<b>234896</b>	<b>&lt;location&gt;VSM DRIVE-CLiQ (CU): Inconsistent component properties</b>
<b>Message value:</b>	Component number: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2) Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The properties of the DRIVE-CLiQ component (Voltage Sensing Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, decimal interpretation): Component number.
<b>Remedy:</b>	- carry out a POWER ON. - when a component is replaced, the same component type and if possible the same firmware version should be used. - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

---

<b>234899</b>	<b>&lt;location&gt;VSM: Unknown fault</b>
<b>Message value:</b>	New message: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SIC_SINUMERIK, VECTOR
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Vector: NONE (OFF1, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	A fault occurred on the Voltage Sensing Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Fault value (r0949, decimal interpretation): Fault number. Note: If required, the significance of this new fault can be read about in a more recent description of the Control Unit.
<b>Remedy:</b>	- replace the firmware on the Voltage Sensing Module by an older firmware version (r0158). - upgrade the firmware on the Control Unit (r0018).

---

**234903**            **<location>VSM: I2C bus error occurred**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              An error has occurred when accessing the module-internal I2C bus.

**Remedy:**              Replace Voltage Sensing Module (VSM).

---

---

**234903**            **<location>VSM: I2C bus error occurred**

**Message value:**        -

**Drive object:**        VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              An error has occurred when accessing the module-internal I2C bus.

**Remedy:**              Replace the Terminal Module.

---

---

**234904**            **<location>VSM: EEPROM**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              An error has occurred accessing the non-volatile memory on the Terminal Module.

**Remedy:**              Replace Voltage Sensing Module (VSM).

---

---

**234905**            **<location>VSM: Parameter access**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**              The Control Unit attempted to write an illegal parameter value to the Voltage Sensing Module (VSM).

**Remedy:**              - check whether the firmware version of the VSM (r0158) matches the firmware version of Control Unit (r0018).  
- if required, replace the Voltage Sensing Module.

**Note:**  
The firmware versions that match each other are in the readme.txt file on the memory card.

---

---

**234920**            **<location>VSM: Temperature sensor fault**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

---

**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).

**Remedy:** - make sure that the sensor is connected correctly.  
- replace the sensor.

**234999 <location>VSM: Unknown alarm**

**Message value:** New message: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A fault occurred on the Voltage Sensing Module (VSM) an alarm has occurred that cannot be interpreted by the Control Unit firmware.  
This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
Alarm value (r2124, interpret decimal):  
Alarm number.  
Note:  
If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

**Remedy:** - replace the firmware on the Voltage Sensing Module by an older firmware version (r0148).  
- upgrade the firmware on the Control Unit (r0018).

**235000 <location>TM54F: Sampling time invalid**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** POWER ON  
**Cause:** The set sampling time is invalid.  
- not a multiple integer of the DP clock cycle.  
Fault value (r0949, floating point):  
Recommended valid sampling time.

**Remedy:** Adapt the sampling time (e.g. set the recommended valid sampling time).  
See also: p10000 (SI sampling time)

**235001 <location>TM54F: Parameter value invalid**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** The entered value is invalid.  
Fault value (r0949, decimal interpretation):  
Parameter number with the invalid value.

**Remedy:** Correct the parameter value.

**235002**                    **<location>TM54F: Commissioning not possible**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                The commissioning mode activation was rejected because the pulses had not been suppressed for at least one drive belonging to the TM54F.  
 Fault value (r0949, decimal interpretation):  
 Drive object number of the first drive found without pulse suppression.

**Remedy:**              Set pulse cancellation for the drive specified in the fault value.

---

**235003**                    **<location>TM54F: Acknowledgement on the Control Unit is required**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A fault on the Terminal Module 54F (TM54) was acknowledged using the safe acknowledgement (P10006).  
 An additional acknowledgement is also required at the Control Unit.

**Remedy:**              Acknowledge the fault at the Control Unit.

---

**235011**                    **<location>TM54F: Drive object number assignment illegal**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                A drive object number was assigned twice. Each drive object number can be assigned only once.

**Remedy:**              Correct the assignment of the drive object numbers.  
 See also: p10010 (SI drive object assignment)

---

**235012**                    **<location>TM54F: Test stop active**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The test stop for the Terminal Module 54F (TM54F) is presently being executed.  
 Note:  
 Fault F35013 is output if a fault occurs during the test stop.

**Remedy:**              The alarm disappears automatically after successfully ending or canceling (when a fault condition occurs) the test stop.

---

**235013****<location>TM54F: Test stop error**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** An error was detected when carrying out the test stop on the TM54F. Failsafe control signals (failsafe values) are transferred to the safety functions.  
 Fault value (r0949, interpret hexadecimal):  
 aaaabbcc hex:  
 aaaa: DO or F-DI (dependent on test step cc), where the expected state was not assumed (bit 0 = F-DI 0 or F-DO 0, bit 1 = F-DI 1 or F-DO 1, etc.).  
 bb: Fault cause  
 bb = 01 hex: Internal fault.  
 bb = 02 hex: Fault when comparing the switching signals of the two channels (F-DI or DI).  
 bb = 03 hex: Internal fault.  
 bb = 04 hex: Fault when comparing the switching signals of the two channels (Diag-DO).  
 cc: State of the test stop in which the fault has occurred.  
 The display format is as follows:  
 Slave fault state: (test actions)(test actions) | corresponding step for the master: (test actions)(test actions) | Description  
 00 hex: (L1+OFF)(L2+ON) | 0A hex: ( ) ( ) | Synchronization / switching step  
 0A hex: (L1+OFF)(L2+ON) | 15 hex: ( ) ( ) | Wait step  
 15 hex: (L1+OFF)(L2+OFF) | 20 hex: ( ) ( ) | 1.) F-DI 0 ... 4 check for 0 V 2.) Switch step to new level  
 20 hex: (L1+OFF)(L2+OFF) | 2B hex: ( ) ( ) | Wait step  
 2B hex: (L1+ON)(L2+ON) | 36 hex: ( ) ( ) | 1.) F-DI 5 ... 9 check for 0 V 2.) Switch step to new level  
 36 hex: (DO OFF)( ) | 41 hex: (DO OFF)( ) | Wait step / switching step  
 41 hex: (DO OFF)( ) | 4C hex: (DO OFF)( ) | Wait step  
 4C hex: (DO ON)( ) | 57 hex: (DO ON)( ) | 1.) Check diag-DO or diag-DI 2.) Switch step to new level  
 57 hex: (DO ON)( ) | 62 hex: (DO ON)( ) | Wait step  
 62 hex: (DO OFF)( ) | 6D hex: (DO ON)( ) | 1.) Check diag-DO or diag-DI 2.) Switch step  
 6D hex: (DO OFF)( ) | 78 hex: (DO ON)( ) | Wait step  
 78 hex: (DO ON)( ) | 83 hex: (DO OFF)( ) | 1.) Check diag-DO or diag-DI 2.) Switch step  
 83 hex: (DO ON)( ) | 8E hex: (DO OFF)( ) | Wait step  
 8E hex: (DO OFF)( ) | 99 hex: (DO OFF)( ) | 1.) Check diag-DO or diag-DI 2.) Switch step  
 99 hex: (DO OFF)( ) | A4 hex: (DO OFF)( ) | Wait step  
 A4 hex: (DO OFF)( ) | AF hex: (DO OFF)( ) | Check Diag-DO or Diag-DI  
 AF hex: (DO original state)( ) | C5 hex: (DO original state)( ) | Switching step  
 C5 hex: End of test  
 The expected states to be checked depend on the parameterized test mode (p10047).  
 The following expected states are tested in the test steps when testing the F-DOs:  
 The display format is as follows:  
 Test step (SL MA): Expected Diag-DO mode 1 | Expected DI 20 ... 23 mode 2 | Expected DI 20 ... 23 mode 3  
 (4C hex 57 hex): Diag-DO = 0 V | DI = 24 V | DI = 24 V  
 (62 hex 6D hex): Diag-DO = 0 V | DI = 0 V | DI = 0 V  
 (78 hex 83 hex): Diag-DO = 0 V | DI = 0 V | DI = 24 V  
 (8E hex 99 hex): Diag-DO = 24 V | DI = 0 V | DI = 24 V  
 (A4 hex AF hex): Diag-DO = 0 V | DI = 24 V | DI = 24 V  
 Example:  
 If an error with fault causes bb = 02 hex or 04 hex occurs in a test stop step, the test action for the fault took place in the previous test stop step. The expected states are tested in the next step.  
 Master signals fault value 0001\_04AF and slave signals fault value 0001\_04A4.  
 aaaa = 1 --> F-DO 0 is involved.  
 bb = 04 hex --> the test of the Diag-DO was unsuccessful.  
 cc = The expected states were tested in test stop step AF on the master and A4 on the slave.  
 The expected state Diag-DO = 0 V was checked in the table, i.e. Diag-DO was at 0 V instead of the expected 24 V.  
 The associated test action took place in the previous step (99 hex DO OFF, A4 hex DO OFF). Both DOs were switched to OFF.

**Remedy:** Check the wiring of the F-DIs and F-DOs and restart the test stop.  
 Note:  
 The fault is withdrawn if the test stop is successfully completed.  
 For fault value = CCCCCCCC hex, DDDDDDDD hex, EEEEEEEE hex the following applies:  
 These fault values occur together with fault F35152. In this case, all parameters for the test stop should be checked.  
 You should also check whether the firmware version of the TM54F matches that of the Control Unit.  
 You also need to check p10001, p10017, p10046 and p10047.  
 A POWER ON must be carried out after correcting the parameters.

**235014 <location>TM54F: Test stop required**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** - after powering up the drive, a test stop has still not been carried out.  
 - a new test stop is required after commissioning.  
 - the time to carry out the forced checking procedure (test stop) has expired (p10003).  
**Remedy:** Initiate test stop (BI: p10007).

**235015 <location>TM54F: Motor Module replaced or configuration inconsistent**

**Message value:** Fault cause: %1 bin  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Cyclic communication of at least one drive with the Terminal Module 54F (TM54F) is not active.  
 Possible causes:  
 - at least one Motor Module was replaced (e.g. hardware was replaced).  
 - The parameterization of the TM54F (p10010) is inconsistent with the number of axes, which have drive-based motion monitoring functions activated with TM54F.  
 - And activated drive has no communication via DRIVE-CLiQ.  
 Fault value (r0949, interpret binary):  
 yyyy yyyy xxxx xxxx bin  
 xxxx xxxx bin: inconsistent configuration  
 Bit 0 = 1: No communication with drive 1.  
 ...  
 Bit 5 = 1: No communication with drive 6.  
 yyyy yyyy bin: Motor Module replaced or a DRIVE-CLiQ cable of a Motor Module not inserted.  
 Bit 8 = 1: Motor Module from drive 1 was replaced or does not communicate.  
 ...  
 Bit 13 = 1: Motor Module from drive 6 was replaced or does not communicate.  
 Note:  
 When this fault is present, none of the drives listed in the fault value, which have drive-based motion monitoring functions operating with TM54F, are enabled.  
 For fault value = 0:  
 The number of drive objects specified in p10010 is not equal to the number of drives that have drive-based motion monitoring functions that have been enabled.  
 See also: p10010 (SI drive object assignment)

**Remedy:** For all drive objects specified in p10010, check whether the drive-based motion monitoring functions with TM54F are enabled (p9601).  
**Note:**  
 If a drive was deactivated and activated without first having established the DRIVE-CLiQ connection, then this alarm is also output.  
 When replacing a Motor Module, carry out the following steps:  
 - start the copy function for the node identifier on the TM54F (p9700 = 1D hex).  
 - acknowledge the hardware CRC on the TM54F (p9701 = EC hex).  
 - save all parameters (p0977 = 1).  
 - carry out a POWER ON (power off/on) for all components.

---

### 235016 <location>TM54F: Net data communication with drive not established

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The cyclic net data communication within the Terminal Module 54F (TM54F) is still not active. This message is output after the TM54F master and TM54F slave have booted and is automatically withdrawn as soon as communications have been established.  
 If a drive does not communicate with the TM54F, then none of the drives parameterized in p10010 are enabled.  
**Remedy:** When replacing a Motor Module, carry out the following steps:  
 - start the copy function for the node identifier on the TM54F (p9700 = 1D hex).  
 - acknowledge the hardware CRC on the TM54F (p9701 = EC hex).  
 - save all parameters (p0977 = 1).  
 - carry out a POWER ON (power off/on) for all components.  
 The following always applies:  
 - for all drive objects specified in p10010, check whether the drive-based motion monitoring functions with TM54F are enabled (p9601).  
 - check whether fault F35150 is present and if required, remove the cause of the fault.  
 See also: r10055 (SI TM54F communication status drive-specific)

---

### 235040 <location>TM54F: 24 V undervoltage

**Message value:** Fault cause: %1 bin  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** For the 24 V power supply for the Terminal Module 54F (TM54F) an undervoltage condition was detected. As fault response fail-safe input terminal signals are transferred to the motion monitoring functions.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Power supply undervoltage at connection X524.  
 Bit 1 = 1: Power supply undervoltage at connection X514.  
**Remedy:**  
 - check the 24 V DC power supply for the TM54F.  
 - carry out safe acknowledgement (p10006).

**235043**            **<location>TM54F: 24 V overvoltage**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** For the 24 V power supply for the Terminal Module 54F (TM54F) an overvoltage condition was detected. As fault response fail-safe input terminal signals are transferred to the motion monitoring functions.  
**Remedy:** - check the 24 V DC power supply for the TM54F.  
 - carry out safe acknowledgement (p10006).

---

**235051**            **<location>TM54F: Defect in a monitoring channel**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The Terminal Module 54F (TM54F) has identified an error in the crosswise data comparison between the two control channels. As fault response fail-safe input terminal signals are transferred to the motion monitoring functions. Fault value (r0949, interpret hexadecimal):  
 aaaabcc hex  
 aaaa: A value greater than zero indicates an internal software error.  
 bb: Data to be cross-checked that resulted in the error.  
 bb = 00 hex: p10000  
 bb = 01 hex: p10001  
 bb = 02 hex: p10002  
 bb = 03 hex: p10006  
 bb = 04 hex: p10008  
 bb = 05 hex: p10010  
 bb = 06 hex: p10011  
 bb = 07 hex: p10020  
 bb = 08 hex: p10021  
 bb = 09 hex: p10022  
 bb = 0A hex: p10023  
 bb = 0B hex: p10024  
 bb = 0C hex: p10025  
 bb = 0D hex: p10026  
 bb = 0E hex: p10027  
 bb = 0F hex: p10028  
 bb = 10 hex: p10036  
 bb = 11 hex: p10037  
 bb = 12 hex: p10038  
 bb = 13 hex: p10039  
 bb = 14 hex: p10040  
 bb = 15 hex: p10041  
 bb = 16 hex: p10042  
 bb = 17 hex: p10043  
 bb = 18 hex: p10044  
 bb = 19 hex: p10045  
 bb = 1A hex: p10046



bb = 1B hex: Test stop internal p10041  
 bb = 1C hex: Test stop internal p10046  
 bb = 1D ... 1F hex: internal test stop p10017, p10002, p10000  
 bb = 20 ... 2A hex: internal test stop p10040, p10046, p10047  
 bb = 2B hex: Test stop initialization  
 bb = 2C hex: Input/output calculation initialization  
 bb = 2D ... 45 hex: internal data for the output calculation p10042 ... p10045  
 bb = 46 ... 63 hex: data for the calculation of drive group 1  
 bb = 64 ... 81 hex: data for the calculation of drive group 2  
 bb = 82 ... 9F hex: data for the calculation of drive group 3  
 bb = A0 ... BD hex: data for the calculation of the drive group 4  
 bb = BE hex: debounce time of the fail-safe inputs (F-DI) p10017  
 bb = BF hex: debounce time of the single-channel inputs (DI) p10017  
 bb = C0 hex: debounce time of the Diag inputs p10017  
 bb = C1 hex: p10030  
 bb = C2 hex: p10031  
 bb = C3 ... CA hex: new data to calculate the drive groups  
 cc: Index of the data to be cross-checked that resulted in the error.

**Remedy:**

Carry out the following steps on the TM54F:
 

- activate the safety commissioning mode (p0010 = 95).
- start the copy function for SI parameters (p9700 = 57 hex).
- acknowledge complete data change (p9701 = AC hex).
- exit the safety commissioning mode (p0010 = 0).
- save all parameters (p0977 = 1).
- carry out safe acknowledgement (p10006).

 For an internal software error (aaaa greater than zero):
 

- upgrade the software on the TM54F.
- contact the Hotline.
- replace the TM54F.

**235052 <location>TM54F: Internal hardware error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** An internal software/hardware error has been detected on the Terminal Module 54F (TM54F).  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:**

- check the electrical cabinet design and cable routing for EMC compliance
- upgrade TM54F firmware to more recent version.
- contact the Hotline.
- replace the TM54F.

**235053 <location>TM54F: Temperature fault threshold exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The temperature measured using the temperature sensing on the TM54F has exceeded the threshold value to initiate this fault.  
 As fault response fail-safe input terminal signals are transferred to the motion monitoring functions.  
 Fault value (r0949, decimal interpretation):  
 Only for internal Siemens troubleshooting.

**Remedy:** - allow the TM54F to cool down.  
- carry out safe acknowledgement (p10006).

---

**235054 <location>TM54F: Temperature alarm threshold exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature measured using the temperature sensing on the TM54F has exceeded the threshold value to initiate this alarm.  
**Remedy:** - allow the TM54F to cool down.  
- carry out safe acknowledgement (p10006).

---

**235075 <location>TM54F: Error during internal communication**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An internal communications error has occurred in the Terminal Module 54F (TM54F).  
This alarm can also occur if the TM54F exists and no safety function has yet been parameterized.  
Alarm value (r2124, interpret decimal):  
Only for internal Siemens diagnostics.  
**Remedy:** For internal communication errors:  
- check the electrical cabinet design and cable routing for EMC compliance  
- upgrade the software on the TM54F.  
- contact the Hotline.  
- replace the TM54F.  
If TM54F exists and no safety function has yet been parameterized:  
- None necessary. The alarm disappears automatically after a safety function has been parameterized.

---

**235080 <location>TM54F: Checksum error safety parameters**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The calculated checksum entered in r10004 over the safety-relevant parameters does not match the reference checksum saved in p10005 at the last machine acceptance.  
Fault value (r0949, decimal interpretation):  
1: Checksum error for functional SI parameters.  
2: Checksum error for SI parameters for component assignment.  
**Remedy:** - check the safety-relevant parameters and if required, correct.  
- set the reference checksum to the actual checksum.  
- acknowledge the hardware replacement.  
- carry out a POWER ON.  
- carry out an acceptance test.

---

<b>235081</b>	<b>&lt;location&gt;TM54F: Static (steady state) 1 signal at the F-DI for safety-relevant acknowledgement</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	A logical 1 signal is present at the F-DI configured in p10006 for more than 10 seconds. If, at the F-DI no acknowledgment was performed for safe acknowledgment, then a steady-state logical and 0 signal must be present. This avoids unintentional safety-relevant acknowledgement (or the "Internal Event Acknowledge" signal) if a wire breaks or one of the two digital inputs bounces.
<b>Remedy:</b>	Set the fail-safe digital input (F-DI) to a logical 0 signal (10006). Note: F-DI: Failsafe Digital Input

---

<b>235150</b>	<b>&lt;location&gt;TM54F: Communication error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	A communication error between the TM54F master and Control Unit or between the TM54F slave and the Motor Module was detected. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
<b>Remedy:</b>	When replacing a Motor Module, carry out the following steps: - start the copy function for the node identifier on the TM54F (p9700 = 1D hex). - acknowledge the hardware CRC on the TM54F (p9701 = EC hex). - save all parameters (p0977 = 1). - carry out a POWER ON (power off/on) for all components. The following always applies: - check the electrical cabinet design and cable routing for EMC compliance - upgrade the software on the TM54F. - contact the Hotline. - replace the TM54F.

---

<b>235151</b>	<b>&lt;location&gt;TM54F: Discrepancy error</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The safety input terminals or output terminals show a different state longer than that parameterized in p10002. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex xxxx: The safety-relevant input terminals F-DI indicate a discrepancy. Bit 0: Discrepancy for F-DI 0 ... Bit 9: Discrepancy for F-DI 9 yyyy: The safety-relevant output terminals F-DO indicate a discrepancy.

Bit 0: Discrepancy for F-DO 0

...

Bit 3: Discrepancy for F-DO 3

Note:

If several discrepancy errors occur consecutively, then this fault is only signaled for the first error that occurs.

The following options are available to analyze all of the discrepancy errors:

- Using the commissioning software, evaluate the input states and output states of the TM54F. All discrepancy errors are displayed here.

- Compare parameters p10051 and p10052 from the TM54F master and TM54F slave for discrepancy.

**Remedy:**

Check the wiring of the corresponding F-DI (contact problems).

Discrepancy errors in the fail-safe digital inputs (F-DI) can only be completely acknowledged if, after the cause of the error was resolved, safe acknowledgement was carried out (see p10006). As long as safety acknowledgement was not carried out, the corresponding F-DI stays in the safe state internally.

For cyclic switching operations at the fail-safe digital inputs (F-DI), it may be necessary to adapt the discrepancy time to the switching frequency:

If the period of a cyclic switching pulse has the order of magnitude of double the value of p10002, then the following formulas must be checked.

$p10002 < (tp / 2) - td$  (discrepancy time must be less than half the period minus the actual discrepancy time)

$p10002 \geq p10000$  (discrepancy time must be no less than p10000)

$p10002 > td$  (discrepancy time must be greater than the switch discrepancy time which may actually apply)

td: possible actual discrepancy time (in ms) that can occur with a switching operation. This must correspond to at least 1 SI sampling cycle (see p10000).

tp: period for a switching operation in ms.

For cyclic switching operations and when debounce (p10017) is active, the discrepancy time is directly specified by the debounce time.

If the period of a cyclic switching pulse has the order of magnitude of twice the debounce time, then the following formulas should be checked.

$p10002 < p10017 + 1ms - td$

$p10002 > td$

$p10002 \geq p10000$

Example:

If the SI sampling cycle is 12 ms and the switching frequency is 110 ms (p10017 = 0), the maximum discrepancy time which can be set is as follows:

$p10002 \leq 110/2 \text{ ms} - 12 \text{ ms} = 43 \text{ ms}$  --> rounded-off, the following is obtained  $p10002 \leq 36 \text{ ms}$

Since the discrepancy time can only be accepted as a whole SI sampling time, the value will need to be rounded up or down to a whole SI sampling time value if it is not an exact integer multiple of an SI sampling time.

F-DI: Failsafe Digital Input

F-DO: Failsafe Digital Output

**235152**

**<location>TM54F: Internal software error**

**Message value:**

%1

**Drive object:**

A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**

NONE

**Acknowledge:**

IMMEDIATELY

**Cause:**

An internal software error has occurred in the Terminal Module 54F (TM54F).

The fail-safe digital inputs and digital outputs (F-DI, F-DO) on the TM54F have been set to the safe state.

Fault value (r0949, decimal interpretation):

Only for internal Siemens troubleshooting.

Note:

F-DI: Failsafe Digital Input

F-DO: Failsafe Digital Output

**Remedy:**

Check that the firmware version of the TM54F matches the Control Unit's firmware version.

The automatic firmware update must be activated in the project.

Note:

This signal will also appear, for example, in conjunction with fault F35013. In this case you should check all the parameters for the test stop on the TM54F (p10001, p10003, p10007, p10041, p10046, p10047). In this case, a POWER ON is required after the parameters have been corrected.

---

<b>235200</b>	<b>&lt;location&gt;TM: Calibration data</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	An error was detected in the calibration data of the Terminal Module. Alarm value (r2124, interpret decimal): The hundred-thousands and ten-thousands position specifies the component ID of the Terminal Module which detected the fault. The thousands location specifies whether the analog input 0 (=0) or analog output 1 (= 1) is involved. The hundreds location specifies the fault type: 0: No calibration data available. 1: Offset too high (> 100 mV). The tens and ones location specifies the number of the input involved.
<b>Remedy:</b>	Power down the unit and power up again. If the fault is still present, replace the module/board.

---

<b>235207</b>	<b>&lt;location&gt;TM: Temperature fault/alarm threshold channel 1 exceeded</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Vector: OFF2 (NONE, OFF1, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	For the temperature evaluation via the Terminal Module (TM), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer stage (p4102[0], p4103[0]). or - fault threshold exceeded (p4102[1]). Note: For PTC, the following applies: - if r4101[0] > 1650 ohms, the temperature r4105[0] = 250 °C - if r4101[0] <= 1650 ohms, the temperature r4105[0] = -50 °C The measured temperature is displayed in connector output r4105[0]. This fault can only be initiated if temperature evaluation was activated (p4100[0] = 2 for KTY84 sensor, p4100[0] = 1 for PTC sensor or p4100[0] = 4 for bimetallic (only for TM120)). Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, decimal interpretation): Temperature value at the time of trip (multiplied by 10).
<b>Remedy:</b>	- allow the temperature sensor to cool down to below p4102[1] - hysteresis (5 K). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

**235208**                    **<location>TM: Temperature fault/alarm threshold channel 2 exceeded**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
                              Servo: OFF2 (NONE, OFF1, OFF3)  
                              Vector: OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                For the temperature evaluation via the Terminal Module 120 (TM120), at least one of the following conditions to initiate this fault is fulfilled:  
                              - alarm threshold has been exceeded longer than that set in the timer stage (p4102[2], p4103[1]).  
                              or  
                              - fault threshold exceeded (p4102[3]).  
                              Note:  
                              For PTC, the following applies:  
                              - if r4101[1] > 1650 ohms, the temperature r4105[1] = 250 °C  
                              - if r4101[1] <= 1650 ohms, the temperature r4105[1] = -50 °C  
                              The measured temperature is displayed in connector output r4105[1].  
                              This fault can only be initiated if temperature evaluation was activated (p4100[1] = 2 for KTY84 sensor, p4100[1] = 1 for PTC sensor or p4100[1] = 4 for bimetallic).  
                              Notice:  
                              This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module.  
                              Fault value (r0949, decimal interpretation):  
                              Temperature value at the time of trip (multiplied by 10).

**Remedy:**                - allow the temperature sensor to cool down to below p4102[3] - hysteresis (5 K).  
                              - if required, set the fault response to NONE (p2100, p2101).  
                              See also: p4102

---

**235209**                    **<location>TM: Temperature fault/alarm threshold channel 3 exceeded**

**Message value:**        %1

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR

**Reaction:**             Infeed: OFF2 (NONE, OFF1)  
                              Servo: OFF2 (NONE, OFF1, OFF3)  
                              Vector: OFF2 (NONE, OFF1, OFF3)

**Acknowledge:**        IMMEDIATELY (POWER ON)

**Cause:**                For the temperature evaluation via the Terminal Module 120 (TM120), at least one of the following conditions to initiate this fault is fulfilled:  
                              - alarm threshold has been exceeded longer than that set in the timer stage (p4102[4], p4103[2]).  
                              or  
                              - fault threshold exceeded (p4102[5]).  
                              Note:  
                              For PTC, the following applies:  
                              - if r4101[2] > 1650 ohms, the temperature r4105[2] = 250 °C  
                              - if r4101[2] <= 1650 ohms, the temperature r4105[2] = -50 °C  
                              The measured temperature is displayed in connector output r4105[2].  
                              This fault can only be initiated if temperature evaluation was activated (p4100[2] = 2 for KTY84 sensor, p4100[2] = 1 for PTC sensor or p4100[2] = 4 for bimetallic).  
                              Notice:  
                              This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module.  
                              Fault value (r0949, decimal interpretation):  
                              Temperature value at the time of trip (multiplied by 10).

**Remedy:**

- allow the temperature sensor to cool down to below p4102[5] - hysteresis (5 K).
- if required, set the fault response to NONE (p2100, p2101).

See also: p4102

### 235210 <location>TM: Temperature fault/alarm threshold channel 4 exceeded

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR

**Reaction:**  
 Infeed: OFF2 (NONE, OFF1)  
 Servo: OFF2 (NONE, OFF1, OFF3)  
 Vector: OFF2 (NONE, OFF1, OFF3)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** For the temperature evaluation via the Terminal Module 120 (TM120), at least one of the following conditions to initiate this fault is fulfilled:

- alarm threshold has been exceeded longer than that set in the timer stage (p4102[6], p4103[3]).

or

- fault threshold exceeded (p4102[7]).

**Note:**  
 For PTC, the following applies:

- if r4101[3] > 1650 ohms, the temperature r4105[3] = 250 °C
- if r4101[3] <= 1650 ohms, the temperature r4105[3] = -50 °C

The measured temperature is displayed in connector output r4105[3].  
 This fault can only be initiated if temperature evaluation was activated (p4100[3] = 2 for KTY84 sensor, p4100[3] = 1 for PTC sensor or p4100[3] = 4 for bimetallic).

**Notice:**  
 This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module.  
 Fault value (r0949, decimal interpretation):  
 Temperature value at the time of trip (multiplied by 10).

**Remedy:**

- allow the temperature sensor to cool down to below p4102[7] - hysteresis (5 K).
- if required, set the fault response to NONE (p2100, p2101).

See also: p4102

### 235211 <location>TM: Temperature alarm threshold channel 1 exceeded

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The temperature measured using the temperature sensing of the Terminal Module (TM) (r4105[0]) has exceeded the threshold value to initiate this alarm (p4102[0]).

**Note:**  
 For PTC, the following applies:

- if r4101[0] > 1650 ohms, the temperature r4105[0] = 250 °C
- if r4101[0] <= 1650 ohms, the temperature r4105[0] = -50 °C

Alarm value (r2124, interpret decimal):  
 Temperature value at the time of trip (multiplied by 10).

**Remedy:** Allow the temperature sensor to cool down to below p4102[0] - hysteresis (5 K).  
 See also: p4102

---

**235212 <location>TM: Temperature alarm threshold channel 2 exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature (r4105[1]) measured using the temperature sensing of the Terminal Module 120 (TM120) has exceeded the threshold value to initiate this alarm (p4102[2]).  
 Note:  
 For PTC, the following applies:  
 - if r4101[1] > 1650 ohms, the temperature r4105[1] = 250 °C  
 - if r4101[1] <= 1650 ohms, the temperature r4105[1] = -50 °C  
 Alarm value (r2124, interpret decimal):  
 Temperature value at the time of trip (multiplied by 10).  
**Remedy:** Allow the temperature sensor to cool down to below p4102[2] - hysteresis (5 K).  
 See also: p4102

---

**235213 <location>TM: Temperature alarm threshold channel 3 exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature (r4105[2]) measured using the temperature sensing of the Terminal Module 120 (TM120) has exceeded the threshold value to initiate this alarm (p4102[4]).  
 Note:  
 For PTC, the following applies:  
 - if r4101[2] > 1650 ohms, the temperature r4105[2] = 250 °C  
 - if r4101[2] <= 1650 ohms, the temperature r4105[2] = -50 °C  
 Alarm value (r2124, interpret decimal):  
 Temperature value at the time of trip (multiplied by 10).  
**Remedy:** Allow the temperature sensor to cool down to below p4102[4] - hysteresis (5 K).  
 See also: p4102

---

**235214 <location>TM: Temperature alarm threshold channel 4 exceeded**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature (r4105[3]) measured using the temperature sensing of the Terminal Module 120 (TM120) has exceeded the threshold value to initiate this alarm (p4102[6]).  
 Note:  
 For PTC, the following applies:  
 - if r4101[3] > 1650 ohms, the temperature r4105[3] = 250 °C  
 - if r4101[3] <= 1650 ohms, the temperature r4105[3] = -50 °C  
 Alarm value (r2124, interpret decimal):  
 Temperature value at the time of trip (multiplied by 10).  
**Remedy:** Allow the temperature sensor to cool down to below p4102[6] - hysteresis (5 K).  
 See also: p4102



---

<b>235220</b>	<b>&lt;location&gt;TM: Frequency limit reached for signal output</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF1 (NONE, OFF2) Servo: OFF1 (NONE, OFF2, OFF3) Vector: OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The signals output from the Terminal Module 41 (TM41) for tracks A/B have reached the limit frequency. The output signals are no longer in synchronism with the specified setpoint. Note: If with SIMOTION the TM41 has been configured as the technology project, this fault is also output in response to short-circuited A/B signals in X520.
<b>Remedy:</b>	SIMOTION (p4400 = 0) operating mode: - enter a lower speed setpoint (p1155). - reduce the encoder pulse number (p0408). - check track A/B for short-circuits. SINAMICS (p4400 = 1) operating mode: - the fine resolution of TM41 in p0418 does not match that of the connector input that was interconnected at P4420 - the encoder position actual value r0479 interconnected at connector input p4420 has an excessively high actual speed

---

<b>235221</b>	<b>&lt;location&gt;TM: Setpoint - actual value deviation, outside the tolerance range</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	Infeed: OFF1 (NONE, OFF2) Servo: OFF1 (NONE, OFF2, OFF3) Vector: OFF1 (NONE, OFF2, OFF3)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	The deviation between the setpoint and the output signals (track A/B) exceeds the tolerance of +/-3 %. The deviation between the internal and external measured value is too high.
<b>Remedy:</b>	- reduce the basic clock cycle (p0110, p0111). - replace the module.

---

<b>235222</b>	<b>&lt;location&gt;TM: Encoder pulse number not permissible</b>
<b>Message value:</b>	%1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM15, TM15DI_DO, TM17, TM31, TM41, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	The encoder pulse number entered does not match the permissible pulse number from a hardware perspective. Fault value (r0949, decimal interpretation): 1: Encoder pulse number is too high. 2: Encoder pulse number is too low. 4: Encoder pulse number is less than the zero mark offset (p4426).

**Remedy:**

- enter the encoder pulse number in the permissible range (p0408).
- if necessary, replace TM41 SAC with TM41 DAC.

Note:

TM41 SAC: order no. = 6SL3055-0AA00-3PA0  
 TM41 DAC: order no. = 6SL3055-0AA00-3PA1

The following applies for TM41 SAC:

- minimum/maximum value for p0408: 1000/8192

The following applies for TM41 DAC:

- minimum/maximum value for p0408: 1000/16384

See also: p0408

**235223 <location>TM: Zero mark offset not permissible**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The entered zero mark offset is not permissible.  
 Fault value (r0949, decimal interpretation):  
 1: Zero mark offset is too high.  
 See also: p4426 (TM41 encoder emulation pulses for zero mark)

**Remedy:** Enter the zero mark offset in the permissible range (p4426).

**235224 <location>TM: Zero mark synchronization interrupted**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The zero mark synchronization with the encoder to be emulated was interrupted.  
 Alarm value (r2124, interpret decimal):  
 0: The encoder is not in the ready state (e.g. encoder parked)  
 1: An absolute encoder was connected.  
 2: The encoder r0479[0...2] interconnected via connector input: p4420 is already communicating with another TM41 (precisely one TM41 can be interconnected with a specific r0479[0...2]).  
 3: The BICO interconnection to Terminal Module 41 (TM41) was removed (CI: p4420 = 0 signal).  
 4: The encoder interconnected via connector input: p4420 has carried out an EDS changeover or has been re-parameterized (this operation is not supported, set p4420 to 0 and interconnect again).  
 5: The maximum number of revolutions of the encoder was exceeded.  
 6: Encoder in an invalid state.  
 7: Encoder in an invalid state.  
 8: Encoder in an invalid state (the encoder is not parameterized or the interconnected signal source is not in the cyclic state).

**Remedy:** Not necessary.

- if the encoder changes into the ready state, then a synchronization operation that was previously interrupted is carried out again.
- if the synchronization was interrupted due to the maximum permissible synchronization duration, then a new synchronization is not carried out.
- The alarm is only output, if, for an absolute encoder, the zero mark synchronization is set to the zero position (p4401.0 = 1 and p4401.1=0).

---

**235225 <location>TM: Zero mark synchronization held - encoder not in the ready state**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The zero mark synchronization with the encoder to be emulated was held.  
The encoder is not in the "ready" state.

**Remedy:** Bring the encoder into the "ready" state.

---

**235226 <location>TM: Tracks A/B are de-activated**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The output of tracks A/B of the Terminal Module 41 (TM41) has been held (frozen).  
The encoder emulation of the TM41 hardware is enabled (this is necessary so that no TRI state of the A/B tracks occurs). The hardware receives a setpoint of zero so that no motion occurs at the A/B tracks. (the hardware is only enabled, if CI: p4420 is interconnected.)  
Reasons for this alarm:

- CI: p4420 was not interconnected (in this case, the encoder emulation of the hardware is de-activated)
- the encoder is not in the "ready" state (parking encoder or non-parameterized encoder data set).
- for TM41 there is an additional fault.

**Remedy:**

- establish an interconnection from CI: p4420.
- bring the encoder into the "ready" state.
- remove any TM41 faults.

---

**235227 <location>EDS changeover/encoder data set change not supported**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Terminal Module 41 (TM41) does not support the following application cases:

- the encoder interconnected via connector input p4420 has carried out an EDS changeover.
- the encoder interconnected with the TM41 was re-parameterized so that the position actual value of the encoder must be newly interpreted.

For example, this is the case when changing the direction of rotation of the motor (p0410, p1821) or when changing the fine resolution (p0418). This may result in a sudden change in the position actual value of the encoder (position setpoint of the TM41), which must not be output at the TM41.  
See also: p4420 (TM41 encoder emulation position setpoint)

**Remedy:** Set connector input p4420 = 0 and re-wire.

**235228 <location>TM: Sampling time p4099[3] invalid**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The sampling time set in p4099[3] for incremental encoder emulation in Terminal Module 41 (TM41) does not correspond to the valid value. To resolve the problem, correct the setting of p4099[3]. The system then automatically performs a warm restart/sub-boot.  
 Alarm value (r2124, interpret decimal):  
 1: A clock cycle p4099[3] < 125us was set.  
 2: An integer multiple of the DQ clock cycle was not entered in p4099[3].  
 3: In the SINAMICS mode, an integer multiple of the clock cycle of the emulated DO was not entered in p4099[3].  
**Remedy:**  
 - if necessary, cancel the BICO interconnection via connector input p4420.  
 - check the rules specified under cause for setting the sampling time in p4099[3].  
 - if necessary, set the BICO interconnection via connector input p4420 again.  
**Note:**  
 Every time the BICO interconnection is reset via connector input p4420, the sampling time is checked in p4099[3] and, where necessary, this message is output.

---

**235229 <location>TM: Time slice de-activated**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: NONE  
 Vector: NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The required value of a cycle time in p4099[0...2] is invalid.  
 The corresponding time slice was not activated.  
 Alarm value (r2124, interpret decimal):  
 0: Digital input/outputs (p4099[0])  
 1: Analog inputs (p4099[1])  
 3: Encoder emulation (p4099[3]).  
 4: Encoder emulation speed setpoint (p4099[3]).  
 5: Encoder emulation speed setpoint (p4099[3]).  
 6: Internal sequence control of the TM41 (internal error)  
**Remedy:** Change the sampling time according to the alarm value.  
**Note:**  
 The sampling time p4099[0] may not be zero.

---

**235230 <location>TM: Hardware fault**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15DI\_DO, TM31, TM41, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: NONE  
 Vector: NONE  
**Acknowledge:** POWER ON  
**Cause:** The Terminal Module (TM) used has signaled internal errors.  
 Signals from this module may not be evaluated because they are very likely to be incorrect.  
**Remedy:** If required, replace the Terminal Module.

---

**235231**            **<location>TM: Master control by PLC missing**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                The "master control by PLC" signal was missing in operation.  
 - interconnection of the binector input for "master control by PLC" is incorrect (p0854).  
 - the higher-level control has withdrawn the "master control by PLC" signal.  
 - data transfer via the fieldbus (master/drive) was interrupted.  
**Note:**  
 This alarm is only decisive in the "SIMOTION" operating mode (p4400 = 0).  
 In the "SINAMICS" operating mode (p4400 = 1), the setpoints at p4420 are evaluated independent of binector input p0854.

**Remedy:**              - check the interconnection of the binector input for "master control by PLC" (p0854).  
 - check the "master control by PLC" signal and, if required, switch in.  
 - check the data transfer via the fieldbus (master/drive).  
 - check the setting of parameter p2037.

---

**235232**            **<location>TM41: Zero mark no longer synchronous POWER ON required**

**Message value:**        -

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**            NONE

**Acknowledge:**        NONE

**Cause:**                SINAMICS (p4400 = 1) operating mode:  
 When parameterizing a Terminal Module 41 (TM41) or when operating a TM41 Module, an operating state was reached which required a POWER ON.  
 These include:  
 - changing the encoder pulse number (p0408).  
 - changing the fine resolution (p0418).  
 - withdrawing the DRIVE-CLiQ cable without first de-activating TM41 via p0105.  
 If this alarm was output, then the zero mark of the TM41 can no longer be output in synchronism to that of the encoder interconnected at p4420.  
 SIMOTION (p4400 = 0) operating mode:  
 A previously set zero mark position (p4426) no longer matches encoder position (r0479) due to the change in the pulse number (p0408).

**Remedy:**              The incremental position at output X520 of TM41 can still be evaluated independent of the zero mark.  
 A POWER ON must be carried out if the TM41 zero mark is evaluated.

---

**235233**            **<location>DRIVE-CLiQ component does not support function**

**Message value:**        %1

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM31, TM41, VECTOR

**Reaction:**            OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                A function requested by the Control Unit is not supported by a DRIVE-CLiQ component.  
 Fault value (r0949, decimal interpretation):  
 1: Terminal Module 31 does not support the function "Timer for temperature evaluation" (X522.7/8, p4103 > 0.000).

**Remedy:** For fault value = 1:  
- De-activate timer for temperature evaluation (X522.7/8) (p4103 = 0.000).  
- Use Terminal Module 31 and the relevant firmware version to enable the "Timer for temperature evaluation" function (Order No. 6SL3055-0AA00-3AA1, firmware version 2.6 and higher).  
See also: p4103

---

**235800 <location>TM: Group signal**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** Infeed: OFF2 (NONE, OFF1)  
Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)  
**Acknowledge:** NONE  
**Cause:** The Terminal Module has detected at least one fault.  
**Remedy:** Evaluates other actual messages.

---

**235801 <location>TM DRIVE-CLiQ: Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module to the encoder involved.  
Alarm value (r2124, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex:  
The sign-of-life bit in the receive telegram is not set.  
**Remedy:** - check the DRIVE-CLiQ connection.  
- replace the component involved.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**235802 <location>TM: Time slice overflow**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A time slice overflow has occurred on the Terminal Module.  
**Remedy:** Replace the Terminal Module.

---

**235803 <location>TM: Memory test**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** An error has occurred during the memory test on the Terminal Module.

**Remedy:** - check whether the permissible ambient temperature for the Terminal Module is being maintained.  
- replace the Terminal Module.

---

**235804 <location>TM: CRC**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A checksum error has occurred when reading-out the program memory on the Terminal Module.  
Fault value (r0949, interpret hexadecimal):  
Difference between the checksum at POWER ON and the actual checksum.

**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
- replace the Terminal Module.

---

**235805 <location>TM: EPROM checksum error**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Internal parameter data is corrupted.  
Alarm value (r2124, interpret hexadecimal):  
01: EEPROM access error.  
02: Too many blocks in the EEPROM.

**Remedy:** - check whether the permissible ambient temperature for the component is maintained.  
- replace the Terminal Module 31 (TM31).

---

**235807 <location>TM: Sequence control time monitoring**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** Error, timeout, sequence control on the Terminal Module.

**Remedy:** Replace the Terminal Module.

**235820 <location>TM DRIVE-CLiQ: Telegram error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the Terminal Module involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 01 hex:  
 CRC error.  
 xx = 02 hex:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 03 hex:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 04 hex:  
 The length of the receive telegram does not match the receive list.  
 xx = 05 hex:  
 The type of the receive telegram does not match the receive list.  
 xx = 06 hex:  
 The address of the component in the telegram and in the receive list do not match.  
 xx = 07 hex:  
 A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
 xx = 08 hex:  
 No SYNC telegram is expected - but the received telegram is one.  
 xx = 09 hex:  
 The error bit in the receive telegram is set.  
 xx = 10 hex:  
 The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**235835 <location>TM DRIVE-CLiQ: Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the Terminal Module involved. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 21 hex:  
 The cyclic telegram has not been received.  
 xx = 22 hex:  
 Timeout in the telegram receive list.  
 xx = 40 hex:  
 Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)



---

**235836**                    **<location>TM DRIVE-CLiQ: Send error for DRIVE-CLiQ data**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             OFF1 (OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communication error has occurred from the Terminal Module to the encoder involved. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:**              Carry out a POWER ON.

---

**235837**                    **<location>PTM DRIVE-CLiQ: Component fault**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             OFF1 (OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.

**Remedy:**              - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
 - check the electrical cabinet design and cable routing for EMC compliance  
 - if required, use another DRIVE-CLiQ socket (p9904).  
 - replace the component involved.

---

**235845**                    **<location>TM DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:**             OFF1 (OFF2)

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communication error has occurred from the Terminal Module (TM) to the encoder involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:**              Carry out a POWER ON.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**235850 <location>TM: Internal software error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** Infeed: OFF1 (NONE, OFF2)  
 Servo: OFF1 (NONE, OFF2, OFF3)  
 Vector: OFF1 (NONE, OFF2, OFF3)  
**Acknowledge:** POWER ON  
**Cause:** An internal software error in the Terminal Module (TM) has occurred.  
 Fault value (r0949, decimal interpretation):  
 1: Background time slice is blocked.  
 2: Checksum over the code memory is not OK.  
**Remedy:**  
 - replace the Terminal Module (TM).  
 - if required, upgrade the firmware in the Terminal Module.  
 - contact the Hotline.

---

**235851 <location>TM DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit.  
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex = 10 dec:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:** Upgrade the firmware of the component involved.

---

**235860 <location>TM DRIVE-CLiQ (CU): Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 CRC error and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 02 hex = 02 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 13 hex = 19 dec:  
 The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 03 hex = 03 dec:  
 Telegram is longer than specified in the length byte or in the receive list.

xx = 14 hex = 20 dec:  
 The length of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 04 hex = 04 dec:  
 The length of the receive telegram does not match the receive list.

xx = 15 hex = 21 dec:  
 The type of the receive telegram does not match the receive list and the receive telegram is too early.

xx = 05 hex = 05 dec:  
 The type of the receive telegram does not match the receive list.

xx = 16 hex = 22 dec:  
 The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.

xx = 06 hex = 06 dec:  
 The address of the power unit in the telegram and in the receive list do not match.

xx = 19 hex = 25 dec:  
 The error bit in the receive telegram is set and the receive telegram is too early.

xx = 09 hex = 09 dec:  
 The error bit in the receive telegram is set.

xx = 10 hex = 16 dec:  
 The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 235885 <location>TM DRIVE-CLiQ (CU): Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 1A hex = 26 dec:  
 Sign-of-life bit in the receive telegram not set and the receive telegram is too early.

xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.

xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.

xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.

xx = 62 hex = 98 dec:  
 Error at the transition to cyclic operation.

**Remedy:**

- check the power supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

### 235886 <location>TM DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

**235887 <location>TM DRIVE-CLiQ (CU): Component fault**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** Fault detected on the DRIVE-CLiQ component (Terminal Module) involved. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex:  
 Response received too late during runtime measurement.  
 xx = 61 hex:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**235895 <location>TM DRIVE-CLiQ (CU): Alternating cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR

**Reaction:** OFF1 (OFF2)

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

<b>235896</b>	<b>&lt;location&gt;TM DRIVE-CLiQ (CU): Inconsistent component properties</b>
<b>Message value:</b>	Component number: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_LINK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2) Vector: OFF2 (IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	The properties of the DRIVE-CLiQ component (Terminal Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, decimal interpretation): Component number.
<b>Remedy:</b>	- carry out a POWER ON. - when a component is replaced, the same component type and if possible the same firmware version should be used. - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

---

<b>235897</b>	<b>&lt;location&gt;TM DRIVE-CLiQ (CU): no communication with component</b>
<b>Message value:</b>	Preliminary component number: %1
<b>Drive object:</b>	VECTOR
<b>Reaction:</b>	OFF2 (ENCODER, IASC/DCBRAKE, NONE, OFF1, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	Communications with the DRIVE-CLiQ component (Terminal Module) specified by the fault value is not possible. One cause may, for example, be that a DRIVE-CLiQ cable has been withdrawn. Fault value (r0949, decimal interpretation): Component ID.
<b>Remedy:</b>	- check the DRIVE-CLiQ connections. - carry out a POWER ON.

---

<b>235899</b>	<b>&lt;location&gt;TM: Unknown fault</b>
<b>Message value:</b>	New message: %1
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2) Vector: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)
<b>Acknowledge:</b>	IMMEDIATELY (POWER ON)
<b>Cause:</b>	A fault has occurred on the Terminal Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Fault value (r0949, decimal interpretation): Fault number. Note: If required, the significance of this new fault can be read about in a more recent description of the Control Unit.
<b>Remedy:</b>	- replace the firmware on the Terminal Module by an older firmware version (r0158). - upgrade the firmware on the Control Unit (r0018).

---

**235903 <location>TM: I2C bus error occurred**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An error has occurred while accessing the internal I2C bus of the Terminal Module.  
**Remedy:** Replace the Terminal Module.

---

**235904 <location>TM: EEPROM**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An error has occurred accessing the non-volatile memory on the Terminal Module.  
**Remedy:** Replace the Terminal Module.

---

**235905 <location>TM: Parameter access**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The Control Unit attempted to write an illegal parameter value to the Terminal Module.  
**Remedy:** - check whether the firmware version of the Terminal Module (r0158) matches the firmware version of Control Unit (r0018).  
 - if required, replace the Terminal Module.  
**Note:**  
 The firmware versions that match each other are in the readme.txt file on the memory card.

---

**235906 <location>TM: 24 V power supply missing**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The 24 V power supply for the digital outputs is missing.  
 Alarm value (r2124, interpret hexadecimal):  
 01: TM17 24 V power supply for DI/DO 0 ... 7 missing.  
 02: TM17 24 V power supply for DI/DO 8 ... 15 missing.  
 04: TM15 24 V power supply for DI/DO 0 ... 7 (X520) missing.  
 08: TM15 24 V power supply for DI/DO 8 ... 15 (X521) missing.  
 10: TM15 24 V power supply for DI/DO 16 ... 23 (X522) missing.  
 20: TM41 24 V power supply for DI/DO 0 ... 3 missing.  
**Remedy:** Check the terminals for the power supply voltage (L1+, L2+, L3+, M or +24 V\_1 for TM41).

---

**235907 <location>TM: Hardware initialization error**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The Terminal Module was not successfully initialized.  
Alarm value (r2124, interpret hexadecimal):  
01: TM17 or TM41 - incorrect configuration request.  
02: TM17 or TM41 - programming not successful.  
04: TM17 or TM41 - invalid time stamp  
**Remedy:** Carry out a POWER ON.

---

**235910 <location>TM: Module overtemperature**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The temperature in the module has exceeded the highest permissible limit.  
**Remedy:** - reduce the ambient temperature.  
- replace the Terminal Module.

---

**235911 <location>TM: Clock synchronous operation sign-of-life missing**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The maximum permissible number of errors in the master sign-of-life (clock synchronous operation) has been exceeded in cyclic operation.  
When the alarm is output, the module outputs are reset up to the next synchronization.  
**Remedy:** - check the physical bus configuration (terminating resistor, shielding, etc.).  
- check the interconnection of the master sign-of-life (r4201 via p0915).  
- check whether the master correctly sends the sign-of-life (e.g. set up a trace with r4201.12 ... r4201.15 and trigger signal r4301.9).  
- check the bus and master for utilization level (e.g. bus cycle time Tdp was set too short).

---

**235920 <location>TM: Error temperature sensor channel 1**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).

**Remedy:** - make sure that the sensor is connected correctly.  
- replace the sensor.

---

**235921 <location>TM: Error temperature sensor channel 2**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).

**Remedy:** - make sure that the sensor is connected correctly.  
- replace the sensor.

---

**235922 <location>TM: Error temperature sensor channel 3**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).

**Remedy:** - make sure that the sensor is connected correctly.  
- replace the sensor.

---

**235923 <location>TM: Error temperature sensor channel 4**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When evaluating the temperature sensor, an error occurred.  
Alarm value (r2124, interpret decimal):  
1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm).  
2: Measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm).

**Remedy:** - make sure that the sensor is connected correctly.  
- replace the sensor.



---

**235999** <location>TM: Unknown alarm**Message value:** New message: %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, TM54F\_MA, TM54F\_SL, VECTOR**Reaction:** NONE**Acknowledge:** NONE**Cause:** An alarm has occurred on the Terminal Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
Alarm value (r2124, interpret decimal):  
Alarm number.

Note:

If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

**Remedy:** - replace the firmware on the Terminal Module by an older firmware version (r0158).  
- upgrade the firmware on the Control Unit (r0018).

---

**236207** <location>Hub: Overtemperature component**Message value:** %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR**Reaction:** NONE (OFF1, OFF2)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** The temperature on the DRIVE-CLiQ Hub Module has exceeded the fault threshold.  
Fault value (r0949, decimal interpretation):  
Actual temperature in 0.1 °C resolution.**Remedy:** - Check ambient temperature at component installation location.  
- replace the component involved.

---

**236211** <location>Hub: Overtemperature alarm component**Message value:** %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR**Reaction:** NONE**Acknowledge:** NONE**Cause:** The temperature on the DRIVE-CLiQ Hub Module has exceeded the alarm threshold.  
Alarm value (r2124, interpret decimal):  
Actual temperature in 0.1 °C resolution.**Remedy:** - Check ambient temperature at component installation location.  
- replace the component involved.

---

**236214** <location>Hub: overvoltage fault 24 V supply**Message value:** %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR**Reaction:** NONE (OFF1, OFF2)**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The 24 V power supply on the DRIVE-CLiQ Hub Module has exceeded the fault threshold.  
 Fault value (r0949, decimal interpretation):  
 Actual operating voltage in 0.1 °C resolution

**Remedy:** - check the supply voltage of the component involved.  
 - replace the component involved.

**236216 <location>Hub: undervoltage fault 24 V supply**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE (OFF1, OFF2)

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** The 24 V power supply on the DRIVE-CLiQ Hub Module has undershot the fault threshold.  
 Fault value (r0949, decimal interpretation):  
 Actual operating voltage in 0.1 °C resolution

**Remedy:** - check the supply voltage of the component involved.  
 - replace the component involved.

**236217 <location>Hub: undervoltage alarm 24 V supply**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The 24 V power supply on the DRIVE-CLiQ Hub Module has undershot the alarm threshold.  
 Alarm value (r2124, interpret decimal):  
 Actual operating voltage in 0.1 °C resolution

**Remedy:** - check the supply voltage of the component involved.  
 - replace the component involved.

**236800 <location>Hub: Group signal**

**Message value:** -

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The DRIVE-CLiQ Hub Module has detected at least one fault.

**Remedy:** Evaluates other actual messages.

**236801 <location>Hub DRIVE-CLiQ: Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.  
Alarm value (r2124, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex = 10 dec:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**

- check the DRIVE-CLiQ connection.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**236802 <location>Hub: Time slice overflow**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** Infeed: OFF2 (NONE)  
Servo: NONE  
Vector: NONE

**Acknowledge:** IMMEDIATELY (POWER ON)

**Cause:** A time slice overflow has occurred on the DRIVE-CLiQ Hub Module.  
Fault value (r0949, decimal interpretation):  
xx: Time slice number xx

**Remedy:**

- reduce the current controller frequency.
- carry out a POWER ON (power off/on) for all components.
- upgrade firmware to later version.
- contact the Hotline.

**236804 <location>Hub: Checksum error**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** A checksum error has occurred when reading out the program memory on the DRIVE-CLiQ Hub Module.  
Alarm value (r2124, interpret hexadecimal):  
Difference between the checksum at POWER ON and the actual checksum.

**Remedy:**

- check whether the permissible ambient temperature for the component is maintained.
- replace the DRIVE-CLiQ Hub Module.

**236805 <location>Hub: EEPROM checksum incorrect**

**Message value:** %1

**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** NONE

**Cause:** The internal parameter data on the DRIVE-CLiQ Hub Module is incorrect.  
Alarm value (r2124, interpret hexadecimal):  
01: EEPROM access error.  
02: Too many blocks in the EEPROM.

**Remedy:**

- check whether the permissible ambient temperature for the component is maintained.
- replace the DRIVE-CLiQ Hub Module.

**236820**                    **<location>Hub DRIVE-CLiQ: Telegram error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**            NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 01 hex = 1 dec:  
 Checksum error (CRC error).  
 xx = 02 hex = 2 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 03 hex = 3 dec:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 04 hex = 4 dec:  
 The length of the receive telegram does not match the receive list.  
 xx = 05 hex = 5 dec:  
 The type of the receive telegram does not match the receive list.  
 xx = 06 hex = 6 dec:  
 The address of the component in the telegram and in the receive list do not match.  
 xx = 07 hex = 7 dec:  
 A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
 xx = 08 hex = 8 dec:  
 No SYNC telegram is expected - but the received telegram is one.  
 xx = 09 hex = 9 dec:  
 The error bit in the receive telegram is set.  
 xx = 10 hex = 16 dec:  
 The receive telegram is too early.

**Remedy:**              - carry out a POWER ON.  
 - check the electrical cabinet design and cable routing for EMC compliance  
 - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**236835**                    **<location>Hub DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**        A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**            NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.  
 The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.

**Remedy:**              - carry out a POWER ON.  
 - replace the component involved.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**236836**                    **<location>Hub DRIVE-CLiQ: Send error for DRIVE-CLiQ data**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved. Data were not able to be sent.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 41 hex = 65 dec:  
Telegram type does not match send list.

**Remedy:**                Carry out a POWER ON.

---

**236837**                    **<location>Hub DRIVE-CLiQ: Component fault**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 20 hex = 32 dec:  
Error in the telegram header.  
xx = 23 hex = 35 dec:  
Receive error: The telegram buffer memory contains an error.  
xx = 42 hex = 66 dec:  
Send error: The telegram buffer memory contains an error.  
xx = 43 hex = 67 dec:  
Send error: The telegram buffer memory contains an error.

**Remedy:**                - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
- check the electrical cabinet design and cable routing for EMC compliance  
- if required, use another DRIVE-CLiQ socket (p9904).  
- replace the component involved.

---

**236845**                    **<location>Hub DRIVE-CLiQ: Cyclic data transfer error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved. Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0B hex = 11 dec:  
Synchronization error during alternating cyclic data transfer.

**Remedy:**                Carry out a POWER ON.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**236851 <location>Hub DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit.  
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex = 10 dec:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:** Upgrade the firmware of the component involved.

---

**236860 <location>Hub DRIVE-CLiQ (CU): Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 Checksum error (CRC error) and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 02 hex = 2 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 13 hex = 19 dec:  
 The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 03 hex = 3 dec:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 14 hex = 20 dec:  
 The length of the receive telegram does not match the receive list and the receive telegram is too early.  
 xx = 04 hex = 4 dec:  
 The length of the receive telegram does not match the receive list.  
 xx = 15 hex = 21 dec:  
 The type of the receive telegram does not match the receive list and the receive telegram is too early.  
 xx = 05 hex = 5 dec:  
 The type of the receive telegram does not match the receive list.  
 xx = 16 hex = 22 dec:  
 The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.  
 xx = 06 hex = 6 dec:  
 The address of the power unit in the telegram and in the receive list do not match.  
 xx = 19 hex = 25 dec:  
 The error bit in the receive telegram is set and the receive telegram is too early.  
 xx = 09 hex = 9 dec:  
 The error bit in the receive telegram is set.  
 xx = 10 hex = 16 dec:  
 The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

### 236885 <location>Hub DRIVE-CLiQ (CU): Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to the Control Unit.  
 The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 1A hex = 26 dec:  
 Sign-of-life bit in the receive telegram not set and the receive telegram is too early.  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.  
 xx = 62 hex = 98 dec:  
 Error at the transition to cyclic operation.

**Remedy:**

- check the supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

### 236886 <location>Hub DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex = 65 dec:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

### 236887 <location>Hub DRIVE-CLiQ (CU): Component fault

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR

**Reaction:** NONE

**Acknowledge:** IMMEDIATELY

**Cause:** Fault detected on the DRIVE-CLiQ component (DRIVE-CLiQ Hub Module) involved. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex = 32 dec:  
 Error in the telegram header.  
 xx = 23 hex = 35 dec:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex = 66 dec:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex = 67 dec:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex = 96 dec:  
 Response received too late during runtime measurement.  
 xx = 61 hex = 97 dec:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**236895 <location>Hub DRIVE-CLiQ (CU): Alternating cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex = 11 dec:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**236896 <location>Hub DRIVE-CLiQ (CU): Inconsistent component properties**

**Message value:** Component number: %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, CU\_LINK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM120, TM15, TM15DI\_DO, TM17, TM31, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The properties of the DRIVE-CLiQ component (DRIVE-CLiQ Hub Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.  
 Fault value (r0949, decimal interpretation):  
 Component number.

**Remedy:**

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).



---

**236899**      **<location>Hub: Unknown fault****Message value:** New message: %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR**Reaction:** Infeed: NONE (OFF1, OFF2)  
Servo: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
Vector: NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** A fault occurred on the DRIVE-CLiQ Hub Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Fault value (r0949, decimal interpretation):

Fault number.

Note:

If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

**Remedy:** - replace the firmware on the DRIVE-CLiQ Hub Module with older firmware (r0158).  
- upgrade the firmware on the Control Unit (r0018).

---

**236999**      **<location>Hub: Unknown alarm****Message value:** New message: %1**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, HUB, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR**Reaction:** NONE**Acknowledge:** NONE**Cause:** An alarm occurred on the DRIVE-CLiQ Hub Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Alarm value (r2124, interpret decimal):

Alarm number.

Note:

If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

**Remedy:** - replace the firmware on the DRIVE-CLiQ Hub Module with older firmware (r0158).  
- upgrade the firmware on the Control Unit (r0018).

---

**237001**      **<location>HF damping module: Overcurrent****Message value:** Fault cause: %1 bin**Drive object:** SERVO, SERVO\_SINUMERIK**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** The power unit has detected an overcurrent condition.  
- Reactor module or damping module defective.  
- Resonance frequency of the output filter was excited.  
Fault value (r0949, interpret bitwise binary):

Bit 0: Phase U.

Bit 1: Phase V.

Bit 2: Phase W.

**Remedy:** - Check the reactor module and damping module and if required, replace.  
- Reduce the motor power in the proximity of the fault-generating frequency.

**237002**                    **<location>HF damping module: Damping voltage too high**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                The damping voltage has reached an inadmissibly high value.

- A motor harmonic with a high amplitude has coincided with the resonance frequency of the output filter.
- The current controller excessively excites the resonance of the output filter.

Fault value (r0949, decimal interpretation):  
Damping voltage in the case of a fault [mV].

Note:  
HF: High frequency converter  
See also: r5171 (HF damping voltage actual value)

**Remedy:**                - Reduce the motor power in the proximity of the fault-generating frequency.  
- Check the current controller and if required, adapt.  
- If required, use another motor.

---

**237004**                    **<location>HF damping module: Heat sink overtemperature**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                The temperature of the damping module heat sink has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.

Fault value (r0949):  
Temperature [1 bit = 0.01 °C].

**Remedy:**                - check whether the fan is running.  
- check the fan elements.  
- check whether the ambient temperature is in the permissible range.

Notice:  
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.

---

**237005**                    **<location>HF damping module: I2t overload**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**              OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                The filter capacitor of the damping module was overloaded (r5173 = 100 %).

- The filter resonance frequency was excessively excited.
- The reactor module is defective.

Fault value (r0949, decimal interpretation):  
I2t [100 % = 16384].

**Remedy:**                - Reduce the motor power in the proximity of the fault-generating frequency.  
- The system should not stay in a steady-state condition in the vicinity of the fault-generating frequency.  
- Check the reactor module and, if required, replace.  
See also: r5173 (HF damping module I2t overload)

---

**237012 <location>HF damping module: Temperature sensor heat sink wire breakage**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The connection to one of the heat sink temperature sensors in the damping module is interrupted.  
Fault value (r0949, interpret hexadecimal):  
Bit 0: Damping module  
Bit 1: Reactor module  
**Remedy:** Contact the manufacturer.

---

**237013 <location>HF damping module: Temperature sensor heat sink short circuit**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF1 (OFF2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** The heat sink temperature sensor in the damping module is short-circuited.  
Fault value (r0949, interpret hexadecimal):  
Bit 0: Damping module  
Bit 1: Reactor module  
**Remedy:** Contact the manufacturer.

---

**237024 <location>HF damping module: Overtemperature thermal model**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The temperature difference between the heat sink and chip has exceeded the permissible limit value.  
- the permissible load duty cycle was not maintained.  
- insufficient cooling, fan failure.  
- overload.  
- ambient temperature too high.  
- pulse frequency too high.  
See also: r0037  
**Remedy:**  
- adapt the load duty cycle.  
- check whether the fan is running.  
- check the fan elements.  
- check whether the ambient temperature is in the permissible range.  
- check the motor load.  
- reduce the pulse frequency if this is higher than the rated pulse frequency.

---

**237025 <location>HF damping module: Overtemperature chip**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** Chip temperature has exceeded the permissible limit value.  
 - the permissible load duty cycle was not maintained.  
 - insufficient cooling, fan failure.  
 - overload.  
 - ambient temperature too high.  
 - pulse frequency too high.  
 Fault value (r0949):  
 Temperature difference between the heat sink and chip [1 Bit = 0.01 °C].

**Remedy:**  
 - adapt the load duty cycle.  
 - check whether the fan is running.  
 - check the fan elements.  
 - check whether the ambient temperature is in the permissible range.  
 - check the motor load.  
 - reduce the pulse frequency if this is higher than the rated pulse frequency.  
 See also: r0037

**237034** <location>HF damping module: Internal overtemperature

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** The alarm threshold for internal overtemperature has been reached.  
 If the temperature inside the unit continues to increase, fault F37036 may be triggered.  
 - ambient temperature might be too high.  
 - insufficient cooling, fan failure.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Control electronics range.  
 Bit 1 = 1: Power electronics range.

**Remedy:**  
 - check the ambient temperature.  
 - check the fan for the inside of the unit.

**237036** <location>HF damping module: Internal overtemperature

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY

**Cause:** The temperature inside the damping module has exceeded the permissible temperature limit.  
 - insufficient cooling, fan failure.  
 - overload.  
 - ambient temperature too high.  
 Fault value (r0949, interpret binary):  
 Bit 0 = 1: Control electronics range.  
 Bit 1 = 1: Power electronics range.

**Remedy:**  
 - check whether the fan is running.  
 - check the fan elements.  
 - check whether the ambient temperature is in the permissible range.  
**Notice:**  
 This fault can only be acknowledged once the permissible temperature limit minus 5 K has been undershot.

---

**237040** <location>HF damping module: Undervoltage 24 V

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** Failure of the 24 V power supply for the damping module.  
- The undervoltage threshold was undershot for longer than 3 ms.  
Fault value (r0949, decimal interpretation):  
24 V voltage [1 bit = 0.1 V].  
**Remedy:** - Check the 24 V DC power supply of the damping module.  
- carry out a POWER ON (power off/on) for the component.

---

**237041** <location>HF damping module: Undervoltage 24 V alarm

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** 24 V power supply fault for the damping module.  
- the 16 V threshold was undershot..  
Fault value (r0949, decimal interpretation):  
24 V voltage [1 bit = 0.1 V].  
**Remedy:** - Check the 24 V DC power supply of the damping module.  
- carry out a POWER ON (power off/on) for the component.

---

**237043** <location>HF damping module: Overvoltage 24 V

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** Overvoltage of the 24 V power supply for the damping module.  
- the 31.5 V threshold was exceeded for more than 3 ms.  
**Remedy:** Check the 24 V DC power supply of the damping module.

---

**237044** <location>HF damping module: Overvoltage 24 V alarm

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** 24 V power supply fault for the damping module.  
- the 32.0 V threshold was exceeded.  
**Remedy:** Check the 24 V DC power supply of the damping module.

---

**237045 <location>HF damping module: Undervoltage supply**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** Power supply fault in the damping module.  
 - The voltage monitor signals an undervoltage fault on the module.  
 Fault value (r0949, decimal interpretation):  
 24 V voltage [1 bit = 0.1 V].  
**Remedy:**  
 - Check the 24 V DC power supply of the damping module.  
 - carry out a POWER ON (power off/on) for the component.  
 - replace the module if necessary.

---

**237049 <location>Damping module: Internal fan faulty**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The internal fan of the damping module has failed.  
**Remedy:** Check the internal fan of the damping module and replace if necessary.

---

**237050 <location>HF damping module: Overvoltage 24 V fault**

**Message value:** -  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** The voltage monitor signals an overvoltage fault on the module.  
**Remedy:**  
 - check the 24 V power supply.  
 - replace the module if necessary.

---

**237052 <location>HF damping module: EEPROM data error**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** POWER ON  
**Cause:** EEPROM data error of the damping module.  
 Fault value (r0949, interpret hexadecimal):  
 0: The EEPROM data read in from the damping module is inconsistent.  
 1: EEPROM data is not compatible to the firmware of the damping module.  
 Additional values:  
 Only for internal Siemens troubleshooting.  
**Remedy:**  
 For fault value = 0:  
 Replace the damping module or update the EEPROM data.  
 For fault value = 1:  
 If necessary, upgrade the firmware to a later version.

---

**237056**                    **<location>HF damping module: Heat sink overtemperature**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The temperature of the damping module heat sink has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.

Fault value (r0949, decimal interpretation):  
Temperature [1 bit = 0.01 °C].

**Remedy:**              - check whether the fan is running.

- check the fan elements.
- check whether the ambient temperature is in the permissible range.

Notice:  
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.

---

**237310**                    **<location>HF reactor module: Overtemperature**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                The temperature of the reactor module has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.

Fault value (r0949, decimal interpretation):  
Temperature [1 bit = 0.01 °C].

**Remedy:**              - check whether the fan is running.

- check the fan elements.
- check whether the ambient temperature is in the permissible range.

Notice:  
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.

---

**237311**                    **<location>HF reactor module: Overtemperature heat sink**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                The temperature of the reactor module has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.

Fault value (r0949, decimal interpretation):  
Temperature [1 bit = 0.01 °C].

**Remedy:**              - check whether the fan is running.

- check the fan elements.
- check whether the ambient temperature is in the permissible range.
- check the motor load.

Notice:  
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.

---

---

**237312**            **<location>HF reactor module: Overtemperature or fan failure**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              The reactor module signals an overtemperature or fan failure.  
                            Fault F37313 is output if the alarm is present for longer than 30 s.  
**Remedy:**             - The connector between the reactor and damping module is either withdrawn or is defective.  
                            - Check the fan of the reactor module and replace if necessary.  
                            - check whether the ambient temperature is in the permissible range.

---

**237313**            **<location>HF reactor module: Overtemperature or fan failure**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK  
**Reaction:**            OFF2  
**Acknowledge:**        IMMEDIATELY (POWER ON)  
**Cause:**              Alarm A37312 to display overtemperature or fan failure in the reactor module was signaled for longer than 30 s.  
**Remedy:**             - The connector between the reactor and damping module is either withdrawn or is defective.  
                            - Check the fan of the reactor module and replace if necessary.  
                            - check whether the ambient temperature is in the permissible range.

---

**237502**            **<location>HF damping module: Damping voltage too high**

**Message value:**        %1  
**Drive object:**        SERVO, SERVO\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              The damping voltage has exceeded the alarm threshold.  
                            - A motor harmonic with a high amplitude has coincided with the resonance frequency of the output filter.  
                            - The current controller excessively excites the resonance of the output filter.  
                            If the damping voltage exceeds an inadmissibly high value, F37002 is output.  
                            Alarm value (r2124, interpret decimal):  
                            Damping voltage in the case of a fault [mV].  
                            Note:  
                            HF: High frequency converter  
                            See also: r5171 (HF damping voltage actual value)  
**Remedy:**             - Reduce the motor power in the proximity of the fault-generating frequency.  
                            - Check the current controller and if required, adapt.  
                            - If required, use another motor.

---

**237800**            **<location>HF damping module: Group signal**

**Message value:**        -  
**Drive object:**        SERVO, SERVO\_SINUMERIK  
**Reaction:**            NONE  
**Acknowledge:**        NONE  
**Cause:**              The HF damping module has detected at least one fault.  
**Remedy:**             Evaluates other actual messages.



---

**237801 <location>HF damping module: Sign of life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module.  
Alarm value (r2124, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex = 10 dec:  
The sign-of-life bit in the receive telegram is not set.  
**Remedy:** - check the DRIVE-CLiQ connection.  
- replace the component involved.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**237820 <location>HF damping module: Telegram error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 01 hex = 1 dec:  
Checksum error (CRC error).  
xx = 02 hex = 2 dec:  
Telegram is shorter than specified in the length byte or in the receive list.  
xx = 03 hex = 3 dec:  
Telegram is longer than specified in the length byte or in the receive list.  
xx = 04 hex = 4 dec:  
The length of the receive telegram does not match the receive list.  
xx = 05 hex = 5 dec:  
The type of the receive telegram does not match the receive list.  
xx = 06 hex = 6 dec:  
The address of the component in the telegram and in the receive list do not match.  
xx = 07 hex = 7 dec:  
A SYNC telegram is expected - but the received telegram is not a SYNC telegram.  
xx = 08 hex = 8 dec:  
No SYNC telegram is expected - but the received telegram is one.  
xx = 09 hex = 9 dec:  
The error bit in the receive telegram is set.  
xx = 10 hex = 16 dec:  
The receive telegram is too early.  
**Remedy:** - carry out a POWER ON.  
- check the electrical cabinet design and cable routing for EMC compliance  
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**237835 <location>HF damping module: Cyclic data transmission error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module. The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

**237836 <location>HF damping module: Send error for DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module. Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex = 65 dec:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

**237837 <location>HF damping module: Component faulted**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex = 32 dec:  
 Error in the telegram header.  
 xx = 23 hex = 35 dec:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex = 66 dec:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex = 67 dec:  
 Send error: The telegram buffer memory contains an error.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

---

**237845**                    **<location>HF damping module: Cyclic data transmission error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0B hex = 11 dec:  
Synchronization error during alternating cyclic data transfer.

**Remedy:**                Carry out a POWER ON.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**237850**                    **<location>HF damping module: Internal software error**

**Message value:**        %1

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             OFF1 (NONE, OFF2, OFF3)

**Acknowledge:**        POWER ON

**Cause:**                An internal software error has occurred in the damping module.  
Fault value (r0949, decimal interpretation):  
Only for internal Siemens troubleshooting.

**Remedy:**                - replace the damping module.  
- if required, upgrade the firmware in the damping module.  
- contact the Hotline.

---

**237851**                    **<location>HF damping module (CU): Sign of life missing**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                DRIVE-CLiQ communication error from the damping module to the Control Unit.  
The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex = 10 dec:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**                Upgrade the firmware of the component involved.

---

**237860**                    **<location>HF damping module (CU): Telegram error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         SERVO, SERVO\_SINUMERIK

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

---

**Cause:** DRIVE-CLiQ communication error from the damping module to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 11 hex = 17 dec:  
 Checksum error (CRC error) and the receive telegram is too early.  
 xx = 01 hex = 01 dec:  
 Checksum error (CRC error).  
 xx = 12 hex = 18 dec:  
 The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 02 hex = 2 dec:  
 Telegram is shorter than specified in the length byte or in the receive list.  
 xx = 13 hex = 19 dec:  
 The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.  
 xx = 03 hex = 3 dec:  
 Telegram is longer than specified in the length byte or in the receive list.  
 xx = 14 hex = 20 dec:  
 The length of the receive telegram does not match the receive list and the receive telegram is too early.  
 xx = 04 hex = 4 dec:  
 The length of the receive telegram does not match the receive list.  
 xx = 15 hex = 21 dec:  
 The type of the receive telegram does not match the receive list and the receive telegram is too early.  
 xx = 05 hex = 5 dec:  
 The type of the receive telegram does not match the receive list.  
 xx = 16 hex = 22 dec:  
 The address of the damping module in the telegram and in the receive list does not match and the receive telegram is too early.  
 xx = 06 hex = 6 dec:  
 The address of the damping module in the telegram and in the receive list do not match.  
 xx = 19 hex = 25 dec:  
 The error bit in the receive telegram is set and the receive telegram is too early.  
 xx = 09 hex = 9 dec:  
 The error bit in the receive telegram is set.  
 xx = 10 hex = 16 dec:  
 The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

---

**237885** <location>HF damping module (CU): Cyclic data transmission error

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** DRIVE-CLiQ communication error from the damping module to the Control Unit.  
 The nodes do not send and receive in synchronism.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 1A hex = 26 dec:  
 Sign-of-life bit in the receive telegram not set and the receive telegram is too early.  
 xx = 21 hex = 33 dec:  
 The cyclic telegram has not been received.  
 xx = 22 hex = 34 dec:  
 Timeout in the telegram receive list.  
 xx = 40 hex = 64 dec:  
 Timeout in the telegram send list.  
 xx = 62 hex = 98 dec:  
 Error at the transition to cyclic operation.

**Remedy:**

- check the supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

**237886 <location>HF damping module (CU): Error when sending DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** DRIVE-CLiQ communication error from the damping module to the Control Unit.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex = 65 dec:  
 Telegram type does not match send list.  
**Remedy:** Carry out a POWER ON.

**237887 <location>HF damping module (CU): Component faulted**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component (damping module) involved. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex = 32 dec:  
 Error in the telegram header.  
 xx = 23 hex = 35 dec:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex = 66 dec:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex = 67 dec:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex = 96 dec:  
 Response received too late during runtime measurement.  
 xx = 61 hex = 97 dec:  
 Time taken to exchange characteristic data too long.  
**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

**237895 <location>HF damping module (CU): Alternating cyclic data transmission error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** DRIVE-CLiQ communication error from the damping module to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex = 11 dec:  
 Synchronization error during alternating cyclic data transfer.

**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**237896 <location>HF damping module (CU): Inconsistent component properties**

**Message value:** Component number: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** The properties of the DRIVE-CLiQ component (damping module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.  
 Fault value (r0949, decimal interpretation):  
 Component number.

**Remedy:** - carry out a POWER ON.  
 - when a component is replaced, the same component type and if possible the same firmware version should be used.  
 - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

**237899 <location>HF damping module: Unknown fault**

**Message value:** New message: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY (POWER ON)  
**Cause:** A fault occurred on the damping module that cannot be interpreted by the Control Unit firmware.  
 This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Fault value (r0949, decimal interpretation):  
 Fault number.  
 Note:  
 If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

**Remedy:** - Replace the firmware on the damping module by an older firmware version (r0168).  
 - upgrade the firmware on the Control Unit (r0018).

**237903 <location>HF damping module: I2C bus error occurred**

**Message value:** %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE (IASC/DCBRAKE, OFF1, OFF2, OFF3, STOP1, STOP2)  
**Acknowledge:** IMMEDIATELY  
**Cause:** Communications error with an EEPROM or A/D converter.  
 Fault value (r0949, interpret hexadecimal):  
 80000000 hex:  
 - internal software error.  
 00000001 hex ... 0000FFFF hex:  
 - module fault.

**Remedy:** Re fault value = 80000000 hex:  
 - upgrade firmware to later version.  
 Re fault value = 00000001 hex ... 0000FFFF hex:  
 - replace the module.

### 237999 <location>HF DM: Unknown alarm

**Message value:** New message: %1  
**Drive object:** SERVO, SERVO\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** An alarm has occurred on the damping module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.  
 Alarm value (r2124, interpret decimal):  
 Alarm number.  
 Note:  
 If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.  
**Remedy:** - Replace the firmware on the damping module by an older firmware version (r0168).  
 - upgrade the firmware on the Control Unit (r0018).

### 240000 <location>Fault at DRIVE-CLiQ socket X100

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X100.  
 Fault value (r0949, decimal interpretation):  
 First fault that has occurred for this drive object.  
**Remedy:** Evaluate the fault buffer of the specified object.

### 240001 <location>Fault at DRIVE-CLiQ socket X101

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY  
**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X101.  
 Fault value (r0949, decimal interpretation):  
 First fault that has occurred for this drive object.  
**Remedy:** Evaluate the fault buffer of the specified object.

### 240002 <location>Fault at DRIVE-CLiQ socket X102

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X102.  
Fault value (r0949, decimal interpretation):  
First fault that has occurred for this drive object.

**Remedy:** Evaluate the fault buffer of the specified object.

---

**240003 <location>Fault at DRIVE-CLiQ socket X103**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X103.  
Fault value (r0949, decimal interpretation):  
First fault that has occurred for this drive object.

**Remedy:** Evaluate the fault buffer of the specified object.

---

**240004 <location>Fault at DRIVE-CLiQ socket X104**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X104.  
Fault value (r0949, decimal interpretation):  
First fault that has occurred for this drive object.

**Remedy:** Evaluate the fault buffer of the specified object.

---

**240005 <location>Fault at DRIVE-CLiQ socket X105**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** IMMEDIATELY

**Cause:** A fault has occurred at the drive object at the DRIVE-CLiQ socket X105.  
Fault value (r0949, decimal interpretation):  
First fault that has occurred for this drive object.

**Remedy:** Evaluate the fault buffer of the specified object.

---

**240100 <location>Alarm at DRIVE-CLiQ socket X100**

**Message value:** %1  
**Drive object:** All objects  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** An alarm has occurred at the drive object at the DRIVE-CLiQ socket X100.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:** Evaluate the alarm buffer of the specified object.



---

**240101**            **<location>Alarm at DRIVE-CLiQ socket X101**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            An alarm has occurred at the drive object at the DRIVE-CLiQ socket X101.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:**           Evaluate the alarm buffer of the specified object.

---

**240102**            **<location>Alarm at DRIVE-CLiQ socket X102**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            An alarm has occurred at the drive object at the DRIVE-CLiQ socket X102.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:**           Evaluate the alarm buffer of the specified object.

---

**240103**            **<location>Alarm at DRIVE-CLiQ socket X103**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            An alarm has occurred at the drive object at the DRIVE-CLiQ socket X103.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:**           Evaluate the alarm buffer of the specified object.

---

**240104**            **<location>Alarm at DRIVE-CLiQ socket X104**

**Message value:**    %1

**Drive object:**     All objects

**Reaction:**         NONE

**Acknowledge:**    NONE

**Cause:**            An alarm has occurred at the drive object at the DRIVE-CLiQ socket X104.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:**           Evaluate the alarm buffer of the specified object.

**240105**                    **<location>Alarm at DRIVE-CLiQ socket X105**

**Message value:**        %1

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        NONE

**Cause:**                An alarm has occurred at the drive object at the DRIVE-CLiQ socket X105.  
Alarm value (r2124, interpret decimal):  
First alarm that has occurred for this drive object.

**Remedy:**                Evaluate the alarm buffer of the specified object.

---

**240799**                    **<location>CX32: Configured transfer end time exceeded**

**Message value:**        -

**Drive object:**         All objects

**Reaction:**             NONE

**Acknowledge:**        IMMEDIATELY

**Cause:**                The configured transfer end time when transferring the cyclic actual values was exceeded.

**Remedy:**                - carry out a POWER ON (power off/on) for all components.  
- contact the Hotline.

---

**240801**                    **<location>CX32 DRIVE-CLiQ: Sign-of-life missing**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         All objects

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 0A hex:  
The sign-of-life bit in the receive telegram is not set.

**Remedy:**                - carry out a POWER ON.  
- replace the component involved.  
See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**240820**                    **<location>CX32 DRIVE-CLiQ: Telegram error**

**Message value:**        Component number: %1, fault cause: %2

**Drive object:**         All objects

**Reaction:**             OFF2

**Acknowledge:**        IMMEDIATELY

**Cause:**                A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 01 hex:  
CRC error.  
xx = 02 hex:  
Telegram is shorter than specified in the length byte or in the receive list.  
xx = 03 hex:  
Telegram is longer than specified in the length byte or in the receive list.

---

xx = 04 hex:  
The length of the receive telegram does not match the receive list.

xx = 05 hex:  
The type of the receive telegram does not match the receive list.

xx = 06 hex:  
The address of the component in the telegram and in the receive list do not match.

xx = 07 hex:  
A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

xx = 08 hex:  
No SYNC telegram is expected - but the received telegram is one.

xx = 09 hex:  
The error bit in the receive telegram is set.

xx = 10 hex:  
The receive telegram is too early.

**Remedy:**

- carry out a POWER ON.
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

### 240835 <location>CX32 DRIVE-CLiQ: Cyclic data transfer error

**Message value:** Component number: %1, fault cause: %2

**Drive object:** All objects

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved. The nodes do not send and receive in synchronism.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 21 hex:  
The cyclic telegram has not been received.

xx = 22 hex:  
Timeout in the telegram receive list.

xx = 40 hex:  
Timeout in the telegram send list.

**Remedy:**

- carry out a POWER ON.
- replace the component involved.

See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

### 240836 <location>CX32 DRIVE-CLiQ: Send error for DRIVE-CLiQ data

**Message value:** Component number: %1, fault cause: %2

**Drive object:** All objects

**Reaction:** OFF2

**Acknowledge:** IMMEDIATELY

**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved. Data were not able to be sent.  
Fault value (r0949, interpret hexadecimal):  
yyxx hex: yy = component number, xx = fault cause  
xx = 41 hex:  
Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

---

**240837 <location>CX32 DRIVE-CLiQ: Component fault**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
**Remedy:**  
 - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).  
 - check the electrical cabinet design and cable routing for EMC compliance  
 - if required, use another DRIVE-CLiQ socket (p9904).  
 - replace the component involved.

---

**240845 <location>CX32 DRIVE-CLiQ: Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.  
**Remedy:**  
 Carry out a POWER ON.  
 See also: p9916 (DRIVE-CLiQ data transfer error shutdown threshold slave)

---

**240851 <location>CX32 DRIVE-CLiQ (CU): Sign-of-life missing**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.  
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0A hex:  
 The sign-of-life bit in the receive telegram is not set.  
**Remedy:**  
 Upgrade the firmware of the component involved.

**240860 <location>CX32 DRIVE-CLiQ (CU): Telegram error**

<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.            Fault value (r0949, interpret hexadecimal):            yyxx hex: yy = component number, xx = fault cause</p> <p>xx = 11 hex:            CRC error and the receive telegram is too early.</p> <p>xx = 01 hex:            CRC error.</p> <p>xx = 12 hex:            The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.</p> <p>xx = 02 hex:            Telegram is shorter than specified in the length byte or in the receive list.</p> <p>xx = 13 hex:            The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.</p> <p>xx = 03 hex:            Telegram is longer than specified in the length byte or in the receive list.</p> <p>xx = 14 hex:            The length of the receive telegram does not match the receive list and the receive telegram is too early.</p> <p>xx = 04 hex:            The length of the receive telegram does not match the receive list.</p> <p>xx = 15 hex:            The type of the receive telegram does not match the receive list and the receive telegram is too early.</p> <p>xx = 05 hex:            The type of the receive telegram does not match the receive list.</p> <p>xx = 16 hex:            The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.</p> <p>xx = 06 hex:            The address of the power unit in the telegram and in the receive list do not match.</p> <p>xx = 19 hex:            The error bit in the receive telegram is set and the receive telegram is too early.</p> <p>xx = 09 hex:            The error bit in the receive telegram is set.</p> <p>xx = 10 hex:            The receive telegram is too early.</p>
<b>Remedy:</b>	<ul style="list-style-type: none"> <li>- carry out a POWER ON.</li> <li>- check the electrical cabinet design and cable routing for EMC compliance</li> <li>- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).</li> </ul> <p>See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)</p>

**240885 <location>CX32 DRIVE-CLiQ (CU): Cyclic data transfer error**

<b>Message value:</b>	Component number: %1, fault cause: %2
<b>Drive object:</b>	All objects
<b>Reaction:</b>	OFF2
<b>Acknowledge:</b>	IMMEDIATELY
<b>Cause:</b>	<p>A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.            The nodes do not send and receive in synchronism.            Fault value (r0949, interpret hexadecimal):            yyxx hex: yy = component number, xx = fault cause</p> <p>xx = 1A hex:            Sign-of-life bit in the receive telegram not set and the receive telegram is too early.</p>

xx = 21 hex:  
The cyclic telegram has not been received.  
xx = 22 hex:  
Timeout in the telegram receive list.  
xx = 40 hex:  
Timeout in the telegram send list.  
xx = 62 hex:  
Error at the transition to cyclic operation.

**Remedy:**

- check the power supply voltage of the component involved.
- carry out a POWER ON.
- replace the component involved.

See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

**240886 <location>CX32 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.  
 Data were not able to be sent.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 41 hex:  
 Telegram type does not match send list.

**Remedy:** Carry out a POWER ON.

**240887 <location>CX32 DRIVE-CLiQ (CU): Component fault**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 20 hex:  
 Error in the telegram header.  
 xx = 23 hex:  
 Receive error: The telegram buffer memory contains an error.  
 xx = 42 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 43 hex:  
 Send error: The telegram buffer memory contains an error.  
 xx = 60 hex:  
 Response received too late during runtime measurement.  
 xx = 61 hex:  
 Time taken to exchange characteristic data too long.

**Remedy:**

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

---

**240895 <location>CX32 DRIVE-CLiQ (CU): Cyclic data transfer error**

**Message value:** Component number: %1, fault cause: %2  
**Drive object:** All objects  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.  
 Fault value (r0949, interpret hexadecimal):  
 yyxx hex: yy = component number, xx = fault cause  
 xx = 0B hex:  
 Synchronization error during alternating cyclic data transfer.  
**Remedy:** Carry out a POWER ON.  
 See also: p9915 (DRIVE-CLiQ data transfer error shutdown threshold master)

---

**249150 <location>Cooling system: Fault occurred**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The cooling system signals a general fault.  
**Remedy:** - check the wiring between the cooling system and the input terminal (Terminal Module).  
 - check the external control device for the cooling system.  
 See also: p0266 (Cooling system, feedback signals, signal source)

---

**249151 <location>Cooling system: Conductivity has exceeded the fault threshold**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The conductivity of the cooling liquid has exceeded the selected fault threshold (p0269[2]).  
 See also: p0261 (Cooling system, starting time 2), p0262 (Cooling system, fault conductivity delay time), p0266 (Cooling system, feedback signals, signal source)  
**Remedy:** Check the device to de-ionize the cooling liquid.

---

**249152 <location>Cooling system: ON command feedback signal missing**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The feedback signal of the ON command of the cooling system is missing.  
 - after the ON command, the feedback signal has not been received within the selected starting time (p0260).  
 - the feedback signal has failed in operation.  
 See also: p0260 (Cooling system, starting time 1), r0267 (Cooling system status word)  
**Remedy:** - check the wiring between the cooling system and the input terminal (Terminal Module).  
 - check the external control device for the cooling system.

---

**249153 <location>Cooling system: Liquid flow too low**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The drive converter cooling system signals that the cooling liquid flow is too low.  
- after the ON command, the feedback signal has not been received within the selected starting time (p0260).  
- in operation, the feedback signal has failed for longer than the permitted failure time (p0263).  
See also: p0260 (Cooling system, starting time 1), p0263 (Cooling system fault liquid flow, delay time), r0267 (Cooling system status word)  
**Remedy:** - check the wiring between the cooling system and the input terminal (Terminal Module).  
- check the external control device for the cooling system.

---

**249154 <location>Cooling system: Liquid leak is present**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The liquid leakage monitoring function has responded.  
Caution:  
If this fault is re-parameterized as an alarm then using other monitoring functions it must be ensured that when cooling water is lost, the drive is powered down!  
See also: r0267 (Cooling system status word)  
**Remedy:** - check the cooling system for leaks in the cooling circuit.  
- check the wiring of the input terminal (Terminal Module) used to monitor leaking fluid.

---

**249155 <location>Cooling system: Power Stack Adapter, firmware version too old**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** POWER ON  
**Cause:** The firmware version in the Power Stack Adapter (PSA) is too old and does not support the liquid cooling.  
**Remedy:** Upgrade the firmware. Check EEPROM data.

---

**249156 <location>Cooling system: Cooling liquid temperature has exceeded the fault threshold**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The cooling liquid intake temperature has exceeded the permanently set fault threshold.  
**Remedy:** Check the cooling system and the ambient conditions.



---

**249170 <location>Cooling system: Alarm has occurred**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The cooling system signals a general alarm.  
**Remedy:** - check the wiring between the cooling system and the input terminal (Terminal Module).  
- check the external control device for the cooling system.

---

**249171 <location>Cooling system: Conductivity has exceeded the alarm threshold**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The conductivity of the cooling liquid has exceeded the selected alarm threshold (p0269[1]).  
The threshold cannot be set higher than the fault threshold specified in the equipment description.  
**Remedy:** Check the device to de-ionize the cooling liquid.

---

**249171 <location>Cooling system: Conductivity has exceeded the alarm threshold**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** Conductivity monitoring is set for the cooling liquid (r0267.7, from p0266[7]).  
See also: p0261 (Cooling system, starting time 2), p0262 (Cooling system, fault conductivity delay time), p0266 (Cooling system, feedback signals, signal source), r0267 (Cooling system status word)  
**Remedy:** Check the device to de-ionize the cooling liquid.

---

**249172 <location>Cooling system: Conductivity actual value is not valid**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** When monitoring the conductivity of the cooling liquid, there is a fault in the wiring or in the sensor.  
**Remedy:** - check the wiring between the cooling system and the Power Stack Adapter (PSA).  
- check the function of the sensor to measure the conductivity.

---

**249173 <location>Cooling system: Cooling liquid temperature has exceeded the alarm threshold**

**Message value:** -  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The cooling liquid intake temperature has exceeded the specified alarm threshold.  
**Remedy:** Check the cooling system and the ambient conditions.

---

**249200 <location>Excitation group signal fault**

**Message value:** %1  
**Drive object:** VECTOR  
**Reaction:** OFF2  
**Acknowledge:** IMMEDIATELY  
**Cause:** The excitation sequence control signals a fault.  
 Fault value (r0949, interpret hexadecimal):  
 Bit 0:  
 When powered down or when powering down the excitation, the signal "excitation ready feedback signal" was not received within the monitoring time.  
 Bit 1:  
 After an ON command, the signal "excitation ready feedback signal" was not received within the monitoring time.  
 Bit 2:  
 After the pulses were enabled, the signal "excitation operational feedback signal" was not received within the monitoring time.  
 Bit 3:  
 The "excitation group signal fault" signal is present.  
**Remedy:** - check the excitation.  
 - check commands, feedback signals and BICO interconnections.

---

**249201 <location>Excitation group signal alarm**

**Message value:** -  
**Drive object:** VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** The "excitation group signal alarm" signal is present.  
**Remedy:** Check the excitation equipment.

---

**250001 <location>COMM BOARD: Alarm 1**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** CBE20: A PROFINET controller attempts to establish a connection using an incorrect configuring telegram. The "Shared Device" function has been activated (p8829 = 2).  
 Alarm value (r2124, interpret decimal):  
 10: A CPU sends a PROFI-safe telegram.  
 11: F CPU sends a PZD telegram.  
 12: F CPU without an A CPU.  
 13: F CPU with more PROFI-safe subslots than activated with p9601.3.  
 14: F CPU with fewer PROFI-safe subslots than activated with p9601.3.  
 See also: p8829 (CBE20 remote controller number), p9601 (SI enable, functions integrated in the drive (Control Unit))

**Remedy:** CBE20: Check the configuration of the PROFINET controllers, as well as the p8829 and p9601.3 settings.

**250002 <location>COMM BOARD: Alarm 2**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of CBE20 SINAMICS Link:  
 A specific telegram word (send) is being used twice.  
 Alarm value (r2124, interpret decimal):  
 Telegram word used twice  
 See also: p8871 (SINAMICS Link send telegram word PZD)

**Remedy:** In the case of CBE20 SINAMICS Link:  
 Correct the parameter assignment.  
 See also: p8871 (SINAMICS Link send telegram word PZD)

**250003 <location>COMM BOARD: Alarm 3**

**Message value:** Info. 1: %1, info. 2: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of CBE20 SINAMICS Link:  
 A specific telegram word (receive) is being used twice.  
 Alarm value (r2124, interpret hexadecimal):  
 yyyyxxx hex: yyyy = info. 1, xxx = info. 2  
 Info. 1 (interpret decimal) = Address of sender  
 Info. 2 (interpret decimal) = Receive telegram word  
 See also: p8870 (SINAMICS Link receive telegram word PZD), p8872 (SINAMICS Link address receive PZD)

**Remedy:** In the case of CBE20 SINAMICS Link:  
 Correct the parameter assignment.

**250004 <location>COMM BOARD: Alarm 4**

**Message value:** Info. 1: %1, info. 2: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE

**Cause:** In the case of CBE20 SINAMICS Link:  
Telegram word (receive) and address of sender inconsistent. Both values have to be either equal to zero or not equal to zero.  
Alarm value (r2124, interpret hexadecimal):  
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2  
Info. 1 (interpret decimal) = Drive object number from p8870, p8872  
Info. 2 (interpret decimal) = Index from p8870, p8872  
See also: p8870 (SINAMICS Link receive telegram word PZD), p8872 (SINAMICS Link address receive PZD)

**Remedy:** In the case of CBE20 SINAMICS Link:  
Correct the parameter assignment.

---

**250005 <location>COMM BOARD: Alarm 5**

**Message value:** %1  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of CBE20 SINAMICS Link:  
Sender not found on SINAMICS Link.  
Alarm value (r2124, interpret decimal):  
Address of sender that cannot be located  
See also: p8872 (SINAMICS Link address receive PZD)

**Remedy:** In the case of CBE20 SINAMICS Link:  
Check the connection to the sender.

---

**250006 <location>COMM BOARD: Alarm 6**

**Message value:** Info. 1: %1, info. 2: %2  
**Drive object:** A\_INF, AFE\_SINUMERIK, B\_INF, BIC\_SINUMERIK, S\_INF, SERVO, SERVO\_SINUMERIK, SIC\_SINUMERIK, TM41, VECTOR  
**Reaction:** NONE  
**Acknowledge:** NONE  
**Cause:** In the case of CBE20 SINAMICS Link:  
The parameter assignment indicates that the sender and the receiver are one and the same. This is not permitted.  
Alarm value (r2124, interpret hexadecimal):  
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2  
Info. 1 (interpret decimal) = Drive object number from p8872  
Info. 2 (interpret decimal) = Index from p8872  
See also: p8836 (SINAMICS Link address), p8872 (SINAMICS Link address receive PZD)

**Remedy:** In the case of CBE20 SINAMICS Link:  
Correct the parameter assignment. All p8872[index] must be set to a value not equal to p8836.

---

<b>250020</b>	<b>&lt;location&gt;COMM BOARD: Alarm 20</b>
<b>Message value:</b>	-
<b>Drive object:</b>	A_INF, AFE_SINUMERIK, B_INF, BIC_SINUMERIK, CU_S_CU310DP, CU_S_CU310PN, CU_S_CU320_DP, CU_S_CU320_PN, ENCODER, ENCSINUMERIK, HUB, S_INF, SERVO, SERVO_SINUMERIK, SIC_SINUMERIK, TB30, TM120, TM15, TM15DI_DO, TM17, TM31, TM41, TM54F_MA, TM54F_SL, VECTOR
<b>Reaction:</b>	NONE
<b>Acknowledge:</b>	NONE
<b>Cause:</b>	CBE20: The PROFINET "Shared Device" function has been activated (p8829 = 2). However, only the connection to a PROFINET controller is present. See also: p8829 (CBE20 remote controller number)
<b>Remedy:</b>	CBE20: Check the configuration of the PROFINET controllers, as well as the p8829 setting.



## Drive and I/O alarms

---

### 300406 **Problem in the non-cyclic communication for basic address %1, additional information %2, %3, %4**

<b>Definitions:</b>	For PROFIdrive only: A problem occurred during the non-cyclic communication with the logical start address. The additional information defines the location of the problem. If the logical start address 0 is output, only the additional information is relevant.
<b>Reaction:</b>	Alarm display. Warning display.
<b>Remedy:</b>	Please inform the authorized personnel/service department. The alarm can be suppressed with MD11411 \$MN_ENABLE_ALARM_MASK bit 1 = 0 Place a support request with the error text under: <a href="http://www.siemens.com/automation/support-request">http://www.siemens.com/automation/support-request</a>
<b>Program Continuation:</b>	Clear alarm with the Delete key or NC START.

---

### 300410 **Axis %1 drive %2 error when storing a file (%3, %4)**

<b>Parameters:</b>	%1 = NC axis number %2 = Drive number %3 = Error code 1 %4 = Error code 2
<b>Definitions:</b>	An attempt to save a data block, e. g. the result of a measuring function, in the file system has failed. On error code 1 == 291: An error occurred during preparation of the ACC information. Basic information prepared on the drive contains an error or has an unknown format. On error code 1 == 292: Memory shortage during preparation of the ACC information.
<b>Reaction:</b>	Interface signals are set. Alarm display.
<b>Remedy:</b>	- Please inform the authorized personnel/service department. - Create more space in the file system. It is normally sufficient to delete 2 NC programs or to free 4 - 8 Kbytes of memory. If these remedies do not work, it will be necessary to increase the number of files per directory or the size of the file system itself (this will require a complete data backup). - Change settings of machine data - 18280 \$MM_NUM_FILES_PER_DIR - 18320 \$MM_NUM_FILES_IN_FILESYSTEM - 18350 \$MM_USER_FILE_MEM_MINIMUM - and, if necessary, of - 18270 \$MM_NUM_SUBDIR_PER_DIR, - 18310 \$MM_NUM_DIR_IN_FILESYSTEM, - Power On - Reload saved data - On error code 1 == 291: Replace the drive software and use version with suitable ACC basic information. - On error code 1 == 292: Replace the drive software and use fewer different versions of the drive software.
<b>Program Continuation:</b>	Clear alarm with the RESET key. Restart part program

---

### 300411 **Axis %1 drive %2 error when reading a file (%3, %4)**

<b>Parameters:</b>	%1 = NC axis number %2 = Drive number %3 = Error code 1 %4 = Error code 2
--------------------	--

**Definitions:** An attempt to read a data block, e.g. a drive boot file, from the file system has failed. The data block or the file system is damaged.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** If the error occurred during power-up, i.e. it is probably connected to a drive boot file, delete all boot files and load them back into the control from the back-up copy.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**300412 Error when storing a file (%1, %2)**

**Parameters:** %1 = Error code 1  
%2 = Error code 2

**Definitions:** An attempt to save a data block, e.g. the result of a measuring function, in the file system has failed.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** Please inform the authorized personnel/service department. Create more space in the file system. It is normally sufficient to delete 2 NC programs or to free 4 - 8 Kbytes of memory. If these remedies do not work, it will be necessary to increase the number of files per directory or the size of the file system itself. To do so, proceed as follows:

- Save all data
- Change settings of machine data
- 18280 \$MM\_NUM\_FILES\_PER\_DIR
- 18320 \$MM\_NUM\_FILES\_IN\_FILESYSTEM
- 18350 \$MM\_USER\_FILE\_MEM\_MINIMUM
- and, if necessary, of
- 18270 \$MM\_NUM\_SUBDIR\_PER\_DIR
- 18310 \$MM\_NUM\_DIR\_IN\_FILESYSTEM
- Power On
- Reload saved data

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**300413 Error when reading a file (%1, %2)**

**Parameters:** %1 = Error code 1  
%2 = Error code 2

**Definitions:** An attempt to read a data block, e.g. a drive boot file, from the file system has failed. The data block or the file system is damaged.

**Reaction:** Interface signals are set.  
Alarm display.

**Remedy:** If the error occurred during power-up, i.e. it is probably connected to a drive boot file, delete all boot files and load them back into the control from the back-up copy.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

---

**300423 Measuring result could not be read (%1)**

**Parameters:** %1 = Error code

**Definitions:** An attempt to read a measurement result has failed:

- Error code = 4: Not enough space for test result
- Error code = 16: Measurement not yet finished

**Reaction:** Interface signals are set.  
Alarm display.



**Remedy:** Repeat measurement. Alter measuring time if necessary.  
**Program** Clear alarm with the RESET key. Restart part program  
**Continuation:**

### 380001 PROFIBUS/PROFINET: Startup error, reason %1 parameter %2 %3 %4.

**Parameters:** %1 = Cause of the error  
 %2 = Parameter 1  
 %3 = Parameter 2  
 %4 = Parameter 3

**Definitions:** An error occurred during startup of the PROFIBUS/PROFINET master.  
 Overview: Cause of the error, Par 1, Par 2, Par 3:  
 - 01 = DPM version, DPM version, DPA version, --  
 - 02 = DPM ramp-up timeout, DPM actual value status, DPM setpoint value status, --  
 - 03 = DPM ramp-up status, DPM actual value status, DPM setpoint value status, DPM error code  
 - 04 = DPM ramp-up error, DPM actual value status, DPM setpoint value status, DPM error code  
 - 05 = DPM-PLL sync error, --, --, --  
 - 07 = Alarm queue too long, Actual number, Setpoint number, --  
 - 08 = Unknown client, Client ID, --, --  
 - 09 = Client version, Client ID, Client version, DPA version  
 - 10 = Too many clients, Client number, max. number of clients, --  
 - 11 = Log.basic address used several times; bus no.; slot no.; log.basic address --  
 - 20 = Slave/device address used several times, slave/device address --  
 - 21 = Slave/device address unknown, slave/device address, --  
 - 22 = Erroneous configuration telegram, slave/device address, error code, --  
 - 23 = OMI incompatible (data), drive version, CDA version, --, --  
 - 24 = OMI incompatible (driver), drive version, CDA version, --, --  
 - 25 = CPI initialization failed, error code, --, --, --  
 - 26 = DMA not active  
 - 27 = Reserved  
 - 28 = Reserved  
 - 29 = Reserved  
 - The 1000s digit of the error cause = number of the affected bus  
 - (Special case: Error causes in the 5000 range indicate problems with the NCU-LINK communication)  
 Clients are the following components of the control system that use the PROFIBUS/PROFINET:  
 Client ID = 1: PLC  
 Client ID = 2: NCK  
 Possible causes are:  
 - Error in contents of SDB  
 - Corruption of parts of the system program  
 - Hardware defect on NC component

**Reaction:** Channel not ready.  
 NC Start disable in this channel.  
 Interface signals are set.  
 Alarm display.

**Remedy:** Remedy for 1-11  
 1. Check the control project, check MD11240 \$MN\_PROFIBUS\_SDB\_NUMBER, and reload it when using a user-specific SDB.  
 2. If the error still occurs, back up data, and restart the control with the standard values as per the as-delivered condition.  
 3. In case of correct ramp-up, reload the user data stage by stage.  
 4. If the error still occurs during ramp-up with standard values, reboot the system from the PC card or update the software.  
 5. If the error still occurs, replace the hardware.  
 Remedy for 20-21  
 1. Check/correct the addresses of the connected slaves/devices.

Remedy for 22

See SINAMICS warning 1903 for a description of the meaning behind the error codes.

1. Control the SDB
  - Check the type and length of the message frame
  - Match slot assignment with P978
2. Evaluate the drive alarms/warnings

Remedy for 23-24

1. Software replacement required

Remedy for 25

1. Change the message frame type
2. Reduce the number of slots
3. Reduce the number of slaves/devices
4. Create a new SDB
5. Software must be replaced

If the error has still not been able to be rectified after this procedure, send the error text to the control manufacturer.

Switch control OFF - ON.

**Program  
Continuation:**

---

**380003 PROFIBUS/PROFINET: Operating error, reason %1 parameter %2 %3 %4.**

- Parameters:**
- %1 = Cause of the error
  - %2 = Parameter 1
  - %3 = Parameter 2
  - %4 = Parameter 3

- Definitions:**
- An operating error occurred on the PROFIBUS/PROFINET in cyclic mode.
- Overview: Cause of the error, Par 1, Par 2, Par 3:
- 01 = unknown alarm, alarm class, logical address, --
  - 02 = DPM cycle timeout, DPM actual value status, DPM setpoint value status, --
  - 03 = DPM cycle status, DPM actual value status, DPM setpoint value status, DPM error code
  - 04 = DPM cycle error, DPM actual value status, DPM setpoint value status, DPM error code
  - 05 = Client not registered, client number, max. number of clients, --
  - 06 = Synchronization error, number of sync violation, --, --
  - 07 = Spinlock timeout, PLC spinlock, NCK spinlock, --
  - 1000s digit of the error cause = number of the affected bus
  - (Special case: Error causes in the 5000 range indicate problems with the NCU-LINK communication)
- Alarm class: (see alarm 380 060)

The following can be primary causes:

- For error cause 01: Data transfer error on the PROFIBUS/PROFINET
- For error causes 02, 03, 04: Error in contents of SDB
- For error causes 02, 03, 04, 05, 07: Corruption of parts of system program
- For error cause 06: The PCI bus cycle does not match the expected rate, so synchronization is not possible. The correct PCI bus cycle must be entered.

The error can also be caused by a hardware problem on the MCI module.

- Reaction:**
- Channel not ready.
  - NC Start disable in this channel.
  - Interface signals are set.
  - Alarm display.

- Remedy:**
- For error cause 01:
    - Check the electrical and fault-related specifications for PROFIBUS/PROFINET, assess the cable installation
    - Check the terminating resistors of the PROFIBUS connectors (ON setting at ends of cables, otherwise OFF setting required)
    - Check slave/device
  - For error causes 02, 03, 04:
    - Check SDB
    - For error causes 02, 03, 04, 05, 07:
      - Follow the procedure described for troubleshooting alarm 380 001
  - For error cause 06:
    - The correct PCI bus cycle must be entered.
- If the error cannot be eliminated by this procedure, send the error text to the control system manufacturer.

**Program Continuation:** Clear alarm with the RESET key. Restart part program

### 380005 PROFIBUS/PROFINET: Bus %3 access conflict, type %1, counter %2

**Parameters:** %1 = Conflict type  
%2 = Serial number within a conflict sequence  
%3 = Number of the affected bus

**Definitions:** An access conflict occurred on the PROFIBUS/PROFINET in cyclic mode: An attempt has been made in the NCK to write data to the bus or to read from the bus while cyclic data transfer was active. This may lead to inconsistent data.  
Type 1: NCK attempts to read data before the cyclic transfer has finished on the bus.  
Type 2: The NCK has not finished writing its data when the cyclic transfer begins again. Counter %2 contains a serial number starting at 1. A maximum of 10 alarms are output in succession. If no conflicts occur in a DP cycle, the counter is reset and new alarms are output again on the next conflict.

**Reaction:** Alarm display.

**Remedy:** - Check the timing again, in particular ensure that the settings in MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME and MD10062 \$MN\_POSCTRL\_CYCLE\_DELAY are correct:  
MD10062 \$MN\_POSCTRL\_CYCLE\_DELAY must be larger for type 1.  
MD10062 \$MN\_POSCTRL\_CYCLE\_DELAY must be smaller for type 2.  
- If alarm-free operation cannot be achieved with any MD10062 \$MN\_POSCTRL\_CYCLE\_DELAY setting, MD10050 \$MN\_SYSCLOCK\_CYCLE\_TIME must be increased.  
- If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.

**Program Continuation:** Clear alarm with the Delete key or NC START.

### 380020 PROFIBUS/PROFINET: Bus %3 SDB %4 error %1 source %2

**Parameters:** %1 = Error  
%2 = SDB source  
%3 = Bus number  
%4 = SDB number

**Definitions:** Error in SDB for configuring PROFIBUS/PROFINET.  
Causes of the error:  
- 01 = SDB does not exist in source.  
- 02 = SDB from source is too large.  
- 03 = SDB from source cannot be activated.  
- 04 = Source is empty.  
- 05 = Source is not present.  
SDB source:  
- 99 = Passive file system: \_N\_SDB\_DIR  
- 100 = CF card: /siemens/sinumerik/sdb/...  
- 101 = CF card: /addon/sinumerik/sdb/...  
- 102 = CF card: /oem/sinumerik/sdb/...  
- 103 = CF card: /user/sinumerik/sdb/...  
Reaction: PROFIBUS/PROFINET is inactive or working with the default SDB.

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** - Check the setting of MD 11240 \$MN\_PROFIBUS\_SDB\_NUMBER.  
- If source = 100: Check directory \_N\_SDB\_DIR in the passive file system.  
- If source = 103-106: Check directories on CF card

**Program Continuation:** Switch control OFF - ON.

---

**380021 Profibus-DP: default SDB-Type-2000 was loaded**

**Definitions:** No user-specific SDB available.  
The default SDB was loaded during start-up.  
The NC is ready for setup even without process peripherals.  
The alarm is triggered the first time the NC is switched on, or once, if the SDB stored in the supported RAM is lost.

**Reaction:** Alarm display.

**Remedy:** Generate user-specific SDB and load it into the control system, or select and activate standard SDB via MD11240 \$MN\_PROFIBUS\_SDB\_NUMBER.  
Restart the NC.  
If the error occurs again when the NC is switched on the next time, the loaded SDB is incorrect and must be generated again.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**380022 PROFIBUS/PROFINET: Configuration of DP master bus %1 has been changed**

**Parameters:** %1 = Number of the affected bus

**Definitions:** The PROFIBUS configuration on the DP master was changed during operation, e.g. by downloading a new hardware configuration via STEP 7. As the cycle data may also have changed, operation cannot be continued, and a warm start is required.  
If the master functionality is within the PLC (as on the 840Di), the PLC will have been stopped for the download, and alarm 2000 (PLC sign-of-life) output.

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** NCK restart  
If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.

**Program Continuation:** Switch control OFF - ON.

---

**380040 PROFIBUS/PROFINET: Bus %3, configuration error %1, parameter %2**

**Parameters:** %1 = Cause of the error  
%2 = Parameter  
%3 = Number of the affected bus

**Definitions:** The generation of the PROFIBUS/PROFINET in the SDB does not conform to the configuration specifications of the NC in use.  
Overview: Cause of the error, par 1:  
- 01 = SDB contains slave/device without diagnostics slot, slave/device address  
- 02 = SDB contains too many slot entries, identifier  
- 03 = SDB contains no equidistance data, no function  
- 04 = PNIO: SDB contains different Tdp (also TDC) on one device  
- 05 = PNIO: SDB contains different Tmapc (also CACF) on one device  
- 06 = PNIO: SDB contains different TI on one device  
- 07 = PNIO: SDB contains different TO on one device  
- 08 = PNIO: SDB contains device numbers that are too high (with values higher than 126)  
- 09 = SDB content transferred segmented (too many slots/frames)  
- 10 = Not enough memory space for segmented SDB content (too many slots/frames)

- 11 = The telegram configured in the SDB is too short for the selected telegram acc. to \$MN\_DRIVE\_TELEGRAM\_TYPE.
- 20 = SDB contains too many slaves/devices, quantity
- 21 = SDB missing or contains invalid data, error code
- 22 = SDB configuration data incorrect, slave/device address, error code
- 23 = Reserved
- 24 = Reserved
- 25 = Reserved
- 26 = Reserved
- 27 = Reserved
- 28 = Reserved
- 29 = Reserved

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Check that the corresponding SDB:  
- Contains a diagnostic slot for every slave/device  
- Contains only slave/device entries relevant to the application  
In principle, it is possible to include a superset of slaves/devices in the SDB that are partially relevant for different end versions of the product. However, this overloads the NC memory and runtime capacity and should, therefore, always be avoided.  
If this alarm occurs, reduce the SDB to a minimum.  
If the code for the error cause is 03, check that equidistance is activated in the SDB (e.g. using STEP 7 HW config).  
If the code for the error cause is 10, reduce the number of slaves/slots on the bus concerned (e.g. using STEP 7 HW config).  
If the alarm continues to occur, please send the error text to the control system manufacturer.  
If the code for the error cause is 11, select a larger telegram as appropriate using STEP 7 HW config or select a smaller telegram under \$MN\_DRIVE\_TELEGRAM\_TYPE.

**Program Continuation:** Switch control OFF - ON.

---

### 380050 PROFIBUS/PROFINET: Multiple assignment of inputs on address %1

**Parameters:** %1 = Logical address

**Definitions:** Multiple assignments of input data have been detected in the logical address space. Logical address: Base address of the address area defined several times

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The address partitioning should be checked as follows:  
Check for multiple assignments in the following machine data:  
- MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS[0] - MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS[n-1] : n = highest axis index on control system  
- MD12970 \$MN\_PLC\_DIG\_IN\_LOGIC\_ADDRESS, MD12971 \$MN\_PLC\_DIG\_IN\_NUM : PLC address area for digital inputs  
- MD12978 \$MN\_PLC\_ANA\_IN\_LOGIC\_ADDRESS, MD12979 \$MN\_PLC\_ANA\_IN\_NUM : PLC address area for analog inputs  
If no inconsistencies can be found in the parameters, compare these machine data with the configuration in SDB (STEP 7 project). In particular, check that the lengths configured for the individual slots do not result in area overlaps. When you find the cause of the error, change the machine data and/or SDB.

**Program Continuation:** Switch control OFF - ON.

---

**380051 PROFIBUS/PROFINET: Multiple assignment of outputs on address %1**

**Parameters:** %1 = Logical address

**Definitions:** Multiple assignments of input data have been detected in the logical address space. Logical address: Base address of the address area defined several times

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** The address partitioning should be checked as follows:  
Check for multiple assignments in the following machine data:  
- MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS[0] - MD13050 \$MN\_DRIVE\_LOGIC\_ADDRESS [n-1] : n = highest axis index on control system  
- MD12974 \$MN\_PLC\_DIG\_OUT\_LOGIC\_ADDRESS, MD12975 \$MN\_PLC\_DIG\_OUT\_NUM : PLC address area for digital outputs  
- MD12982 \$MN\_PLC\_ANA\_OUT\_LOGIC\_ADDRESS, MD12983 \$MN\_PLC\_ANA\_OUT\_NUM : PLC address area for analog outputs  
If no inconsistencies can be found in the parameters, compare these machine data with the configuration in the SDB (STEP 7 project). In particular, check that the lengths configured for the individual slots do not result in area overlaps. When you find the cause of the error, change the machine data and/or SDB.

**Program Continuation:** Switch control OFF - ON.

---

**380060 PROFIBUS/PROFINET: Alarm %1 on logical address %2 from unassigned slave/device**

**Parameters:** %1 = Alarm class  
%2 = Logical address

**Definitions:** SDB contains a slave/device which is not assigned in the NC via the MD parameters (see also alarm 380050/051). The slave/device is however connected to the PROFIBUS/PROFINET, and has reported an alarm.  
Alarm class:  
- 01 = Station return (or arrival)  
- 02 = Station failure  
Display alarm, further operation with the NC is possible.

**Reaction:** Alarm display.

**Remedy:** - Enter machine data or  
- Modify SDB or  
- Disconnect the slave/device from the PROFIBUS/PROFINET or  
- Acknowledge the alarm.

**Program Continuation:** Clear alarm with the Delete key or NC START.

---

**380070 PROFIBUS/PROFINET: No input slot available for basic address %1 (length %2)**

**Parameters:** %1 = Logical base address of the requested area  
%2 = Size of the area in bytes

**Definitions:** An incorrect logical base address was specified for a digital or analog input. Either no slot has been configured for this base address or the requested area extends beyond the end of the slot.  
Length=1 indicates a digital input.  
Length=2 indicates a analog input.

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

---

**Remedy:** Enter correct base addresses in the machine data:  
- For length=1: Correct machine data MN\_HW\_ASSIGN\_DIG\_FASTIN.  
- For length=2: Correct machine data MN\_HW\_ASSIGN\_ANA\_FASTIN.  
- NCK restart  
If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.

**Program Continuation:** Switch control OFF - ON.

---

---

### **380071 PROFIBUS/PROFINET: No output slot available for basic address %1 (size %2)**

**Parameters:** %1 = Logical base address of the requested area  
%2 = Size of the area in bytes

**Definitions:** An incorrect logical base address was specified for a digital or analog input. Either no slot has been configured for this base address or the requested area extends beyond the end of the slot.  
For length =1 it is a digital output,  
For length =2 it is an analog output.

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Enter correct base addresses in the machine data:  
- For length=1: Correct machine data MN\_HW\_ASSIGN\_DIG\_FASTOUT.  
- For length=2: Correct machine data MN\_HW\_ASSIGN\_ANA\_FASTOUT.  
- NCK restart  
If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.

**Program Continuation:** Switch control OFF - ON.

---

---

### **380072 PROFIBUS/PROFINET: Output slot for basic address %1 (size %2) not allowed**

**Parameters:** %1 = Logical base address of the requested area  
%2 = Size of the area in bytes

**Definitions:** An incorrect logical base address was set for a digital or analog output, the area resides in the access range of the PLC (PIQ, base addresses < 256).  
For length =1 it is a digital output,  
For length =2 it is an analog output.

**Reaction:** Channel not ready.  
NC Start disable in this channel.  
Interface signals are set.  
Alarm display.

**Remedy:** Only use addresses outside the PLC process image (e.g. >= 256) for output slots.  
Enter correct basic addresses in the machine data:  
- For length=1: Correct machine data MN\_HW\_ASSIGN\_DIG\_FASTOUT.  
- For length=2: Correct machine data MN\_HW\_ASSIGN\_ANA\_FASTOUT.  
- NCK restart  
If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.

**Program Continuation:** Switch control OFF - ON.

---

---

**380075 PROFIBUS/PROFINET: DP I/O failure bus %2 slave/device %1**

**Parameters:** %1 = Slave/device address  
%2 = Number of the affected bus

**Definitions:** Failure of a PROFIBUS/PROFINET slot used by the NCK for digital or analog I/Os.

**Reaction:** Alarm display.

**Remedy:** Check that the slave/device is operating correctly (all slaves/devices must be included in the bus, green LEDs).

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**380076 PROFIBUS/PROFINET: No DO1 message frame: Bus %2 slave/device %1**

**Parameters:** %1 = Slave/device address  
%2 = Number of the affected bus

**Definitions:** Note for the system setup engineer: A PROFIBUS slave/PROFINET device used as an NCK drive does not have a valid DO1 message frame assignment (see MD13120 \$MN\_CONTROL\_UNIT\_LOGIC\_ADDRESS with the STEP 7 configuration).  
This alarm is indicating, among other things, that the alarm time-of-day synchronization is not working between the controller and this slave/device.

**Reaction:** Alarm display.

**Remedy:** Enter a valid value in MD13120 \$MN\_CONTROL\_UNIT\_LOGIC\_ADDRESS.

**Program Continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

---

**380077 PROFIBUS/PROFINET: Too many DOs: Currently minimum %2, maximum %3 in DO group %1**

**Parameters:** %1 = DO group  
%2 = Current number of DOs  
%3 = Maximum permissible number of DOs

**Definitions:** Note for the system setup engineer: The number of equivalent DOs ("drive objects" group) on all busses (configured and connected) exceeds predefined limit values.  
The services linked to these DOs (e.g. time synchronization, alarm display, HMI diagnostics, HMI data archiving) can no longer be guaranteed for all DOs in this group.  
The following different DO groups exist (see parameter %1):  
0 = Device (CU, DO1)  
1 = Communications (CU-LINK)  
2 = Drive (SERVO, VECTOR)  
3 = Infeed (ALM etc.)  
4 = Terminal block (TB)  
5 = Terminal module (TM)

**Reaction:** Alarm display.

**Remedy:** Reduce the number of devices (containing DOs of this type) on the bus.  
Use a more powerful type of controller (one which supports more DOs).

**Program Continuation:** Switch control OFF - ON.

---

**380500 PROFIBUS/PROFINET: Fault on drive %1, code %2, value %3, time %4**

**Parameters:** %1 = Axis  
%2 = Fault code of drive (P947/(945)/P824)  
%3 = Fault value of drive ((P949/P826)  
%4 = Fault time of drive (P948/P825)



---

**Definitions:** Contents of fault memory of assigned drive.  
**Reaction:** Alarm display.  
**Remedy:** See drive documentation for fault codes/fault values.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

---

---

**380501 PROFIBUS/PROFINET: Fault on bus, slave/device, DO ID %1, code %2, value %3, time %4**

**Parameters:** %1 = 8 bit bus number, 8 bit slave/device number, 16 bit DO ID  
%2 = Fault code of drive (P947)  
%3 = Fault value of the drive (P949)  
%4 = Fault time of the drive (P948)

**Definitions:** Contents of the fault memory of the assigned slave/device.  
**Reaction:** Alarm display.  
**Remedy:** See drive documentation for fault codes/fault values.  
**Program** Alarm display showing cause of alarm disappears. No further operator action necessary.  
**Continuation:**

---

---

**380502 PROFIBUS/PROFINET: Bus %1, slave/device %2 configuration changed**

**Parameters:** %1 = Bus number  
%2 = Slave/device address

**Definitions:** The bus configuration has changed.  
Causes:  
- First commissioning  
- New slave/device recognized on the bus

**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** In order to operate the bus with the new configuration, an additional restart will be required.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**380503 PROFIBUS/PROFINET: Bus %1 configuration changed**

**Parameters:** %1 = Bus number  
**Definitions:** A new SDB with a modified configuration has been provided.  
The new settings will be activated only at the next bus power up.  
**Reaction:** Interface signals are set.  
Alarm display.  
**Remedy:** In order to operate the bus with the new configuration, an additional restart will be required.  
**Program** Switch control OFF - ON.  
**Continuation:**



## PLC alarms

---

### 400102 Delete DB 2 in the PLC and restart

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

### 400103 Delete DB 3 in the PLC and restart

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

### 400106 Delete DB 6 in the PLC and restart

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

### 400109 Delete DB 9 in the PLC and restart

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

### 400110 Delete DB 10 in the PLC and restart

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400111**            **Delete DB 11 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400120**            **Delete DB 20 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400121**            **Delete DB 21 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400122**            **Delete DB 22 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400123**            **Delete DB 23 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400124**            **Delete DB 24 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

---

**400125 Delete DB 25 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400126 Delete DB 26 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400127 Delete DB 27 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400128 Delete DB 28 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400129 Delete DB 29 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400130 Delete DB 30 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

---

**400131**            **Delete DB 31 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400132**            **Delete DB 32 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400133**            **Delete DB 33 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400134**            **Delete DB 34 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400135**            **Delete DB 35 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400136**            **Delete DB 36 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

---

**400137 Delete DB 37 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400138 Delete DB 38 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400139 Delete DB 39 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400140 Delete DB 40 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400141 Delete DB 41 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400142 Delete DB 42 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400143**            **Delete DB 43 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400144**            **Delete DB 44 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400145**            **Delete DB 45 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400146**            **Delete DB 46 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400147**            **Delete DB 47 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400148**            **Delete DB 48 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---



---

**400149 Delete DB 49 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400150 Delete DB 50 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400151 Delete DB 51 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400152 Delete DB 52 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400153 Delete DB 53 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400154 Delete DB 54 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

---

**400155**            **Delete DB 55 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400156**            **Delete DB 56 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400157**            **Delete DB 57 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400158**            **Delete DB 58 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400159**            **Delete DB 59 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**400160**            **Delete DB 60 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

---

**400161 Delete DB 61 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400171 Delete DB 71 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400172 Delete DB 72 in the PLC and restart**

**Definitions:** --  
**Reaction:** Alarm display.  
**Remedy:** See the machine manufacturer's information.  
**Program** Internal  
**Continuation:**

---

**400173 Delete DB 73 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400174 Delete DB 74 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

**400176 Delete DB 76 in the PLC and restart**

**Definitions:** The DB created by the basic program and the existing DB differ in size.  
**Reaction:** Alarm display.  
**Remedy:** Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program** Internal  
**Continuation:**

---

---

**400177**                    **Delete DB 77 in the PLC and restart**

**Definitions:**            The DB created by the basic program and the existing DB differ in size.

**Reaction:**                Alarm display.

**Remedy:**                 Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.

**Program**                   Internal

**Continuation:**

---

---

**400201**                    **PLC STOP due to DB loading in the RUN state: DB%Z**

**Parameters:**            %Z = Data block

**Definitions:**            An existing DB was reloaded in the RUN state.

**Reaction:**                Alarm display.

**Remedy:**                 Restart required.

**Program**                   Switch control OFF - ON.

**Continuation:**

---

---

**400202**                    **Access error**

**Definitions:**            The data could not be accessed.

**Reaction:**                Alarm display.

**Remedy:**                 System error, contact the Siemens AG A&D MC Hotline with the error text.

**Program**                   Switch control OFF - ON.

**Continuation:**

---

---

**400203**                    **DB access error: DB%Z**

**Parameters:**            %Z = Data block

**Definitions:**            Data block is either not present or write-protected.

**Reaction:**                Alarm display.

**Remedy:**                 The displayed DB has to be reloaded via STEP 7 or its write protection has to be removed. Restart required.

**Program**                   Switch control OFF - ON.

**Continuation:**

---

---

**400204**                    **Restart required**

**Definitions:**            DB generated by the basic program are different in size of existing DB.

**Reaction:**                Alarm display.

**Remedy:**                 The DB is deleted during the next start-up and it is generated again by the basic program.

**Program**                   Switch control OFF - ON.

**Continuation:**

---

---

**400250**                    **NCK sign-of-life monitoring**

**Definitions:**            NCK has not contacted the PLC during cyclic operation. Timer of FB1 parameter NCCyclTimeout was executed without retrigger.

**Reaction:**                Alarm display.

---

---

**Remedy:** NCK restart  
**Program** Internal  
**Continuation:**

---

---

**400251 NCK has not started up**

**Definitions:** NCK has not contacted the PLC.  
NCK has not ramped up.  
Acknowledgement error during ramp-up: the time limit entered in OB1 / FB1 under parameter address MCP1Cycl or MCP2Cycl has been exceeded.

**Reaction:** Alarm display.

**Remedy:** Enter the default values in FB1 correctly.  
Carry out a general NCK reset and restart.  
Increase the time values in FB1.

**Program** Internal  
**Continuation:**

---

---

**400252 Error in internal communication with NCK**

**Definitions:** An error has occurred during data transmission between the PLC and the NCK (FM-NC only).

**Reaction:** Alarm display.

**Remedy:** NCK restart

**Program** Internal  
**Continuation:**

---

---

**400253 PLC STOP because of SPL system error**

**Definitions:** After the interruption of the communication between the NCK and the PLC with regard to the SPL data cross-check, the PLC was switched to STOP with a delay of 5 s.

**Reaction:** Alarm display.

**Remedy:** Do no longer start SPL. Check the system components (PLC must be provided with the correct version of FB15 and with DB18).

**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**400254 Checksum error found: %1**

**Parameters:** %1 = Note on code section or table

**Definitions:** Checksum error in safety-relevant code or safety-relevant data. The safe monitoring functions (Safety Integrated) in the PLC may be damaged.

**Reaction:** Alarm display.

**Remedy:** Power OFF/ON of the control. If the error occurs again, inform the service department.

**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**400255 Sign of life monitoring NCK2**

**Definitions:** NCK2 has not contacted the PLC during cyclic operation. Timer of FB1 parameter NCCyclTimeout was executed without retrigger. (FM-NC only).

**Reaction:** Alarm display.

**Remedy:** NCK restart

**Program Continuation:** Internal

---

**400256 NCK2 has not run up**

**Definitions:** NCK2 has not run up. NCK has not contacted the PLC. Timer of FB1 parameter NCRunupTimeout has expired. (FM-NC only).

**Reaction:** Alarm display.

**Remedy:** General NCK reset and restart.

**Program Continuation:** Internal

---

**400257 Error in internal communication with NCK2**

**Definitions:** An error has occurred during data transmission between the PLC and the NCK. (FM-NC only)

**Reaction:** Alarm display.

**Remedy:** NCK restart

**Program Continuation:** Internal

---

**400260 Failure of machine control panel 1**

**Definitions:** Machine control panel (MCP) at machine control panel interface 1 has failed. Timer of FB1 parameter MCP1Timeout has expired. Incorrect address in DB7 parameter MCP1BusAdr. DB7 parameter MCP1NotSend=TRUE.

**Reaction:** Alarm display.

**Remedy:** Check the connection to the MCP. Increase the value of the timer parameter MCP1Timeout. Set MCP1Cycl to the default value. Correct the MCP1BusAdr in the DB7 parameter/compare with the selected address. Set DB7 parameter MCP1NotSend=FALSE.

**Program Continuation:** Internal

---

**400261 Failure of machine control panel 2**

**Definitions:** Machine control panel (MCP) at machine control panel interface 2 has failed. Timer of FB1 parameter MCP2Timeout has expired. Incorrect address in the DB7 parameter MCP2BusAdr. DB7 parameter MCP2NotSend=TRUE.

**Reaction:** Alarm display.

**Remedy:** Check the connection to the MCP. Increase the value of the timer parameter MCP2Timeout. Set MCP2Cycl to the default value. Correct the MCP2BusAdr in the DB7 parameter/compare with selected address. Set DB7 parameter MCP2NotSend=FALSE.

**Program Continuation:** Internal

---

---

**400262 Failure of handheld unit**

**Definitions:** Handheld unit (HHU) at handheld unit interface has failed. Timer of FB1 parameter HHUTimeout has expired.  
**Reaction:** Alarm display.  
**Remedy:** Check the connection to the HHU. Increase the value of timer parameter HHUTimeout. Set HHUCycl to the default value.  
**Program Continuation:** Internal

---

**400264 Pointer parameter machine control panel 1 incorrect**

**Definitions:** A pointer is incorrect in the MCP1 parameter range.  
**Reaction:** Alarm display.  
**Remedy:** Correct the PLC configuration in the FB1 parameters.  
**Program Continuation:** Switch control OFF - ON.

---

**400265 Pointer parameter machine control panel 2 incorrect**

**Definitions:** A pointer is incorrect in the MCP 2 parameter range.  
**Reaction:** Alarm display.  
**Remedy:** Correct the PLC configuration in the FB1 parameters.  
**Program Continuation:** Switch control OFF - ON.

---

**400266 Pointer parameter handheld unit incorrect**

**Definitions:** A pointer is incorrect in the HHU parameter range.  
**Reaction:** Alarm display.  
**Remedy:** Correct the PLC configuration in the FB1 parameters.  
**Program Continuation:** Switch control OFF - ON.

---

**400267 Access error**

**Definitions:** MCP or HHU data could not be accessed  
**Reaction:** Alarm display.  
**Remedy:** Check the MCP or HHU parameters of the FB1.  
**Program Continuation:** Switch control OFF - ON.

---

**400268 Error in internal communication with machine control panel 1, internal error code: %Z**

**Definitions:** Communication error between CP and PLC.  
**Reaction:** Alarm display.  
**Remedy:** Check MCP parameter of FB1, MCP1Stop, switch TRUE->FALSE

---

**Program** Switch control OFF - ON.  
**Continuation:**

---

**400269 Error in internal communication with machine control panel 2, internal error code: %Z**

**Definitions:** Communication error between CP and PLC.  
**Reaction:** Alarm display.  
**Remedy:** Check MCP parameter of FB1, MCP2Stop, switch TRUE->FALSE  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**400270 Error in internal communication with handheld unit, internal error code: %Z**

**Definitions:** Communication error between CP and PLC.  
**Reaction:** Alarm display.  
**Remedy:** Check HHU parameter of FB1, HHUStop, switch TRUE->FALSE  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**400271 Direct keys 1 communication error, internal error code: %Z**

**Definitions:** Communication error between CP and PLC.  
**Reaction:** Alarm display.  
**Remedy:** Check OpKey parameter  
**Program** Internal  
**Continuation:**

---

**400272 Direct keys 2 communication error, internal error code: %Z**

**Definitions:** Communication error between CP and PLC.  
**Reaction:** Alarm display.  
**Remedy:** Check OpKey parameter  
**Program** Internal  
**Continuation:**

---

**400274 Direct keys 1 failed**

**Definitions:** Direct keys 1: internal timeout has expired.  
**Reaction:** Alarm display.  
**Remedy:** Check connection to direct key module  
**Program** Internal  
**Continuation:**



---

**400275 Direct keys 2 failed**

**Definitions:** Direct keys 2: internal timeout has expired.  
**Reaction:** Alarm display.  
**Remedy:** Check connection to direct key module  
**Program** Internal  
**Continuation:**

---

**400276 Pointer parameter direct keys 1 incorrect**

**Definitions:** Pointer incorrectly defined  
**Reaction:** Alarm display.  
**Remedy:** Correct the pointer  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**400277 Pointer parameter direct keys 2 incorrect**

**Definitions:** Pointer incorrectly defined  
**Reaction:** Alarm display.  
**Remedy:** Correct the pointer  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**400551 Fault on MPI/DP bus**

**Definitions:** Error detected on I/O bus  
**Reaction:** Alarm display.  
**Remedy:** Check I/Os, rectify I/O fault  
**Program** Internal  
**Continuation:**

---

**400552 Fault on DP bus**

**Definitions:** Error detected on I/O bus  
**Reaction:** Alarm display.  
**Remedy:** Check I/Os, rectify I/O fault  
**Program** Internal  
**Continuation:**

---

**400553 Fault on PROFINET bus**

**Definitions:** Error detected on I/O bus  
**Reaction:** Alarm display.  
**Remedy:** Check I/Os, rectify I/O fault  
**Program** Internal  
**Continuation:**

---

---

**400601**                    **Configuration loading points incorrect**

**Definitions:**            The PLC configuration in the DB4 does not match the NC configuration

**Reaction:**                Alarm display.

**Remedy:**                 Correct tool management setup

**Program**                 Switch control OFF - ON.

**Continuation:**

---

**400602**                    **Spindle configuration incorrect**

**Definitions:**            The PLC configuration in the DB4 does not match the NC configuration

**Reaction:**                Alarm display.

**Remedy:**                 Correct tool management setup

**Program**                 Switch control OFF - ON.

**Continuation:**

---

**400603**                    **Revolver configuration incorrect**

**Definitions:**            The PLC configuration in the DB4 does not match the NC configuration

**Reaction:**                Alarm display.

**Remedy:**                 Correct tool management setup

**Program**                 Switch control OFF - ON.

**Continuation:**

---

**400604**                    **Set change with M06 in the machine data**

**Definitions:**            With the magazine type used (box magazine, chain), changing is possible only with M06. If necessary, also check for impermissible settings at revolver magazines.

**Reaction:**                Alarm display.

**Remedy:**                 Set the value in the channel-specific machine data TOOL\_CHANGE\_MODE (MD 22550) to 1.

**Program**                 Internal

**Continuation:**

---

**400902**                    **Parameter ChanNo impermissible in FC 9**

**Definitions:**            The parameterized channel does not exist.

**Reaction:**                Alarm display.

**Remedy:**                 Correct the parameter.

**Program**                 Switch control OFF - ON.

**Continuation:**

---

**400903**                    **Parameter IntNo impermissible in FC 9**

**Definitions:**            The parameterized interrupt does not exist.

**Reaction:**                Alarm display.

**Remedy:**                 Correct the parameter.

---

**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401003 FC 10 system error 0x8083**

**Definitions:** System error SFC52 has occurred.  
**Reaction:** Alarm display.  
**Remedy:** Restart, contact the Siemens AG A&D MC Hotline with the error text.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401004 FC 10 system error 0x8084**

**Definitions:** System error SFC52 has occurred.  
**Reaction:** Alarm display.  
**Remedy:** Restart, contact the Siemens AG A&D MC Hotline with the error text.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401005 FC 10 system error 0x8085**

**Definitions:** System error SFC52 has occurred.  
**Reaction:** Alarm display.  
**Remedy:** Restart, contact the Siemens AG A&D MC Hotline with the error text.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401006 FC 10 system error 0x8086**

**Definitions:** System error SFC52 has occurred.  
**Reaction:** Alarm display.  
**Remedy:** Restart, contact the Siemens AG A&D MC Hotline with the error text.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401007 FC 10 system error 0x8087**

**Definitions:** System error SFC52 has occurred.  
**Reaction:** Alarm display.  
**Remedy:** Restart, contact the Siemens AG A&D MC Hotline with the error text.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**401502 Impermissible axis no. parameter in FC 15**

**Definitions:** The parameterized axis does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**401602 Impermissible axis no. parameter in FC 16**

**Definitions:** The parameterized axis does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**401702 Impermissible spindle IF no. parameter in FC 17**

**Definitions:** The parameterized spindle does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**401805 Impermissible axis no. parameter in FC 18**

**Definitions:** The parameterized axis / spindle does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**401901 Parameter BAGNo impermissible in FC19**

**Definitions:** The parameterized mode group, channel does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**401902 Parameter ChanNo impermissible in FC19.**

**Definitions:** The parameterized channel does not exist.  
**Reaction:** Alarm display.  
**Remedy:** Correct the parameter.  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**402401            Parameter BAGNo impermissible in FC24**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

**402402            Parameter ChanNo impermissible in FC24.**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

**402501            Parameter BAGNo impermissible in FC25**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

**402502            Parameter ChanNo impermissible in FC25.**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

**402601            Parameter BAGNo impermissible in FC26**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

**402602            Parameter ChanNo impermissible in FC26**

**Definitions:**        The parameterized mode group, channel does not exist.  
**Reaction:**            Alarm display.  
**Remedy:**             Correct the parameter.  
**Program**             Switch control OFF - ON.  
**Continuation:**

---

---

**403000**            **Delete DB 1000 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**403071**            **Delete DB 1071 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**403072**            **Delete DB 1072 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**403073**            **Delete DB 1073 in the PLC and restart**

**Definitions:**        The DB created by the basic program and the existing DB differ in size.  
**Reaction:**            Alarm display.  
**Remedy:**             Displayed DB must be deleted via STEP7. Possibly max. program size of the user program exceeded.  
**Program**                Internal  
**Continuation:**

---

**410141**            **TM: Too many loading points**

**Definitions:**        The PLC configuration in the DB4 has more than 32 loading points  
**Reaction:**            Alarm display.  
**Remedy:**             Correct tool management setup  
**Program**                Switch control OFF - ON.  
**Continuation:**

---

**410142**            **TM: Too many toolholders**

**Definitions:**        The PLC configuration in the DB4 has more than 32 toolholders  
**Reaction:**            Alarm display.  
**Remedy:**             Correct tool management setup  
**Program**                Switch control OFF - ON.  
**Continuation:**

---

---

**410143**      **TM: Too many revolvers**

**Definitions:**      The PLC configuration in the DB4 has more than 32 revolvers  
**Reaction:**          Alarm display.  
**Remedy:**            Correct tool management setup  
**Program**            Switch control OFF - ON.  
**Continuation:**

---

**410144**      **TOOLMAN: Multiple definition of magazine number %Z**

**Definitions:**      Multiple definition of the magazine number  
**Reaction:**          Alarm display.  
**Remedy:**            Magazines, spindles, loading points must be uniquely defined in different TO areas  
**Program**            Switch control OFF - ON.  
**Continuation:**

---

**410150**      **Area in M group decoder list is too large**

**Definitions:**      Number of M groups in PLC too large.  
**Reaction:**          Alarm display.  
**Remedy:**            Reduce the number of groups  
**Program**            Internal  
**Continuation:**

---

**410151**      **Magazine data for tool management missing in the PLC**

**Definitions:**      Magazine data are not available in the PLC. The setup has not been completed, although the option TOOLMAN has been activated.  
**Reaction:**          Alarm display.  
**Remedy:**            In HMI Advanced the softkey 'Create PLC Data' must be pressed during TOOLMAN setup. Or create the data in data block DB4 from DBB64 onward.  
**Program**            Internal  
**Continuation:**

---

**410160**      **PROFIBUS configuration is too large for DP1**

**Definitions:**      Internal data area is too large for PROFIBUS configuration.  
**Reaction:**          Alarm display.  
**Remedy:**            Define and load a smaller PROFIBUS configuration  
**Program**            Internal  
**Continuation:**

---

**410900**      **M:N: call waiting was not continued**

**Definitions:**      The switchover sequence started was not completed  
**Reaction:**          Alarm display.  
**Remedy:**            Reactuate channel menu on HMI

**Program** Internal  
**Continuation:**

---

**410901 M:N: HMI 1 does not respond to displacement**

**Definitions:** The HMI that is to be switched over does not respond  
**Reaction:** Alarm display.  
**Remedy:** Reactuate channel menu on HMI  
**Program** Internal  
**Continuation:**

---

**410902 M:N: HMI 1 does not go offline**

**Definitions:** The HMI that is to be switched over does not respond  
**Reaction:** Alarm display.  
**Remedy:** Reactuate channel menu on HMI  
**Program** Internal  
**Continuation:**

---

**410903 M:N: HMI 2 does not respond to displacement**

**Definitions:** The HMI that is to be switched over does not respond  
**Reaction:** Alarm display.  
**Remedy:** Reactuate channel menu on HMI  
**Program** Internal  
**Continuation:**

---

**410904 M:N: HMI 2 does not go offlin**

**Definitions:** The HMI that is to be switched over does not respond  
**Reaction:** Alarm display.  
**Remedy:** Reactuate channel menu on HMI  
**Program** Internal  
**Continuation:**

---

**410905 M:N: No HMI link to assigned interface**

**Definitions:** The HMI to be switched over is not connecting to the NC  
**Reaction:** Alarm display.  
**Remedy:** Reactuate channel menu on HMI  
**Program** Internal  
**Continuation:**



---

**410906 M:N: No sign of life of an HMI**

**Definitions:** Link to NC disconnected  
**Reaction:** Alarm display.  
**Remedy:** Check connection to HMI  
**Program** Internal  
**Continuation:**

---

**411101 Impermissible Parameter Axis in FB11**

**Definitions:** Axis parameter not within the permissible range.  
**Reaction:** Alarm display.  
**Remedy:** Use permissible axis number.  
**Program** Internal  
**Continuation:**

---

**411501 Incorrect version of FB 15, > general reset, do not transmit FB 15 from project**

**Definitions:** FB 15 does not match the basic program used.  
**Reaction:** Alarm display.  
**Remedy:** General PLC reset. Use correct version of the basic program.  
**Program** Internal  
**Continuation:**

---

**411502 Incorrect basic PLC program version**

**Definitions:** FB 15 does not match the basic program used.  
**Reaction:** Alarm display.  
**Remedy:** Load the basic program that matches the NCK version.  
**Program** Internal  
**Continuation:**

---

**428201 Diagnostic alarm**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428221 Diagnostic alarm from diagnostics address %Z**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**428601            Module failure of the expansion unit**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

**428602            Recurrence of module failure of the expansion unit**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

**428603            Module failure of the DP master**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

**428604            Failure of a DP slave**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

**428605            Fault in a DP slave**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

**428606            Expansion unit recurrence, parameterization error**

**Definitions:**            OB82 or OB86 has been triggered.  
**Reaction:**                Alarm display.  
**Remedy:**                 Rectify the cause of the error displayed  
**Program**  
**Continuation:**           Switch control OFF - ON.

---

---

**428607 DP slave recurrence, parameterization error**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428608 DP slave recurrence, discrepancy between preset and actual configurations**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428621 Failure of expansion unit**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428622 Restoration of expansion unit, discrepancy between preset and actual configurations**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428623 Failure of a DP master system, bus: %2**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428624 Failure of a DP slave, bus: %2, slave: %1**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**428625 Restoration of DP slave with fault, bus: %2, slave: %1**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428626 Restoration of expansion unit, parameterization error**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428627 Restoration of DP slave, parameterization error, bus: %2, slave: %1**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428628 Restoration of DP slave, discrepancy between preset and actual configurations, bus: %2, slave: %1**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428630 Failure of the PROFINET IO system**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

**428631 Failure of a PROFINET device, device: %Z**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed

---

**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**428632 Restoration of PROFINET device with fault, device %Z**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**428633 Restoration of PROFINET device, discrepancy between preset and actual configurations, device %Z**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**428634 Restoration of PROFINET device, parameterization error, device %Z**

**Definitions:** OB82 or OB86 has been triggered.  
**Reaction:** Alarm display.  
**Remedy:** Rectify the cause of the error displayed  
**Program** Switch control OFF - ON.  
**Continuation:**

---

---

**800000 Error: HiGraph group no. %A graph no. %N status %Z**

**Definitions:** -  
**Reaction:** Alarm display.  
**Remedy:** -  
**Program** Internal  
**Continuation:**

---

---

**810001 Error OB event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

---

**810002 Synchronous error, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810003 Asynchronous error, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810004 Stop/cancel event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810005 Operational state sequence event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810006 Error communication event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810007 Error H/F system event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810008 Error diagnostics data from modules, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Alarm display, PLC Stop if required.  
**Program** Internal  
**Continuation:**

---

**810009 User diagnostics event, error analysis via STEP7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**810015 Module diagnosis event, error analysis via STEP 7 required**

**Definitions:** Reduced PLC error message. STEP7 is required for exact analysis.  
**Reaction:** Alarm display.  
**Remedy:** Diagnose with STEP7.  
**Program** Internal  
**Continuation:**

---

**8830000 Message: HiGraph group no. %A graph no. %N status %Z**

**Definitions:** -  
**Reaction:** Alarm display.  
**Remedy:** -  
**Program** Internal  
**Continuation:**





# List of actions

Product: Handbuch\_Sinumerik, Version: V13.0, Language: eng,  
Objects:

---

## **/NON/ No. 0**

---

## **/SYSTEM\_SHUTDOWN/ No. 96**

**Definitions:** Switch off system  
(VDI signal)  
Should not occur in any alarm

---

## **/SERUPRO\_ON/ No. 97**

**Definitions:** Connect block search PI in mode 5.  
Block search is simulated in this mode  
by executing the program under "program test mode"  
as far as the search target block.

---

## **/ESR/ No. 98**

**Definitions:** Extended Stop and Retract

---

## **/BLOCKSEARCHRUN\_SIGNAL/ No. 99**

**Definitions:** Block search (general) is being activated.  
Should not occur in any alarm as, if necessary, the PI service is acknowledged negatively.

---

## **/BLOCKSEARCHRUN\_INTEGR/ No. 100**

**Definitions:** Integrated block search, this means that a search run is restarted after a stopped program.

---

**/EXT\_ZERO\_POINT/ No. 101**

**Definitions:** External work offset is activated via PLC.  
To do this the path is stopped, REORG executed, the interpreter changed over, and then selected and continued automatically with REPOS.  
Not permitted if:  
1. The channel is not in AUTO or MDA.  
2. The channel has stopped, and the current block cannot be reorganized.  
Possible actions:  
1. Select AUTO or MDA.  
2. Activate block change until NC block can be reorganized.

---

**/SINGLEBLOCK\_IPONOSBLOF/ No. 102**

**Definitions:** Single block type 3 is activated.  
With single block type 3, there is a stop at all main blocks.  
In contrast to single block type 1, the part programm command SBLOF is ignored.

---

**/SINGLEAX\_STOPALL\_MASTER/ No. 103**

**Definitions:** Stopping a single axis motion (VDI signal)  
Not permitted if:  
The axis is not controlled by the PLC  
(Exception: "old" behavior in the case of a reciprocating axis)

---

**/SINGLEAX\_STOPALARM\_MASTER/ No. 104**

**Definitions:** Stopping a single axis motion by an alarm (alarm)  
Not permitted if:  
The axis is not controlled by the PLC  
(Exception: "old" behavior in the case of a reciprocating axis)

---

**/SINGLEAX\_RESUME\_MASTER/ No. 105**

**Definitions:** Continuation of a single axis motion (VDI signal)  
Not permitted if:  
The axis has not previously stopped  
Initially, not for all types of axis

---

---

**/SINGLEAX\_RESET\_MASTER/ No. 106**

**Definitions:** Canceling a single axis motion  
(VDI signal)  
Not permitted if:  
    The axis is not controlled by the PLC  
Initially, not for all types of axis

---

**/SINGLEAX\_DELDIS\_MASTER/ No. 107**

**Definitions:** Delete distance-to-go of a single axis motion  
(VDI signal)  
Not permitted if:  
    The axis is not controlled by the PLC  
Initially, not for all types of axis

---

**/SINGLEAX\_PLCCTRL\_ON\_MASTER/ No. 108**

**Definitions:** Activate: The axis is now controlled by the PLC  
(VDI signal)  
Not permitted if:  
    The axis is not controlled by the PLC  
Initially, not for all types of axis

---

**/SINGLEAX\_PLCCTRL\_OFF\_MASTER/ No. 109**

**Definitions:** Deactivate: The axis is now controlled by the PLC  
(VDI signal)  
Not permitted if:  
    The axis is a main run axis or neutral.  
Initially, not for all types of axis

---

**/SINGLEAX\_JOG\_WHEEL/ No. 110**

**Definitions:** Available soon

---

**/SINGLEAX\_JOG\_PLUS\_MASTER/ No. 111**

**Definitions:** Available soon

---

**/SINGLEAX\_JOG\_MINUS\_MASTER/ No. 112**

**Definitions:** Available soon

---

**/SINGLEAX\_JOG\_PLUS\_INC\_MASTER/ No. 113**

**Definitions:** Available soon

---

**/SINGLEAX\_JOG\_MINUS\_INC\_MASTER/ No. 114**

**Definitions:** Available soon

---

**/REPOSMODECHANGE/ No. 115**

**Definitions:** The event is triggered by the positive PLC edge of the signal "Repos mode edge".  
Not permitted if:  
1. The channel is active (program running, block search, loading machine data)  
Possible actions:  
1. Cancel the program with the Reset button  
or stop the program (not with block search, loading machine data)

---

**/TOOLCHANGECMDON/ No. 116**

**Definitions:** Enable the tool management commands.  
(CH VDI signal)  
Not permitted if:  
1. The NCK channel status is not Ready  
Possible actions:  
1. Cancel program or process with reset button  
or wait for end of program

---

**/TOOLCHANGECMDOFF/ No. 117**

**Definitions:** Disable the tool management commands.  
(CH VDI signal)  
Not permitted if:  
1. The NCK channel status is not Ready  
Possible actions:  
1. Cancel program or process with reset button  
or wait for end of program

---

**/SIVLIMCHANGE/ No. 118**

**Definitions:** Switching over the desired safety limits (SGE)  
is always permitted

---

---

**/STOPRUN/ No. 119**

**Definitions:** Stop run, that is the NCK stops automatically at a block defined by the OPI.  
Not permitted if  
1. Control is not in Automatic.

---

**/SINGLEAX\_LIFFASTOFF\_MASTER/ No. 120**

**Definitions:** Fast retraction with a single axis  
Not permitted if:  
The axis is not controlled by the PLC

---

**/SINGLEAX\_STOPLIFTOFF\_MASTER/ No. 121**

**Definitions:** Stop fast retraction with a single axis  
Not permitted if:  
The axis is not controlled by the PLC  
and the single axis does not execute a fast retraction

---

**/TEST\_SYNC\_ASYNC/ No. 122**

**Definitions:** For test purposes only, and only in assert systems.

---

**/START\_LOCK/ No. 123**

**Definitions:** PI\_N\_STRTLK Set global start disable  
always permitted

---

**/START\_UNLOCK/ No. 124**

**Definitions:** PI\_N\_STRTUL Reset global start disable  
always permitted

---

**/FASTMODESWITCHTOAHANDMODE/ No. 125**

**Definitions:** Implicit change to JOG mode at the start of a "JOG motion" in Automatic  
See also \$MN\_JOG\_MODE\_MASK  
Not permitted if:  
1. A channel has left the mode group on account of an interrupt.  
2. Overstoring  
Possible actions:  
1. Cancel the program with the Reset button or wait until the interrupt has finished.  
4. Deselect overstore

---

**/FASTMODESWITCHTOAPROGMODE/ No. 126**

**Definitions:** Implicit mode change back at the end of a "JOG motion" started in automatic mode.  
See also \$MN\_JOG\_MODE\_MASK  
Not permitted if:  
1. A channel has left the mode group on account of an interrupt.  
2. Overstoring  
Possible actions:  
1. Cancel the program with the Reset button or wait until the interrupt has finished.  
4. Deselect overstore

---

**/SIMULATIONBLOCKSEARCHRUN/ No. 127**

**Definitions:** Simulation block search is to be started, that means the results of the computation will only be displayed on the HMI, NO traverse after block search.  
Not permitted if:  
1. The NCK channel is not in RESET  
Possible action:  
1. Press reset

---

**/EXECPROGPART/ No. 128**

**Definitions:** Execute program area has been rejected.  
Not permitted if:  
1. The channel is not in RESET.  
2. The channel is not in Automatic.  
Possible actions:  
1. Press reset.  
2. Switch to automatic.

---

**/SYNTAXCHECK\_SELECT/ No. 129**

**Definitions:** Selection of PI service syntax check "\_N\_CHKSEL" has been rejected.  
Not permitted if:  
1. The channel is not in RESET  
Possible action:  
1. Press reset

---

**/SYNTAXCHECK\_RUN/ No. 130**

**Definitions:** Starting of PI service syntax check "\_N\_CHKRUN" has been rejected.  
Not permitted if:  
1. The channel is not in RESET  
Possible action:  
1. Press reset

---

**/SYNTAXCHECK\_ABORT/ No. 131**

**Definitions:** Starting of PI service syntax check "\_N\_CHKABO" has been rejected.  
Not permitted if:  
Should not occur.

---

**/REDUCE\_CALC\_TIME/ No. 132**

**Definitions:** PI service \_N\_NCKMOD (BIT-1) has been rejected.  
Not permitted if:  
Should not occur.

---

**/SIMULATION\_ON\_OFF/ No. 133**

**Definitions:** PI service \_N\_NCKMOD (BIT-1) has been rejected.  
Not permitted if:  
Should not occur.

---

**/\_UPDATE\_LOOKAHEAD/ No. 134**

**Definitions:** Updating the LOOKAHEAD calculation  
should always be permitted

---

**Abort subroutine execution /PROGCANCELSUB/ No. 17**

**Definitions:** Cancel the subprogram execution.  
(VDI signal: program level cancel)  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Cancel program  
2. Cancel program

---

**Abort subroutine repeat /PROGRESETREPEAT/ No. 16**

**Definitions:** Cancel the subprogram repetition.  
(VDI signal: delete subprogram number of passes)  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Cancel program  
2. Cancel program

---

**Activate block skip /PROGMODESLASHON/ No. 61**

**Definitions:** Activate skip slash blocks  
(VDI signal: skip block)  
Not permitted if:  
1. The nesting depth is too great  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program

---

**Activate decoding single block /SINGLEBLOCK\_DECODIER/ No. 21**

**Definitions:** Activate decoding single block.  
(OPI variable and VDI signal: activate single block)  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program  
2. Cancel program

---

**Activate main program single block /SINGLEBLOCK\_MAINBLOCK/ No. 22**

**Definitions:** Activate main program single block.  
(OPI variable and VDI signal: activate single block)  
Should not occur in any alarm

---

**Activate main run single block /SINGLEBLOCK\_IPO/ No. 20**

**Definitions:** Activate main run single block.  
(OPI variable and VDI signal: activate single block)  
Should not occur in any alarm

---

**Activate motion single block /SINGLEBLOCK\_PATH/ No. 23**

**Definitions:** Activate traversing single block.  
(OPI variable and VDI signal: activate single block)  
Should not occur in any alarm

---

**Activate program test /PROGTESTON/ No. 69**

**Definitions:** Activate program test.  
(VDI signal: program test)  
Not permitted if:  
1. Tool management is active  
2. The NCK channel status is not Ready  
Possible actions:  
1. Backup tool data  
2. Cancel program or process with reset button  
or wait for end of program

---

**Activate read-in disable /BLOCKREADINHIBIT\_ON/ No. 65**

**Definitions:** Activate read-in disable for main run block.  
(VDI signal: read-in disable)  
Should not occur in any alarm

---



---

**Activate single block /SINGLEBLOCKSTOP/ No. 18**

**Definitions:** Activate single block.  
(VDI signal: activate single block)  
Should not occur in any alarm

---

**Activate test run /PROGMODEDRYRUNON/ No. 63**

**Definitions:** Activate test run.  
(VDI signal: rapid traverse override)  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program  
2. Cancel program

---

**Activate user data /SET\_USER\_DATA/ No. 93**

**Definitions:** Set all user data to active.  
For example, that means tool lengths newly changed via MMC become active immediately in the current program.  
Not permitted if:  
1. The NCK channel status is not Stopped  
2. The channel has stopped, and the current block cannot be reorganized.  
Possible actions:  
1. Press stop button/single block/reset/StopAtEnd button (in Auto).  
2. Activate block change until NC block can be reorganized

---

**All MD (NEW\_CONF) active /NEWCONF/ No. 48**

**Definitions:** Sets all machine data with the attribute (NEW\_CONF) to active (PI command)  
Should not occur in any alarm

---

**All MD (NEW\_CONF) active (block search) /BLOCKSEARCHRUN\_NEWCONF/ No. 90**

**Definitions:** Set all machine data with the attribute (NEW\_CONF) to active.  
(NC\_Satz, NEW\_CONF with block search)  
Should not occur in any alarm

---

**All MD (NEW\_CONF) active (program) /NEWCONF\_PREP\_STOP/ No. 89**

**Definitions:** Set all machine data with the attribute (NEW\_CONF) to active.  
(NC\_Satz, NEW\_CONF)  
Should not occur in any alarm

---

---

### Automatic mode change /MODESWITCHTOSAVEDMODE/ No. 6

**Definitions:** Automatic change from an internal mode into the externally set mode.  
E.g: With teach-in: Internal mode = automatic or MDA  
Should not occur in any alarm

---

### Change measuring system /CONVERT\_SCALING\_SYSTEM/ No. 95

**Definitions:** Change over PI service measuring system  
Should not occur in any alarm as, if necessary, the PI service is acknowledged negatively

---

### Change to manual mode /MODESWITCHTOAHANDMODE/ No. 7

**Definitions:** Change the mode to a manual mode  
(VDI signal: mode group signals, JOG, TEACH\_IN, RE)  
Not permitted if:

1. The nesting depth is too great  
The current processing procedure can be interrupted by various events.  
ASUB programs are activated according to the event.  
These ASUB programs can be interrupted in the same way as the user program.  
Free nesting depth of the ASUB programs is not possible for memory reasons.  
Example:  
An interrupt interrupts the current program execution.  
Other higher priority interrupts interrupt the previously activated ASUB program execution.
2. The channel is active (program running, block search, loading machine data)
3. A channel has left the mode group on account of an interrupt.
4. Overstoring

Possible actions:

1. Cancel the program with the Reset button
2. Cancel the program with the Reset button or stop the program (not with block search, loading machine data)
3. Cancel the program with the Reset button or wait until the interrupt has finished.
4. Deselect overstore

---

### Change to program mode /MODESWITCHTOAPROGMODE/ No. 5

**Definitions:** Change the mode to a program operation mode "MDA or automatic"  
(VDI signal: mode group signals)  
Not permitted if:

1. The channel is active (program running, block search, loading machine data)
2. Has already been started in the other program operation mode.
3. A channel has left the mode group on account of an interrupt.
4. Overstoring

Possible actions:

1. Cancel the program with the Reset button or stop the program (not with block search, loading machine data)
2. Cancel the program with the Reset button
3. Cancel the program with the Reset button or wait until the interrupt has finished.
4. Deselect overstore

---

**Conditional stop at end of block /CONDITIONAL\_STOPATEND/ No. 73**

**Definitions:** Conditional stop at the block boundary. There is another stop if there is still a stop reason "Stop at end of block" after continuation by an NC start.  
Should not occur in any alarm

---

**Conditional stop at end of block (SBL2) /CONDITIONAL\_SBL\_DEC\_STOPATEND/ No. 74**

**Definitions:** Conditional stop at the block boundary. Despite Start, the interpreter or preprocessing does not bring any blocks into the main run.  
Should not occur in any alarm

---

**Continue block search /BLOCKSEARCHRUN\_CONTINUE/ No. 50**

**Definitions:** Continue block search (NC block: = Stopre)  
Should not occur in any alarm

---

**Continue block search /BLOCKSEARCHRUN\_RESUME/ No. 52**

**Definitions:** Continue block search (PI command)  
Should not occur in any alarm

---

**Continue interpreter processing /CONTINUE\_INTERPR/ No. 91**

**Definitions:** Start the continuation of the interpreter processing (internal preprocessing stop)  
Should not occur in any alarm

---

**Continue program execution /RESUMEPROG/ No. 26**

**Definitions:** Start continue program execution,  
(VDI signal, NC start)  
Not permitted if:

1. Program status is active,
2. An alarm response is pending:  
which prevents a start,  
or compels braking.
3. Reference point approach not yet executed.

Possible actions:

1. None
2. Execute alarm clear condition.
3. Execute reference point approach

---

**Continue program in Teach-in /RESUME\_TEACHINPROG/ No. 83**

**Definitions:** Continue a program in the teach-in submode.  
(VDI signal, NC start)  
See STARTSIG and MODESWITCHTOAPROGMODE

---

---

### Continue selected processing /RESUMEJOGREFDIGIT/ No. 27

**Definitions:** Start continue the selected processing,  
(VDI signal, NC start)  
(JOG or reference point)  
Not permitted if:  
1. JOG motion is active,  
2. An alarm response is pending:  
which prevents a start,  
or compels braking.  
Possible actions:  
1. None  
2. Execute alarm clear condition.

---

### Deactivate block skip /PROGMODESLASHOFF/ No. 62

**Definitions:** Deactivate skip slash blocks  
(VDI signal: skip block)  
Not permitted if:  
1. The nesting depth is too great  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program

---

### Deactivate program test /PROGTESTOFF/ No. 70

**Definitions:** Deactivate program test.  
(VDI signal: program test)  
Not permitted if:  
1. The NCK channel status is not Ready  
Possible actions:  
2. Cancel program or process with reset button  
or wait for end of program

---

### Deactivate read-in disable /BLOCKREADINHIBIT\_OFF/ No. 66

**Definitions:** Deactivate read-in disable for main run block.  
(VDI signal: read-in disable)  
Should not occur in any alarm

---

### Deactivate single block /SINGLEBLOCKOFF/ No. 19

**Definitions:** Disable single block.  
(VDI signal: deactivate single block)  
Should not occur in any alarm

---

**Deactivate test run /PROGMODEDRYRUNOFF/ No. 64**

**Definitions:** Deactivate test run.  
(VDI signal: rapid traverse override)  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program  
2. Cancel program

---

**Delete all cancel alarms /CLEARCANCELALARM/ No. 49**

**Definitions:** Clears all alarms with the clear condition CANCELCLEAR (PI command, Cancel key)  
Should not occur in any alarm

---

**Delete distance to go / axis synchronization /DELDISTOGO\_SYNC/ No. 15**

**Definitions:** Execute delete distance-to-go or axis synchronization.  
(VDI signal: delete distance-to-go or follow-up mode)  
Follow-up mode: e.g. on enabling axis control  
Not permitted if:  
1. The nesting depth is too great  
2. If there is a reorganize brake error  
Possible actions:  
1. Cancel program  
2. Cancel program

---

**Delete marker /CLEARM/ No. 79**

**Definitions:** Delete marker (NC\_block,CLEARM)  
Should not occur in any alarm

---

**Deselect overstore /OVERSTOEROFF/ No. 9**

**Definitions:** Deselect overstore (PI command)  
Should not occur in any alarm

---

**Digitizing active /DIGITIZEON/ No. 53**

**Definitions:** ! Digitize function removed !  
Activate digitization (PI command)  
Should not occur in any alarm

---

**Digitizing inactive /DIGITIZEOFF/ No. 54**

**Definitions:** ! Digitize function removed !  
Deactivate digitization (PI command)  
Should not occur in any alarm

---

**Digitizing processing /STARTDIGITIZE/ No. 28**

**Definitions:** ! Digitize function removed !  
Start processing in digitize submode  
(VDI signal, NC start)  
Not permitted if:  
1. JOG motion is active,  
2. An alarm response is pending:  
    which prevents a start,  
    or compels braking.  
3. Reference point approach has not yet been executed.  
Possible actions:  
1. None  
2. Execute alarm clear condition.  
3. Execute reference point approach

---

**Disable NC program /LOCK\_FOR\_EDIT/ No. 81**

**Definitions:** Block editing of the NC program  
currently being processed (PI command)  
Should not occur in any alarm

---

**End of overstore buffer /OVERSTORE\_BUFFER\_END\_REACHED/ No. 39**

**Definitions:** Stop because the end of the overstore buffer "\_N\_OSTOREXX\_SYF" has been reached  
Should not occur in any alarm

---

**Function generator OFF /FUNCTGENOFF/ No. 56**

**Definitions:** 'Disable the function generator (PI command)  
Should not occur in any alarm

---

**Function generator ON /FUNCTGENON/ No. 55**

**Definitions:** Enable the function generator (PI command)  
Should not occur in any alarm

---

**Init phase /INIIT/ No. 1**

**Definitions:** Execute initialization phase (internal, after power on, initialization of tasks)

---

---

**Locking save data /SAVEDATA/ No. 92**

**Definitions:** Interlock for data recovery  
Is not permitted if:  
The NCK channel status is not Stopped

---

**Machine data execution (external) /INITIALINIEXTSTART/ No. 36**

**Definitions:** Start machine data processing (PI command)  
(INI file is located externally (e.g.) on MMC)  
Should not occur in any alarm

---

**Machine data processing /INITIALINISTART/ No. 35**

**Definitions:** Start machine data processing (PI command)  
(INI file is already in the NCK)  
Should not occur in any alarm

---

**Move tool /TM\_MOVETOOL/ No. 14**

**Definitions:** Move tool (only with tool management) (PI command)  
Should not occur in any alarm

---

**Preprocess stop /INTERPRETERSTOP\_ALARM/ No. 75**

**Definitions:** Stop the preprocessing (alarm)  
Should not occur in any alarm

---

**Processing stop /STOPBAG/ No. 88**

**Definitions:** Stop processing  
(VDI signal, mode group stop)  
Should not occur in any alarm

---

**Program selection from other channel /CHANNEL\_PROGSELECT/ No. 46**

**Definitions:** Program selection from another channel (channel communication, NC block INIT)  
Should not occur in any alarm

---

**Program selection from other channel /INIT\_SYNC/ No. 59**

**Definitions:** Program selection from the other channel with synchronization  
(Channel communication, NC block INIT + SYNC)  
Should not occur in any alarm

---

---

**Program stop /STOPPROG/ No. 30**

**Definitions:** Execute a program stop (NC block M0)  
Should not occur in any alarm

---

**Rapid retract /FASTLIFTOFF/ No. 13**

**Definitions:** Execute a fast retraction  
Should not occur in any alarm

---

**Reorganize after block preparation /STOPATIPOBUF\_EMPTY\_ALARM\_REORG/ No. 72**

**Definitions:** Stop at end of block preparation (alarm)  
followed by reorganization of the block preparation.  
Not permitted if:  
1. The nesting depth is too great  
Possible actions:  
1. Wait until previous ASUB has finished or cancel program

---

**Reorganize block preparation /PURE\_REORG/ No. 84**

**Definitions:** Reorganize block execution  
Should not occur in any alarm

---

**Reset /RESET/ No. 2**

**Definitions:** Execute reset (VDI signal reset, mode group reset or after power on).  
Should not occur in any alarm

---

**Reset due to end of program /PROG\_END/ No. 4**

**Definitions:** Execute reset. Program end has been detected (NC block M30).  
Should not occur in any alarm

---

**Reset Init blocks /RESET\_INITBLOCK/ No. 3**

**Definitions:** Activate reset INIT blocks.  
(Is initiated by the VDI signal reset)  
Should not occur in any alarm

---

**Retraction movement and stop /RETREAT\_MOVE\_THREAD/ No. 76**

**Definitions:** Retraction motion with G33 and Stop  
Should not occur in any alarm

---



---

**Save asynchron. subroutine /ASUPDEFINITION/ No. 47**

**Definitions:** Save definition of an activatable ASUB (PI command)  
Should not occur in any alarm

---

**Select external program /PROGSELECTEXT/ No. 45**

**Definitions:** Select program that is still located internally (PI command)  
Should not occur in any alarm

---

**Select NC block /BLOCK\_SELECT/ No. 80**

**Definitions:** Select an NC block (PI command)  
Should not occur in any alarm

---

**Select overstore /OVERSTOERON/ No. 8**

**Definitions:** Select overstore (PI command)  
Should not occur in any alarm

---

**Select program /PROGSELECT/ No. 44**

**Definitions:** Select program (PI command)  
Should not occur in any alarm

---

**Set marker /SETM/ No. 78**

**Definitions:** Set marker (NC\_block,SETM)  
Should not occur in any alarm

---

**Start block search /BLOCKSEARCHRUN\_START/ No. 51**

**Definitions:** Start block search (PI command)  
Should not occur in any alarm

---

**Start preprocessing /PREP\_STOP/ No. 40**

**Definitions:** Start the preprocessing (NC block, Stopre)  
Should not occur in any alarm

---

---

### Start program execution (program) /STARTPROG/ No. 24

- Definitions:** Start program execution,  
(VDI signal, NC start)  
Not permitted if:
1. Program status is active,
  2. An alarm response is pending:  
which prevents a start,  
or compels braking.
  3. Reference point approach not yet executed
- Possible actions:
1. None
  2. Execute alarm clear condition.
  3. Execute reference point approach

---

### Start program execution (VDI) /CHANNELSTARTPROG/ No. 25

- Definitions:** Start program execution (Channel communication, NC block:START)  
Not permitted if:
1. Program status is active,
  2. An alarm response is pending:  
which prevents a start,  
or compels braking.
  3. Reference point approach not yet executed.
  4. An incorrect mode has been selected (automatic only).
- Possible actions:
1. Protect start with WAITE.
  2. Execute alarm clear condition.
  3. Execute reference point approach
  4. Select program operation mode

---

### Start program in Teach-in /START\_TEACHINPROG/ No. 82

- Definitions:** Start a program in the teach-in submode.  
(VDI signal, NC start)  
See STARTSIG and MODESWITCHTOAPROGMODE

---

### Start selected processing /STARTSIG/ No. 33

- Definitions:** Start the selected machining  
(VDI signal, NC start)  
Not permitted if:
1. Process switch is active (mode change,  
enable and disable overstore)
  2. An alarm response is pending:  
which prevents a start,  
or compels braking.
  3. A process is running (NC program, block search, loading machine data)
- Possible actions:
1. None
  2. Execute alarm clear condition.
  3. None

---

**Stop active processing /STOPSIG/ No. 34**

**Definitions:** Stop the active processing.  
(VDI signal, NC stop)  
Should not occur in any alarm

---

**Stop after block preparation /STOPATIOBUFFER\_IEMPTY\_ALARM/ No. 71**

**Definitions:** Stop at the end of block preparation (alarm)  
Should not occur in any alarm

---

**Stop all axes /STOPALL/ No. 29**

**Definitions:** Stop all axes  
(VDI signal, stop all or by means of reset button)  
Should not occur in any alarm

---

**Stop all axes /STOP\_ALARM/ No. 68**

**Definitions:** Stop all axes (alarm)  
Should not occur in any alarm

---

**Stop at end of asynchron. subroutine /STOPPROGATASUPEND/ No. 43**

**Definitions:** Stop at ASUB end if started from "stopped" (internal command)  
Should not occur in any alarm

---

**Stop at end of block /STOPATEND\_ALARM/ No. 67**

**Definitions:** Stop at the block boundary (alarm)  
Should not occur in any alarm

---

**Stop digitizing processing /STOPDIGITIZE/ No. 32**

**Definitions:** ! Digitize function removed !  
Stop the digitizer processing.  
(VDI signal, NC stop)  
Should not occur in any alarm

---

**Stop JOG motion /STOPJOGREF/ No. 31**

**Definitions:** Stop the JOG motion  
Should not occur in any alarm

---

---

**Stop processing at block limit (program) /PROG\_STOP/ No. 41**

**Definitions:** Stop the processing at the block boundary. (NC block, M00/M01)  
Should not occur in any alarm

---

**Stop processing at block limit (VDI) /STOPPROGATBLOCKEND/ No. 42**

**Definitions:** Stop the processing at the block boundary.  
(Alarm, VDI signal: NC stop at the block boundary)  
Should not occur in any alarm

---

**Stop single block because of mode group (type A) /BAGSTOP\_SLBTYPA/ No. 37**

**Definitions:** Stop on account of mode group single block.  
(VDI signal: single type A, after stop in another channel of this mode group)  
Should not occur in any alarm

---

**Stop single block because of mode group (type B) /BAGSTOPATEND\_SLBTYPB/ No. 38**

**Definitions:** Stop on account of mode group single block.  
(VDI signal: single type B, after stop at the block boundary in the other channel of this mode group)  
Should not occur in any alarm

---

**User interrupt /INTERRUPT\_SIGNAL/ No. 87**

**Definitions:** Execute an "ASUB" user interrupt.  
(VDI signal, ASUB interface, digital-analog interface)  
Collective event for all interrupt signals.  
This event decides which actual interrupt one would like to trigger.  
Possible candidates are:  
    INTERRUPT  
    INTERRUPTFASTLIFTOFF  
    INTERRUPTBLSYNC  
    INTERRUPT\_TOPROG\_NOEPOS  
    INTERRUPT\_START  
See INTERRUPT

---

**User interrupt (initial setting) /INTERRUPT\_START/ No. 86**

**Definitions:** Activate a user interrupt "ASUB".  
Is only executed in channel status READY.  
(VDI signal, ASUB interface, digital-analog interface)  
See INTERRUPT

---

---

**User interrupt ASUP /INTERRUPT/ No. 10**

**Definitions:** Execute an "ASUB" user interrupt.  
(VDI signal, ASUB interface, digital-analog interface)  
Alarms can be switched on by machine data "HW\_DEBUG\_MASK" (for test purposes only).  
Not permitted if:

1. The channel is active on account of block search or loading machine data
2. The channel has stopped, and the ASUB "ASUP\_START\_MASK" has to be started, and the current block cannot be reorganized.
3. Reference point approach has not yet been made

Possible actions:

1. Wait until block search or loading machine data has finished, or cancel the program with the Reset button.
2. Activate block change until NC block can be reorganized
3. Execute reference point approach, or this status can be ignored by means of machine data "ASUP\_START\_MASK".

---

**User interrupt at end of block /INTERRUPTBLSYNC/ No. 12**

**Definitions:** Execute an "ASUB" user interrupt at the block boundary.  
(VDI signal, ASUB interface, digital-analog interface)  
as INTERRUPT

---

**User interrupt in manual mode /INTERRUPT\_TOPROG\_NOREPOS/ No. 85**

**Definitions:** Activate a user interrupt "ASUB" in a manual mode (JOG, REF,...).  
(VDI signal, ASUB interface, digital-analog interface)  
See INTERRUPT

---

**User interrupt with rapid retract /INTERRUPTFASTLIFTOFF/ No. 11**

**Definitions:** Execute an "ASUB" user interrupt with fast retraction.  
(VDI signal, ASUB interface, digital-analog interface)  
as INTERRUPT

---

**User PLC version file /PLCVERSION/ No. 94**

**Definitions:** Write user PLC version in version file  
Should not occur in any alarm

---

**Waiting for acknowledgment /MMCCMD/ No. 60**

**Definitions:** Wait until acknowledgement arrives from MMC (NC block, MMC\_CMD)  
Should not occur in any alarm

---

**Waiting for end of program /WAITE/ No. 58**

**Definitions:** Wait for a program end (channel communication, NC block, WAITE)  
Should not occur in any alarm

---

**Waiting for program marker /WAITM/ No. 57**

**Definitions:** Wait for a program marker (channel communication, NC block, WAITM)  
Should not occur in any alarm

---

**Waiting for program marker /WAITMC/ No. 77**

**Definitions:** Conditional wait for a program marker (NC block, WAITMC)  
Should not occur in any alarm

## System responses

### 9.1 System reactions to SINUMERIK alarms

<b>Identifier</b>	COMPBLOCKWITHREORG
<b>Effects</b>	Block preparation has detected an error, which can be rectified by modifying the program. Reorganization is performed after a program modification. <ul style="list-style-type: none"> <li>• Correction block with reorganization.</li> </ul>

<b>Identifier</b>	COMPENSATIONBLOCK
<b>Effects</b>	Block preparation has detected an error, which can be rectified by modifying the program. <ul style="list-style-type: none"> <li>• Correction block.</li> </ul>

<b>Identifier</b>	FOLLOWUP
<b>Effects</b>	Follow-up of axes. <ul style="list-style-type: none"> <li>• NC switches to follow-up mode.</li> </ul>

<b>Identifier</b>	INTERPRETERSTOP
<b>Effects</b>	Program execution is aborted after all the prepared blocks (IPO buffer) have been processed. <ul style="list-style-type: none"> <li>• Interpreter stop.</li> </ul>

<b>Identifier</b>	LOCALREACTION
<b>Effects</b>	<ul style="list-style-type: none"> <li>• Local alarm reaction.</li> </ul>

<b>Identifier</b>	NOALARMREACTION
<b>Effects</b>	<ul style="list-style-type: none"> <li>• No alarm reaction.</li> </ul>

<b>Identifier</b>	NOREADY   NCKREACTIONVIEW
<b>Effects</b>	NCK ready off: Active fast braking (i.e. with maximum braking current) of all drives, the controller enable for all NC axes is deleted, the NC ready relay drops out. <ul style="list-style-type: none"> <li>• NC not ready.</li> </ul>

## System responses

### 9.1 System reactions to SINUMERIK alarms

<b>Identifier</b>	NOREADY   BAGREACTIONVIEW
<b>Effects</b>	Mode group ready off: Active fast braking (i.e. with maximum braking current) of the drives in this mode group, the controller enable of the NC axes involved is deleted. <ul style="list-style-type: none"><li>• Mode group not ready.</li></ul>

<b>Identifier</b>	NOREADY
<b>Effects</b>	Channel ready off: Active fast braking (i.e. with maximum braking current) of the drives in this channel, the controller enable of the NC axes involved is deleted. <ul style="list-style-type: none"><li>• Channel not ready.</li></ul>

<b>Identifier</b>	NONCSTART
<b>Effects</b>	It is not possible to start a program in this channel. <ul style="list-style-type: none"><li>• NC start inhibit in this channel.</li></ul>

<b>Identifier</b>	NOREFMARK
<b>Effects</b>	The axes in this channel have to be referenced again. <ul style="list-style-type: none"><li>• Re-reference axes in this channel.</li></ul>

<b>Identifier</b>	SETVDI
<b>Effects</b>	VDI interface signal alarm is set. <ul style="list-style-type: none"><li>• Interface signals are set.</li></ul>

<b>Identifier</b>	SHOWALARM
<b>Effects</b>	Alarm is displayed on the HMI. <ul style="list-style-type: none"><li>• Alarm display.</li></ul>

<b>Identifier</b>	STOPBYALARM
<b>Effects</b>	Ramp stop of all channel axes. <ul style="list-style-type: none"><li>• NC stop for alarm.</li></ul>

<b>Identifier</b>	STOPATENDBYALARM
<b>Effects</b>	Stop at end of block. <ul style="list-style-type: none"><li>• NC Stop for alarm at end of block.</li></ul>



<b>Identifier</b>	SHOWALARMAUTO
<b>Effects</b>	The alarm is displayed whenever bit 0 of machine data ENABLE_ALARM_MASK is set. The reaction should be set whenever an alarm should only occur during automatic mode without manual operation by the user. <ul style="list-style-type: none"> <li>Alarm reaction in automatic mode</li> </ul>

<b>Identifier</b>	SHOWWARNING
<b>Effects</b>	The alarm is displayed whenever bit 1 of machine data ENABLE_ALARM_MASK is set. It is used for alarms which should normally be suppressed. <ul style="list-style-type: none"> <li>Message display.</li> </ul>

<b>Identifier</b>	ALLBAGS_NOREADY
<b>Effects</b>	The Ready is canceled in all mode groups. The reaction thus corresponds to an NCKREACTIONVIEW   NOREADY, the difference being that the NC READY relay is not canceled and the corresponding VDI bit is not set. This is desirable in the event of an emergency stop for example. <ul style="list-style-type: none"> <li>Mode group not ready.</li> </ul>

<b>Identifier</b>	DELAY_ALARM_REACTION
<b>Effects</b>	If this alarm reaction is configured in the alarm handler, all alarm reactions for alarms, which occur at this point, are buffered channel-specifically and are, therefore, not active. The alarms are displayed on the HMI. Mode group and NCK-wide reactions are transferred. The reaction is cleared by activating the clearDelayReaction call or by an alarm, which has configured NO_DELAY_ALARM_REACTION. This activates all the delayed alarm reactions. <ul style="list-style-type: none"> <li>All channel-specific alarm reactions delayed on alarm, alarm display.</li> </ul>

<b>Identifier</b>	NO_DELAY_ALARM_REACTION
<b>Effects</b>	The DELAY_ALARM_REACTION state is canceled. <ul style="list-style-type: none"> <li>The alarm reaction delay is canceled.</li> </ul>

<b>Identifier</b>	ONE_IPO_CLOCK_DELAY_ALARM_REACTION
<b>Effects</b>	All alarm reactions are delayed by one cycle when an alarm is output. This functionality became necessary as part of ESR development. <ul style="list-style-type: none"> <li>All alarm reactions are delayed by one IPO cycle on alarm.</li> </ul>

## 9.2 Cancel criteria for alarms

<b>Identifier</b>	CANCELCLEAR
<b>Effects</b>	The alarm is cleared in any channel when the Cancel key is pressed. It is also cleared by the Start part program key. <ul style="list-style-type: none"> <li>Clear the alarm with the Clear key or with NC-START.</li> </ul>

<b>Identifier</b>	CLEARHIMSELF
<b>Effects</b>	Self-clearing alarm. The alarm is not cleared by an operator action but explicitly by a "clearAlarm" programmed in the NCK source code. <ul style="list-style-type: none"> <li>The alarm is no longer displayed when the alarm cause has been removed. No other operator actions are required.</li> </ul>

<b>Identifier</b>	NCSTARTCLEAR
<b>Effects</b>	The alarm is cleared by starting a program in the channel, in which the alarm occurred. The alarm is also cleared by an NC reset. <ul style="list-style-type: none"> <li>Clear the alarm with NC START or the RESET key and continue the program.</li> </ul>

<b>Identifier</b>	POWERONCLEAR
<b>Effects</b>	The alarm is canceled by switching off the control and switching it on again. <ul style="list-style-type: none"> <li>Switch the control OFF - ON.</li> </ul>

<b>Identifier</b>	RESETCLEAR
<b>Effects</b>	The alarm is cleared by pressing the Reset key in the channel in which the alarm occurred. <ul style="list-style-type: none"> <li>Clear the alarm with the RESET key. Restart the part program.</li> </ul>

<b>Identifier</b>	BAGRESETCLEAR
<b>Effects</b>	The alarm is cleared by a "BAGRESETCLEAR" command or by carrying out a reset in all channels of this mode group. <ul style="list-style-type: none"> <li>Press the RESET key to clear the alarm in all channels of this mode group. Restart the part program.</li> </ul>

<b>Identifier</b>	NCKRESETCLEAR
<b>Effects</b>	The alarm is cleared by an "NCKRESETCLEAR" command or by carrying out a reset in all channels. <ul style="list-style-type: none"> <li>Clear alarm in all channels with the RESET key. Restart the part program.</li> </ul>

Identifier	NOCLEAR
Effects	The clear information is only required for the internal pseudo alarm number EXBSAL_NOMOREALARMS.

### 9.3 System reactions for SINAMICS alarms

Designation	NONE
Response	None
Description	No reaction when a fault occurs

Designation	OFF1
Response	Brake along the ramp-function generator deceleration ramp followed by pulse disable
Description	<p>Closed loop speed control (p1300 = 20, 21)</p> <ul style="list-style-type: none"> <li>n_set=0 is input immediately to brake the drive along the ramp-function generator deceleration ramp (p1121).</li> <li>Standstill is detected when the motor holding brake (if parameters have been assigned for it) is closed (p1215). The pulses are suppressed when the brake closing time (p1217) expires.</li> </ul> <p>The standstill is detected when the speed actual value of the speed threshold (p1226) is undershot or when the monitoring time (p1227) started when speed setpoint <math>\leq</math> speed threshold (p1226) has expired.</p> <p>Closed loop torque control (p1300 = 23)</p> <ul style="list-style-type: none"> <li>The following applies to closed-loop torque control: Response as for OFF2</li> <li>When the system switches over to closed-loop torque control (p1501), the following applies: There is no separate braking reaction.</li> </ul> <p>If the speed actual value falls below the speed threshold (p1226), then a possibly parameterized motor holding brake is closed. The pulses are suppressed when the brake closing time (p1217) expires.</p>

Designation	OFF2
Response	Internal/external pulse disable
Description	<p>Closed-loop speed and torque control</p> <ul style="list-style-type: none"> <li>Instantaneous pulse suppression, the drive "coasts" to a standstill.</li> <li>The motor holding brake (if parameterized) is closed immediately.</li> <li>Switch-on inhibit is activated.</li> </ul>

## System responses

### 9.3 System reactions for SINAMICS alarms

Designation	OFF3
Response	Brake along the OFF3 deceleration ramp followed by pulse disable
Description	<p>Closed loop speed control (p1300 = 20, 21)</p> <ul style="list-style-type: none"> <li>• n_set=0 is input immediately to brake the drive along the OFF3 deceleration ramp (p1135).</li> <li>• When zero speed is detected, the motor holding brake (if parameterized) is closed. The pulses are suppressed when the closing time of the holding brake (p1217) expires.</li> </ul> <p>Standstill is detected when the speed actual value of the speed threshold (p1226) is undershot or when the monitoring time (p1227) started when speed setpoint &lt;= speed threshold (p1226) has expired.</p> <ul style="list-style-type: none"> <li>• Switch-on inhibit is activated.</li> </ul> <p>Closed loop torque control (p1300 = 23)</p> <ul style="list-style-type: none"> <li>• Switchover to closed-loop speed-controlled operation and other reactions as described for closed-loop speed-controlled operation</li> </ul>

Designation	STOP1
Response	-
Description	In preparation

Designation	STOP2
Response	n_set = 0
Description	<ul style="list-style-type: none"> <li>• n_set=0 is input immediately to brake the drive along the OFF3 deceleration ramp (p1135).</li> <li>• The drive remains in closed-loop speed control.</li> </ul>

Designation	IASC/DCBRAKE
Response	-
Description	<ul style="list-style-type: none"> <li>• For synchronous motors, the following applies: If a fault occurs with this fault reaction, an internal armature short-circuit is triggered. The conditions for p1231 = 4 must be observed.</li> <li>• For induction motors, the following applies: If a fault occurs with this fault reaction, DC braking is triggered. DC braking must have been commissioned (p1232, p1233, p1234).</li> </ul>

Designation	ENCODER
Response	Internal/external pulse disable (p0491)
Description	<p>The fault reaction ENCODER is applied as a function of the setting in p0491.</p> <p>Factory setting: p0491=0 → Encoder fault results in OFF2</p>

## Acknowledging faults

Specifies the default method of acknowledging faults after the cause has been removed.

Designation	POWER ON
Description	The fault is acknowledged by a POWER ON process (switch drive unit off and on again). <b>Note:</b> If this action has not removed the fault cause, the fault is displayed again immediately after power up.

Designation	IMMEDIATELY
Description	After the fault has been removed, the alarm can be cleared by pressing the RESET key.

## Reference to SINAMICS parameters

In the "Cause" and "Remedy" fields, for several alarms, reference is made to a SINAMICS parameter.

The parameter number consists of a "p" or "r" as prefix, followed by a 4-digit number(xxxx) and optionally an index, e.g. p0918[0...3].

## References

A detailed description of the SINAMICS parameters is provided in the:  
SINAMICS S120/S150 List Manual



# Appendix A

## A.1 List of abbreviations

Abbreviation	Source of abbreviation	Meaning
ALM	Active Line Module	Infeed module for drives
ASCII	American Standard Code for Information Interchange	American coding standard for the exchange of information
ASIC	Application Specific Integrated Circuit	User switching circuit
AUTO	Operating mode "Automatic"	
ASUB	Asynchronous subprogram	
AUXFU	Auxiliary Function:	Auxiliary functions
BA	Operating mode	
Mode group	Mode group	
BERO	Proximity limit switch with feedback oscillator	
HHU	Handheld unit	
BICO	Binector Connector	Interconnection technology for the drive
BIN	Binary files	Binary files
BIOS	Basic Input Output System	
BCS	Basic Coordinate System	
OPI	Operator Panel Interface	
CAD	Computer Aided Design	
CNC	Computerized Numerical Control	Computerized numerical control
COM board	Communication Board	
CP	Communications Processor	
CPU	Central Processing Unit	Central processing unit
CR	Carriage Return	
CRC	Cyclic Redundancy Check	Checksum test
CRT	Cathode Ray Tube	picture tube
CSB	Central Service Board	PLC module
CTS	Clear To Send:	Signal from serial data interfaces
CUTCOM	Cutter radius Compensation:	Tool radius compensation
DB	Data block in the PLC	
DBB	Data block byte in the PLC	
DBW	Data block word in the PLC	
DBX	Data block bit in the PLC	
DDE	Dynamic Data Exchange	Dynamic Data Exchange
DIN	Deutsche Industrie Norm (German Industry Standard)	
DIR	Directory	Directory
DLL	Dynamic Link Library	

Appendix A

A.1 List of abbreviations

Abbreviation	Source of abbreviation	Meaning
DO	Drive Object	Drive object
DPM	Dual-Port Memory	
DRAM	Dynamic Random Access Memory	Dynamic memory block
DRF	Differential Resolver Function	Differential resolver function (handwheel)
DRY	DRY run	DRY run feedrate
DRIVE-CLiQ	Drive Component Link with IQ	
DSB	Decoding Single Block	Decoding single block
DSR	Data Send Ready	Signals that data is ready to be sent from the serial data interfaces
DW	Data word	
DWORD	Double word (currently 32 bit)	
E	Input	
I/O	Input/Output	
ENC	Encoder	Actual value encoder
EPROM	Erasable Programmable Read Only Memory	Erasable, electronically programmable read-only memory
Error	Error from printer	
ETC	ETC Key	Expansion of the softkey bar in the same menu
FB	Function block	
FBS	Slimline screen	
FC	Function call	Function block in the PLC
FEPROM	Flash-EPROM:	Read and write memory
FIFO	First In - First Out	Method of storing and retrieving data in a memory
FIPO	Fine InterPOLator	
FM	Function Module	
FM-NC	Function Module Numerical Control	Numerical Control
FPU	Floating-point unit	Floating Point Unit
FRA	Frame block	
FRAME	Data set	Coordinate conversion with the components zero (work) offset, rotation, scaling, mirroring
CRC	Cutter radius compensation	
FST	Feed Stop	Feed stop
CSF	Function plan (PLC programming method)	
BP	Basic program	
GUD	Global User Data	Global user data
HD	Hard Disk	Hard disk
HEX	Abbreviation for hexadecimal number	
AuxF	Auxiliary function	
HMI	Human Machine Interface	Controller user interface
MSD	Main Spindle Drive	
HW	Hardware	
IBN	Startup	



Abbreviation	Source of abbreviation	Meaning
IF	Drive module pulse enable	
IK (GD)	Implicit communication (global data)	
IKA	Interpolative Compensation	Interpolatory compensation
IM	Interface module	Interconnection module
INC	Increment	Increment
INI	Initializing Data	Initializing data
IGBT	Insulated Gate Bipolar Transistor	
IPO	Interpolator	
ISO	International Standardization Organization	International Standards Organization
JOG	"Jogging" operating mode	
C Bus	Communication bus	
KV	Servo-gain factor	Gain factor of control loop
KDV	Crosswise data comparison	Crosswise data comparison between the NCK and PLC
COR	Coordinate rotation	
$K_v$	Servo-gain factor	
$K_{UE}$	Speed ratio	
LAD	Ladder diagram (PLC programming method)	
LCD	Liquid Crystal Display: Liquid crystal display	
LED	Light Emitting Diode	Light Emitting Diode
LF	Line Feed	
LUD	Local User Data	Local user data
MB	Megabyte	
MCP	Machine control panel	Machine control panel
MD	Machine data	
MDI	"Manual Data Automatic" operating mode	Manual input
MCS	Machine coordinate system	
MLFB	Machine-readable product designation	
MPF	Main Program File	Main program (NC part program)
MAIN	Main program	Main program (OB1, PLC)
MPI	Multi-Point Interface	Multiport Interface
MCP	Machine control panel	
NC	Numerical Control	Numerical Control
NCK	Numerical Control Kernel	Numerical control kernel
NCU	Numerical Control Unit	Hardware unit of the NCK
WO	Zero offset	
OB	Organization block in the PLC	
OEM	Original Equipment Manufacturer	
OP	Operator panel	Operating setup
OPI	Operator Panel Interface	Interface for connection to the operator panel
OSI	Open Systems Interconnection	Standard for computer communications

Appendix A

A.1 List of abbreviations

Abbreviation	Source of abbreviation	Meaning
P bus	Peripheral Bus	
PC	Personal Computer	
PCU	Programmable Control Unit	
PCMCIA	Personal Computer Memory Card International Association	Standard for plug-in memory cards
PI	Program Instance	
PG	Programming device	
PLC	Programmable logic controller	Programmable Logic Controller
POU	Program Organization Unit	in the PLC user program
PPU	Panel Processing Unit	Panel-based control
PZD	Process data for drives	
QEC	Quadrant Error Compensation	Quadrant error compensation
QEC		Quadrant error compensation
RAM	Random Access Memory	Program memory that can be read and written to
REF POINT	"Reference-point approach" in JOG mode	
REPOS	"Repositioning" in JOG mode	
RPA	R parameter Active	Memory area on the NCK for R parameter numbers
RPY	Roll Pitch Yaw	Rotation type of a coordinate system
RTC	Real Time Clock	Real-time clock
RTS	Request To Send	RTS, control signal of serial data interfaces
SBL	Single Block	Single block
SBR	Subroutine	Subroutine (PLC)
SD	Setting Data	
SDB	System Data Block	
SEA	Setting Data Active	Identifier (file type) for setting data
SK	Softkey	
SKP	Skip	Skip block
SLM	Smart Line Module	
SM	Stepper Motor	
SPF	Subprogram file	Subprogram (NC)
PLC	Programmable Logic Controller	
SRAM	Static Random Access Memory	Static memory block
TNRC	Tool Nose Radius Compensation	
LEC	Leadscrew error compensation	
SSI	Serial Synchronous Interface	Synchronous serial interface
SW	Software	
SYF	System Files	System files
TEA	Testing Data Active	Identifier for machine data
TO	Tool offset	Tool offset
TOA	Tool Offset Active	Identifier (file type) for tool offsets

Abbreviation	Source of abbreviation	Meaning
TRANSMIT	Transform Milling Into Turning	Coordinate conversion on turning machine for milling operations
UFR	User frame	Zero offset
V24	Serial interface (definition of the exchange lines between DTE and DCE)	
FDD	Feed Drive	
VPM	Voltage Protection Module	
VSM	Voltage Sensing Module	
WAB		Smooth approach and retraction
Work	Workpiece coordinate system	
T	Tool	
TLC	Tool length compensation	
TC	Tool change	
TM	Tool management	
ZOA	Work Offset Active	Identifier (file type) for zero offset data

## A.2 Overview

